




85 West Street

ENTERED

Clariss

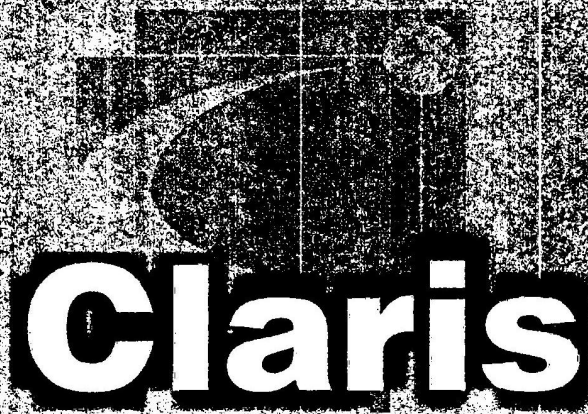

May 6, 2002

Via Federal Express

Mr. R. Radhakrishnan, P.E.
Director, Asbestos Control Program
The City of New York
Department of Environmental Protection
59-17 Junction Blvd.
Corona, NY 11368


Re: Air Monitoring and Quality Assurance Summary
New York Financial Center Marriott
85 West Street

Dear Mr. Radhakrishnan:

Enclosed is the "Air Monitoring and Quality Assurance Summary of the New York Financial Center Marriott" dated May 6, 2002 prepared by Claris Services Corporation for CCMH Fin Center Marriott. This document summarizes the remedial response actions undertaken at the New York Financial Center Marriott and includes results of asbestos sampling of debris, dust and air at the Hotel. This information is being provided to comply with your request that CCMH Fin Center Marriott share the results of asbestos sampling performed at the New York Financial Center Marriott as a consequence of the World Trade Center collapse.

If you have questions or need further information, I can be reached at (301) 493-6900 x1008.

Sincerely,

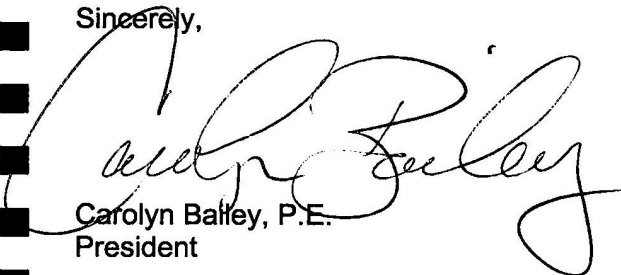
Carolyn Bailey, P.E.
President

Enclosure

cc: CCMH Fin Center Marriott c/o Host Marriott Corporation
FM Global

Atlanta, GA
Charlotte, NC
Manassas, VA
Toronto, Ontario

Claris Services Corporation
6903 Rockledge Drive, Suite 920
Bethesda, MD 20817
Tel: 301-493-6900 Fax: 301-530-4185



Air Monitoring and Quality Assurance Summary

**New York Financial Center Marriott
85 West Street
New York, NY**

May 6, 2002

Prepared for:

**CCMH Fin Center LLC
c/o Host Marriott Corporation
10400 Fernwood Road
Bethesda, MD 20817**

Prepared by

**Clariss Services Corporation
6903 Rockledge Drive, Suite 920
Bethesda, MD 20817**

Clariss

Introduction

The New York Financial Center Marriott Hotel ("the Hotel") is located at 85 West Street, two blocks south of the former World Trade Center ("WTC"). It is a 40-story, 504 guest room, full service hotel constructed in 1990.

On September 11, 2001 the Hotel was open and operating for business as usual. During the attacks on the World Trade Center and its subsequent collapse, the Hotel was evacuated. Damage to the Hotel included broken windows and dust and debris accumulation throughout the building. As a result of fire fighting efforts, basement flooding and water damage occurred to interior fixtures, finishes and equipment throughout the Hotel.

Clean-up efforts at the Hotel began in late September with the Hotel re-opening on January 7, 2002. Repairs to building components and the Hotel interior continue to be performed as of the date of this report.

During October and November 2001, the Red Cross occupied the first three floors of the Hotel. The Red Cross provided meals, hot showers, rest areas, and supplies to the workers associated with the recovery and clean-up efforts at the former WTC site. The areas of the Hotel occupied by the Red Cross included the 1st floor lobby; 2nd floor ballroom, meeting rooms and kitchen; the 3rd floor ballroom and meeting rooms; and the 5th floor locker rooms.

Assessment

On September 18, 2001, CCMH Fin Center LLC was able to gain access to the Hotel to observe and assess the damage. Hillmann Environmental Group of Union, New Jersey was mobilized to the Hotel at the request of FM Global, the insurance provider to CCMH Fin Center LLC. Hillmann provided environmental consulting services through October 13, 2001. Hillmann's responsibilities included the assessment of the environmental conditions at the Hotel and providing recommendations for remedial action. Hillmann's services are more fully described in their *Air Monitoring and Quality Assurance Report*, dated April 17, 2002 attached as Appendix A to this report (the "Hillmann Report").

The interior area of the Hotel exhibiting the worst damage was Roy's Restaurant, the associated kitchen and the adjacent corridor. These areas contained measurable quantities of dust and debris. Damage to this area occurred when the windows on the north and east side of the restaurant were blown out. Other areas evidencing dust and debris were the Battery Park Tavern and the main hotel lobby which were under renovation at the time. These areas front onto West Street and were impacted when the windows along this facade were broken.

Throughout the remainder of the Hotel a fine layer of dust was evident on all horizontal and vertical surfaces.

Significant water damage occurred to floors 5 through 38 of the Hotel as a result of fire fighting efforts to contain a fire that was burning in the office building directly adjacent to the north. Fire hoses were run from the standpipes in the Hotel stairwells through the hallways and into the guestrooms. The fire hoses were anchored at the windows in the guestrooms and directed north to the office building.

Hillmann observed all areas of the Hotel and collected representative dust and debris samples for analysis as well as air samples. The results of these analyses can be found in the Hillmann Report. It was determined that the dust observed throughout the Hotel was non-asbestos containing (<1%).

(Note: The results of this sampling were consistent with the findings of an asbestos survey of the Hotel conducted in 1996 by AquaTerra of New York, NY which found no friable asbestos-containing materials in the Hotel.)

Remedial Response

On September 23, 2001, Environmental Drying Services d.b.a. Environmental Disaster Services ("EDS") was mobilized to the site to commence clean-up activities. As Hillmann assessed various areas of the Hotel, EDS commenced drying and cleaning operations. EDS provided dehumidifiers, air movers, carpet extractors, pumps, and other equipment and materials necessary to remove the moisture from the building. In addition, wall cavities were inspected and anti-microbial applied. Ozone generating equipment was used to deodorize the facility. During the drying activities, moisture levels in the walls were monitored using moisture meters to determine when the walls had dried to within Industry Standards.

All horizontal and vertical surfaces of the Hotel including furniture and fixtures were Hepa vacuumed, and wet wiped with appropriate cleaners. Upholstered items and carpet were cleaned with extraction equipment. Bathrooms were cleaned and sanitized and electronic equipment was externally vacuumed with Hepa vacuums. The interiors of all file cabinets, desks and other furniture were opened, inspected, and cleaned if determined necessary.

Due to the significant volume of dust and debris present in Roy's Restaurant, the associated kitchen and adjacent corridor, there was concern that dust could be spread to other areas of the Hotel during clean-up. In order to prevent this from occurring, a decision was made to clean-up these areas under containment. A licensed asbestos contractor, LVI Environmental Services of Clifton, New Jersey, was hired to perform this clean-up. This work is more fully discussed in the Hillmann Report.

In order to control the re-introduction of dust and debris into the Hotel, access was limited to the entrance door on Carlisle Street. Prior to entering the Hotel, shoes were washed down of dust and debris and exterior garments were removed or brushed off. This access point was monitored by Red Cross volunteers who directed all those entering to the wash down areas.

Air Monitoring

Hillmann had advised CCMH FIN Center LLC that the former WTC complex had some asbestos containing materials and that air monitoring was on-going around the WTC site. Consequently, an air monitoring program was implemented at the Hotel.

The purpose of this program was to test the air quality in those spaces occupied by the Red Cross and the WTC workers to determine whether or not asbestos fibers were being transported into the Hotel by the WTC workers. Accredited Environmental Technologies ("AET") of Media, PA was contracted to conduct the air sampling and analysis. This testing occurred weekly and then bi-weekly from October 13, 2001 through December 19, 2001. A subsequent sampling and analysis event occurred post opening on April 9, 2002. The results of the air sampling performed by AET are attached in Appendix B. Also included in Appendix B are the results of air sampling performed by ATC Associates (on behalf of the City of New York) of the Hotel Ballroom. The Hotel Ballroom was serving as the Red Cross Dining Room. All air sample results were below the New York City Department of Environmental Protection's re-occupancy level.

Conclusion

The results of the dust and debris sampling at the Hotel did not evidence asbestos above the EPA's definition of 1% asbestos by weight. Air samples collected and analyzed by Hillmann and AET, including final clearance samples, reported fibers below the New York City Department of Environmental Protection's re-occupancy level.

**AIR MONITORING AND QUALITY ASSURANCE REPORT
FOR THE CLEAN UP OF ASBESTOS CONTAINING MATERIALS
AT THE FINANCIAL CENTER MARRIOTT
85 WEST STREET
WORLD TRADE CENTER COLLAPSE RESPONSE
NEW YORK, NY**

April 17, 2002

Prepared For:

**CCMH Fin Center LLC
C/o Host Marriott Corporation
10400 Fernwood Road
Bethesda, MD 20817**

Prepared By:

**HILLMANN ENVIRONMENTAL GROUP
1600 ROUTE 22 EAST
UNION, NJ 07083
908-688-7800 TEL
908-686-2636 FAX
www.hillmanngroup.com**

PROJECT NUMBER Y1-3508



Hillmann Environmental Group, LLC

March 17, 2002

AIR MONITORING AND QUALITY ASSURANCE REPORT

PROJECT NUMBER: Y1-3508

SUBJECT AREA: Financial Center Marriott
85 West Street
World Trade Center Collapse Response
New York, NY

REPORT PREPARED BY: Michael Nehlsen
Director of Operations
HILLMANN ENVIRONMENTAL GROUP, LLC



REPORT REVIEWED BY: Christopher Hillmann
President
HILLMANN ENVIRONMENTAL GROUP, LLC



TABLE OF CONTENTS

Section 1 Background

1.1 General	1
1.2 General Findings	1

Section 2 New York Financial Center Marriott

2.1 Preliminary Assessment Findings at the Subject Property	2
2.2 Conclusion and Recommendations	2

Section 3 Sampling Parameters and Methodology

3.1 General	3
3.2 Sampling Parameters and Methods	3
I. Airborne Asbestos fibers.....	3
A) Phase Contrast Microscopy	3
B) Transmission Electron Microscopy.....	3
II. Bulk and Accumulated Dust/ Debris Sample Analysis.....	3

Section 4 Discussion

4.1 Outdoor Airborne Asbestos Concentrations	4
4.2 Indoor Airborne Asbestos Concentrations	4
4.3 Bulk Sample Analysis	5
4.4 Summary of Abatement Activities	5

Section 4 Appendices

4.1 Air Sample Result Listings
4.2 List of Abbreviations
4.3 Air Sample Lab Data
4.4 Bulk Sample Lab Data
4.5 Letter of Completion

SECTION 1

1.1 General

Hillmann Environmental Group, LLC ("Hillmann") has been one of the more active environmental consulting firms responding to the recent World Trade Center collapse. Our clients have included building managers, tenants, insurers, and workers in seven of the nine buildings surrounding the World Trade Center which were directly impacted by the collapse of the complex, as well as more than 25 additional buildings in the surrounding area. The purpose of these efforts has been to collect and evaluate environmental data to determine if the buildings are suitable for re-occupancy and whether or not adverse health effects can be anticipated.

Hillmann recognizes their role is both sensitive and vital to the people who live, visit, and work in the downtown area. As a result, Hillmann's staff has been diligent in providing credible and knowledgeable information in a scientific and unbiased manner. In addition to Hillmann's site activities, its staff has been involved in many public discussions. Hillmann has been involved with the Manhattan Borough's Ground Zero Task Force, provided expert testimony to City Council, and has presented informational conferences in an effort to educate and inform those who may have concerns over the conflicting air quality issues raised by the press, local and federal governments, and other outlets.

1.2 General Findings

Since Hillmann's mobilization on September 11, 2001, a number of environmental parameters have been tested in both indoor and outdoor locations throughout the downtown area. These parameters were selected in response to the expected contaminants that may have resulted from the collapse of the World Trade Center, as well as the subsequent fire and construction activities.

Asbestos concentrations were found to be elevated infrequently through September and the early part of October. Since that time, no significant levels of contaminants have been identified. Sampling results have consistently verified that levels of contaminants have been below the OSHA, EPA and New York City recommended limits in the areas surrounding the World Trade Center site. Elevated levels of contaminants have been measured on the debris pile at the former World Trade Center site, and through the date of this report, it is still recommended that emergency workers wear proper respiratory protection. Many of the parameters tested are being compared to the OSHA recommended limits established for indoor conditions, which assume a constant exposure of eight to ten hours per day.

2.1 Preliminary Assessment Findings at the Subject Property

The collapse of the World Trade Center on September 11, 2001, resulted in the dissipation of dust and debris throughout the Downtown Manhattan area. This debris penetrated a number of the buildings in the vicinity. At the request of Claris Services Corporation Project Manager for CCMH Fin Center LLC, Hillmann Environmental Group, LLC, visited the New York Financial Center Marriott, located at 85 West Street in New York, New York, (the "Hotel") to perform an assessment of the dust/ debris intrusion and potential asbestos hazard. The Hotel is located two blocks south of the World Trade Center site. Air samples were taken to assess the airborne asbestos levels and dust/ debris samples were collected to characterize the asbestos content of the debris within the building.

Hillmann's initial assessment of the Financial Center Marriott occurred on September 18, 2001. Phase Contrast Microscopy (PCM) and Transmission Electron Microscopy (TEM) analyzed air samples collected from the first floor of the Hotel in Roy's Restaurant, the adjoining kitchen and adjacent lobby. The results of the PCM air sampling indicated airborne fiber concentrations in excess of the New York City established re-occupancy level (0.01 f/cc). The air samples analyzed by the more stringent Transmission Electron Microscopy (TEM) detected the presence of asbestos structures. The concentration of asbestos structures was not found to be in excess of the New York City Re-occupancy level of 70 Structures per square millimeter. Subsequent analysis of the bulk dust/ debris collected from the rooftops on various floors and lobby gift shop and analyzed using polarized light microscopy (PLM) were found to contain trace amounts of asbestos (<1%).

2.2 Conclusions and Recommendations

The evidence provided by the preliminary sample data collected from these locations indicated that asbestos concentrations in bulk debris materials were not substantial enough to qualify the debris as an asbestos containing material (>1%). However, given the significant amount of debris in these areas, Hillmann believed that the presence of the asbestos fibers in the debris could constitute a significant health hazard during the cleanup of these areas. Therefore, the recommendation was made to have these areas cleaned by a licensed asbestos abatement contractor using engineering controls to avoid the spread of debris and potentially contaminated air to other areas of the Hotel.

Based on the findings of preliminary air sampling and bulk debris analysis, CCMH Fin Center LLC decided that Roy's Restaurant, the adjoining kitchen and adjacent lobby would be cleaned by a licensed asbestos abatement contractor. During the licensed asbestos abatement contractor's clean-up of Roy's Restaurant, the adjoining kitchen and adjacent lobby, Hillmann conducted air sampling in these areas until the debris had been cleaned and New York City air clearance levels were obtained.

SECTION 3 – SAMPLING PARAMETERS AND METHODOLOGY

3.1 General. Hillmann's air and dust sampling had been conducted in response to the client's concerns over possible exposure to asbestos fibers by contractors and employees conducting cleanup and restoration work at the Hotel. As a result, air and dust samples were collected in a number of locations throughout the Hotel.

The inspection and sampling was performed by trained industrial hygienists, using Environmental Protection Agency (EPA) and National Institute for Occupational Safety and Health (NIOSH) sampling techniques. Sampling was conducted either by a Certified Industrial Hygienist, a New York City DEP Certified Asbestos Investigator or a New York State Certified Asbestos Inspector. Samples were analyzed at an ELAP and NVLAP accredited laboratory.

3.2 Sampling and Analysis Parameters and Methodology. The following sampling parameters and analysis methodologies were used to determine airborne asbestos concentrations and asbestos content in dust/ debris samples. Hillmann selected the sampling parameters based on federal, state and local regulations, consultations with the client, the laboratories performing the analysis and our in-house experts.

I. **Airborne Asbestos fiber concentrations** were determined by drawing air through a 25 mm PCM or TEM cassette, for a minimum volume of 580 Liters. Samples were then analyzed by either Phase Contrast Microscopy (PCM) or Transmission Electron Microscopy (TEM). The analysis was conducted by an appropriately accredited laboratory, in accordance with NIOSH Methods 582 and 7402. Hillmann technicians collecting samples were all New York State certified project monitors or air sampling technicians.

A) **Phase Contrast Microscopy** – The air samples analyzed by PCM report the average number of fibers per cubic centimeter of air sampled. The fiber concentration established by New York City as acceptable for the re-occupancy of an area is 0.01 fibers per cubic centimeter (f/cc). Fibers are defined by NIOSH as any particle greater than 5 μ m in length with at least a 5:1 length to width aspect ratio. NIOSH believes that this is a reliable method for quantifying airborne levels of asbestos fibers. However, this method is not exclusively a measurement of asbestos concentration. A number of other materials meet the criteria of a fiber and are also counted by this method without differentiation. To confidently characterize fibers as asbestos structures, TEM, a more stringent analytical method is required.

B) **Transmission Electron Microscopy** – The air samples analyzed by TEM report the number of asbestos structures per cubic centimeter of air and square millimeter of filter media. This analysis is capable of determining both the concentration of asbestos structures and the type of asbestos mineral identified in the sample. This is the most accurate method of analysis commonly available. The OSHA and New York City regulations have set the acceptable level of asbestos at any number less than 70 structures per millimeter of filter media.

If an air sample analyzed by PCM was found to exceed the acceptable re-occupancy level, the same sample was subsequently analyzed by TEM to positively classify the fibers as asbestos. Using this combination of methods, Hillmann was able to determine whether acceptable air quality with respect to asbestos was being attained

II. **Bulk and heavily accumulated dust/ debris samples** were collected with a disposable plastic spoon and placed in a re-sealable plastic bag. When accumulations were not great enough to facilitate this sampling method, tape or a mixed cellulose ester (MCE) filter was swiped over the dust covered surface to offer an qualitative indication of asbestos presence.

Analysis of bulk and heavily accumulated dust/ debris samples was conducted by Polarized Light Microscopy (PLM) in order to characterize the asbestos content of dust/debris samples. Because of the analytical method used to determine asbestos content in heavily accumulated dust/ debris samples, which is identical to the method of analysis used for bulk samples, these results are included in the appendix under the heading of Bulk Sample Lab Data.

SECTION 4 – DISCUSSION

The discussion below is a summary of air sand bulk sample findings obtained by Hillmann.

4.1 Outdoor Airborne Asbestos Fibers

In general, the buildings constituting the World Trade Center did not contain extensive levels of friable asbestos containing materials at the time of their collapse. Nonetheless, asbestos levels in the air of the downtown area have been one of the highest levels of concern for health and safety since the World Trade Center collapse. Hillmann has recently obtained extensive outdoor sampling for asbestos levels in the ambient air in Downtown Manhattan for various clients. In the initial days after the collapse of the World Trade Center levels of airborne asbestos were elevated. However, since that time levels of airborne asbestos fibers have been below the EPA NESHAP standard of 0.01 fibers/cc. It is unlikely that outdoor concentrations of asbestos would lead to the re-contamination of the Financial Center Marriott.

4.2 Indoor Airborne Asbestos Fibers

The preliminary assessment of airborne asbestos concentrations at the Hotel was conducted on September 18, 2001. The results of this sampling found fiber concentrations analyzed by PCM to be in excess of the acceptable level of 0.01 f/cc. Those samples analyzed using TEM revealed asbestos structures to be present in these samples below the concentrations deemed acceptable for re-occupation by New York City standards.

Air sampling continued for the duration of the cleanup of Roy's Restaurant, the adjoining kitchen and adjacent lobby. This cleanup began on September 26, 2001 and continued until September 30, 2001. Air sampling conducted outside of the work area during the cleanup often indicated fiber levels in excess of the 0.01 f/cc deemed acceptable by OSHA. TEM analysis of these same samples identified the presence of asbestos structures among the fibers, but rarely in excess of the 70 structures per mm permissible under New York City regulation. All of the final air test samples collected after the clean-up was complete passed the New York City clearance air quality standard.

After the contractor had completed the clean up of Roy's Restaurant, the adjoining kitchen and adjacent lobby, the area was inspected by Hillmann's industrial hygienist. Final air tests were conducted inside of the work area. Four (4) of the five (5) TEM samples analyzed, evidenced no asbestos structures. Less than 10 asbestos structures were identified on the fifth sample. This was well below the asbestos level acceptable for re-occupancy in New York City.

Additional air quality testing was performed on various floors on October 13, 2001. PCM clearance air sample results were obtained, with no sample concentration exceeding 0.01 f/cc.

Specific air sample locations and results can be seen in the Air Sample Result Listings in table 4.1.

4.3 Bulk Sample Analysis

Bulk samples were collected and analyzed prior to and at the commencement of the cleanup of various areas of the hotel. Sampling was conducted by a qualified industrial hygienist.

Bulk debris samples were collected from the rooftops on various levels of the facility. Each of these samples was identified to contain asbestos in concentrations less than 1% by PLM analysis. Sampling was also conducted on the windowsills of rooms on various floors throughout the building. One sample on the windowsill of room 3015 on the 30th floor was found to contain asbestos in concentrations less than 1% by PLM analysis. No asbestos was detected in the other samples taken on floors 1, 4, 5, 7, 10, 15, 20 and 25.

Numerous bulk samples were also collected from the first floor flower and gift shops. Each of these samples was found to contain less than 1% asbestos by PLM analysis.

4.4 Summary of Abatement Activities

Prior to the commencement of clean-up activities the asbestos abatement contractor erected critical barriers to stop the flow of air to and from Roy's Restaurant, the adjoining kitchen and adjacent lobby. Air filtration devices were set up within this containment area to actively filter the air within the work area. Once these engineering controls were established clean up of the debris began.

All non-cloth surfaces were wet wiped with clean rags prior to being vacuumed with a HEPA equipped vacuum. Walls, tables and floors are examples of surfaces cleaned in this fashion. Cloth surfaces were cleaned using the HEPA equipped vacuum. These surfaces include carpeted floors and upholstered chairs, which were to be salvaged. When the clean up was complete, the industrial hygienist conducted a visual inspection. Air samples were collected, and once clearance levels were obtained the engineering controls and barriers were removed.

4.1 Air Sample Result Listings

Date	Sample Location	PCM Result (f/cc)	Acceptable Conc. By PCM (<0.01 f/cc)	TEM Result (Struct./sq. mm)	Acceptable Conc. By TEM (<70 Struct./sq. mm)
9/18/01	1 st Fl. Lobby			<10	Yes
	1 st Fl. Lobby Stairs	<0.002	Yes		Yes
	1 st Fl. Bar Area/ N Door	0.003	Yes		
	1 st Fl. Bar Area/ Center			<10	Yes
	1 st Fl. Restaurant/ Center			<10	Yes
	1 st Fl. Restaurant/ Step	<0.002			Yes
	1 st Fl. Carlisle St/ Door	0.028	No	30	Yes
	1 st Fl. Gift Shop. Hallway			60	Yes
9/26/01	1 st Fl./ Elev. And Bathroom	0.018	No	20	Yes
	1 st Fl. Main Lobby	0.025	No	60	Yes
	1 st Fl. Between SE Bathrooms	0.017	No	NAD	-
	1 st Fl. Back Door - Restaurant	0.009	Yes		
	Near Elev. and Bathroom.	0.012	No	20	Yes
	1 st Fl. Main Lobby	0.009	Yes		
	Corridor near SE Bathroom.	0.002	Yes		
	Back Door Restaurant	0.004	Yes		
	Near Elev. And Bathroom	0.013	No	10	Yes
	Near Elev. And Bathroom	0.011	No	20	Yes
	Main Lobby	0.01	No	20	Yes
	Corridor near SE Bathrooms	0.011	No	40	Yes
	Back Door of Restaurant	0.006	Yes		
	Near Elev. And Bathroom	0.004	Yes		
	Main Lobby	0.009	Yes		
	Corridor near SE bathrooms	0.007	Yes		
9/26/01	Restaurant NE Corner	0.024	No	<10	Yes
	Southwest Dining area	0.031	No	NAD	-
	SE Corner Near Main Entry	0.017	No	20	Yes
	Restaurant Kitchen Area	0.016	No	<10	Yes
	SW Exit	0.068	No	10	Yes
	Near Elev. And Bathrooms	0.025	No	<10	Yes
	Main Lobby	0.006	Yes		
	Corridor near SE Bathrooms	0.037	No	<10	Yes
	Back door of Restaurant	0.053	No	<10	Yes
	Near Elev. And Bathrooms	0.067	No	10	Yes

Hillmann Environmental Group, LLC

9/26/01	Back Door of Restaurant	0.006	Yes		
	Near Elev. And Bathroom	0.004	Yes		
	Main Lobby	0.009	Yes		
	Corridor Near SE Bathrooms	0.004	Yes		
	Back Door of Restaurant	0.007	Yes		
	Southwest Exit	0.027	No	<10	Yes
	Near Elev. And Bathrooms	0.029	No	<10	Yes
	Main Lobby Area	0.029	No	<10	Yes
	Security Desk	0.106	No	NAD	-
	Near Elev. And Bathrooms	0.017	No	<10	Yes
	Main Lobby Area	0.011	No	<10	Yes
	SW Exit	0.051	No	<10	Yes
	Bathroom	<0.005	Yes		
	Security Desk	0.007	Yes		
	SW Exit	0.010	No	<10	Yes
	Near Bathroom and Elevators	<0.005	Yes		
	Security Desk	<0.005	Yes		
	Back Door of Restaurant	0.002	Yes		
	Hallway to Restaurant	0.004	Yes		
	Near Elev. And Bathrooms	0.008	Yes		
	Main Lobby	0.039	No	<10	Yes
	Back Door of Restaurant	0.007	Yes		
	Hallway Leading to Restaurant	0.010	No	<10	Yes
	Near Elev. And Bathroom	0.058	No	<10	Yes
	Main Lobby	0.010	No	<10	Yes
9/27/01	Main Lobby	0.014	No	<10	Yes
	West Exit	0.022	No	20	Yes
	Hallway Near Men's Room	0.023	No	30	Yes
	Hallway Outside Restaurant	0.034	No	NAD	Yes
	Main Lobby Floor	0.013	No	30	Yes
	West Exit Door	0.015	No	20	Yes
	Hallway Near Men's Room	0.024	No	30	Yes
	Hallway Outside Restaurant	0.051	No	NAD	-
	Main Lobby Door	0.004	Yes		
	West Exit Door	0.012	No	60	Yes
	Hallway Outside Men's Room	0.029	No	80	No
	Hallway Outside Restaurant	0.034	No	50	Yes
	Main Lobby Door	0.008	Yes		
	West Exit Door	0.019	No	NAD	-
	Hallway Outside Men's Room	0.020	No	NAD	-

Hillmann Environmental Group, LLC

9/27/01	Hallway Outside Restaurant	0.025	No	20	Yes
	Main Lobby Door	0.010	No	10	Yes
	West Exit Door	0.010	No	10	Yes
	Hallway Outside Restaurant	0.007	Yes		
	Main Lobby	0.004	Yes		
9/27/01	Near Elevator Bathrooms	0.013	No	30	Yes
	Between Restaurant and Store	0.027	No	NATP	-
	Entry to Restaurant	0.010	No	NATP	-
	Main Lobby	0.003	Yes		
	Near Elevator and Bathrooms	0.004	Yes		
	Between Restaurant and Store	0.017	No	NATP	-
	Main Entry to Restaurant	0.006	Yes		
	Security Desk	0.006	Yes		
	Near Elevators	0.026	No	10	Yes
	Near Restaurant and Stores	0.011	No	NATP	-
	Main Entry to Restaurant	0.007	Yes		
	Security Desk	0.003	Yes		
	Near Elevator and Bathrooms	<0.002	Yes		
	Near Restaurant and Stores	<0.002	Yes		
	Main Entry to Restaurant	<0.002	Yes		
	Main Entry to Restaurant	0.007	Yes		
	Security Desk	0.003	Yes		
	Near Elev. And Bathrooms	<0.002	Yes		
	Corridor Bet. Restaurant	<0.002	Yes		
	Entry to Restaurant Airlock	<0.002	Yes		
9/28/01	Main Lobby	0.008	Yes		
	Elevator West	0.011	No	<10	Yes
	Hallway Adj. To Men's Bath	0.009	Yes		
	Main Restaurant Door	0.008	No	NAD	-
	Main Lobby	0.009	Yes		
	Elevator West	0.013	No	<10	
	Hallway Adj. To Men's Bath	0.005	Yes		
	Outside Main Restaurant	0.004	Yes		
	Main Lobby Area	0.009	Yes		
	Elevator/ West	0.020	No	20	
	Outside Men/s Bath	0.022	No	<10	
	Outside Main Restaurant	0.030	No	NAD	-
	Main Lobby Area	0.003	Yes		
	Elevator/ West	0.033	No	NAD	-
	Outside Men's Bath	0.038	No	NAD	-

	Outside Main Restaurant	0.004	Yes		
	Main Lobby Area	0.011	No	NAD	-
	Elevator/ West	0.007	Yes		
	Hallway Outside Men's Bath	0.004	Yes		
	Outside Main Restaurant	0.006	Yes		
	Near Elevator and Bathroom	0.021	No	NAD	-
	Main Lobby	Overload	No	NAD	-
	In Corridor	0.036	No	NAD	-
	Near Back Door	Overload	No	NAD	-
	Near Elev. And Bathroom	0.008	No	NAD	-
9/28/01	Main Lobby	0.008	No	<10	Yes
	Corridor	0.005	Yes		
	Back Door	0.009	Yes		
	Between Elevator and Bath	0.012	No	<10	Yes
	Main Lobby	0.011	No	<10	Yes
	Corridor	0.009	Yes		
	Near Back Door	0.010	No	<10	Yes
	Near Elev. And Bathroom	0.003	Yes		
	Main Lobby	0.007	Yes		
	Corridor	0.006	Yes		
	Near Back Door	0.005	Yes		
	Near Elev. And Bathroom	0.009	Yes		
	Main Lobby	0.005	Yes		
	Corridor	0.004	Yes		
	Back Door	0.010	No	<10	Yes
	Near Elev. And Bathroom	0.011	No	<10	Yes
	Main Lobby	0.013	No	<10	Yes
	Corridor	0.019	No	NAD	-
	Near Back Door	0.010	No	NAD	-
9/29/01	Main Lobby	0.011	No	10	Yes
	Near Elev. And Bathrooms	0.015	No	10	Yes
	Entry to Restaurant	0.010	No	10	Yes
	Ladies Bathroom	0.017	No	20	Yes
	Main Lobby	0.007	Yes		
	Near Elev. And Bathrooms	0.005	Yes		
	Main Entry to Restaurant	0.002	Yes		
	Ladies Bathroom	0.006	Yes		
	Main Lobby	0.005	Yes		
	Near Elev. And Bathroom	0.011	No	<10	
	Main Entry to Restaurant	0.010	No	10	

Hillmann Environmental Group, LLC

	Ladies Bathroom	0.005	Yes		
	Main Lobby	0.013	No	<10	
	Near Elev. And Bathrooms	0.012	No	<10	
	Main Entry to Restaurant	0.020	No	<10	
	Ladies Bathroom	<0.002	Yes		
	Main Lobby	0.010	No	<10	
	Near Elev. And Bathrooms	0.006	Yes		
	Main Entry to Restaurant	0.006	Yes		
	Ladies Bathroom	0.011	No	<10	
	Main Lobby	<0.002	Yes		
9/29/01	Near Elev. And Bathrooms	Overload	No	10	
	Main Entry to Restaurant	0.014	No	<10	
	Ladies Room	0.010	No	<10	
	Elevator Lobby/ West	0.012	No	20	Yes
	Outside Men's Bath	<0.002	Yes		
	Hallway Adj. To Gift Shop	0.014	No	Overload	
	Hallway Adj. To Roy's	0.005	Yes		
	Elevator Lobby/ West	0.003	Yes		
	Outside Men's Bathroom	0.006	Yes		
	Hallway Outside of Gift Shop	<0.002	Yes		
	Hallway Outside Roy's	0.013	No	110	No
	Elevator Lobby West	0.004	Yes		
	Outside Men's Bathroom	0.007	Yes		
	Hallway Outside Gift Shop	0.003	Yes		
	Hallway Outside Roy's	0.006	Yes		
9/30/01	FAT Behind Bar			NAD	Yes
	FAT/ Kitchen Area			NAD	Yes
	FAT/ Back Dining Area			10	Yes
	Outside Restaurant Main Door			NAD	Yes
	Restaurant Kitchen Rear Door			NAD	Yes
10/13/01	FAT/ 36th Fl. Adj. To Elev.	0.004	Yes		
	FAT/ 36 th Fl. Adj. to Rm. 3612	0.006	Yes		
	FAT/ 2 nd Fl. Offices East	0.003	Yes		
	FAT/ 2 nd Fl. Offices West	<0.002	Yes		

4.2 List of Abbreviations

Hillmann	Hillmann Environmental Group, LLC
PEL	Permissible exposure level. This is the enforceable standard.
ACM	Asbestos containing material
PCM	Phase contrast microscopy
TEM	Transmission electron microscopy
PLM	Polarized light microscopy
NAD	Overloaded with particulate. No asbestos detected by qualitative scan
Overload	Overloaded with particulate. Chrysotile detected by qualitative scan
NATP	Not able to prepare sample because of particulate interference
f/cc	Fibrous dust per cubic centimeter of air
Struct./sq. mm	Structures per square millimeter of filter media
FAT	Final Air Test (To test for acceptable air clearance results prior to re-occupancy)

Hillmann Environmental Group, LLC

Section 4.3 Air Sample Lab Data

**HILLMANN ENVIRONMENTAL GROUP, L.L.C.**

ENVIRONMENTAL CONSULTING & LAB SERVICES

1600 ROUTE 22 EAST

P.O. BOX 1597

UNION, NEW JERSEY 07083-1597

(908) 688-7800

FAX (908) 688-7800

www.hillmanngroup.com

ate of Sampling: September 18, 2001
Date of Sample Receipt: September 19, 2001

To: CLARIS SERVICES GROUP
6903 ROCKLEDGE DRIVE
SUITE 920
BETHSEDA, MD 20817
Attn: MS. JUDY GILBERT

Location: Marriott World Financial Center
85 West Street/New York/NY
HECO# Y1-3508

Procedure: Air Quality

Field Technician: MAYBERRY, MARQUETTE
Date of Analysis: September 19, 2001
Date of Issue: October 3, 2001

AIR SAMPLE CERTIFICATE OF ANALYSIS

Method: Phase Contrast Microscopy: NIOSH 7400; Issue #2, 1994/ELAP ID 10926

<u>LAB ID#</u>	<u>LOCATION/SAMPLE ID</u>	<u>VOLUME (LITERS)</u>	<u>FIBERS/CC</u>
K39929	1st Fl/Lobby Area	1200	TEM
K39930	1st Fl/Lobby Stairs	1200	<0.002
K39931	1st Fl/Bar Area/Near North Door	1200	0.003
K39932	1st Fl/Bar Area/Center	1200	TEM
K39933	1st Fl/Restaurant/Center	1200	TEM
K39934	1st Fl/Restaurant/Step	1200	<0.002
K39935	1st Fl/Carlisle St. Door	1200	0.028
K39936	1st Fl/Gift Shop/Hallway Outside	1200	TEM


Analyst Signature: _____

JAYCOX, DYLAN M.

(<) Indicates results are below the limit of detection (LOD). LOD is based on 5.5 fibers/100 fields.

Page 1 of 2





HILLMANN ENVIRONMENTAL GROUP, L.L.C.
ENVIRONMENTAL CONSULTING & LAB SERVICES

Continuation

To: CLARIS SERVICES GROUP

Location: Marriott World Financial Center
85 West Street/New York/NY
HECO# Y1-3508

Procedure: Air Quality

AIR SAMPLE CERTIFICATE OF ANALYSIS

Method: Phase Contrast Microscopy: NIOSH 7400; Issue #2, 1994/ELAP ID 10926

<u>LAB ID#</u>	<u>LOCATION/SAMPLE ID</u>	<u>VOLUME(LITERS)</u>	<u>FIBERS/CC</u>
		<u>FIBERS/100 FIELDS</u>	
K39937	Field Blank	ND	
K39938	Field Blank	ND	

Analyst Signature: _____

JAYCOX, DYLAN-M.

(<) Indicates results are below the limit of detection (LOD). LOD is based on 5.5 fibers/100 fields.

Page 2 of 2



Lab Job #: 201092345

Client Name: Hillmann Environmental Company, Inc.

Table I

Summary of Transmission Electron Microscopy (TEM) Results for Asbestos (air)

85 West Street

SciLab Sample #	Client Sample #	Dilution Factor	Air Filtered (liters)	Area Analyzed (sq. mm.)	* Analytical Sensitivity (struc/cc air)	Asbestos Structures Detected (Microns)			Structure Density (struc/sq. mm.)		Structure Concentration (struc/cc air)		Type of Asbestos
						0.5-5.0	>5.0	Total	>5.0	Total	>5.0	Total	
01	MM0918-01M 1st Fl. Lobby Area		1200	.1	0.0032	0.0	0.0	0.0	<10	<10	<0.0032	<0.0032	NSD
02	MM0918-4M 1st floor Bar Area Center AQ		1200	.1	0.0032	0.0	0.0	0.0	<10	<10	<0.0032	<0.0032	NSD
03	MM0918-5M 1st Fl. Restaurant Center AQ T		1200	.1	0.0032	0.0	0.0	0.0	<10	<10	<0.0032	<0.0032	NSD
04	MM0918-7M 1st Floor Carlsie St. Door AQ		1200	.1	0.0032	3.0	0.0	3.0	<10	30.0	<0.0032	0.0096	chrysotile
05	MM0918-8M 1st Floor Hallway Outside/Gift Shop AQ		1200	.1	0.0032	3.0	3.0	6.0	30.0	60.0	0.0096	0.0193	chrysotile

* concentration represented by the detection of 1 structure

** not analyzed

NSD: No Asbestos Structures Detected

Reviewed By: _____

Analyzed By: _____

Date: 9/19/01

Lance Tuckruskye

NVLAP#: 200546-0

SEP-19-2001 11:14

SCIENTIFIC LABS

212 679 9392 P.02/03

212 679 9392 -> Hillmann Environmental; Page 2

**HILLMANN ENVIRONMENTAL GROUP, L.L.C.**
ENVIRONMENTAL CONSULTING & LAB SERVICES

1600 ROUTE 22 EAST

P.O. BOX 1597

UNION, NEW JERSEY 07083-1597

(908) 688-7800

FAX (908) 688-7800

www.hillmanngroup.com

Date of Sampling: September 26, 2001
Date of Sample Receipt: September 27, 2001

To: CLARIS SERVICES GROUP
6903 ROCKLEDGE DRIVE
SUITE 920
BETHSEDA, MD 20817
Attn: MS. JUDY GILBERT

Location: Marriott World Financial Center
85 West Street/New York/NY
HECO# Y1-3508

Procedure: Air Quality

Field Technician: MAYBERRY, MARQUETTE

Date of Analysis: September 27, 2001

Date of Issue: October 12, 2001

AIR SAMPLE CERTIFICATE OF ANALYSIS

Method: Phase Contrast Microscopy: NIOSH 7400; Issue #2, 1994/ELAP ID 10926

<u>LAB ID#</u>	<u>LOCATION/SAMPLE ID</u>	<u>VOLUME(LITERS)</u>	<u>FIBERS/CC</u>
K43691	1st Fl/WI10 of Elevator & Bathroom	1200	0.018
K43692	1st Fl/Main Lobby	1200	0.025
K43693	1st FL/WI10/Critical Barrier Corridor/Between Bathrooms Southeast	1200	0.017
K43694	1st Fl/WI10 of Airlock/Back Door to Restaurant	1200	0.009
K43695	1st Fl/WI10 of Elevator & Bathroom	1200	0.012
K43696	1st FL/Main Lobby	1200	0.009

Analyst Signature: 
ELLIS, BENJAMIN, J. , ASSISTANT MANAGER

(<) Indicates results are below the limit of detection (LOD). LOD is based on 5.5 fibers/100 fields.

Page 1 of 3





HILLMANN ENVIRONMENTAL GROUP, L.L.C.
ENVIRONMENTAL CONSULTING & LAB SERVICES

Continuation**To:** CLARIS SERVICES GROUP**Location:** Marriott World Financial Center
85 West Street/New York/NY
HECO# Y1-3508**Procedure:** Air Quality**AIR SAMPLE CERTIFICATE OF ANALYSIS**

Method: Phase Contrast Microscopy: NIOSH 7400; Issue #2, 1994/ELAP ID 10926

<u>LAB ID#</u>	<u>LOCATION/SAMPLE ID</u>	<u>VOLUME(LITERS)</u>	<u>FIBERS/CC</u>
K43697	1st Fl/WI10/Critical Barrier Corridor/Between Bathrooms Southeast	1200	0.002
K43698	1st Fl/WI10 of Airlock/Back Door of Restaurant	1200	0.004
K43699	1st Fl/WI10 of Elevator & Bathroom	1200	0.013
K43700	1st Fl/Main Lobby	1200	0.009
K43701	1st Fl/WI10/Critical Barrier Corridor/Between Bathrooms Southeast	1200	0.006
K43702	1st Fl/WI10/of Airlock/Back Door of Restaurant	1200	0.006
K43703	1st Fl/WI10 of Elevator & Bathroom	1200	0.011
K43704	1st Fl/Main Lobby	1200	0.010
K43705	1st Fl/WI10/Critical Barrier Corridor Between Bathrooms Southeast	1200	0.011

Analyst Signature: _____

ELLIS, BENJAMIN, J. , ASSISTANT MANAGER

(<) Indicates results are below the limit of detection (LOD). LOD is based on 5.5 fibers/100 fields.

Page 2 of 3





HILLMANN ENVIRONMENTAL GROUP, L.L.C.
ENVIRONMENTAL CONSULTING & LAB SERVICES

Continuation**To:** CLARIS SERVICES GROUP**Location:** Marriott World Financial Center
85 West Street/New York/NY
HECO# Y1-3508**Procedure:** Air Quality**AIR SAMPLE CERTIFICATE OF ANALYSIS**

Method: Phase Contrast Microscopy: NIOSH 7400; Issue #2, 1994/ELAP ID 10926

<u>LAB ID#</u>	<u>LOCATION/SAMPLE ID</u>	<u>VOLUME(LITERS)</u>	<u>FIBERS/CC</u>
K43706	1st Fl/WI10 of Airlock/Back Door of Restaurant	1200	0.006
K43707	1st Fl/WI10 of Elevator & Bathroom	1350	0.004
K43708	1st Fl/Main Lobby	1350	0.009
K43709	1st Fl/WI10/Critical Barrier Corridor Between Bathrooms Southeast	1350	0.004
K43710	1st Fl/WI10 of Airlock/Back Door of Restaurant	1350	0.007

Analyst Signature: _____

ELLIS, BENJAMIN, J. , ASSISTANT MANAGER

(<) Indicates results are below the limit of detection (LOD). LOD is based on 5.5 fibers/100 fields.

Page 3 of 3



Job #: 2010-0335

Client Name: Hillmann Environmental Company, Inc.

Table I
Summary of Transmission Electron Microscopy (TEM) Results for Asbestos (air)
 VI-; Marriott; 85 West Street

SciLab Sample #	Client Sample #	Dilution Factor	Air Filtered (liters)	Area * Analyzed (sq. mm.)	Analytical Sensitivity (struc/cc air)	Asbestos Structures Detected (Microns)		Structure Density (struc/sq. mm.)		Structure Concentration (struc/cc air)		Type of Asbestos
						>5.0	Total	>5.0	Total	>5.0	Total	
03	MM092603N		1200	.1	0.0032	2.0	0.0	<10	20.0	<0.0032	0.0064	chrysotile
	1st Floor W1 10CR Barrier & Corridor Btw. Bathroom (SE) Rest.											
02	MM092602N		1200	.1	0.0032	4.0	2.0	20.0	60.0	0.0064	0.0193	chrysotile
	1st Floor Main Lobby											
01**	MM092601N		1200									
	1st Floor W1 10 Of Elevator & Bathroom (OVERLOADED WITH PARTICULATE, NO ASBESTOS DETECTED BY QUALITATIVE SCAN)											
04	MM092605N		1200	.1	0.0032	2.0	1.0	10.0	30.0	0.0032	0.0096	chrysotile
	1st Floor W1 10 Of Elevator & Bathroom											
05	MM092609N		1200	.1	0.0032	0.0	1.0	10.0	10.0	0.0032	0.0032	chrysotile
	1st Floor W1 10 Of Elevator & Bathroom											
06	MM092713N		1200	.1	0.0032	1.0	1.0	10.0	20.0	0.0032	0.0064	chrysotile
	1st Floor W1 10 Of Elevator & Bathroom											
07	MM092714N		1200	.1	0.0032	2.0	0.0	<10	20.0	<0.0032	0.0064	chrysotile
	1st Floor Main Lobby											
08	MM092715N		1200	.1	0.0032	3.0	1.0	10.0	40.0	0.0032	0.0128	chrysotile
	1st Floor W1 10 CR Barrier Corridor Btw. Bathroom (SE) Rest.											

* concentration represented by the detection of 1 structure

** not analyzed

NSD: No Asbestos Structures Detected

Reviewed By:

Analyzed By:

Date: 9/28/01

Mark Peysakhov

NVLAP#: 200546-0

**HILLMANN ENVIRONMENTAL GROUP, L.L.C.**

ENVIRONMENTAL CONSULTING & LAB SERVICES

1600 ROUTE 22 EAST

P.O. BOX 1597

UNION, NEW JERSEY 07083-1597

(908) 688-7800

FAX (908) 688-7800

www.hillmanngroup.com

Date of Sampling: September 26, 2001
Date of Sample Receipt: September 26, 2001

To: CLARIS SERVICES GROUP
6903 ROCKLEDGE DRIVE
SUITE 920
BETHSEDA, MD 20817
Attn: MS. JUDY GILBERT

Location: Marriott World Financial Center
85 West Street/New York/NY
HECO# Y1-3508

Procedure: Air Quality

Field Technician: CUASCUT, DETRICK F
Date of Analysis: September 26, 2001
Date of Issue: October 18, 2001

AIR SAMPLE CERTIFICATE OF ANALYSIS

Method: Phase Contrast Microscopy: NIOSH 7400; Issue #2, 1994/ELAP ID 10926

<u>LAB ID#</u>	<u>LOCATION/SAMPLE ID</u>	<u>VOLUME (LITERS)</u>	<u>FIBERS/CC</u>
K43622	1st Fl/Restaurant/Northeast Corner	1200	0.024
K43623	1st Fl/Southwest Dining Area	1200	0.031
K43624	1st Fl/Restaurant/Southeast Corner/With in 10' of Main Entry	1200	0.017
K43625	1st Fl/Restaurant/Kitchen Area	1200	0.016
K43626	1st Fl/With in 10' of Airlock Southwest Exit	600	0.068
K43627	1st Fl/With in 10' of Elevator & Bathrooms	600	0.025

Analyst Signature: _____

JAYCOX, DYLAN M.

(<) Indicates results are below the limit of detection (LOD). LOD is based on 5.5 fibers/100 fields.

Page 1 of 4





HILLMANN ENVIRONMENTAL GROUP, L.L.C.
ENVIRONMENTAL CONSULTING & LAB SERVICES

Continuation**to:** CLARIS SERVICES GROUP

Location: Marriott World Financial Center
85 West Street/New York/NY
HECO# Y1-3508

Procedure: Air Quality

AIR SAMPLE CERTIFICATE OF ANALYSIS

Method: Phase Contrast Microscopy: NIOSH 7400; Issue #2, 1994/ELAP ID 10926

<u>LAB ID#</u>	<u>LOCATION/SAMPLE ID</u>	<u>VOLUME(LITERS)</u>	<u>FIBERS/CC</u>
K43628	1st Fl/main Lobby	600	0.006
K43629	1st Fl/With in 10' of Critical Barrier/Corridor Between Bathrooms/Southeast & Restaurant	600	0.037
K43630	1st Fl/With in 10' of Airlock Back Door of Restaurant	600	0.053
K43631	1st Fl/With in 10' of Elevator & Bathrooms	600	0.067
K43632	1st Fl/With in 10' of Airlock & Southwest Exit	600	0.027
K43633	1st Fl/With in 10' of Elevator & bathrooms	600	0.029
K43634	With in 10' of Decon Main Lobby Area	600	0.017
K43635	Main Lobby/With in 10' of Security Desk	600	0.106
K43636	1st Fl/With in 10' of Elevator & Bathrooms	600	0.017

Analyst Signature: _____

JAYCOX, DYLAN M.

(<) Indicates results are below the limit of detection (LOD). LOD is based on 5.5 fibers/100 fields.

Page 2 of 4





HILLMANN ENVIRONMENTAL GROUP, L.L.C.
ENVIRONMENTAL CONSULTING & LAB SERVICES

Continuation**To:** CLARIS SERVICES GROUP**Location:** Marriott World Financial Center
85 West Street/New York/NY
HECO# Y1-3508**Procedure:** Air Quality**AIR SAMPLE CERTIFICATE OF ANALYSIS**

Method: Phase Contrast Microscopy: NIOSH 7400; Issue #2, 1994/ELAP ID 10926

<u>LAB ID#</u>	<u>LOCATION/SAMPLE ID</u>	<u>VOLUME(LITERS)</u>	<u>FIBERS/CC</u>
K43637	With in 10' of Decon Main Lobby Area	600	0.011
K43638	1st Fl/With in 10' of Airlock & Southwest Exit	600	0.051
K43639	1st Fl/Bathroom	600	<0.005
K43640	Main Lobby Area/With in 10' Security Desk	600	0.007
K43641	1st Fl/With in 10' of Airlock Southwest Exit	600	0.010
K43642	1st Fl/With in 10' of Bathroom & Elevators	600	<0.005
K43643	Main Lobby/With in 10' of Security Desk	600	<0.005
K43644	1st Fl/With in 10' of Airlock Back Door of Restaurant	1200	0.002
K43645	Hallway Leading to Reastaurant 10CK Boost	1200	0.004

Analyst Signature: _____

JAYCOX, DYLAN M.

(<) Indicates results are below the limit of detection (LOD). LOD is based on 5.5 fibers/100 fields.

Page 3 of 4





HILLMANN ENVIRONMENTAL GROUP, L.L.C.
ENVIRONMENTAL CONSULTING & LAB SERVICES

Continuation**To:** CLARIS SERVICES GROUP**Location:** Marriott World Financial Center
85 West Street/New York/NY
HECO# Y1-3508**Procedure:** Air Quality**AIR SAMPLE CERTIFICATE OF ANALYSIS**

Method: Phase Contrast Microscopy: NIOSH 7400; Issue #2, 1994/ELAP ID 10926

<u>LAB ID#</u>	<u>LOCATION/SAMPLE ID</u>	<u>VOLUME(LITERS)</u>	<u>FIBERS/CC</u>
K43646	With in 10' of Elevators & Bathrooms	1200	0.008
K43647	Main Lobby/With in 10' of Desk	1200	0.039
K43648	1st Fl/With in 10' of Airlock Back Door of Restaurant	600	0.007
K43649	Hallway Leading to Restaurant	600	0.010
K43650	With in 10' of Elevator & Bathroom	600	0.058
K43651	Main Lobby/With in 10' of Desk	600	0.010

Analyst Signature: _____

JAYCOX, DYLAN M.

(<) Indicates results are below the limit of detection (LOD). LOD is based on 5.5 fibers/100 fields.

Page 4 of 4



SciLab # 2010032

Client Name: Hillmann Environmental Company, Inc.

Table I

Summary of Transmission Electron Microscopy (TEM) Results for Asbestos (air)


Marriot; 85 West Street (1st Floor Restaurant)

SciLab Sample #	Client Sample #	Dilution Factor	Air Filtered (liters)	Area Analyzed (sq. mm.)	* Analytical Sensitivity (struc/cc air)	Asbestos Structures Detected (Microns)		Structure Density (struc/sq. mm.)		Structure Concentration (struc/cc air)		Type of Asbestos
						0.5-5.0	>5.0	>5.0	Total	>5.0	Total	
01	DC092601		1200	.1	0.0032	0.0	0.0	<10	<10	<0.0032	<0.0032	NSD
1st Floor Restaurant												
02**	DC092602		1200			NO VISUAL ASBESTOS BY QUALITATIVE SCAN						
1st Floor Restaurant South West Doorway Area OVERLOADED WITH >25% PARTICULATE. NO VISUAL ASBESTOS BY QUALITATIVE SCAN												
03	DC092603		1200	.1	0.0032	2.0	0.0	<10	<10	<0.0032	0.0064	chrysotile
1st Floor Restaurant South East Corner Within 10' Of Main Entry												
04	DC092604		1200	.1	0.0032	0.0	0.0	<10	<10	<0.0032	<0.0032	NSD
1st Floor Restaurant Kitchen Area												
05	DC092605		600	.1	0.0064	1.0	0.0	<10	<10	<0.0064	0.0064	chrysotile
1st Floor Within 10' Of Airlock South West Exit												
06	DC092606		600	.1	0.0064	0.0	0.0	<10	<10	<0.0064	<0.0064	NSD
1st Floor Within 10' Of Elevators + Bathrooms												
07	DC092608		600	.1	0.0064	0.0	0.0	<10	<10	<0.0064	<0.0064	NSD
1st Floor Within 10' C/R Barrier Corridor Between Bathroom (South East) + Restaurant												
08	DC092609		600	.1	0.0064	0.0	0.0	<10	<10	<0.0064	<0.0064	NSD
1st Floor Within 10' Of Airlock Back Door Of Restaurant												
09	DC092610		600	.1	0.0064	1.0	0.0	<10	<10	<0.0064	0.0064	chrysotile
1st Floor Within 10' Of Elevator + Bathroom												
10	DC092611		600	.1	0.0064	0.0	0.0	<10	<10	<0.0064	<0.0064	NSD
1st Floor Within 10' Of Airlock South West												
11	DC092612		600	.1	0.0064	0.0	0.0	<10	<10	<0.0064	<0.0064	NSD
1st Floor Within 10' Of Elevators + Bathroom												
12	DC092613		600	.1	0.0064	0.0	0.0	<10	<10	<0.0064	<0.0064	NSD
Within 10' From Decon Main Lobby Area												
13**	DC0926DC092614		600			NO VISUAL ASBESTOS BY QUALITATIVE SCAN/						
In Main Lobby Within 10' Of Security Desk OVERLOADED WITH >25% PARTICULATE. NO VISUAL ASBESTOS BY QUALITATIVE SCAN/												
14	DC092615		600	.1	0.0064	0.0	0.0	<10	<10	<0.0064	<0.0064	NSD
1st Floor Within 10' Elevator + Bathrooms												

* concentration represented by the detection of 1 structure

** not analyzed

NSD: No Asbestos Structures Detected

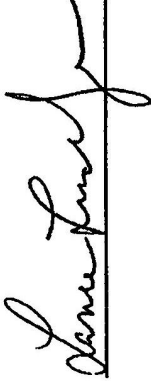Reviewed By:  : Analyzed By:  Date: 9/27/2001

Aleksandr Barengolis

NVLAP#: 200546-0

SciLab Job #: 201093206

Client Name: Hillmann Environmental Company, Inc.

Table I

Summary of Transmission Electron Microscopy (TEM) Results for Asbestos (air)

Marriot; 85 West Street (1st Floor Restaurant)

SciLab Sample #	Client Sample #	Dilution Factor	Air Filtered (liters)	Area Analyzed (sq. mm.)	* Analytical Sensitivity (struc/cc air)	Asbestos Structures Detected (Microns)			Structure Density (struc/sq. mm.)		Structure Concentration (struc/cc air)		Type of Asbestos
						0.5-5.0	>5.0	Total	>5.0	Total	>5.0	Total	
15	DC092616		600	.1	0.0064	0.0	0.0	0.0	<10	<10	<0.0064	<0.0064	NSD
	Within 10' From Decon Main Lobby Area												
16	DC092617		600	.1	0.0064	0.0	0.0	0.0	<10	<10	<0.0064	<0.0064	NSD
	1st Floor Within Airlock + South West Exit												
17	DC092620		600	.1	0.0064	0.0	0.0	0.0	<10	<10	<0.0064	<0.0064	NSD
	1st Floor Within 10' Of Airlock South West Exit												
18	DC092626		1200	.1	0.0032	0.0	0.0	0.0	<10	<10	<0.0032	<0.0032	NSD
	Within Main Lobby 10' Of Desk												
19	DC092628		600	.1	0.0064	0.0	0.0	0.0	<10	<10	<0.0064	<0.0064	NSD
	Within Hallway Heading To Restaurant												
20	DC092629		600	.1	0.0064	0.0	0.0	0.0	<10	<10	<0.0064	<0.0064	NSD
	Within 10' Elevator + Bathroom												
21	DC092630		600	.1	0.0064	0.0	0.0	0.0	<10	<10	<0.0064	<0.0064	NSD
	Within Main Lobby Within 10' Of Desk												

* concentration represented by the detection of 1 structure

** not analyzed

NSD: No Asbestos Structures Detected


Reviewed By:

Analyzed By:

Date: 9/27/2001

Aleksandr Barengolts

NVLAP#: 200546-0

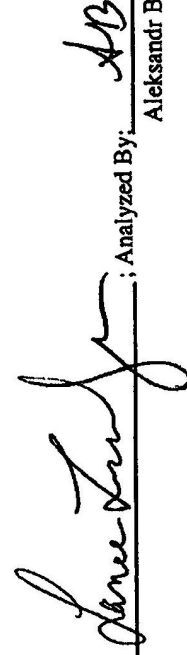

**HILLMANN ENVIRONMENTAL GROUP, L.L.C.**

ENVIRONMENTAL CONSULTING & LAB SERVICES

1600 ROUTE 22 EAST

P.O. BOX 1597

UNION, NEW JERSEY 07083-1597

(908) 688-7800

FAX (908) 688-7800

www.hillmanngroup.com

Date of Sampling: September 27, 2001
Date of Sample Receipt: September 28, 2001

To: CLARIS SERVICES GROUP
6903 ROCKLEDGE DRIVE
SUITE 920
BETHSEDA, MD 20817
Attn: MS. JUDY GILBERT

Location: Marriott World Financial Center
85 West Street/New York/NY
HECO# Y1-3508

Procedure: Air Quality

Field Technician: MAYBERRY, MARQUETTE

Date of Analysis: September 28, 2001

Date of Issue: October 12, 2001

AIR SAMPLE CERTIFICATE OF ANALYSIS

Method: Phase Contrast Microscopy: NIOSH 7400; Issue #2, 1994/ELAP ID 10926

<u>LAB ID#</u>	<u>LOCATION/SAMPLE ID</u>	<u>VOLUME(LITERS)</u>	<u>FIBERS/CC</u>
K43762	Main Lobby Floor	1200	0.014
K43763	West Exit Door/West Elevator Floor	1200	0.022
K43764	Hallway Outside Men's Bathroom	1200	0.023
K43765	Hallway Outside Restaurant Main Room	1200	0.034
K43766	Man Lobby Floor	1200	0.013
K43767	West Exit Door/West Elevator Floor	1200	0.015
K43768	Hallway Outside Men's Bathroom	1200	0.024

Analyst Signature: _____
ELLIS, BENJAMIN, J. , ASSISTANT MANAGER

(<) Indicates results are below the limit of detection (LOD). LOD is based on 5.5 fibers/100 fields.

Page 1 of 3





HILLMANN ENVIRONMENTAL GROUP, L.L.C.
ENVIRONMENTAL CONSULTING & LAB SERVICES

Continuation

To: CLARIS SERVICES GROUP

Location: Marriott World Financial Center
85 West Street/New York/NY
HECO# Y1-3508

Procedure: Air Quality

AIR SAMPLE CERTIFICATE OF ANALYSIS

Method: Phase Contrast Microscopy: NIOSH 7400; Issue #2, 1994/ELAP ID 10926

<u>LAB ID#</u>	<u>LOCATION/SAMPLE ID</u>	<u>VOLUME(LITERS)</u>	<u>FIBERS/CC</u>
K43769	Hallway Outside Restaurant Main Door	1200	0.051
K43770	Main Lobby Floor	1200	0.004
K43771	West Exit Door/West Elevator Floor	1200	0.012
K43772	Hallway Outside Men's Bathroom	1200	0.029
K43773	Hallway Outside Restaurant Main Door	1200	0.034
K43774	Main Lobby Floor	1200	0.008
K43775	West Exit Door/West Elevator Floor	1200	0.019
K43776	Hallway Outside Men's Bathroom	1200	0.020
K43777	Hallway Outside Restaurant Main Door	1200	0.025
K43778	Main Lobby Floor	1200	0.010
K43779	West Exit Door/West Elevator Floor	1200	0.010

Analyst Signature: _____

ELLIS, BENJAMIN, J. , ASSISTANT MANAGER

(<) Indicates results are below the limit of detection (LOD). LOD is based on 5.5 fibers/100 fields.

Page 2 of 3





HILLMANN ENVIRONMENTAL GROUP, L.L.C.
ENVIRONMENTAL CONSULTING & LAB SERVICES

Continuation

To: CLARIS SERVICES GROUP

Location: Marriott World Financial Center
85 West Street/New York/NY
HECO# Y1-3508

Procedure: Air Quality

AIR SAMPLE CERTIFICATE OF ANALYSIS

Method: Phase Contrast Microscopy: NIOSH 7400; Issue #2, 1994/ELAP ID 10926

<u>LAB ID#</u>	<u>LOCATION/SAMPLE ID</u>	<u>VOLUME (LITERS)</u>	<u>FIBERS/CC</u>
K43780	Hallway Outside Restaurant Main Door	1200	0.007

Analyst Signature: _____

ELLIS, BENJAMIN, J. , ASSISTANT MANAGER

(<) Indicates results are below the Limit of detection (LOD). LOD is based on 5.5 fibers/100 fields.

Page 3 of 3



SEP-29-2001 15:34

SCIENTIFIC LABS

212 679 9392 P.02/06

SciLab Job #: 201093429

Client Name: Hillmann Environmental Company, Inc.

Table I

Summary of Transmission Electron Microscopy (TEM) Results for Asbestos (air)

Marriot; 85 West Street

SciLab Sample #	Client Sample #	Dilution Factor	Air Filtered (liters)	Area Analyzed (sq. mm.)	* Analytical Sensitivity (struc/cc air)	Asbestos Structures Detected (Microns)		Structure Density (struc/sq. mm.)		Structure Concentration (struc/cc air)		Type of Asbestos
						>5.0	0.5-5.0	>5.0	<10	>5.0	Total	
01	MM0927-01N Main Lobby Floor		1200	.1	0.0032	0.0	0.0	0.0	<10	<0.0032	<0.0032	NSD
02	MM0927-02N 03 West Exit Door West Elevator Floor		1200	.1	0.0032	1.0	1.0	2.0	10.0	0.0032	0.0064	chrysotile
03	MM0927-03N Hallway Outside Mens Bathroom		1200	.1	0.0032	3.0	0.0	3.0	<10	<0.0032	0.0096	chrysotile
04**	MM0927-04N Hallway Outside Restaurant Main Door (SAMPLE OVERLOADED, CHRYSOTILE DETECTED BY QUALITATIVE SCAN.)		1200									
05	MM0927-05N Main Lobby Floor		1200	.1	0.0032	3.0	0.0	3.0	<10	<0.0032	0.0096	chrysotile
06	MM0927-06N West Exit Door West Elevator Floor		1200	.1	0.0032	0.0	0.0	2.0	20.0	0.0064	0.0064	chrysotile
07	MM0927-07N Hallway Outside Mens Bathroom		1200	.1	0.0032	2.0	1.0	3.0	10.0	0.0032	0.0096	chrysotile
08**	MM0927-08N Hallway Outside Restaurant Main Door (SAMPLE OVERLOADED, CHRYSOTILE DETECTED BY QUALITATIVE SCAN.)		1200									
09	MM0927-10N West Exit Door West Elevator Floor		1200	.1	0.0032	6.0	0.0	6.0	<10	<0.0032	0.0193	chrysotile
10	MM0927-11N Hallway Outside Mens Bathroom		1200	.1	0.0032	5.0	3.0	8.0	30.0	0.0096	0.0257	chrysotile
11	MM0927-12N Hallway Outside Restaurant Main Door		1200	.1	0.0032	4.0	1.0	5.0	10.0	0.0032	0.0160	chrysotile
12**	MM0927-14N West Exit Door West Elevator Floor (SAMPLE OVERLOADED, CHRYSOTILE DETECTED BY QUALITATIVE SCAN.)		1800									
13**	MM0927-15N Hallway Outside Mens Bathroom (SAMPLE OVERLOADED, CHRYSOTILE DETECTED BY QUALITATIVE SCAN.)		1800									
14	MM0927-16N Hallway Outside Restaurant Main Door		1800	.1	0.0021	0.0	2.0	2.0	20.0	0.0043	0.0043	chrysotile

* concentration represented by the detection of 1 structure

** not analyzed

NSD: No Asbestos Structures Detected

Reviewed By:

Analyzed By:

Date: 9/29/01

Glenn Massey

NVLAP#: 346-0

SEP-29-2001 15:34

SCIENTIFIC LABS

212 679 9392 P.03/06

SciLab Job #: 201093429

Client Name: Hillmann Environmental Company, Inc.

Table I

Summary of Transmission Electron Microscopy (TEM) Results for Asbestos (air)

Marriot; 85 West Street

SciLab Sample #	Client Sample #	Dilution Factor	Air Filtered (liters)	Area Analyzed (sq. mm.)	* Analytical Sensitivity (struc/cc air)	Asbestos Structures Detected (Microns)		Structure Density (struc/sq. mm.)		Structure Concentration (struc/cc air)		Type of Asbestos
						0.5-5.0	>5.0	>5.0	Total	>5.0	Total	
15	MM0927-17N		1200	.1	0.0032	1.0	0.0	<10	10.0	<0.0032	0.0032	chrysotile
	Main Lobby Floor											
16	MM0927-18N		1200	.1	0.0032	1.0	0.0	<10	10.0	<0.0032	0.0032	chrysotile
	West Exit Door West Elevator Floor											

* concentration represented by the detection of 1 structure

** not analyzed

NST: No Asbestos Structures Detected

NVLA P# 7546-0

Reviewed By:

; Analyzed By:

Date: 9/29/01

Glenn Massey

**HILLMANN ENVIRONMENTAL GROUP, L.L.C.**
ENVIRONMENTAL CONSULTING & LAB SERVICES

1600 ROUTE 22 EAST

P.O. BOX 1597

UNION, NEW JERSEY 07083-1597

(908) 688-7800

FAX (908) 688-7800

www.hillmanngroup.com

Date of Sampling: September 27, 2001**Date of Sample Receipt:** September 28, 2001**To:** CLARIS SERVICES GROUP
6903 ROCKLEDGE DRIVE
SUITE 920
BETHSEDA, MD 20817
Attn: MS. JUDY GILBERT**Location:** Marriott World Financial Center
85 West Street/New York/NY
HECO# Y1-3508**Procedure:** Air Quality**Field Technician:** CUASCUT, DETRICK F**Date of Analysis:** September 28, 2001**Date of Issue:** October 18, 2001**AIR SAMPLE CERTIFICATE OF ANALYSIS**

Method: Phase Contrast Microscopy: NIOSH 7400; Issue #2, 1994/ELAP ID 10926

<u>LAB ID#</u>	<u>LOCATION/SAMPLE ID</u>	<u>VOLUME(LITERS)</u>	<u>FIBERS/CC</u>
K43816	Main Lobby/With in 10' of Security Desk	1200	0.004
K43817	1st Fl/With in 10' of Elevator Bathrooms	1200	0.013
K43818	Corridor/Between Restaurant & Store	1200	0.027
K43819	With in 10' of Main Entry to Restaurant Airlock	1200	0.010
K43820	Main Lobby/With in 10' of Security Desk	1200	0.003
K43821	1st Fl/With in 10' of Elevator & Bathrooms	1200	0.004

Analyst Signature: _____
ELLIS, BENJAMIN, J. , ASSISTANT MANAGER

(<) Indicates results are below the limit of detection (LOD). LOD is based on 5.5 fibers/100 fields.

Page 1 of 3





HILLMANN ENVIRONMENTAL GROUP, L.L.C.
ENVIRONMENTAL CONSULTING & LAB SERVICES

Continuation

To: CLARIS SERVICES GROUP

Location: Marriott World Financial Center
85 West Street/New York/NY
HECO# Y1-3508

Procedure: Air Quality

AIR SAMPLE CERTIFICATE OF ANALYSIS

Method: Phase Contrast Microscopy: NIOSH 7400; Issue #2, 1994/ELAP ID 10926

<u>LAB ID#</u>	<u>LOCATION/SAMPLE ID</u>	<u>VOLUME(LITERS)</u>	<u>FIBERS/CC</u>
K43822	Corridor Between Restaurant & Store	1200	0.004
K43823	With in 10' of Main Entry to Restaurant Airlock	1200	0.008
K43824	Main Lobby/With in 10' of Security Desk	1200	0.020
K43825	1st Fl/With in 10' of Elevator & Elevators	1200	0.018
K43826	Corridor Between Restaurant & Store	1200	0.017
K43827	with in 10' of Main Entry to Restaurant Airlock	1200	0.006
K43828	Main Lobby/With in 10' of Security Desk	1200	0.006
K43829	1st Fl/With in 10' of Elevator & Bathrooms	1200	0.026
K43830	Corridor Between Restaurant & Store	1200	0.011

Analyst Signature: _____

ELLIS, BENJAMIN, J. , ASSISTANT MANAGER

(<) Indicates results are below the limit of detection (LOD). LOD is based on 5.5 fibers/100 fields.

Page 2 of 3





HILLMANN ENVIRONMENTAL GROUP, L.L.C.
ENVIRONMENTAL CONSULTING & LAB SERVICES

Continuation**To:** CLARIS SERVICES GROUP**Location:** Marriott World Financial Center
85 West Street/New York/NY
HECO# Y1-3508**Procedure:** Air Quality**AIR SAMPLE CERTIFICATE OF ANALYSIS**

Method: Phase Contrast Microscopy: NIOSH 7400; Issue #2, 1994/ELAP ID 10926

<u>LAB ID#</u>	<u>LOCATION/SAMPLE ID</u>	<u>VOLUME (LITERS)</u>	<u>FIBERS/CC</u>
K43831	With in 10' of Main Entry to Restaurant Airlock	1200	0.007
K43832	Main Lobby/With in 10' of Security Desk	1800	0.003
K43833	1st Fl/With in 10' of Elevator & bathrooms	1800	<0.002
K43834	Corridor Between Restaurant & Store	1800	<0.002
K43835	With in 10' of Main Entry to Restaurant Airlock	1800	<0.002

Analyst Signature: _____

ELLIS, BENJAMIN, J. , ASSISTANT MANAGER

(<) Indicates results are below the limit of detection (LOD). LOD is based on 5.5 fibers/100 fields.

Page 3 of 3



RECEIVED: 9/28/01 10:19AM;

212 679 9392 -> Hillmann Environmental; Page 2

SEP-29-2001 09:13

SCIENTIFIC LABS

212 679 9392 P.02/04

SciLab Job #: 201093389

Client Name: Hillmann Environmental Company, Inc.

Table 1

Summary of Transmission Electron Microscopy (TEM) Results for Asbestos (air)

Marriot; 85 West Street (WTC), Rays Restaurant

SciLab Sample #	Client Sample #	Dilution Factor	Air Filtered (liters)	Area Analyzed (sq. mm.)	* Analytical Sensitivity (struc/cc air)	Asbestos Structures Detected (Microns)		Structure Density (struc/sq. mm.)		Structure Concentration (struc/cc air)		Type of Asbestos	
						0.5-5.0	>5.0	>5.0	Total	>5.0	Total		>5.0
01	DC0927-02		1200	.1	0.0032	2.0	1.0	3.0	10.0	30.0	0.0032	0.0096	chrysotile
	WI 10' Of Elevators & Bathrooms 1st Floor												
02**	DC0927-03		1200										
	WI Corridor Btw. Restaurant & Store (OA) (UNABLE TO PREPARE SAMPLE BECAUSE OF PARTICULATE INTERFERENCE.)												
03**	DC0927-04		1200										
	WI 10' Main Entry To Restaurant Airlock (OA) (UNABLE TO PREPARE SAMPLE BECAUSE OF PARTICULATE INTERFERENCE.)												
04**	DC0927-09		1200										
	WI Main Lobby WI 10' Of Security Desk (UNABLE TO PREPARE SAMPLE BECAUSE OF PARTICULATE INTERFERENCE.)												
05	DC0927-10		1200	.1	0.0032	0.0	1.0	1.0	10.0	10.0	0.0032	0.0032	chrysotile
	WI 10' Of Elevators & Bathroom 1st Floor												
06**	DC0927-11		1200										
	WI Corridor Restaurant & Store (UNABLE TO PREPARE SAMPLE BECAUSE OF PARTICULATE INTERFERENCE.)												
07**	DC0927-14		1200										
	WI 10' Of Elevators & Bathrooms 1st Floor (UNABLE TO PREPARE SAMPLE BECAUSE OF PARTICULATE INTERFERENCE.)												
08	DC0927-15		1200	.1	0.0032	3.0	2.0	5.0	20.0	50.0	0.0064	0.0160	chrysotile
	WI Corridor Btw. Corridor & Store												

* concentration represented by the detection of 1 structure

** not analyzed

NSD: No Asbestos Structures Detected

Reviewed By:

Analyzed By:

Date: 9/28/01

Glenn Massey

NYLAP#: 200546-0

**HILLMANN ENVIRONMENTAL GROUP, L.L.C.**
ENVIRONMENTAL CONSULTING & LAB SERVICES

1600 ROUTE 22 EAST

P.O. BOX 1597

UNION, NEW JERSEY 07083-1597

(908) 688-7800

FAX (908) 688-7800

www.hillmanngroup.com

Date of Sampling: September 28, 2001
Date of Sample Receipt: September 29, 2001

To: CLARIS SERVICES GROUP
6903 ROCKLEDGE DRIVE
SUITE 920
BETHSEDA, MD 20817
Attn: MS. JUDY GILBERT

Location: Marriott World Financial Center
85 West Street/New York/NY
HECO# Y1-3508

Procedure: Air Quality

Field Technician: MAYBERRY, MARQUETTE
Date of Analysis: September 29, 2001
Date of Issue: October 12, 2001

AIR SAMPLE CERTIFICATE OF ANALYSIS

Method: Phase Contrast Microscopy: NIOSH 7400; Issue #2, 1994/ELAP ID 10926

<u>LAB ID#</u>	<u>LOCATION/SAMPLE ID</u>	<u>VOLUME(LITERS)</u>	<u>FIBERS/CC</u>
K43887	1st Fl/Main Lobby Area	1800	0.008
K43888	1st Fl/Elevator/West	1800	0.011
K43889	1st Fl/Outside Men's Bathroom in Hallway	1800	0.009
K43890	1st Fl/Outside Main Restaurant Door	1800	0.008
K43891	1st Fl/Main Lobby Area	1200	0.009
K43892	1st Fl/Elevator/West	1200	0.013
K43893	1st Fl/Outside Men's Bathroom in Hallway	1200	0.005

Analyst Signature: _____

ELLIS, BENJAMIN, J. , ASSISTANT MANAGER

(<) Indicates results are below the limit of detection (LOD). LOD is based on 5.5 fibers/100 fields.

Page 1 of 3





HILLMANN ENVIRONMENTAL GROUP, L.L.C.
ENVIRONMENTAL CONSULTING & LAB SERVICES

Continuation

To: CLARIS SERVICES GROUP

Location: Marriott World Financial Center
85 West Street/New York/NY
HECO# Y1-3508

Procedure: Air Quality

AIR SAMPLE CERTIFICATE OF ANALYSIS

Method: Phase Contrast Microscopy: NIOSH 7400; Issue #2, 1994/ELAP ID 10926

<u>LAB ID#</u>	<u>LOCATION/SAMPLE ID</u>	<u>VOLUME(LITERS)</u>	<u>FIBERS/CC</u>
K43894	1st Fl/Outside Main Restaurant Door	1200	0.004
K43895	1st Fl/Main Lobby Area	1200	0.009
K43896	1st Fl/Elevator/West	1200	0.020
K43897	1st Fl/Outside Men's Bathroom in Hallway	1200	0.022
K43898	1st Fl/Outside Main Restaurant Door	1200	0.030
K43899	1st Fl/Main Lobby Area	1200	0.003
K43900	1st Fl/Elevator/West	1200	0.033
K43901	1st Fl/Outside Men's Bathroom in Hallway	1200	0.038
K43902	1st Fl/Outside Main Restaurant Door	1200	0.004
K43903	1st Fl/Main Lobby Area	1300	0.011
K43904	1st Fl/Elevator/West	1300	0.007

Analyst Signature: _____

ELLIS, BENJAMIN, J. , ASSISTANT MANAGER

(<) Indicates results are below the limit of detection (LOD). LOD is based on 5.5 fibers/100 fields.

Page 2 of 3





HILLMANN ENVIRONMENTAL GROUP, L.L.C.
ENVIRONMENTAL CONSULTING & LAB SERVICES

Continuation

To: CLARIS SERVICES GROUP

Location: Marriott World Financial Center
85 West Street/New York/NY
HECO# Y1-3508

Procedure: Air Quality

AIR SAMPLE CERTIFICATE OF ANALYSIS

Method: Phase Contrast Microscopy: NIOSH 7400; Issue #2, 1994/ELAP ID 10926

<u>LAB ID#</u>	<u>LOCATION/SAMPLE ID</u>	<u>VOLUME(LITERS)</u>	<u>FIBERS/CC</u>
K43905	1st Fl/Outside Men's Bathroom in Hallway	1300	0.004
K43906	1st Fl/Outside Main Restaurant Door	1300	0.006

Analyst Signature: 
ELLIS, BENJAMIN, J. , ASSISTANT MANAGER

(<) Indicates results are below the limit of detection (LOD). LOD is based on 5.5 fibers/100 fields.

Page 3 of 3



SciLab Job #: 201093505

Client Name: Hillmann Environmental Company, Inc.

Table I

Summary of Transmission Electron Microscopy (TEM) Results for Asbestos (air)

V1-3395; Marriott; 85 West Street, NY, NY

SciLab Sample #	Client Sample #	Dilution Factor	Air Filtered (liters)	Area Analyzed (sq. mm.)	* Analytical Sensitivity (struc/cc air)	Asbestos Structures Detected (Microns)			Structure Density (struc/sq. mm.)		Structure Concentration (struc/cc air)		Type of Asbestos
						0.5-5.0	>5.0	Total	>5.0	Total	>5.0	Total	
01**	MM0928-02		1800										
	1st Floor West Elevator	/SAMPLE OVERLOADED WITH >25% PARTICULATE. NO VISUAL ASBESTOS DETECTED BY QUALITATIVE SCAN/											
02	MM0928-06		900	.1	0.0043	0.0	0.0	0.0	<10	<10	<0.0043	<0.0043	NSD
03	MM0928-10		1200	.1	0.0032	1.0	1.0	2.0	10.0	20.0	0.0032	0.0064	chrysotile
04	MM0928-11		1200	.1	0.0032	0.0	0.0	0.0	<10	<10	<0.0032	<0.0032	NSD
05**	MM0928-12		1200										
	04/SAMPLE OVERLOADED WITH >25% PARTICULATE. NO VISUAL ASBESTOS DETECTED BY QUALITATIVE SCAN/												
06**	MM0928-14		1200										
	02/SAMPLE OVERLOADED WITH >25% PARTICULATE. NO VISUAL ASBESTOS DETECTED BY QUALITATIVE SCAN/												
07**	MM0928-15		1200										
	03/SAMPLE OVERLOADED WITH >25% PARTICULATE. NO VISUAL ASBESTOS DETECTED BY QUALITATIVE SCAN/												
08**	MM0928-17		1300										
	01/SAMPLE OVERLOADED WITH >25% PARTICULATE. NO VISUAL ASBESTOS DETECTED BY QUALITATIVE SCAN/												

* concentration represented by the detection of 1 structure

** not analyzed

NSD: No Asbestos Structures Detected

Reviewed By:

; Analyzed By:

Date: 9/29/01

Aleksandr Barengolts

NVLAP#: 200546-0

**HILLMANN ENVIRONMENTAL GROUP, L.L.C.**

ENVIRONMENTAL CONSULTING & LAB SERVICES

1600 ROUTE 22 EAST

P.O. BOX 1597

UNION, NEW JERSEY 07083-1597

(908) 688-7800

FAX (908) 688-7800

www.hillmanngroup.com

Date of Sampling: September 28, 2001**Date of Sample Receipt:** September 28, 2001**To:** CLARIS SERVICES GROUP
6903 ROCKLEDGE DRIVE
SUITE 920
BETHSEDA, MD 20817
Attn: MS. JUDY GILBERT**Location:** Marriott World Financial Center
85 West Street/New York/NY
HECO# Y1-3508**Procedure:** Air Quality**Field Technician:** CUASCUT, DETRICK F**Date of Analysis:** September 28, 2001**Date of Issue:** October 18, 2001**AIR SAMPLE CERTIFICATE OF ANALYSIS**

Method: Phase Contrast Microscopy: NIOSH 7400; Issue #2, 1994/ELAP ID 10926

<u>LAB ID#</u>	<u>LOCATION/SAMPLE ID</u>	<u>VOLUME(LITERS)</u>	<u>FIBERS/CC</u>
K43920	1st Fl/With in 10' of Elevator & Bathroom	1200	0.021
K43921	1st Fl/Main Lobby	1200	Overload
K43922	1st Fl/With in 10' of Critical Barrier/Between Corridor & Airlock	1200	0.036
K43923	1st Fl/Between Back Door & Airlock	1200	Overload
K43924	1st Fl/With in 10' of Elevator & Bathroom	1200	0.008
K43925	1st Fl/Main Lobby	1200	0.008

Analyst Signature: _____

JAYCOX, DYLAN M.

(<) Indicates results are below the limit of detection (LOD). LOD is based on 5.5 fibers/100 fields.

Page 1 of 3





HILLMANN ENVIRONMENTAL GROUP, L.L.C.
ENVIRONMENTAL CONSULTING & LAB SERVICES

Continuation**To:** CLARIS SERVICES GROUP**Location:** Marriott World Financial Center
85 West Street/New York/NY
HECO# Y1-3508**Procedure:** Air Quality**AIR SAMPLE CERTIFICATE OF ANALYSIS**

Method: Phase Contrast Microscopy: NIOSH 7400; Issue #2, 1994/ELAP ID 10926

<u>LAB ID#</u>	<u>LOCATION/SAMPLE ID</u>	<u>VOLUME(LITERS)</u>	<u>FIBERS/CC</u>
K43926	1st Fl/With in 10' of Critical Barrier/Between Corridor & Airlock	1200	0.005
K43927	1st Fl/Between Back Door & Airlock	1200	0.009
K43928	1st Fl/With in 10' of Elevator & Bathroom	1200	0.012
K43929	1st Fl/Main Lobby	1200	0.011
K43930	1st Fl/With in 10' of Critical Barrier/Between Corridor & Airlock	1200	0.009
K43931	1st Fl/Between Back Door & Airlock	1200	0.010
K43932	1st Fl/With in 10' of Elevator & Bathroom	1200	0.003
K43933	1st Fl/Main Lobby	1200	0.007
K43934	1st Fl/With in 10' of Critical Barrier/Between Corridor & Airlock	1200	0.006

Analyst Signature: _____

JAYCOX, DYLAN M.

(<) Indicates results are below the limit of detection (LOD). LOD is based on 5.5 fibers/100 fields.

Page 2 of 3





HILLMANN ENVIRONMENTAL GROUP, L.L.C.
ENVIRONMENTAL CONSULTING & LAB SERVICES

Continuation**To:** CLARIS SERVICES GROUP**Location:** Marriott World Financial Center
85 West Street/New York/NY
HECO# Y1-3508**Procedure:** Air Quality**AIR SAMPLE CERTIFICATE OF ANALYSIS**

Method: Phase Contrast Microscopy: NIOSH 7400; Issue #2, 1994/ELAP ID 10926

<u>LAB ID#</u>	<u>LOCATION/SAMPLE ID</u>	<u>VOLUME(LITERS)</u>	<u>FIBERS/CC</u>
K43935	1st Fl/Between Back Door & Airlock	1200	0.005
K43936	1st Fl/With in 10' of Elevator & Bathroom	1200	0.009
K43937	1st Fl/Main Lobby	1200	0.005
K43938	1st Fl/With in 10' of Critical Barrier/Between Corridor & Airlock	1200	0.004
K43939	1st Fl/Between Back Door & Airlock	1200	0.010
K43940	1st Fl/With in 10' of Elevator & Bathroom	1200	0.011
K43941	1st Fl/Main Lobby	1200	0.013
K43942	1st Fl/With in 10' of Critical Barrier/Between Corridor & Airlock	1200	0.019
K43943	1st Fl/Between Back Door & Airlock	1200	0.010

Analyst Signature: _____

JAYCOX, DYLAN M.

(<) Indicates results are below the limit of detection (LOD). LOD is based on 5.5 fibers/100 fields.

Page 3 of 3



SciLab Job #: 201093450

Client Name: Hillmann Environmental Company, Inc.

Table I

Summary of Transmission Electron Microscopy (TEM) Results for Asbestos (air)

Marriot; 85 West Street (Roy's Restaurant)

SciLab Sample #	Client Sample #	Dilution Factor	Air Filtered (liters)	Area Analyzed (sq. mm.)	* Analytical Sensitivity (struc/cc air)	Asbestos Structures Detected (Microns)		Structure Density (struc/sq. mm.)		Structure Concentration (struc/cc air)		Type of Asbestos	
						0.5-5.0	>5.0	Total	>5.0	Total	>5.0		Total
01**	DC092801		1200	1st Floor W/1 10' Of Elevator + Bath /SAMPLE OVERLOADED WITH >25% PARTICULATE. NO VISUAL ASBESTOS BY QUALITATIVE SCAN/									
02**	DC092802		1200	1st Floor Main Lobby /SAMPLE OVERLOADED WITH >25% PARTICULATE. NO VISUAL ASBESTOS BY QUALITATIVE SCAN/									
03**	DC092803		1200	1st Floor W/1 10' Of C/R Barrier Between Corridor And Airlock /SAMPLE OVERLOADED WITH >25% PARTICULATE. NO VISUAL ASBESTOS BY QUAL									
04**	DC092804		1200	1st Floor Between Back Door + Airlock /SAMPLE OVERLOADED WITH >25% PARTICULATE. NO VISUAL ASBESTOS BY QUALITATIVE SCAN/									
05**	DC092809		1200	1st Floor W/1 10' Of Elevator + Bath /SAMPLE OVERLOADED WITH >25% PARTICULATE. NO VISUAL ASBESTOS BY QUALITATIVE SCAN/									NSD
06	DC092810		1200	.1	0.0032	0.0	0.0	0.0	<10	<10	<0.0032	<0.0032	NSD
07	DC092812		1200	.1	0.0032	0.0	0.0	0.0	<10	<10	<0.0032	<0.0032	NSD
08	DC092820		1200	.1	0.0032	0.0	0.0	0.0	<10	<10	<0.0032	<0.0032	NSD
09	DC092821		1200	.1	0.0032	0.0	0.0	0.0	<10	<10	<0.0032	<0.0032	NSD
10	DC092822		1200	.1	0.0032	0.0	0.0	0.0	<10	<10	<0.0032	<0.0032	NSD
11**	DC092823		1200	1st Floor Main Lobby									
	DC092824		1200	1st Floor W/1 10' Of C/R Barrier Between Corridor And Airlock /SAMPLE OVERLOADED WITH >25% PARTICULATE. NO VISUAL ASBESTOS BY QUAL									
12**	DC092824		1200	1st Floor Between Back Door + Airlock /SAMPLE OVERLOADED WITH >25% PARTICULATE. NO VISUAL ASBESTOS BY QUALITATIVE SCAN/									

* concentration represented by the detection of 1 structure

** not analyzed

NSD: No Asbestos Structures Detected

Reviewed By:

Analyzed By:

Date: 9/29/01

Aleksandr Barengolts

NYLAP#: 200546-0

**HILLMANN ENVIRONMENTAL GROUP, L.L.C.**
ENVIRONMENTAL CONSULTING & LAB SERVICES

1600 ROUTE 22 EAST

P.O. BOX 1597

UNION, NEW JERSEY 07083-1597

(908) 688-7800

FAX (908) 688-7800

www.hillmannngroup.com

Date of Sampling: September 29, 2001
Date of Sample Receipt: September 29, 2001

To: CLARIS SERVICES GROUP
6903 ROCKLEDGE DRIVE
SUITE 920
BETHSEDA, MD 20817
Attn: MS. JUDY GILBERT

Location: Marriott World Financial Center
85 West Street/New York/NY
HECO# Y1-3508

Procedure: Air Quality

Field Technician: CUASCUT, DETRICK F
Date of Analysis: September 29, 2001
Date of Issue: October 19, 2001

AIR SAMPLE CERTIFICATE OF ANALYSIS

Method: Phase Contrast Microscopy: NIOSH 7400; Issue #2, 1994/ELAP ID 10926

<u>LAB ID#</u>	<u>LOCATION/SAMPLE ID</u>	<u>VOLUME(LITERS)</u>	<u>FIBERS/CC</u>
K43992	1st Fl/Main Lobby	1200	0.011
K43993	1st Fl/With in 10' of Elevator & Bathrooms	1200	0.015
K43994	Main Entry to Restaurant Airlock	1200	0.010
K43995	1st Fl/Ladies' Bathroom	1200	0.017
K43996	1st Fl/Main Lobby	1200	0.007
K43997	1st Fl/With in 10' of Elevator & Bathrooms	1200	0.005
K43998	Main Entry to Restaurant Airlock	1200	0.002

Analyst Signature: _____

SAE-LAO, CHAIYUT, LAB DIRECTOR

(<) Indicates results are below the limit of detection (LOD). LOD is based on 5.5 fibers/100 fields.

Page 1 of 3





HILLMANN ENVIRONMENTAL GROUP, L.L.C.
ENVIRONMENTAL CONSULTING & LAB SERVICES

Continuation

To: CLARIS SERVICES GROUP

Location: Marriott World Financial Center
85 West Street/New York/NY
HECO# Y1-3508

Procedure: Air Quality

AIR SAMPLE CERTIFICATE OF ANALYSIS

Method: Phase Contrast Microscopy: NIOSH 7400; Issue #2, 1994/ELAP ID 10926

<u>LAB ID#</u>	<u>LOCATION/SAMPLE ID</u>	<u>VOLUME(LITERS)</u>	<u>FIBERS/CC</u>
K43999	1st Fl/Ladies' Bathroom	1200	0.006
K44000	1st Fl/Main Lobby	1200	0.005
K44001	1st Fl/With in 10' of Elevator & Bathroom	1200	0.011
K44002	Main Entry to Restaurant Airlock	1200	0.010
K44003	1st Fl/Ladies' Bathroom	1200	0.005
K44004	1st Fl/Main Lobby	1200	0.013
K44005	1st Fl/With in 10' of Elevator & Bathrooms	1200	0.012
K44006	Main Entry to Restaurant Airlock	1200	0.020
K44007	1st Fl/Ladies' Bathroom	1200	<0.002
K44008	1st Fl/Main Lobby	1200	0.010
K44009	1st Fl/With in 10' of Elevator & Bathrooms	1200	0.006

Analyst Signature: _____

SAE-LAO, CHAIYUT, LAB DIRECTOR

(<) Indicates results are below the limit of detection (LOD). LOD is based on 5.5 fibers/100 fields.

Page 2 of 3





HILLMANN ENVIRONMENTAL GROUP, L.L.C.
ENVIRONMENTAL CONSULTING & LAB SERVICES

Continuation**To:** CLARIS SERVICES GROUP**Location:** Marriott World Financial Center
85 West Street/New York/NY
HECO# Y1-3508**Procedure:** Air Quality**AIR SAMPLE CERTIFICATE OF ANALYSIS**

Method: Phase Contrast Microscopy: NIOSH 7400; Issue #2, 1994/ELAP ID 10926

<u>LAB ID#</u>	<u>LOCATION/SAMPLE ID</u>	<u>VOLUME(LITERS)</u>	<u>FIBERS/CC</u>
K44010	Main Entry to Restaurant Airlock	1200	0.006
K44011	1st Fl/Ladies' Bathroom	1200	0.011
K44012	1st Fl/Main Lobby	1200	<0.002
K44013	1st Fl/With in 10' of Elevator & Bathrooms	1200	Overload
K44014	Main Entry to Restaurant Airlock	1200	0.014
K44015	1st Fl/Ladies' Room	1200	0.010

Analyst Signature: _____

SAE-LAO, CHAIYUT, LAB DIRECTOR

(<) Indicates results are below the limit of detection (LOD). LOD is based on 5.5 fibers/100 fields.

Page 3 of 3



SciLab Job #: 201093536

Client Name: Hillmann Environmental Company, Inc.

Table I

Summary of Transmission Electron Microscopy (TEM) Results for Asbestos (air)

Y1-3395; 85 West Street (Marriott); Marriott Roy's Restaurant & Adjacent Area

SciLab Sample #	Client Sample #	Dilution Factor	Air Filtered (liters)	Area Analyzed (sq. mm.)	* Analytical Sensitivity (struc/cc air)	Asbestos Structures Detected (Microns)		Structure Density (struc/sq. mm.)		Structure Concentration (struc/cc air)		Type of Asbestos
						0.5-5.0	>5.0	Total	>5.0	Total	>5.0	
01	DC092901	:	1200	.1	0.0032	1.0	0.0	1.0	<10	10.0	<0.0032	chrysotile
	Main Lobby, 1st Floor											
02	DC092902		1200	.1	0.0032	1.0	0.0	1.0	<10	10.0	<0.0032	chrysotile
	W/in 10' of Elevators & Bathroom, 1st Floor											
03	DC092903		1200	.1	0.0032	0.0	1.0	1.0	10.0	10.0	0.0032	chrysotile
	W/in Main Entry to Restaurant Airllock											
04	DC092904		1200	.1	0.0032	1.0	1.0	2.0	10.0	20.0	0.0064	chrysotile
	W/in Ladies' Bathroom, 1st Floor											
05	DC092910		1200	.1	0.0032	0.0	0.0	0.0	<10	<10	<0.0032	NSD
02												
06	DC092911		1200	.1	0.0032	1.0	0.0	1.0	<10	10.0	<0.0032	chrysotile
03												
07	DC092913		1200	.1	0.0032	0.0	0.0	0.0	<10	<10	<0.0032	NSD
01												
08	DC092914		1200	.1	0.0032	0.0	0.0	0.0	<10	<10	<0.0032	NSD
02												
09	DC092915		1200	.1	0.0032	0.0	0.0	0.0	<10	<10	<0.0032	NSD
03												
10	DC092917		1200	.1	0.0032	0.0	0.0	0.0	<10	<10	<0.0032	NSD
01												
11	DC092920		1200	.1	0.0032	0.0	0.0	0.0	<10	<10	<0.0032	NSD
04												
12	DC092922		1200	.1	0.0032	0.0	1.0	1.0	10.0	10.0	0.0032	chrysotile
02												
13	DC092923		1200	.1	0.0032	0.0	0.0	0.0	<10	<10	<0.0032	NSD
03												
14	DC092924		1200	.1	0.0032	0.0	0.0	0.0	<10	<10	<0.0032	NSD
04												

Concentration represented by the detection of 1 structure not analyzed

ID: No Asbestos Structures Detected

Reviewed By:

Analyzed By:

Date: 9/30/01

G. Massey/M. Gruzman

VLA P#: 200546-0

**HILLMANN ENVIRONMENTAL GROUP, L.L.C.**
ENVIRONMENTAL CONSULTING & LAB SERVICES

1600 ROUTE 22 EAST

P.O. BOX 1597

UNION, NEW JERSEY 07083-1597

(908) 688-7800

FAX (908) 688-7800

www.hillmanngroup.com

Date of Sampling: September 29, 2001
Date of Sample Receipt: September 30, 2001

To: CLARIS SERVICES GROUP
6903 ROCKLEDGE DRIVE
SUITE 920
BETHSEDA, MD 20817
Attn: MS. JUDY GILBERT

Location: Marriott World Financial Center
85 West Street/New York/NY
HECO# Y1-3508

Procedure: Air Quality

Field Technician: MAYBERRY, MARQUETTE
Date of Analysis: September 30, 2001
Date of Issue: October 12, 2001

AIR SAMPLE CERTIFICATE OF ANALYSIS

Method: Phase Contrast Microscopy: NIOSH 7400; Issue #2, 1994/ELAP ID 10926

<u>LAB ID#</u>	<u>LOCATION/SAMPLE ID</u>	<u>VOLUME (LITERS)</u>	<u>FIBERS/CC</u>
K44040	1st Fl/Elevator Lobby/West	1350	0.012
K44041	1st Fl/Outside Men's Bathroom	1350	<0.002
K44042	1st Fl/Hallway Outside Gift Shop	1350	0.014
K44043	Hallway Outside Ray's Restaurant	1350	0.005
K44044	1st Fl/Elevator Lobby/West	1330	0.003
K44045	1st Fl/Outside Men's Bathroom	1330	0.006
K44046	1st Fl/Hallway Outside Gift Shop	1330	<0.002

Analyst Signature: _____

JAYCOX, DYLAN M.

(<) Indicates results are below the limit of detection (LOD). LOD is based on 5.5 fibers/100 fields.

Page 1 of 2





HILLMANN ENVIRONMENTAL GROUP, L.L.C.
ENVIRONMENTAL CONSULTING & LAB SERVICES

Continuation**To:** CLARIS SERVICES GROUP**Location:** Marriott World Financial Center
85 West Street/New York/NY
HECO# Y1-3508**Procedure:** Air Quality**AIR SAMPLE CERTIFICATE OF ANALYSIS**

Method: Phase Contrast Microscopy: NIOSH 7400; Issue #2, 1994/ELAP ID 10926

<u>LAB ID#</u>	<u>LOCATION/SAMPLE ID</u>	<u>VOLUME(LITERS)</u>	<u>FIBERS/CC</u>
K44047	Hallway Outside Ray's Restaurant	1330	0.013
K44048	1st Fl/Elevator Lobby/West	1200	0.004
K44049	1st Fl/Outside Men's Bathroom	1200	0.007
K44050	1st Fl/Hallway Outside of Gift	1200	0.003
K44051	Hallway Outside Ray's Restaurant	1200	0.006

Analyst Signature: _____

JAYCOX, DYLAN M.

(<) Indicates results are below the limit of detection (LOD). LOD is based on 5.5 fibers/100 fields.

Page 2 of 2



SciLab Job #: 201093562

Client Name: Hillmann Environmental Company, Inc.

Table 1

Summary of Transmission Electron Microscopy (TEM) Results for Asbestos (air)

V1-3395; Marquette Mayberry, 85 West Street

SciLab sample #	Client Sample #	Dilution Factor	Air Filtered (liters)	Area * Analytical Analyzed (sq. mm.)	Sensitivity (struc/cc air)	Asbestos Structures Detected (Microns)		Structure Density (struc/sq. mm.)		Structure Concentration (struc/cc air)		Type of Asbestos
						0.5-5.0	>5.0	>5.0	Total	>5.0	Total	
01	MM092901 01N		1350	.1	0.0029	0.0	2.0	20.0	20.0	0.0057	0.0057	chrysotile
	Elevator Lobby West 1st Floor											
02**	MM092901 03N		1350									
	Hallway Outside Gift Shop 1st Floor - Overloaded with Particulate - Chrysotile Detected by Qualitative Scan											
03	MM092901 08N		1350	.1	0.0029	6.0	5.0	50.0	110.0	0.0143	0.0314	chrysotile
	Hallway Outside Ray's Restaurant											
04**	MM092901 10N		1200									
	Outside Mens Bathroom 1st Floor - Overloaded with Particulate - Chrysotile Detected by Qualitative Scan											

* concentration represented by the detection of 1 structure

** not analyzed

†SD: No Asbestos Structures Detected

Reviewed By:

; Analyzed By:

Date: 10/1/01

Lance Tuckrsky

NVLAP#: 200546-0

SciLab Job #: 201093537

Client Name: Hillmann Environmental Company, Inc.

Table I

Summary of Transmission Electron Microscopy (TEM) Results for Asbestos (air)

V1-3395; Marriott; 85 West Street

SciLab Sample #	Client Sample #	Dilution Factor	Air Filtered (liters)	Area Analyzed (sq. mm.)	* Analytical Sensitivity (struc/cc air)	Asbestos Structures Detected (Microns)		Structure Density (struc/sq. mm.)		Structure Concentration (struc/cc air)		Type of Asbestos
						0.5-5.0	>5.0	>5.0	Total	>5.0	Total	
01	MM093001T		1800	.1	0.0021	0.0	0.0	<10	<10	<0.0021	<0.0021	NSD
	1st Floor Roy's Restaurant Behind Bar											
02	MM093002T		1800	.1	0.0021	0.0	0.0	<10	<10	<0.0021	<0.0021	NSD
	1st Floor Roy's Restaurant Kitchen Area											
03	MM093003T		1800	.1	0.0021	1.0	0.0	<10	10.0	<0.0021	0.0021	chrysotile
	1st Floor Roy's Restaurant Back Dining Area											
04	MM093004T		1800	.1	0.0021	0.0	0.0	<10	<10	<0.0021	<0.0021	NSD
	1st Floor Outside Roy's Restaurant Main Door											
05	MM093005T		1800	.1	0.0021	0.0	0.0	<10	<10	<0.0021	<0.0021	NSD
	1st Floor Roy's Restaurant Kitchen Rear Door											
06**	MM093006T											
	Field Blank											
07**	MM093007T											
	Field Blank											

* concentration represented by the detection of 1 structure

** not analyzed

NSD: No Asbestos Structures Detected

Reviewed By: _____

Analyzed By: Glenn Massey

Date: 9/30/01

NYLAB#: 200546-0

**HILLMANN ENVIRONMENTAL GROUP, L.L.C.**

ENVIRONMENTAL CONSULTING & LAB SERVICES

1600 ROUTE 22 EAST

P.O. BOX 1597

UNION, NEW JERSEY 07083-1597

(908) 688-7800

FAX (908) 688-7800

www.hillmanngroup.com

Date of Sampling: October 13, 2001**Date of Sample Receipt:** October 13, 2001**To:** CLARIS SERVICES GROUP

6903 ROCKLEDGE DRIVE

SUITE 920

BETHSEDA, MD 20817

Attn: MS. JUDY GILBERT

Location: Marriott World Financial Center

85 West Street/New York/NY

HECO# Y1-3508

Procedure: Final Air Test**Field Technician:** DOWNS, CRAIG D.**Date of Analysis:** October 13, 2001**Date of Issue:** October 19, 2001**AIR SAMPLE CERTIFICATE OF ANALYSIS**

Method: Phase Contrast Microscopy: NIOSH 7400; Issue #2, 1994/ELAP ID 10926

<u>LAB ID#</u>	<u>LOCATION/SAMPLE ID</u>	<u>VOLUME (LITERS)</u>	<u>FIBERS/CC</u>
K48304	36th Fl/Adjacent to Elevators	1200	0.004
K48305	36th Fl/Adjacent to Room 3612	1200	0.006
K48306	2nd Fl/Offices/East	1200	0.003
K48307	2nd Fl/Offices/West	1200	<0.002

Analyst Signature: _____


SAE-LAO, CHAIYUT, LAB DIRECTOR

(<) Indicates results are below the limit of detection (LOD). LOD is based on 5.5 fibers/100 fields.

Page 1 of 2





HILLMANN ENVIRONMENTAL GROUP, L.L.C.
ENVIRONMENTAL CONSULTING & LAB SERVICES

Continuation

to: CLARIS SERVICES GROUP

Location: Marriott World Financial Center
85 West Street/New York/NY
HECO# Y1-3508

Procedure: Final Air Test

AIR SAMPLE CERTIFICATE OF ANALYSIS

Method: Phase Contrast Microscopy: NIOSH 7400; Issue #2, 1994/ELAP ID 10926

<u>LAB ID#</u>	<u>LOCATION/SAMPLE ID</u>	<u>VOLUME(LITERS)</u>	<u>FIBERS/CC</u>
		<u>FIBERS/100 FIELDS</u>	
K48308	Field Blank	ND	
K48309	Field Blank	ND	

Analyst Signature: _____

Shaiyut S. h.
SAE-LAO, CHAIYUT , LAB DIRECTOR


(<) Indicates results are below the limit of detection (LOD). LOD is based on 5.5 fibers/100 fields.

Page 2 of 2



Hillmann Environmental Group, LLC

Section 4.4 Bulk Sample Lab Data

**HILLMANN ENVIRONMENTAL GROUP, L.L.C.**
ENVIRONMENTAL CONSULTING & LAB SERVICES

1600 ROUTE 22 EAST

P.O. BOX 1597

UNION, NEW JERSEY 07083-1597

(908) 688-7800

FAX (908) 688-7800

www.hillmanngroup.com

Date of Sampling: September 21, 2001
Date of Sample Receipt: September 22, 2001

To: CLARIS SERVICES GROUP
6903 ROCKLEDGE DRIVE
SUITE 920
BETHSEDA, MD 20817
Attn: MS. JUDY GILBERT

Location: Marriott World Financial Center
85 West Street/New York/NY
HECO# Y1-3508

Field Technician: GLASS, JOHN B. JR.
Date of Analysis: September 23, 2001
Date of Issue: September 24, 2001

BULK SAMPLE CERTIFICATE OF ANALYSIS

Method: EPA/600/R-93/116; PLM with Dispersion Staining/ELAP ID 10926

<u>LAB ID#</u>	<u>LOCATION/SAMPLE ID</u>	<u>CONTENTS</u>	<u>PERCENT</u>
J59967	JG-0921-01-01/1st Fl/Battery Park Tavern/Northwest Corner Sample of: Debris/Dust Color: Gray	Fibrous Glass Non-Fibrous	55 45
J59968	02/5th Fl/Exit Roof/North Center Sample of: Debris/Dust Color: Gray	Cellulose Fibrous Glass Non-Fibrous	5 40 55
J59969	03/7th Fl/Room 715/Window Sill Northwest Sample of: Debris/Dust Color: Gray	Cellulose Fibrous Glass Non-Fibrous	10 40 50
J59970	04/10th Fl/Room 1015/West Window Sample of: Debris/Dust Color: Gray	Cellulose Fibrous Glass Non-Fibrous	10 45 45

Analyst Signature: _____


ELLIS, BENJAMIN, J. , ASSISTANT MANAGER

Page 1 of 2

NVLAQ



HILLMANN ENVIRONMENTAL GROUP, L.L.C.
ENVIRONMENTAL CONSULTING & LAB SERVICES

Continuation

To: CLARIS SERVICES GROUP

Location: Marriott World Financial Center
85 West Street/New York/NY
HECO# Y1-3508

BULK SAMPLE CERTIFICATE OF ANALYSIS

Method: EPA/600/R-93/116; PLM with Dispersion Staining/ELAP ID 10926

<u>LAB ID#</u>	<u>LOCATION/SAMPLE ID</u>	<u>CONTENTS</u>	<u>PERCENT</u>
J59971	05/15th Fl/Room 1515/North Window Sill Sample of: Debris/Dust Color: Gray	Cellulose Non-Fibrous	12 48
J59972	06/20th Fl/Room 2016/East Window Sill Sample of: Debris/Dust Color: Gray	Cellulose Fibrous Glass Non-Fibrous	5 50 45
J59973	07/25th Fl/Room 2514/East Window Sill Sample of: Debris/Dust Color: Gray	Cellulose Fibrous Glass Non-Fibrous	10 50 40
J59974	08/30th Fl/Room 3015/East Window Sill Sample of: Debris/Dust Color: Gray	Chrysotile Asbestos Cellulose Fibrous Glass Non-Fibrous	< 1 9 64 27
J59975	09/Roof/North/Edge of Building Sample of: Debris/Dust Color: Gray	Fibrous Glass Non-Fibrous	90 10
J59976	10/4th Fl/Corridor/Adjacent to HVAC 4, 5 & 6 Room Sample of: Debris/Dust Color: Gray	Cellulose Fibrous Glass Non-Fibrous	60 5 35

Analyst Signature: _____
ELLIS, BENJAMIN, J. , ASSISTANT MANAGER

Page 2 of 2

NVLAQ

SEP-26-2001 03:08

SCIENTIFIC LABS

212 679 9392 P.02/04

SCIENTIFIC LABORATORIES, INC.117 EAST 30TH STREET
NEW YORK, NY 10016

TEL: (212) 679-8600 • FAX: (212) 679-9392



PLM Bulk Asbestos Report

Hillmann Environmental Company, Inc. Date Received 09/26/2001 SciLab Job No. 201093034
 Attn: Mike Nehlsen Date Examined 09/26/2001 P.O. # Claris
 1600 Rt. 22 East ELAP Number 11480 Page 1 of 2
 Union, NJ 07083 RE: Claris; Marriott World Financial

Client No. / HGA	Lab No.	Asbestos Present	Total % Asbestos
JG092501-01	201093034-01	Yes	<1. % ¹
Location: Street Level/Restaurant			
Description: Beige, Heterogeneous, Bulk Material			
Asbestos Types: Chrysotile <1. %			
Other Material: Cellulose 15. %, Fibrous glass 40. %, Non-fibrous >44. %			
JG092501-02	201093034-02	Yes	<1. % ¹
Location: 5th Floor/Roof			
Description: Beige, Heterogeneous, Roofing Material			
Asbestos Types: Chrysotile <1. %			
Other Material: Cellulose 15. %, Fibrous glass 35. %, Non-fibrous >49. %			
JG092501-03	201093034-03	Yes	<1. % ¹
Location: 4th Floor/Roof			
Description: Beige, Heterogeneous, Roofing Material			
Asbestos Types: Chrysotile <1. %			
Other Material: Cellulose 20. %, Fibrous glass 35. %, Non-fibrous >44. %			
JG092501-04	201093034-04	Yes	<1. % ¹
Location: 6th Floor/Roof			
Description: Beige, Heterogeneous, Roofing Material			
Asbestos Types: Chrysotile <1. %			
Other Material: Cellulose 20. %, Fibrous glass 45. %, Non-fibrous >34. %			

SEP-26-2001 03:08

SCIENTIFIC LABS

212 679 9392 P.03/04

**SCIENTIFIC LABORATORIES, INC.**117 EAST 30TH STREET
NEW YORK, NY 10016


TEL: (212) 679-8600 • FAX: (212) 679-9392

PLM Bulk Asbestos Report

Hillmann Environmental Company, Inc.	Date Received	09/26/2001	SciLab Job No.	201093034
Attn: Mike Nehlsen	Date Examined	09/26/2001	P.O. #	Clariss
1600 Rt. 22 East	ELAP Number	11480	Page	2 of 2
Union, NJ 07083	RE:	Clariss; Marriott World Financial		

Reporting Notes:

- (1) Composite analysis results for heterogeneous debris samples may be highly variable due to inhomogeneities in materials present.

Analyzed by: Ivan Recalde 

*NAD/NSD = no asbestos detected; NA = not analyzed; NA/PS = not analyzed / positive stop; PLM Bulk Asbestos Analysis by EPA 600/M4-82-020 per 40 CFR 763 (NVLAP Lab #200546-0) and ELAP PLM Analysis Protocol 198.1 for New York samples (NYSDOH ELAP Lab # 11480); Note: PLM is not consistently reliable in detecting asbestos in floor coverings and similar non-friable organically bound materials. TEM is currently the only method that can be used to determine if this material can be considered or treated as non-asbestos-containing in New York State (also see EPA Advisory for floor tile, FR 59, 146, 38970, 8/1/94). National Institute of Standards and Technology Accreditation requirements mandate that this report must not be reproduced except in full without the approval of the laboratory. This PLM report relates ONLY to the items tested. AIHA# 102843; VT Cert# AL016055

Reviewed By: _____

SciLab Job#: 201093155

Client Name: Hillmann Environmental Company, Inc.

Table I
Summary of Bulk Asbestos Analysis Results
 85 West Street, New York, NY

SciLab Sample #	Client Sample# Location	HG Area	Sample Weight (gram)	Heat Sensitive Organic %	Acid Soluble Inorganic %	Insoluble Non-Asbestos Inorganic %	Asbestos by PLM/DS	Asbestos by TEM
01	MM092601 1st Floor, Ray's Restaurant		---	---	---	---	NVA	NA
02	MM092602 3rd Floor, Kitchen Hallway		---	---	---	---	NVA	NA
03	MM092603 4th Floor, Engineering Office		---	---	---	---	NVA	NA
04	MM092604 4th Floor, Carpentry Shop		---	---	---	---	NVA	NA
05	MM092605 4th Floor, Electric Room		---	---	---	---	NVA	NA
06	MM092606 3rd Floor, Kitchen		---	---	---	---	NVA	NA

Analyzed by: Jonathan Teda *Jonathan Teda* Date Analyzed: 9/26/2001

*NAD/NSD = no asbestos detected; NA = not analyzed; NA/PS = not analyzed / positive stop; PLM Bulk Asbestos Analysis by EPA 600/M4-82-0700 per 40 CFR 763 (NVLAP Lab #200546-0) and ELAP PLM Analysis Protocol 198.1 for New York samples (NYSDOH ELAP Lab # 11488); ELAP TEM Analysis Protocol 198.4 for negative NY NOB samples. Note: PLM is not consistently reliable in detecting asbestos in floor coverings and similar non-friable organically bound materials. TEM is currently the only method that can be used to determine if this material can be considered or treated as non-asbestos-containing in New York State (also see EPA Advisory for floor tile, FR 59, 146, 38970, 8/1/94). National Institute of Standards and Technology Accreditation requirements mandate that this report must not be reproduced except in full without the approval of the laboratory. This PLM report relates ONLY to the items tested.
 AUTH# 102843; VT Cert# AL016055 NVA=No Visible Asbestos

Reviewed By: _____

212 679 9392 P.02/03

212 679 9392 - HILLMANN ENVIRONMENTAL; Page 2

SCIENTIFIC LABS

SEP-26-2001 19:58

Received: 9/26/01 9:04PM

SciLab Job#: 201093317
Client Name: Hillmann Environmental Company, Inc.

Table I
Summary of Bulk Asbestos Analysis Results
85 West Street (Marriot); Roy's Restaurant

SciLab Sample #	Client Sample# Location	HG Area	Sample Weight (gram)	Heat Sensitive Organic %	Acid Soluble Inorganic %	Insoluble Non-Asbestos Inorganic %	Asbestos by PLM/DS	Asbestos by TEM
01	DC0927TS01 1st Floor Roy's Rest.		----	----	----	----	N/A	NA
02	DC0927TS02 1st Floor Roy's Rest.		----	----	----	----	N/A	NA
03	DC0927TS03 1st Floor Roy's Rest.		----	----	----	----	N/A	NA
04	DC0927PS001 1st Floor Roy's Rest.		----	----	----	----	N/A	NA
05	DC0927SS002 1st Floor Roy's Rest.		----	----	----	----	N/A	NA
06	DC0927GS003 1st Floor Roy's Rest.		----	----	----	----	N/A	NA

Analyzed by: *Shan Beaudet* 9/27/01
Date Analyzed: 00/00/00

*NAD/NSD = no asbestos detected; NA = not analyzed; NA/PS = not analyzed / positive stop; PLM Bulk Asbestos Analysis by EPA 600/M4-82-020 per 40 CFR 763 (NVLAP Lab #200546-0) and ELAP PLM Analysis Protocol 198.1 for New York samples (NYSDOH ELAP Lab # 11480); ELAP TEM Analysis Protocol 198.4 for negative NY NOB samples; Note: PLM is not consistently reliable in detecting asbestos in floor coverings and similar non-friable organically bound materials. TEM is currently the only method that can be used to determine if this material can be considered or treated as non-asbestos-containing in New York State (also see EPA Advisory for floor tile, FR 59, 146, 38970, 8/1/94). National Institute of Standards and Technology Accreditation requirements mandate that this report must not be reproduced except in full without the approval of the laboratory. This PLM report relates ONLY to the items tested.
AIHA# 102843; VT Cert# AL016055 N/A=No Visible Asbestos

Reviewed By: *Paul Dele*

SciLab Job#: 201093313

Client Name: Hillmann Environmental Company, Inc.

Table I
Summary of Bulk Asbestos Analysis Results
58 West Street (Marriot); Roy's Restaurant

SciLab Sample #	Client Sample# Location	HG Area	Sample Weight (gram)	Heat Sensitive Organic %	Acid Soluble Inorganic %	Insoluble Non-Asbestos Inorganic %	Asbestos by PLM/DS	Asbestos by TEM
01	DC0927FS1 1st Floor Roy's Restaurant Green Fabric Chairs		---	---	---	---	N/A	NA
02	DC0927FS2 1st Floor Roy's Restaurant Green Fabric Chairs		---	---	---	---	N/A	NA
03	DC0927FS3 1st Floor Roy's Restaurant Green Fabric Chairs		---	---	---	---	N/A	NA

Analyzed by: Jonathan Teda *Jonathan Teda* Date Analyzed: 9/27/01

*NAD/NSD = no asbestos detected; NA = not analyzed; NA/PS = not analyzed / positive stop; PLM Bulk Asbestos Analysis by EPA 600/M4-82-020 per 40 CFR 763 (NVLAP Lab #200546-0) and ELAP PLM Analysis Protocol 198.1 for New York samples (NYSDOH ELAP Lab # 11480); ELAP TEM Analysis Protocol 198.4 for negative NY NOB samples: Note: PLM is not consistently reliable in detecting asbestos in floor coverings and similar non-friable organically bound materials. TEM is currently the only method that can be used to determine if this material can be considered or treated as non-asbestos-containing in New York State (also see EPA Advisory for floor tile, FR 59, 146, 38970, 8/1/94). National Institute of Standards and Technology Accreditation requirements mandate that this report must not be reproduced except in full without the approval of the laboratory. This PLM report relates ONLY to the items tested.

AIHA# 102843; VT Cert# AL016057 N/A=No Visible Asbestos

Reviewed By: *Paul Charles*

SciLab Job#: 201093155

Client Name: Hillmann Environmental Company, Inc.

Table I
Summary of Bulk Asbestos Analysis Results

85 West Street, New York, NY

SciLab Sample #	Client Sample# Location	HG Area	Sample Weight (gram)	Heat Sensitive Organic %	Acid Soluble Inorganic %	Insoluble Non-Asbestos Inorganic %	Asbestos by PLM/DS	Asbestos by TEM
01	MM092601 1st Floor, Ray's Restaurant		----	----	----	----	N/A	NA
02	MM092602 3rd Floor, Kitchen Hallway		----	----	----	----	N/A	NA
03	MM092603 4th Floor, Engineering Office		----	----	----	----	N/A	NA
04	MM092604 4th Floor, Carpentry Shop		----	----	----	----	N/A	NA
05	MM092605 4th Floor, Electric Room		----	----	----	----	N/A	NA
06	MM092606 3rd Floor, Kitchen		----	----	----	----	N/A	NA

Analyzed by: Jonathan Teda Jonathan Teda; Date Analyzed: 9/26/2001

*NAD/NSD = no asbestos detected; NA = not analyzed; NA/PS = not analyzed / positive stop; PLM Bulk Asbestos Analysis by EPA 600/M4-82-020 per 40 CFR 763 (NVLAP Lab #200546-0) and ELAP PLM Analysis Protocol 198.1 for New York samples (NYSDOH ELAP Lab # 11480); ELAP TEM Analysis Protocol 198.4 for negative NY NOB samples: Note: PLM is not consistently reliable in detecting asbestos in floor coverings and similar non-friable organically bound materials. TEM is currently the only method that can be used to determine if this material can be considered or treated as non-asbestos-containing in New York State (also see EPA Advisory for floor tile, FR 59, 146, 38970, 8/1/94). National Institute of Standards and Technology Accreditation requirements mandate that this report must not be reproduced except in full without the approval of the laboratory. This PLM report relates ONLY to the items tested.
 AIHA# 102843; V# Cert# AL076053; N/A=No Visible Asbestos

Reviewed By: James P. Smith

**SCIENTIFIC LABORATORIES, INC.**117 EAST 30TH STREET
NEW YORK, NY 10018

TEL: (212) 679-8600 • FAX: (212) 679-9392

PLM Bulk Asbestos Report

Hillmann Environmental Company, Inc. Date Received 09/27/2001 SciLab Job No. 201093316
 Attn: Mike Nehlsen Date Examined 09/27/2001 P.O. # 85 West Street (Marr
 1600 Rt. 22 East Page 1 of 2
 Union, NJ 07083 RE: 85 West Street (Marriot); Flower Shop

Client No. / HGA	Lab No.	Asbestos Present	Total % Asbestos
1-001	201093316-01	Yes	<1.0% ¹
1	Location: 1st Floor Flower Shop Floor		
	Description: Grey, Heterogeneous, Grey Debris		
	Asbestos Types: Chrysotile <1.0 %		
	Other Material: Cellulose 5.0 %, Fibrous glass 45. %, Non-fibrous >49. %		
1-002	201093316-02	Yes	<1.0% ¹
1	Location: 1st Floor Flower Shop Floor		
	Description: Grey, Heterogeneous, Grey Debris		
	Asbestos Types: Chrysotile Trace		
	Other Material: Cellulose 3.0 %, Fibrous glass 3.0 %, Non-fibrous 94. %		
1-003	201093316-03	Yes	<1.0% ¹
1	Location: 1st Floor Flower Shop Counter Top		
	Description: Grey, Heterogeneous, Grey Debris		
	Asbestos Types: Chrysotile <1.0 %		
	Other Material: Cellulose 4.0 %, Fibrous glass 30. %, Non-fibrous >65. %		
2-004	201093316-04	Yes	<1.0% ¹
2	Location: 1st Floor Gift Shop Floor		
	Description: Grey, Heterogeneous, Grey Debris		
	Asbestos Types: Chrysotile <1.0 %		
	Other Material: Cellulose 5.0 %, Fibrous glass 35. %, Synthetic fibers Trace, Non-fibrous >59. %		

212 679 9392 P.02/04

SCIENTIFIC LABS

SEP-27-2001 20:07

**SCIENTIFIC LABORATORIES, INC.**117 EAST 30TH STREET
NEW YORK, NY 10018

TEL: (212) 679-8600 • FAX: (212) 679-8392

PLM Bulk Asbestos Report

Hillmann Environmental Company, Inc. Date Received 09/27/2001 SciLab Job No. 201093316
 Attn: Mike Nehlsen Date Examined 09/27/2001 P.O. # 85 West Street (Marriott)
 1600 Rt. 22 East Page 2 of 2
 Union, NJ 07083 RE: 85 West Street (Marriott); Flower Shop

Client No. / HGA	Lab No.	Asbestos Present	Total % Asbestos
2-005	201093316-05	Yes	<1.0% ¹
2	Location: 1st Floor Gift Shop		

Description: Grey, Heterogeneous, Grey Debris
 Asbestos Types: Chrysotile <1.0 %
 Other Material: Cellulose 4.0 %, Fibrous glass 45. %, Non-fibrous >50. %

Reporting Notes:

(1) Composite analysis results for heterogeneous debris samples may be highly variable due to inhomogeneities in materials present.

Analyzed by: Jonathan Teda

*NAD/NSD = no asbestos detected; NA = not analyzed; NA/PS = not analyzed / positive stop; PLM Bulk Asbestos Analysis by EPA 600/M4-82-020 per 40 CFR 763 (NVLAP Lab #200546-0) and ELAP PLM Analysis Protocol 198.1 for New York samples (NYSDOH ELAP Lab # 11480); Note: PLM is not consistently reliable in detecting asbestos in floor coverings and similar non-friable organically bound materials. TEM is currently the only method that can be used to determine if this material can be considered or treated as non-asbestos-containing in New York State (also see EPA Advisory for floor tile, FR 59, 146, 38970, 8/1/94). National Institute of Standards and Technology Accreditation requirements mandate that this report must not be reproduced except in full without the approval of the laboratory. This PLM report relates ONLY to the items tested. AIHA# 102843; VT Cert# AL016055

Reviewed By: _____

212 679 9392 P.03/04

SCIENTIFIC LABS

SEP-27-2001 20:07

Hillmann Environmental Group, LLC

Section 4.5 Letter of Completion

January 24, 2002

Ms. Carolyn Bailey
Claris Services Group
6903 Rockledge Drive
Suite 920
Bethesda, MD 20817

RE: Air Monitoring and Quality Assurance for the Asbestos Dust and Debris Clean Up
at Marriott World Financial Center/85 West Street/New York/NY

Dear Ms. Bailey:

Hillmann Environmental Group, L.L.C., was responsible for air monitoring and quality assurance for the above referenced project. This service was conducted on September 18 – October 13, 2001.

LVI was the contractor performing the removal of the asbestos containing dust and debris materials at this site.

Analysis of the air samples was performed using Phase Contrast Microscopy NIOSH Method 7400.

The American Industrial Hygiene Association certifies that both the Hillmann and Scientific Laboratories are proficient for asbestos air test analysis. All final air tests were below 0.01 f/cc.

The asbestos containing materials were removed and the project was successfully completed as per all applicable New York City, State, and Federal laws, rules, and regulations.

Sincerely,

HILLMANN ENVIRONMENTAL GROUP, L.L.C.

Michael Nehlsen
Director of Operations
HECO Job # Y1-3508

Air Sample Results

October 13, 2001

Air Samples for the Executive Offices & 36th Floor

Obtained & Analyzed by
Hillmann Environmental Group, L.L.C.

AIR MPLE DATA SHEET

HILLMANN ENVIRONMENTAL CO., INC.
ENVIRONMENTAL CONSULTING & LAB SERVICES
1600 ROUTE 22 EAST
UNION, NEW JERSEY 07083-1597
(908) 688-7800
Fax (908) 686-2636

CHAIN OF CUSTODY

Sampled By: Transported By: Rc'd By: Analyzed By:

Name	Craig Downs	C. SAE-AD C. SAE-AD 10/13/01
Signature	<i>Craig Downs</i>	
Date	10/13/01	

Rush Turn Around

Client Claire Services Field Hygienist C. P. Davis
Location Finacial Centre - Marxist Hotel
Hillmann Job # 41-3503 Procedure FAT Rotometer # _____

Rotometer!

SAMPLE ID#	LAB ID#	Location/Code Relation to Work/Note	FLOW RATE Start/End	TIME On Off	TOTAL Time	TOTAL Volume	FIBERS FIELD#	FIBERS CC
CD-01		36 TH Floor, Adj. to Elevators	10 10	1030 1230	120	200 1200	14/100	0.004
CD-02		36 TH Floor, Adj. to Room 3612	10 10	1033 1233	120	1200	14/100	0.006
CD-03		2 ND Floor Offices - East	10 10	1100 1400	120	1200	8/10	0.003
CD-04		2 ND Floor Offices - West	10 10	1106 1406	120	1200	3/100	0.002
CD-05		Field	/	/	/	/	N.D	/
CD-06		Blank	/	/	/	/	N.D	/
		① Fax Results To: 301-530-4185						
		Att: Judy Gilbert						
		② Fax Results To: 212-625-2840						
		Att: Hillmann						


IWA=Inside Work Area
 OWA=Outside Work Area
 DCU=During Clean Up
 EL =Excursion Limit
 PRE=Pretest
 PREP=Preparation
 DR=During Removal
 MTE=Microtrap Ex.
 FAF=Final Air Test
 PAS=Personal Air Test
 DGB=During Glovebag
 OB= Outside Bldg.
 DC=Dust Control
 CR=Clean Room
 AQ=Air Quality
 GBF=Glove Bag Final
 BDC=Bagging Decon Chamber
 TP=Test Procedure

Air Sample Results

April 9, 2002

All air samples results are all below the New York City Department of Environmental Protection's clearance threshold criteria for building occupancy.

Obtained & analyzed by
Accredited Environmental Technologies, Inc.

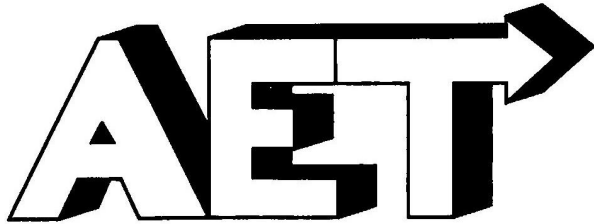

Accredited Environmental Technologies, inc.
April 15, 2002

Ms. Carolyn Bailey
CCMH Fin Center LLC
c/o Claris Services Corporation
6903 Rockledge Drive, Suite 920
Bethesda, MA 20817

RE: New York Financial Center Marriott, 85 West Street, New York, New York

Dear Ms. Bailey:

Attached are the laboratory results for airborne asbestos samples collected at the above referenced location. These samples were collected and analyzed by Accredited Environmental Technologies, Inc. for comparison with the clearance standards for airborne asbestos established by the New York City Department of Environmental Protection Asbestos Control Program (Title 15, Chapter 1). Sample collection occurred under normal occupancy conditions on April 9, 2002. All samples were collected with high volume sampling pumps with sample durations of approximately five hours and are considered representative of background fiber concentrations throughout the basement, 1st and 2nd floors.

Results indicate that fiber concentrations in the background samples were primarily below 0.01 F/cc, a level considered acceptable for occupancy according to the Department of Environmental Protection standards, with the exception of one sample from the basement which contained an elevated number of fibers. The basement sample was reanalyzed by Transmission Electron Microscopy which verified that none of the fibers were asbestos. The reported concentration for the reanalyzed sample was below 70 S/mm², a level considered acceptable according to DEP standards.

All samples were initially analyzed by Phase Contrast Microscopy per NIOSH Method 7400 for asbestos fibers. This method measures total airborne fibers and does not distinguish fiber morphology. All structures with a length to diameter ratio of 3 to 1 or greater and a length greater than 5 microns, are considered to be fibers and are counted as such. The sample that yielded the elevated result by PCM was reanalyzed by Transmission Electron Microscopy in accordance with EPA requirements as stipulated in 40 CFR 763.90(i) (3) and (4). This method is capable of distinguishing asbestos fibers from other non-asbestiform mineral fibers. TEM analysis was performed by EMSL Analytical, Inc. of Piscataway, NJ. If you have any questions or require additional information, please do not hesitate to contact our office.

Sincerely,

A handwritten signature in black ink, appearing to read 'Eric Houseknecht', written over a horizontal line.

Eric Houseknecht
Vice President
EH/bg

335 High Street • Metuchen, NJ 08840 • (732) 321-0666 • FAX: (732) 321-3666

Accredited Environmental Technologies, Inc.**ASBESTOS AIR SAMPLING DATA****CLARIS SERVICES CORPORATION****BETHESDA, MARYLAND****LOCATION: NEW YORK FINANCIAL CENTER MARRIOTT, 85 WEST ST., NY, NY****SITE ACTIVITY: BACKGROUND AIR SAMPLING**

SAMPLE #	DATE	TIME(min)/VOLUME(L)	LOCATION	F/CC*
5877-6001	04/09/02	210/1260	Roy's Restaurant Northwest corner	<0.002
5877-6002	04/09/02	210/1260	85 West - Tavern center	0.002
5877-6003	04/09/02	210/1260	2 nd Floor Ballroom Prefunction Area	0.003
5877-6004	04/09/02	210/1260	1 st Floor - Hallway Roy's rear entrance	0.003
5877-6005	04/09/02	210/1260	Level C - Basement Hallway	0.03
5877-6006	BLANK	0 Fibers/ 100 Fields		

* Sample analysis was performed in accordance with NIOSH 7400 Method utilizing "A" Counting Rules; the OSHA Reference Method by Phase Contrast Microscopy. NY State ELAP No. 10973

Accredited Environmental Technologies, Inc.

ASBESTOS AIR SAMPLING DATA

CLARIS SERVICES CORPORATION

BETHESDA, MARYLAND

LOCATION: NEW YORK FINANCIAL CENTER MARRIOTT, 85 WEST ST., NY, NY

SITE ACTIVITY: FINAL CLEARANCE SAMPLING / TEM ANALYSIS

SAMPLE #	DATE	TIME(min)/VOLUME(L)	LOCATION	AS/mm2
5877-6005	04/09/02	210/1260	Level C - Basement Hallway	<16.00

Air Sample Results

December 19, 2001

All air samples results are all below the New York City Department of Environmental Protection's clearance threshold criteria for building occupancy.

Obtained & analyzed by
Accredited Environmental Technologies, Inc.



Accredited Environmental Technologies, Inc.

December 21, 2001

**Ms. Carolyn Bailey
CCMH Fin Center LLC
c/o Claris Services Corporation
6903 Rockledge Drive, Suite 920
Bethesda, MA 20817**

RE: New York Financial Center Marriott, 85 West Street, New York, New York

Dear Ms. Bailey:

Attached are the laboratory results for airborne asbestos samples collected at the above referenced location. These samples were collected and analyzed by Accredited Environmental Technologies, Inc. for comparison with the clearance standards for airborne asbestos established by the New York City Department of Environmental Protection Asbestos Control Program (Title 15, Chapter 1). Sample collection occurred under normal occupancy conditions on December 19, 2001. All samples were collected with high volume sampling pumps with sample durations of approximately five hours and are considered representative of background fiber concentrations throughout the first three floors of the building.

Results indicate that fiber concentrations in the background samples were all below 0.01 F/cc, a level considered acceptable for occupancy according to the Department of Environmental Protection standards, with the exception of one sample from the 1st Floor which could not be analyzed due to overloading with construction debris from an adjacent demolition operation.

Samples were analyzed by Phase Contrast Microscopy per NIOSH Method 7400 for asbestos fibers. This method measures total airborne fibers and does not distinguish fiber morphology. All structures with a length to diameter ratio of 3 to 1 or greater and a length greater than 5 microns, are considered to be fibers and are counted as such.

If you have any questions or require additional information, please do not hesitate to contact our office.

Sincerely,

A handwritten signature in black ink that reads 'Eric Houseknecht'. The signature is fluid and cursive, with the first and last names being clearly legible.

**Eric Houseknecht
Vice President**

335 High Street • Metuchen, NJ 08840 • (732) 321-0666 • FAX: (732) 321-3666

Accredited Environmental Technologies, Inc.**ASBESTOS AIR SAMPLING DATA****CCMH FIN CENTER, LLC.****BETHESDA, MARYLAND****LOCATION: 1st FLOOR, MARRIOTT FINANCIAL CENTER, NEW YORK, NEW YORK****SITE ACTIVITY: BACKGROUND AIR SAMPLING**

SAMPLE #	DATE	TIME(min)/VOLUME(L)	LOCATION	F/CC*
5807-7080	12/19/01	295/1770	Lobby - main hallway entrance	overloaded
5807-7084	12/19/01	185/1665	Roy's Restaurant back back entrance door to kitchen area	0.006
5807-7085	BLANK	0 Fibers/ 100 Fields		

* Sample analysis was performed in accordance with NIOSH 7400 Method utilizing "A" Counting Rules; the OSHA Reference Method by Phase Contrast Microscopy. NY State ELAP No. 10973

Accredited Environmental Technologies, Inc.**ASBESTOS AIR SAMPLING DATA****CCMH FIN CENTER, LLC.****BETHESDA, MARYLAND****LOCATION: 2nd FLOOR, MARRIOTT FINANCIAL CENTER, NEW YORK, NEW YORK****SITE ACTIVITY: BACKGROUND AIR SAMPLING**

SAMPLE #	DATE	TIME(min)/VOLUME(L)	LOCATION	F/CC*
5807-7076	12/19/01	300/1800	Executive Office - center	0.002
5807-7077	12/19/01	300/1800	Financial Ballroom - south	0.004
5807-7078	12/19/01	300/1800	Financial Ballroom - north	0.003
5807-7079	12/19/01	297/1782	Treasury Meeting Room East	<0.002

* Sample analysis was performed in accordance with NIOSH 7400 Method utilizing "A" Counting Rules; the OSHA Reference Method by Phase Contrast Microscopy. NY State ELAP No. 10973

Accredited Environmental Technologies, Inc.**ASBESTOS AIR SAMPLING DATA****CCMH FIN CENTER, LLC.****BETHESDA, MARYLAND****LOCATION: 3RD FLOOR, MARRIOTT FINANCIAL CENTER, NEW YORK, NEW YORK****SITE ACTIVITY: BACKGROUND AIR SAMPLING**

SAMPLE #	DATE	TIME(min)/VOLUME(L)	LOCATION	F/CC*
5807-7081	12/19/01	290/1740	Grand Ballroom A-B-C South	0.003
5807-7082	12/19/01	288/1728	Grand Ballroom A-B-C North	0.002
5807-7083	12/19/01	290/1740	Ellis Meeting Room East	0.002

* Sample analysis was performed in accordance with NIOSH 7400 Method utilizing "A" Counting Rules; the OSHA Reference Method by Phase Contrast Microscopy. NY State ELAP No. 10973


**Accredited Environmental Technologies, Inc.****FAX TRANSMITTAL COVER SHEET**TO: Carolyn BaileyFROM Eric HorvathCOMPANY: Claris ServicesFAX NO. 301/530-4185DATE: December 21, 2001Number of Pages Including Cover Sheet 5
Call to Confirm YES ☒ NO ☐Remarks: Report - Results from December 19, 2001**IF YOU REQUIRE ADDITIONAL INFORMATION, PLEASE FEEL FREE TO CONTACT US****Accredited Environmental Technologies Offers a wide range of
Environmental Services:****Asbestos -**
Surveys, Specifications, Monitoring**Phase I Site Audit -**
Real Estate Transfers**Lead-Based Paint -**
HUD Testing, Specifications, Monitoring**PCB's -**
TSCA Compliance**Indoor Air Quality -**
Sick Building Syndrome**Hazardous Waste -**
EPA Handling/RCRA Disposal**Industrial Hygiene -**
OSHA Compliance**Underground Storage Tanks -**
Testing and Management**Total System Audit**
Commercial Building**Site Regulatory Audit -**
Industrial Clients**If this transmittal is not clear, please call 732/321-0666****335 High Street • Metuchen, NJ 08840
732/321-0666 • Fax 732/321-3666**

Air Sample Results

December 3, 2001

All air samples results are all below the New York City Department of Environmental Protection's clearance threshold criteria for building occupancy.

Obtained & analyzed by
Accredited Environmental Technologies, Inc.

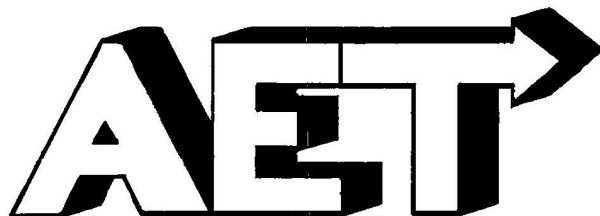

Accredited Environmental Technologies, Inc.

December 7, 2001

**Ms. Carolyn Bailey
CCMH Fin Center LLC
c/o Claris Services Corporation
6903 Rockledge Drive, Suite 920
Bethesda, MA 20817**

RE: New York Financial Center Marriott, 85 West Street, New York, New York

Dear Ms. Bailey:

Attached are the laboratory results for airborne asbestos samples collected at the above referenced location. These samples were collected and analyzed by Accredited Environmental Technologies, Inc. for comparison with the clearance standards for airborne asbestos established by the New York City Department of Environmental Protection Asbestos Control Program (Title 15, Chapter 1). Sample collection occurred under normal occupancy conditions on December 3, 2001. All samples were collected with high volume sampling pumps with sample durations of approximately five hours and are considered representative of background fiber concentrations throughout the first three floors of the building.

Results indicate that fiber concentrations in the background samples were all below 0.01 F/cc, a level considered acceptable for occupancy according to the Department of Environmental Protection standards.

Samples were analyzed by Phase Contrast Microscopy per NIOSH Method 7400 for asbestos fibers. This method measures total airborne fibers and does not distinguish fiber morphology. All structures with a length to diameter ratio of 3 to 1 or greater and a length greater than 5 microns, are considered to be fibers and are counted as such.

If you have any questions or require additional information, please do not hesitate to contact our office.

Sincerely,

A handwritten signature in black ink, appearing to read 'Eric Houseknecht', is written over a horizontal line.

Eric Houseknecht
Vice President
EH/bg

335 High Street • Metuchen, NJ 08840 • (732) 321-0666 • FAX: (732) 321-3666

Accredited Environmental Technologies, Inc.**ASBESTOS AIR SAMPLING DATA****CCMH FIN CENTER, LLC.****BETHESDA, MARYLAND****LOCATION: 1ST FLOOR, MARRIOTT FINANCIAL CENTER, NEW YORK, NEW YORK****SITE ACTIVITY: BACKGROUND AIR SAMPLING**

SAMPLE #	DATE	TIME(min)/VOLUME(L)	LOCATION	F/CC*
5807-7066	12/03/01	300/1500	Lobby by staircase	<0.002
5807-7067	12/03/01	300/1500	Roy's Restaurant Center of room	<0.002
5807-7075	BLANK	0 Fibers/ 100 Fields		

* Sample analysis was performed in accordance with NIOSH 7400 Method utilizing "A" Counting Rules; the OSHA Reference Method by Phase Contrast Microscopy. NY State ELAP No. 10973

Accredited Environmental Technologies, Inc.**ASBESTOS AIR SAMPLING DATA****CCMH FIN CENTER, LLC.****BETHESDA, MARYLAND****LOCATION: 2ND FLOOR, MARRIOTT FINANCIAL CENTER, NEW YORK, NEW YORK****SITE ACTIVITY: BACKGROUND AIR SAMPLING**

SAMPLE #	DATE	TIME(min)/VOLUME(L)	LOCATION	F/CC*
5807-7068	12/03/01	295/1475	Executive Office Center of room	<0.002
5807-7069	12/03/01	295/1475	Capital Meeting Room North	<0.002
5807-7070	12/03/01	295/1475	Financial Ballroom North	<0.002
5807-7071	12/03/01	297/1485	Financial Ballroom South	<0.002

* Sample analysis was performed in accordance with NIOSH 7400 Method utilizing "A" Counting Rules; the OSHA Reference Method by Phase Contrast Microscopy. NY State ELAP No. 10973

Accredited Environmental Technologies, Inc.**ASBESTOS AIR SAMPLING DATA****CCMH FIN CENTER, LLC.****BETHESDA, MARYLAND****LOCATION: 3RD FLOOR, MARRIOTT FINANCIAL CENTER, NEW YORK, NEW YORK****SITE ACTIVITY: BACKGROUND AIR SAMPLING**

SAMPLE #	DATE	TIME(min)/VOLUME(L)	LOCATION	F/CC*
5807-7072	12/03/01	303/1515	Seaport Meeting Room South	<0.002
5807-7073	12/03/01	297/1485	Grand Ballroom A-B-C North	<0.002
5807-7074	12/03/01	298/1490	Grand Ballroom A-B-C	<0.002

* Sample analysis was performed in accordance with NIOSH 7400 Method utilizing "A" Counting Rules; the OSIIA Reference Method by Phase Contrast Microscopy. NY State ELAP No. 10973

**Accredited Environmental Technologies, Inc.****FAX TRANSMITTAL COVER SHEET**TO: Carolyn BaileyFROM: Eric HoraknechtCOMPANY: Claris ServicesFAX NO. 301/530-4185DATE: Dec. 6, 2001Number of Pages Including Cover Sheet 5
Call to Confirm YES ☐ NO ☒Remarks: Marriott Financial Center - results/report.**IF YOU REQUIRE ADDITIONAL INFORMATION, PLEASE FEEL FREE TO CONTACT US****Accredited Environmental Technologies Offers a wide range of
Environmental Services:****Asbestos -**
Surveys, Specifications, Monitoring**Phase I Site Audit -**
Real Estate Transfers**Lead-Based Paint -**
HUD Testing, Specifications, Monitoring**PCB's -**
TSCA Compliance**Indoor Air Quality -**
Sick Building Syndrome**Hazardous Waste -**
EPA Handling/RCRA Disposal**Industrial Hygiene -**
OSHA Compliance**Underground Storage Tanks -**
Testing and Management**Total System Audit**
Commercial Building**Site Regulatory Audit -**
Industrial Clients**If this transmittal is not clear, please call 732/321-0666****335 High Street o Metuchen, NJ 08840
732/321-0666 o Fax 732/321-3666**

Air Sample Results

November 21, 2001

All air samples results are all below the New York City Department of Environmental Protection's clearance threshold criteria for building occupancy.

Obtained & analyzed by
Accredited Environmental Technologies, Inc.



Accredited Environmental Technologies, Inc.

November 26, 2001

**Ms. Carolyn Bailey
CCMH Fin Center LLC
c/o Claris Services Corporation
6903 Rockledge Drive, Suite 920
Bethesda, MA 20817**

RE: New York Financial Center Marriott, 85 West Street, New York, New York

Dear Ms. Bailey:

Attached are the laboratory results for airborne asbestos samples collected at the above referenced location. These samples were collected and analyzed by Accredited Environmental Technologies, Inc. for comparison with the clearance standards for airborne asbestos established by the New York City Department of Environmental Protection Asbestos Control Program (Title 15, Chapter 1). Sample collection occurred under normal occupancy conditions on November 21, 2001. All samples were collected with high volume sampling pumps with sample durations of approximately five hours and are considered representative of background fiber concentrations throughout the first three floors of the building.

Results indicate that fiber concentrations in the background samples were all below 0.01 F/cc, a level considered acceptable for occupancy according to the Department of Environmental Protection standards.

Samples were analyzed by Phase Contrast Microscopy per NIOSH Method 7400 for asbestos fibers. This method measures total airborne fibers and does not distinguish fiber morphology. All structures with a length to diameter ratio of 3 to 1 or greater and a length greater than 5 microns, are considered to be fibers and are counted as such.

If you have any questions or require additional information, please do not hesitate to contact our office.

Sincerely,

A handwritten signature in black ink, appearing to read 'Eric Houseknecht', is written over the typed name.

**Eric Houseknecht
Vice President
EH/bg**

335 High Street • Metuchen, NJ 08840 • (732) 321-0666 • FAX: (732) 321-3666

Accredited Environmental Technologies, Inc.**ASBESTOS AIR SAMPLING DATA****CCMH FIN CENTER, LLC.****BETHESDA, MARYLAND****LOCATION: 1st FLOOR, MARRIOTT FINANCIAL CENTER, NEW YORK, NEW YORK****SITE ACTIVITY: BACKGROUND AIR SAMPLING**

SAMPLE #	DATE	TIME(min)/VOLUME(L)	LOCATION	F/CC*
5807-7059	11/21/01	299/1495	Lobby by staircase	0.002
5807-7060	11/21/01	299/1495	Roy's Restaurant Center	<0.002
5807-7066	BLANK	0 Fibers/ 100 Fields		

* Sample analysis was performed in accordance with NIOSH 7400 Method utilizing "A" Counting Rules; the OSHA Reference Method by Phase Contrast Microscopy. NY State ELAP No. 10973

Accredited Environmental Technologies, Inc.**ASBESTOS AIR SAMPLING DATA****CCMH FIN CENTER, LLC.****BETHESDA, MARYLAND****LOCATION: 2nd FLOOR, MARRIOTT FINANCIAL CENTER, NEW YORK, NEW YORK****SITE ACTIVITY: BACKGROUND AIR SAMPLING**

SAMPLE #	DATE	TIME(min)/VOLUME(L)	LOCATION	F/CC*
5807-7056	11/21/01	302/1510	Financial Center Ballroom North	0.004
5807-7057	11/21/01	301/1505	Financial Center Ballroom South	0.007
5807-7058	11/21/01	300/1500	Traders Meeting Room East	<0.002
5807-7065	11/21/01	302/1510	Executive Offices - center	0.002

* Sample analysis was performed in accordance with NIOSH 7400 Method utilizing "A" Counting Rules; the OSHA Reference Method by Phase Contrast Microscopy. NY State ELAP No. 10973

Accredited Environmental Technologies, Inc.**ASBESTOS AIR SAMPLING DATA****CCMH FIN CENTER, LLC.****BETHESDA, MARYLAND****LOCATION: 3RD FLOOR, MARRIOTT FINANCIAL CENTER, NEW YORK, NEW YORK****SITE ACTIVITY: BACKGROUND AIR SAMPLING**

SAMPLE #	DATE	TIME(min)/VOLUME(L)	LOCATION	F/CC*
5807-7061	11/21/01	303/1515	Grand Ballroom "A" North	<0.002
5807-7062	11/21/01	303/1515	Grand Ballroom "B-C" North	0.002
5807-7063	11/21/01	303/1515	Grand Ballroom "B-C" South	0.003
5807-7064	11/21/01	303/1515	Empire Room - north	<0.002

* Sample analysis was performed in accordance with NIOSH 7400 Method utilizing "A" Counting Rules; the OSHA Reference Method by Phase Contrast Microscopy. NY State ELAP No. 10973

Air Sample Results

November 7, 2001

All air samples results are all below the New York City Department of Environmental Protection's clearance threshold criteria for building occupancy.

Obtained & analyzed by
Accredited Environmental Technologies, Inc.



Accredited Environmental Technologies, Inc.

November 9, 2001

**Ms. Carolyn Bailey
CCMH Fin Center LLC
c/o Claris Services Corporation
6903 Rockledge Drive, Suite 920
Bethesda, MA 20817**

RE: New York Financial Center Marriott, 85 West Street, New York, New York

Dear Ms. Bailey:

Attached are the laboratory results for airborne asbestos samples collected at the above referenced location. These samples were collected and analyzed by Accredited Environmental Technologies, Inc. for comparison with the clearance standards for airborne asbestos established by the New York City Department of Environmental Protection Asbestos Control Program (Title 15, Chapter 1). Sample collection occurred under normal occupancy conditions on November 7, 2001. All samples were collected with high volume sampling pumps with sample durations of approximately five hours and are considered representative of background fiber concentrations throughout the first three floors as well as the basement of the building.

Results indicate that fiber concentrations in the background samples were all below 0.01 F/cc, a level considered acceptable for occupancy according to the Department of Environmental Protection standards.

Samples were analyzed by Phase Contrast Microscopy per NIOSH Method 7400 for asbestos fibers. This method measures total airborne fibers and does not distinguish fiber morphology. All structures with a length to diameter ratio of 3 to 1 or greater and a length greater than 5 microns, are considered to be fibers and are counted as such.

If you have any questions or require additional information, please do not hesitate to contact our office.

Sincerely,

A handwritten signature in black ink, appearing to read 'Eric Houseknecht', is written over a circular stamp. The signature is fluid and cursive.

Eric Houseknecht
Vice President
EH/bg

335 High Street • Metuchen, NJ 08840 • (732) 321-0666 • FAX: (732) 321-3666

Accredited Environmental Technologies, Inc.**ASBESTOS AIR SAMPLING DATA****CCMH FIN CENTER, LLC.****BETHESDA, MARYLAND****LOCATION: BASEMENT, MARRIOTT FINANCIAL CENTER, NEW YORK, NEW YORK****SITE ACTIVITY: BACKGROUND AIR SAMPLING**

SAMPLE #	DATE	TIME(min)/VOLUME(L)	LOCATION	F/CC*
5807-7041	11/07/01	135/1350	Housekeeping Area Center	<0.002
5807-7042	11/07/01	136/1360	Employee Café East wall	0.002
5807-7043	11/07/01	135/1350	Human Resources Center room	<0.002
5807-7044	11/07/01	135/1350	Stairway "C" to 1 st Floor	0.003

* Sample analysis was performed in accordance with NIOSH 7400 Method utilizing "A" Counting Rules; the OSHA Reference Method by Phase Contrast Microscopy. NY State ELAP No. 10973

Accredited Environmental Technologies, Inc.**ASBESTOS AIR SAMPLING DATA****CCMH FIN CENTER, LLC.****BETHESDA, MARYLAND****LOCATION: 1st FLOOR, MARRIOTT FINANCIAL CENTER, NEW YORK, NEW YORK****SITE ACTIVITY: BACKGROUND AIR SAMPLING**

SAMPLE #	DATE	TIME(min)/VOLUME(L)	LOCATION	F/CC*
5807-7045	11/07/01	240/1440	Lobby by stairs	<0.002
5807-7046	11/07/01	240/1440	Roy's Restaurant Center	<0.002

* Sample analysis was performed in accordance with NIOSH 7400 Method utilizing "A" Counting Rules; the OSHA Reference Method by Phase Contrast Microscopy. NY State ELAP No. 10973

Accredited Environmental Technologies, Inc.**ASBESTOS AIR SAMPLING DATA****CCMH FIN CENTER, LLC.****BETHESDA, MARYLAND****LOCATION: 2ND FLOOR, MARRIOTT FINANCIAL CENTER, NEW YORK, NEW YORK****SITE ACTIVITY: BACKGROUND AIR SAMPLING**

SAMPLE #	DATE	TIME(min)/VOLUME(L)	LOCATION	F/CC*
5807-7047	11/07/01	235/1410	Financial Center Ballroom North wall	0.003
5807-7048	11/07/01	232/1392	Financial Center Ballroom South wall	0.005
5807-7049	11/07/01	230/1380	Executive Office Center	<0.002
5807-7050	11/07/01	230/1380	Capital Room North wall	<0.002

* Sample analysis was performed in accordance with NIOSH 7400 Method utilizing "A" Counting Rules; the OSHA Reference Method by Phase Contrast Microscopy. NY State ELAP No. 10973

Accredited Environmental Technologies, Inc.**ASBESTOS AIR SAMPLING DATA****CCMH FIN CENTER, LLC.****BETHESDA, MARYLAND****LOCATION: 3RD FLOOR, MARRIOTT FINANCIAL CENTER, NEW YORK, NEW YORK****SITE ACTIVITY: BACKGROUND AIR SAMPLING**

SAMPLE #	DATE	TIME(min)/VOLUME(L)	LOCATION	F/CC*
5807-7051	11/07/01	255/1530	Grand Ballroom "A" North wall	<0.002
5807-7052	11/07/01	255/1530	Grand Ballroom "B-C" North wall	0.004
5807-7053	11/07/01	255/1530	Grand Ballroom "B-C" South wall	0.003
5807-7054	11/07/01	256/1536	Seaport Meeting Room South wall	0.002
5807-7055	BLANK	0 Fibers/ 100 Fields		


* Sample analysis was performed in accordance with NIOSH 7400 Method utilizing "A" Counting Rules; the OSHA Reference Method by Phase Contrast Microscopy. NY State ELAP No. 10973

Air Sample Results

November 1, 2001

All air samples results are all below the New York City Department of Environmental Protection's clearance threshold criteria for building occupancy.

Obtained & analyzed by
Accredited Environmental Technologies, Inc.

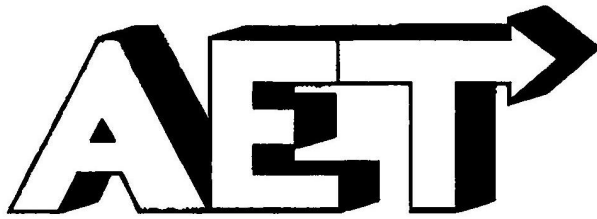

Accredited Environmental Technologies, inc.

November 2, 2001

**Ms. Carolyn Bailey
CCMH Fin Center LLC
c/o Claris Services Corporation
6903 Rockledge Drive, Suite 920
Bethesda, MA 20817**

RE: New York Financial Center Marriott, 85 West Street, New York, New York

Dear Ms. Bailey:

Attached are the laboratory results for airborne asbestos samples collected at the above referenced location. These samples were collected and analyzed by Accredited Environmental Technologies, Inc. for comparison with the clearance standards for airborne asbestos established by the New York City Department of Environmental Protection Asbestos Control Program (Title 15, Chapter 1). Sample collection occurred under normal occupancy conditions on November 1, 2001. All samples were collected with high volume sampling pumps with sample durations of approximately five hours and are considered representative of background fiber concentrations throughout the first three floors of the building.

Results indicate that fiber concentrations in the background samples were all below 0.01 F/cc, a level considered acceptable for occupancy according to the Department of Environmental Protection standards.

Samples were analyzed by Phase Contrast Microscopy per NIOSH Method 7400 for asbestos fibers. This method measures total airborne fibers and does not distinguish fiber morphology. All structures with a length to diameter ratio of 3 to 1 or greater and a length greater than 5 microns, are considered to be fibers and are counted as such.

If you have any questions or require additional information, please do not hesitate to contact our office.

Sincerely,

A handwritten signature in black ink, appearing to read 'Eric Houseknecht', is written over the typed name.

**Eric Houseknecht
Vice President
EH/bg**

335 High Street • Metuchen, NJ 08840 • (732) 321-0666 • FAX: (732) 321-3666

Accredited Environmental Technologies, Inc.**ASBESTOS AIR SAMPLING DATA****CCMH FIN CENTER, LLC.****BETHESDA, MARYLAND****LOCATION: 1st FLOOR, MARRIOTT FINANCIAL CENTER, NEW YORK, NEW YORK****SITE ACTIVITY: BACKGROUND AIR SAMPLING**

SAMPLE #	DATE	TIME(min)/VOLUME(L)	LOCATION	F/CC*
5807-7038	11/01/01	266/1596	Lobby by stairs	0.005
5807-7039	11/01/01	269/1614	Roy's restaurant - center	<0.002
5807-7040	BLANK	0 Fibers/ 100 Fields		

* Sample analysis was performed in accordance with NIOSH 7400 Method utilizing "A" Counting Rules; the OSHA Reference Method by Phase Contrast Microscopy. NY State ELAP No. 10973

Accredited Environmental Technologies, Inc.**ASBESTOS AIR SAMPLING DATA****CCMH FIN CENTER, LLC.****BETHESDA, MARYLAND****LOCATION: 2nd FLOOR, MARRIOTT FINANCIAL CENTER, NEW YORK, NEW YORK****SITE ACTIVITY: BACKGROUND AIR SAMPLING**

SAMPLE #	DATE	TIME(min)/VOLUME(L)	LOCATION	F/CC*
5807-7034	11/01/01	267/1602	Executive office - center	<0.002
5807-7035	11/01/01	266/1596	Treasury Room by doors	0.002
5807-7036	11/01/01	263/1578	Financial Ballroom - north	0.003
5807-7037	11/01/01	262/1572	Financial Ballroom - south	0.004

* Sample analysis was performed in accordance with NIOSH 7400 Method utilizing "A" Counting Rules; the OSHA Reference Method by Phase Contrast Microscopy. NY State ELAP No. 10973

Accredited Environmental Technologies, Inc.**ASBESTOS AIR SAMPLING DATA****CCMH FIN CENTER, LLC.****BETHESDA, MARYLAND****LOCATION: 3rd FLOOR, MARRIOTT FINANCIAL CENTER, NEW YORK, NEW YORK****SITE ACTIVITY: BACKGROUND AIR SAMPLING**

SAMPLE #	DATE	TIME(min)/VOLUME(L)	LOCATION	F/CC*
5807-7030	11/01/01	265/1590	Grand Ballroom B&C North	0.002
5807-7031	11/01/01	265/1590	Grand Ballroom B&C South	0.003
5807-7032	11/01/01	264/1584	Grand Ballroom A East wall	0.002
5807-7033	11/01/01	260/1560	Ellis Room - North wall	<0.002

* Sample analysis was performed in accordance with NIOSH 7400 Method utilizing "A" Counting Rules; the OSHA Reference Method by Phase Contrast Microscopy. NY State ELAP No. 10973

Air Sample Results

October 25, 2001

All air samples results are all below the New York City Department of Environmental Protection's clearance threshold criteria for building occupancy.

Obtained & analyzed by
Accredited Environmental Technologies, Inc.



Accredited Environmental Technologies, Inc.

October 26, 2001

**Ms. Carolyn Bailey
CCMH Fin Center LLC
c/o Claris Services Corporation
6903 Rockledge Drive, Suite 920
Bethesda, MA 20817**

RE: New York Financial Center Marriott, 85 West Street, New York, New York

Dear Ms. Bailey:

Attached are the laboratory results for airborne asbestos samples collected at the above referenced location. These samples were collected and analyzed by Accredited Environmental Technologies, Inc. for comparison with the clearance standards for airborne asbestos established by the New York City Department of Environmental Protection Asbestos Control Program (Title 15, Chapter 1). Sample collection occurred under normal occupancy conditions on October 25, 2001. All samples were collected with high volume sampling pumps with sample durations of approximately five hours and are considered representative of background fiber concentrations throughout the first three floors of the building.

Results indicate that fiber concentrations in the background samples were all below 0.01 F/cc, a level considered acceptable for occupancy according to the Department of Environmental Protection standards.

Samples were analyzed by Phase Contrast Microscopy per NIOSH Method 7400 for asbestos fibers. This method measures total airborne fibers and does not distinguish fiber morphology. All structures with a length to diameter ratio of 3 to 1 or greater and a length greater than 5 microns, are considered to be fibers and are counted as such.

If you have any questions or require additional information, please do not hesitate to contact our office.

Sincerely,

A handwritten signature in black ink, appearing to read 'Eric Houseknecht', with a long, sweeping horizontal stroke extending to the right.

**Eric Houseknecht
Vice President
EH/bg**

335 High Street • Metuchen, NJ 08840 • (732) 321-0666 • FAX: (732) 321-3666

Accredited Environmental Technologies, Inc.**ASBESTOS AIR SAMPLING DATA****CCMH FIN CENTER, LLC.****BETHESDA, MARYLAND****LOCATION: 1st FLOOR, MARRIOTT FINANCIAL CENTER, NEW YORK, NEW YORK****SITE ACTIVITY: BACKGROUND AIR SAMPLING**

SAMPLE #	DATE	TIME(min)/VOLUME(L)	LOCATION	F/CC*
5708-7028	10/25/01	300/1500	Roy's restaurant By West Street entrance	0.002
5708-7029	BLANK	0 Fibers/ 100 Fields		

* Sample analysis was performed in accordance with NIOSH 7400 Method utilizing "A" Counting Rules; the OSHA Reference Method by Phase Contrast Microscopy. NY State ELAP No. 10973

Accredited Environmental Technologies, Inc.**ASBESTOS AIR SAMPLING DATA****CCMH FIN CENTER, LLC.****BETHESDA, MARYLAND****LOCATION: 2nd FLOOR, MARRIOTT FINANCIAL CENTER, NEW YORK, NEW YORK****SITE ACTIVITY: BACKGROUND AIR SAMPLING**

SAMPLE #	DATE	TIME(min)/VOLUME(L)	LOCATION	F/CC*
5807-7023	10/25/01	300/1500	Financial Ballroom North wall	0.004
5807-7024	10/25/01	300/1500	Financial Ballroom South wall	0.005
5807-7025	10/25/01	300/1500	Traders meeting room	<0.002
5807-7027	10/25/01	300/1500	Executive office	<0.002

* Sample analysis was performed in accordance with NIOSH 7400 Method utilizing "A" Counting Rules; the OSHA Reference Method by Phase Contrast Microscopy. NY State ELAP No. 10973

Accredited Environmental Technologies, Inc.**ASBESTOS AIR SAMPLING DATA****CCMH FIN CENTER, LLC.****BETHESDA, MARYLAND****LOCATION: 3rd FLOOR, MARRIOTT FINANCIAL CENTER, NEW YORK, NEW YORK****SITE ACTIVITY: BACKGROUND AIR SAMPLING**

SAMPLE #	DATE	TIME(min)/VOLUME(L)	LOCATION	F/CC*
5807-7019	10/25/01	300/1500	Ballroom B-C North wall	0.003
5807-7020	10/25/01	300/1500	Ballroom B-C South wall	<0.002
5807-7021	10/25/01	300/1500	Ballroom A West wall	<0.002
5807-7022	10/25/01	300/1500	Empire meeting room	<0.002

* Sample analysis was performed in accordance with NIOSH 7400 Method utilizing "A" Counting Rules; the OSHA Reference Method by Phase Contrast Microscopy. NY State ELAP No. 10973

Air Sample Results

October 18, 2001

All air samples results are all below the New York City Department of Environmental Protection's clearance threshold criteria for building occupancy.

Obtained & analyzed by
Accredited Environmental Technologies, Inc.



Accredited Environmental Technologies, Inc.

October 22, 2001

**Ms. Carolyn Bailey
CCMH Fin Center LLC
c/o Claris Services Corporation
6903 Rockledge Drive, Suite 920
Bethesda, MA 20817**

RE: New York Financial Center Marriott, 85 West Street, New York, New York

Dear Ms. Bailey:

Attached are the laboratory results for airborne asbestos samples collected at the above referenced location. These samples were collected and analyzed by Accredited Environmental Technologies, Inc. for comparison with the clearance standards for airborne asbestos established by the New York City Department of Environmental Protection Asbestos Control Program (Title 15, Chapter 1). Sample collection occurred under normal occupancy conditions on October 18 and October 19, 2001. All samples were collected with high volume sampling pumps with sample durations of approximately four to six hours and are considered representative of background fiber concentrations throughout the first five floors of the building.

Results indicate that fiber concentrations in the background samples were all below 0.01 F/cc, a level considered acceptable for occupancy according to the Department of Environmental Protection standards.

Samples were analyzed by Phase Contrast Microscopy per NIOSH Method 7400 for asbestos fibers. This method measures total airborne fibers and does not distinguish fiber morphology. All structures with a length to diameter ratio of 3 to 1 or greater and a length greater than 5 microns, are considered to be fibers and are counted as such.

If you have any questions or require additional information, please do not hesitate to contact our office.

Sincerely,

A handwritten signature in black ink that reads 'Eric Houseknecht'. The signature is written in a cursive, flowing style.

**Eric Houseknecht
Vice President
EH/bg**

335 High Street • Metuchen, NJ 08840 • (732) 321-0666 • FAX: (732) 321-3666

Accredited Environmental Technologies, Inc.**ASBESTOS AIR SAMPLING DATA****CCMH FIN CENTER, LLC.****BETHESDA, MARYLAND****LOCATION: 1ST FLOOR, MARRIOTT FINANCIAL CENTER, NEW YORK, NEW YORK****SITE ACTIVITY: BACKGROUND AIR SAMPLING**

SAMPLE #	DATE	TIME(min)/VOLUME(L)	LOCATION	F/CC*
5807-7001	10/18/01	300/1500	Lobby by stairs & security desk	0.003
5807-7002	10/18/01	300/1500	Roy's restaurant (center)	<0.002
5807-7003	10/18/01	300/1500	Battery Park Tavern (at bar)	<0.002
5807-7017	10/19/01	255/1530	Roy's restaurant (By rear door)	<0.002
5807-7008	BLANK	0 Fibers/ 100 Fields		

* Sample analysis was performed in accordance with NIOSH 7400 Method utilizing "A" Counting Rules; the OSHA Reference Method by Phase Contrast Microscopy. NY State ELAP No. 10973

Accredited Environmental Technologies, Inc.**ASBESTOS AIR SAMPLING DATA****CCMH FIN CENTER, LLC.****BETHESDA, MARYLAND****LOCATION: 2nd FLOOR, MARRIOTT FINANCIAL CENTER, NEW YORK, NEW YORK****SITE ACTIVITY: BACKGROUND AIR SAMPLING**

SAMPLE #	DATE	TIME(min)/VOLUME(L)	LOCATION	F/CC*
5807-7004	10/18/01	300/1500	Traders Room (First Aid)	<0.002
5807-7005	10/18/01	300/1500	Capital Room (mental health)	0.005
5807-7006	10/18/01	300/1500	Ballroom, north wall (Dining Room)	0.004
5807-7007	10/18/01	300/1500	Ballroom, south wall (Dining Room)	0.004
5807-7008	10/19/01	255/1530	Treasury Room (Red Cross Command Center)	<0.002

* Sample analysis was performed in accordance with NIOSH 7400 Method utilizing "A" Counting Rules; the OSHA Reference Method by Phase Contrast Microscopy. NY State ELAP No. 10973

Accredited Environmental Technologies, Inc.**ASBESTOS AIR SAMPLING DATA****CCMH FIN CENTER, LLC.****BETHESDA, MARYLAND****LOCATION: 3rd FLOOR, MARRIOTT FINANCIAL CENTER, NEW YORK, NEW YORK****SITE ACTIVITY: BACKGROUND AIR SAMPLING**

SAMPLE #	DATE	TIME(min)/VOLUME(L)	LOCATION	F/CC*
5807-7010	10/19/01	250/1500	Grand Ballroom Pre-function	0.003
5807-7011	10/19/01	250/1500	Grand Ballroom "A"	0.004
5807-7012	10/19/01	250/1500	Grand Ballroom "B" & "C"	<0.002
5807-7013	10/19/01	250/1500	Empire Room	<0.002
5807-7014	10/19/01	250/1500	Seaport Room	<0.002
5807-7015	10/19/01	250/1500	Ellis Room	<0.002
5807-7018	BLANK	0 Fibers/ 100 Fields		

* Sample analysis was performed in accordance with NIOSH 7400 Method utilizing "A" Counting Rules; the OSHA Reference Method by Phase Contrast Microscopy. NY State ELAP No. 10973

Accredited Environmental Technologies, Inc.**ASBESTOS AIR SAMPLING DATA****CCMH FIN CENTER, LLC.****BETHESDA, MARYLAND****LOCATION: 5th FLOOR, MARRIOTT FINANCIAL CENTER, NEW YORK, NEW YORK****SITE ACTIVITY: BACKGROUND AIR SAMPLING**

SAMPLE #	DATE	TIME(min)/VOLUME(L)	LOCATION	F/CC*
5807-7009	10/19/01	255/1530	Elevator Lobby	0.002

* Sample analysis was performed in accordance with NIOSH 7400 Method utilizing "A" Counting Rules; the OSHA Reference Method by Phase Contrast Microscopy. NY State ELAP No. 10973

Air Sample Results

October 11 & 12, 2001

**Air Samples for the Financial Center Ballroom
(Red Cross Dining Room)**

Obtained & Analyzed by
ATC Associates Inc. for the City of New York

WTC Project
Bechtel/Washington ES&H
October 17, 2001

Bob Adams
WTC/DDC

Regarding Marriott Hotel Asbestos Results:

On October 11, 2001 samples were collected in the lobby of the Marriott Financial Center hotel in order to determine if any asbestos containing dust was present in the designated break area for the WTC operations. These samples were collected following a remark by a work that dust on his clothing was asbestos. In order to verify that asbestos was not being deposited in the break area by poor hygiene practices, the samples were collected and analyzed by TEM according to AHERA protocols.

The results indicate that asbestos as chrysotile was present in one sample but the level was reported as 0.0023 f/cc which is less the EPA ambient level of 0.01 f/cc. The levels are approximately similar to ambient levels reported in the October 16 EPA Summary Report on "Air/Bulk/Wipe/Water Sampling Situation Report". As such the preliminary results indicate that hazards of exposure to asbestos fibers in the break area are within recommended levels under the operation as typical for the break area operation.

No further action is recommended at this time except to caution employees about making inaccurate or misleading announcements regarding possible asbestos contamination.

Attachment:

Laboratory report from ATC Associates.

FAX to:

Judy Gilbert (301) 530.4185

OCT-18-2001 12:28

DDC

F.03



104 East 25th Street
New York, New York 10010
www.atc-enviro.com
212.353.8280
Fax 212.353.8306

October 15, 2001

ATC Associates Inc.
104 East 25th Street
New York, NY 10010
Attn: Mr. James Cohn

Re: Report of TEM Analysis

Dear Mr. Cohn:

Following are the results of transmission electron microscopy (TEM) analysis of two PCM air samples from our Group No. 5696:

Client: Bectel
Project Name: Marriot Hotel, WTC
Location: Cafeteria
Samples received in TEM Lab: 10/15/01

These results will confirm and document the data transmitted to you today. The analyses were performed in strict conformance with the methodology of the NIOSH method 7402, Issue 2, August 15, 1994.

Forty grid openings from each of the samples were examined at relatively low magnifications (approximately 1,000X and 10,000X) for structures greater than 5um in length and widths between 0.25um and 3um, and having a length-to-width ratio greater than 3:1. These structures would be large enough to be observed by PCM analysis.

Asbestos and non-asbestos structures were detected in the samples in the following proportions:

sample	chrysotile	cellulose	gypsum	fiber glass	F/CC as asbestos
03	0.0%	64.8	5.6%	29.6%	0.0
04	15.6%	34.4	25.0	25.0%	0.0023

As a consequence, both samples do not exceed 0.01 F/CC as asbestos.

OCT-18-2001 12:28

DDC

P.02



104 East 25th Street
New York, New York 10010
www.atc-enviro.com
212.353.8280
Fax 212.353.8306

This report may be reproduced only in its entirety and not without prior permission of this laboratory. The analyses were supervised by Dr. Michael A. Gorycki, Director of Electron Microscopy.

We are pleased to note that our TEM lab has received full accreditation from NVLAP, as is currently required for recognized analysis of TEM air samples for AHERA projects, and also approval under the NY State DOH ELAP program. These analyses were performed by ATC d/b/a ATC Associates Inc. Please contact me regarding any questions relating to these materials.

Very truly yours,

A handwritten signature in cursive script, appearing to read 'Michael A. Gorycki'.

Michael A. Gorycki, Ph.D.
Director of Electron Microscopy

U.S. Environmental Protection Agency (www.epa.gov)
Air / Bulk / Wipe/ Water Sampling Situation Report
Tuesday, October 16, 2001 (12:00 noon)

Fixed Ambient Air Sampling Locations (Asbestos)

- NYC / ER (Oct 12, 0001 to 1200 hrs)
 - Resubmittal of results from Sunday, October 14 Sampling Situation Report with additional data for two stations (Locations I and Q) previously not reported.
 - Additional 2 samples analyzed were below the TEM AHERA standard.
- NYC / ER (Oct 12, 1200 to 2400 hrs)
 - All 20 samples analyzed were below the TEM AHERA standard.
- NYC / ER (Oct 13, 0001 to 1200 hrs)
 - All 20 samples analyzed were below the TEM AHERA standard.
- NYC / ER (Oct 13, 1200 to 2400 hrs)
 - All 20 samples analyzed were below the TEM AHERA standard.
- NYC / ER (Oct 14, 1200 to 2400 hrs)
 - All 20 samples analyzed were below the TEM AHERA standard.
- NYC / ER (Oct 15, 0001 to ¹²2400 hrs)
 - All 17 samples analyzed were below the TEM AHERA standard.
 - No results available for 3 additional samples due to pump failure from rain.
- NJ (Oct 12)
 - All 4 samples analyzed were below the TEM AHERA standard.
- NJ (Oct 13)
 - All 4 samples analyzed were below the TEM AHERA standard.
- NJ (Oct 14)
 - All 4 samples analyzed were below the TEM AHERA standard.


Landfill Ambient Air Sampling Locations

- Fresh Kills (Oct 9, 0630 - 2000 hrs) - Asbestos
 - All 17 samples were below the TEM AHERA standard.

OCT-15-2001 16:00

DDC

P.01/02


**DDC****City of New York Department of Design and Construction****Kenneth Holden**
Commissioner**Michael Burton, P.E.**
Executive Deputy Commissioner

October 15, 2001

VIA FACSIMILE 301-530-4185

30-30 Thomson Avenue
Long Island City, NY 11101Tel. 718 / 391-1591
Fax 718 / 391-3480
www.nyc.gov/buildnyc

To: Judy Gilbert

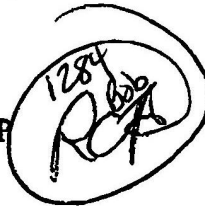From: Robert C. Adams, CIH, CSP
Director EHS Services

RE: Air Sampling Report

Asbestos air samples collected at the Marriott Hotel on October 11, 2001 were found to be slightly elevated above levels acceptable by the USEPA for general occupancy. However, these samples were analyzed by phase contrast microscopy (PCM), an analytical method that identifies fibers but does not distinguish between asbestos and non-asbestos fibers, e.g., fiberglass. The samples have been resubmitted to the laboratory for analysis by transmission electron microscopy (TEM), an analytical method that does specifically identify asbestos fibers. The results of these tests will be communicated when they become available.



AIR MONITORING TA AND CHAIN OF CUSTODY FORM

TURNAROUND TIME

☐ 2 hrs ☐ 6 hrs ☐ 48 hrs ☐ Standard

☐ 4 hrs ☐ 24 hrs ☐ 72 hrs ☐ Other _____

CONTACT INFORMATION

2. Project Name W.T.C		3. Project # 		4. Project Narrative 		5. Project Narrative Civilization	
2a. Project Address Marriott Hotel		1575720001		4a. Air Sampler: M. Kari'm		1528-5	
6. Attachment Location: Samuel's Marriott Hotel		7. ☒ PCM (0.45 micron MCE) Cassette/Filter Manufacturer _____ Lot # _____		8. ☐ TEM (0.45 micron MCE) Cassette/Filter Manufacturer _____ Lot # _____		9. Type: a. ☐ Abatement b. ☐ Background c. ☐ Post-Abate d. ☐ OSHA e. ☒ Ambient f. ☐ Other	
11-01 Marriott Hotel		11-01 Marriott Hotel		11-01 Marriott Hotel		11-01 Marriott Hotel	

AIR SAMPLE RECORD

[illegible]

IN OF CUSTODY

IN OF CUSTODY	19. Received By:	20. Date:	21. Time:
illiquished By:		10/11/01	1900
<i>y. Rain</i>	<i>Phog</i>		
IC Project Manager:	27. Result To:		
<i>John</i>	Beeper/Phone #'s		

AP INEORINATION (ATCE LAP # 10879. ATC NVLAP # 1187)

22. Lab Name:	23. Date:	24. Time:
25. Microscope Model Serial #:	26. Comments:	
☐ Nikon Labophot 238913 ☐ Nikon Labophot 238917 ☐ Nikon Labophot 238979	Analysis Methodology ☒ PCM - NIOSH 7400A TEM - AHERA	

WHITE - File **YELLOW - Client/Report**

PINK - Lab **GOLDENROD - Field**

NY-1 (1,000)