

**SCIENTIFIC LABORATORIES, INC.**

117 EAST 30TH STREET

NEW YORK, NY 10018

TEL: (212) 679-8600 • FAX: (212) 679-8392

PLM Bulk Asbestos Report

Hygienetics Environmental, Inc.

Attn: Lawrence Smith

1 West 34th Street

7th Floor

New York, NY 10001

Date Received 09/19/2001 SciLab Job No. 201092424

Date Examined 09/19/2001 P.O. # 2016.2557NY-39410

Page 1 of 3

RE: 2016.2557NY-39410; Jones Lang LaSalle; 61 Broadway,
Manhattan, NY

Client No. / HGA	Lab No.	Asbestos Present	Total % Asbestos
0919011021-01	201092424-01	Yes	1.5 %

Location: Roof

Description: Grey, Homogeneous, Debris

Asbestos Types: Chrysotile 1.5 %

Other Material: Cellulose 10. %, Fibrous glass 40. %, Non-fibrous 48.5 %

0919011021-02	201092424-02	Yes	1.3 %
---------------	--------------	-----	-------

Location: Roof

Description: Grey, Homogeneous, Debris

Asbestos Types: Chrysotile 1.3 %

Other Material: Cellulose 10. %, Fibrous glass 45. %, Non-fibrous 43.7 %

0919011021-03	201092424-03	Yes	1.3 %
---------------	--------------	-----	-------

Location: 33rd Floor, West Side Ledge Set Back

Description: Grey, Homogeneous, Debris

Asbestos Types: Chrysotile 1.3 %

Other Material: Cellulose 8.0 %, Fibrous glass 30. %, Non-fibrous 60.7 %

0919011021-04	201092424-04	Yes	<1. %
---------------	--------------	-----	-------

Location: 33rd Floor, CEO Ruth D. Corearan

Description: Grey, Homogeneous, Debris

Asbestos Types: Chrysotile <1.0 %

Other Material: Cellulose 5.0 %, Fibrous glass 25. %, Non-fibrous >69. %

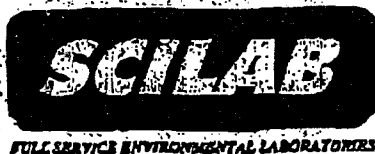
0919011021-06	201092424-05	Yes	<1. %
---------------	--------------	-----	-------

Location: 33rd Floor, West Side

Description: Grey, Homogeneous, Debris

Asbestos Types: Chrysotile <1.0 %

Other Material: Cellulose 3.0 %, Fibrous glass 22. %, Non-fibrous >74. %

**SCIENTIFIC LABORATORIES, INC.**

117 EAST 30TH STREET

NEW YORK, NY 10016

TEL: (212) 679-8800 • FAX: (212) 679-9392

PLM Bulk Asbestos Report

Hygienetics Environmental, Inc.
 Attn: Lawrence Smith
 1 West 34th Street
 7th Floor
 New York, NY 10001

Date Received 09/19/2001 SciLab Job No. 201092424
 Date Examined 09/19/2001 P.O. # 2016.2557NY-39410
 Page 2 of 3
 RE: 2016.2557NY-39410; Jones Lang LaSalle; 61 Broadway,
 Manhattan, NY

Client No. / HGA	Lab No.	Asbestos Present	Total % Asbestos
0919011021-07	201092424-06	Yes	<1.0%

Location: 32nd Floor, Conference Room Across Food Store

Description: Grey, Homogeneous, Debris
 Asbestos Types: Chrysotile Trace
 Other Material: Cellulose 5.0 %, Fibrous glass 20. %, Non-fibrous 75. %

0919011021-08	201092424-07	Yes	<1.0%
---------------	--------------	-----	-------

Location: 32nd Floor

Description: Grey, Homogeneous, Debris
 Asbestos Types: Chrysotile Trace
 Other Material: Cellulose 8.0 %, Fibrous glass 15. %, Non-fibrous 77. %

0919011021-09	201092424-08	Yes	<1.0%
---------------	--------------	-----	-------

Location: 31st Floor, 2705 Conference Room Ledge

Description: Grey, Homogeneous, Debris
 Asbestos Types: Chrysotile <1.0 %
 Other Material: Cellulose 5.0 %, Fibrous glass 25. %, Non-fibrous >69. %

0919011021-10	201092424-09	Yes	<1.0%
---------------	--------------	-----	-------

Location: 4th Floor, SW Corner

Description: Grey, Homogeneous, Debris
 Asbestos Types: Chrysotile <1.0 %
 Other Material: Cellulose 5.0 %, Fibrous glass 30. %, Synthetic fibers 5.0 %, Non-fibrous >59. %



SCIENTIFIC LABORATORIES, INC.

117 EAST 30TH STREET
NEW YORK, NY 10018

TEL: (212) 679-8600 • FAX: (212) 679-9392

PLM Bulk Asbestos Report

Hygienetics Environmental, Inc.
Attn: Lawrence Smith
1 West 34th Street
7th Floor
New York, NY 10001

Date Received 09/19/2001 SciLab Job No. 201092424
Date Examined 09/19/2001 P.O. # 2016.255?NY-39410
Page 3 of 3
RE: 2016.255?NY-39410; Jones Lang LaSalle; 61 Broadway,
Manhattan, NY

Reporting Notes:

Analyzed by: Jonathan Teda

Jonathan Teda
*NAD/NSD = no asbestos detected; NA = not analyzed; NA/PS = not analyzed / positive stop; PLM Bulk Asbestos Analysis by EPA 600/M4-82-020 per 40 CFR 763 (NVLAP Lab #200546-0) and ELAP PLM Analysis Protocol 198.1 for New York samples (NYSDOH ELAP Lab # 11480); Note: PLM is not consistently reliable in detecting asbestos in floor coverings and similar non-friable organically bound materials. TEM is currently the only method that can be used to determine if this material can be considered or treated as non-asbestos-containing in New York State (also see EPA Advisory for floor tile, FR 59, 146, 38970, 8/1/94). National Institute of Standards and Technology Accreditation requirements mandate that this report must not be reproduced except in full without the approval of the laboratory. This PLM report relates ONLY to the items tested. AIHA# 102843; VT Cert# AL016055

Reviewed By: _____