

EMSL Analytical, Inc.

107 Haddon Ave., Westmont, NJ 08106

Phone: (856) 858-4800 Fax: (856) 858-4960 Email: salegal@EMSL.com**EMSL**

Attn: Jeffrey J. Tasca
AMEC
285 Davidson Avenue
Somerset, NJ 08873

Suite 100

Fax: (212) 227-5230

Phone: 732-302-9500

Project: 1-7418 0000

Customer ID: OGDE54
Customer PO: 1-7418-0000-0200
Received: 11/13/01 11:16 AM


EMSL Order: 040117373

EMSL Project ID:

Analysis Date: 11/14/2001

Asbestos Analysis of Bulk Materials via EPA 600/R-93/116 Method using Polarized Light Microscopy

Sample	Location	Appearance	Treatment	Non-Asbestos		Asbestos
				% Fibrous	% Non-Fibrous	% Type
110901-0305 040117373-0001	26 FLR	White Fibrous Homogeneous	Teased	5% Cellulose 5% Glass	90% Non-fibrous (other)	None Detected
110901-0310 040117373-0002	S WALL-26 FLR	White Fibrous Homogeneous	Teased	5% Cellulose 5% Glass	90% Non-fibrous (other)	None Detected
110901-0315 040117373-0003	S WALL ADJ TO 0310	Brown Fibrous Homogeneous	Teased	40% Cellulose 10% Glass	50% Non-fibrous (other)	None Detected
110901-2110 040117373-0004	PLATFORM @ COLUMN	Brown Fibrous Homogeneous	Teased	40% Cellulose 15% Glass	45% Non-fibrous (other)	None Detected
110901-2120 040117373-0005	20TH FLR	Brown Fibrous Homogeneous	Teased	35% Cellulose 10% Glass	55% Non-fibrous (other)	None Detected
110901-2140 040117373-0006	FLOOR 17 AMEX BLDG	Brown Fibrous Homogeneous	Teased	35% Cellulose 10% Glass	55% Non-fibrous (other)	None Detected
110901-2145 040117373-0007	WINDOWSILL	White Fibrous Homogeneous	Teased	5% Cellulose <1% Glass	95% Non-fibrous (other)	None Detected
110901-2150 040117373-0008	EAST WALL	Brown Fibrous Homogeneous	Teased	95% Cellulose 5% Glass		None Detected
110901-2130 040117373-0009	SOUTH WALL 20TH FLR	White Fibrous Homogeneous	Teased	3% Cellulose 10% Glass	87% Non-fibrous (other)	None Detected




Analyst(s)

Dolores Beard (9)

Stephen Siegel, CIH
or other approved signatory

PLM has been known to miss asbestos in a small percentage of samples which contain asbestos. Negative PLM results cannot be guaranteed. Samples reported as <1% or none detected should be tested with TEM. The above test report relates only to the items tested. This report may not be reproduced, except in full, without written approval by EMSL Analytical, Inc. This above test must not be used by the client to claim product endorsement by NVLAP nor any agency of the United States Government.

Analysis performed by EMSL Westmont (NVLAP #101048-0), NY ELAP 10672

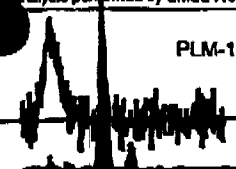

024/045

AMEC PHILADELPHIA

12/10/2001 16:45 FAX 610 828 6700

CITY_21MC100_007079182