

APR-16-2003 15:40

BANHAM LABORATORY UNIT

P.01/05



FAX TRANSMISSION

COVER PAGE

DEPARTMENT OF ENVIRONMENTAL PROTECTION

Bureau of Environmental Compliance

Laboratory Unit

96-05 HORACE HARDING EXPRESSWAY

CORONA, N.Y. 11368

718-595-6309

FAX: 718-595-6307

To: PENNY

Date: April 16, 2003

Fax #: 3744

No. of Pages: 5
(including cover page)

From: LEONARD

Subject: LAB REPORT

COMMENTS:

APR-16-2003 15:40

BANHM LABORATORY UNIT

P.02/05

BUREAU OF AIR, NOISE & HAZARDOUS MATERIALS
ASBESTOS/LEAD CONTROL PROGRAM
59-17 JUNCTION BOULEVARD
CORONA, NY 11368

JOEL A. MIELE, SR., P.E.
COMMISSIONER

ASBESTOS CONTROL PROGRAM
BULK ANALYSIS CHAIN OF CUSTODY

Incident No.: TRU0273MN03

Date Sampled: 03/27/03

Premise: 114 LIBERTY STREET

Time: 12:50 am/pm

Boro: MANHATTAN

Inspector: R. RAMMOHAN
 Print

NR Mahay
 Sign

TURNAROUND TIME: 24HRS ☒ 48HRS ☐ 1 WK ☐ 2 WKS ☐ 4 WKS ☐

SAMPLE NUMBER	DESCRIPTION	LOCATION SAMPLED	LAB ID
1. 030327/A078001	FIBROUS MATERIAL	PIZZARIA, ON FLOOR	373
2. 030327/A078002	FIBROUS MATERIAL	PIZZARIA, ON FLOOR	374
3. 030327/A078003	FIBROUS MATERIAL	PIZZARIA, ON FLOOR	375
4. 030327/A078004	FIBROUS MATERIAL	PIZZARIA, ON TABLE	376
5. 030327/A078005	CEMENTITIOUS PLASTER	PIZZARIA, ON DROP CEILING	377
6.			
7.			
8.			
9.			
10.			

ANALYSES REQUESTED: Asbestos PLM ☒ Asbestos TEM ☐ Lead ☐

DATE	TIME	ACCEPTED BY	COMMENTS
3/27/03	2:45pm	PRINT <u>Gleada Banton</u>	<u>Safe custody lab</u>
		SIGN <u>Gleada Banton</u>	
		P	
		S	
		P	
		S	
		P	
		S	
		P	
		S	

DEP ACT REV 9/96

ASBESTOS ANALYTICAL REPORT

DEP

DIVISION OF EMERGENCY RESPONSE AND TECHNICAL ASSESSMENT
ASBESTOS LABORATORY
96-05 HORACE HARDING EXPRESSWAY
CORONA, NEW YORK 11368
(718) 595-6309 FAX# (718) 595-6307

ELAP # 11045

TEST METHODS : 1) 40 CFR Part 763, Subpart F, App. A
2) Polarized Light Microscopy plus Stratified Point-Counting Method
3) EPA/600/R-93/116

Incident #: TRU0273MN03
Inspector : R. RAMMOHAN
Premise : 114 LIBERTY STREET
Boro : Manhattan
Analyst : G. ROMAN

Date Collected: 03/27/03
Received: 03/27/03
Analyzed: 03/27/03

Client #:

DEP Sample #:	30327/A078001	30327/A078002	30327/A078003
Laboratory #:	30327/373	30327/374	30327/375
Location Sampled:	PIZZARIA ON FLOOR	PIZZARIA ON FLOOR	PIZZARIA ON FLOOR
Color:	BEIGE	BEIGE	BEIGE
Homogenous:	Yes	Yes	Yes
Asbestos Present:	Yes	Yes	Yes

Results (%)

Amosite	44.5	Amosite	40	Amosite	50
Fibrous glass	22.2	Cellulose	trace	Cellulose	trace
Matrix	33.3	Fibrous glass	30	Fibrous glass	25
		Matrix	30	Matrix	25

Comments: 1. Sample #005 has 2 types of material.
2. This report has results for the beige cementitious material.

Reviewed by: A. A. Adamey
Laboratory Director

This test report may not be reproduced except with the written approval of this laboratory. The test report relates only to the item(s) listed and does not represent a product endorsement by NVLAP or any other U.S. Government agency.

ASBESTOS ANALYTICAL REPORT

DEP

DIVISION OF EMERGENCY RESPONSE AND TECHNICAL ASSESSMENT

ASBESTOS LABORATORY
96-05 HORACE HARDING EXPRESSWAY
CORONA, NEW YORK 11368
(718) 595-6309 FAX# (718) 595-6307

ELAP # 11045

TEST METHODS : 1) 40 CFR Part 763, Subpart F, App. A
2) Polarized Light Microscopy plus Stratified Point-Counting Method
3) EPA/600/R-93/116

Incident #: TRU0273MN03
Inspector : R. RAMMOHAN
Premise : 114 LIBERTY STREET
Boro : Manhattan
Analyst : G. ROMAN

Date Collected: 03/27/03
Received: 03/27/03
Analyzed: 03/27/03

Client #:

DEP Sample #:	30327/A078004	30327/A078005
Laboratory #:	30327/376	30327/377
Location Sampled:	PIZZARIA ON TABLE	ON DROP CEILING
Color:	BEIGE	BEIGE
Homogenous:	Yes	No
Asbestos Present:	Yes	Yes

Results (%)

Amosite	44.5	Chrysotile	3.1
Cellulose	trace	Quartz	65.4
Fibrous glass	33.3	Matrix	31.5
Matrix	22.2		

Comments: 1. Sample #005 has 2 types of material
 2. This report has results for the beige cementitious material.

Reviewed by: 
 Laboratory Director

This test report may not be reproduced except with the written approval of this laboratory. The test report relates only to the item(s) listed and does not represent a product endorsement by NVLAP or any other U.S. Government agency.

ASBESTOS ANALYTICAL REPORT

DEP

DIVISION OF EMERGENCY RESPONSE AND TECHNICAL ASSESSMENT

ASBESTOS LABORATORY
96-05 HORACE HARDING EXPRESSWAY
CORONA, NEW YORK 11368
(718) 595-6309 FAX# (718) 595-6307

ELAP # 11045

TEST METHODS : 1) 40 CFR Part 763, Subpart F, App. A
2) Polarized Light Microscopy plus Stratified Point-Counting Method
3) EPA/600/R-93/116

Incident #: TRU0273MN03
 Inspector : R. Rammohan
 Premise : 114 Liberty Street
 Boro : Manhattan
 Analyst : G. Roman

Date Collected: 03/27/03
 Received: 03/27/03
 Analyzed: 03/27/03

Client # :

DEP Sample # : 30327/A078005A

Laboratory # : 30327/377A

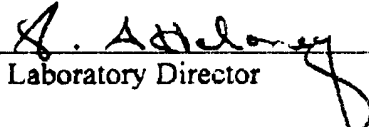
Location Sampled: On drop ceiling

Color : Light brown

Homogenous: No
 Asbestos Present: No

Results (%)	Matrix	88
	Fibrous	2
	Quartz	10

Comments: This report has results for the brown cementitious material.

Reviewed by: 
 Laboratory Director

This test report may not be reproduced except with the written approval of this laboratory. The test report relates only to the item(s) listed and does not represent a product endorsement by NVLAP or any other U.S. Government agency.