

SciLab #: 202082252

Client Name: TRC Environmental Corporation

Table I

Summary of Transmission Electron Microscopy (TEM) Results for Asbestos (ASTM D5755 Dust Microvac)
35052-0000-00009; New York City Law Department; 100 Church St. - 10x10 Area Sampled


SciLab Sample #	Client Sample #	Surface Area Sampled (sq. cm)	Dilution Factor	Asbestos Structures Detected	* Analytical Sensitivity on Grid (Str / sq mm)	Structure Density on Grid (Str / sq mm)	* Analytical Sensitivity on Surface (Str / sq. cm)	Limit Of Detection (Str/ sq. cm)	Structure Density on Surface (Str/ sq. cm)	Type of Asbestos
01	BA081002MV-2001 20th Fl. - Northeast - Women's Toilet Vestibule	100.0	0.01000	1	10	10.0	2,140	2,140	2,140	chrysotile
02	BA081002MV-2002 20th Fl. - Northeast - Women's Toilet	100.0	0.02000	0	10	<10	1,070	1,070	<1,070	NSD
03	BA081002MV-2003 20th Fl. - Northwest - Men's Toilet	100.0	0.02000	0	10	<10	1,070	1,070	<1,070	NSD
04	BA081002MV-2004 20th Fl. - Southeast - Men's Toilet	100.0	0.02000	0	10	<10	1,070	1,070	<1,070	NSD
05	BA081002MV-2005 20th Fl. - South Corridor 5' West Of Exit Door "B"	100.0	0.02000	0	10	<10	1,070	1,070	<1,070	NSD
06	BA081002MV-2006 20th Fl. - South Corridor Next To Men's Toilet	100.0	0.02000	0	10	<10	1,070	1,070	<1,070	NSD
07	BA081002MV-2007 20th Fl. - Northwest Corner Rm # 8-1405	100.0	0.02000	0	10	<10	1,070	1,070	<1,070	NSD
08	BA081002MV-2008 20th Fl. - Northwest Corridor 5' East Of Men's Toilet	100.0	0.02000	0	10	<10	1,070	1,070	<1,070	NSD
09**	BA081002MV-2009 Blank				1					

* structure density represented by the detection of 1 structure

** not analyzed

NSD: No Asbestos Structures Detected

Reviewed By:

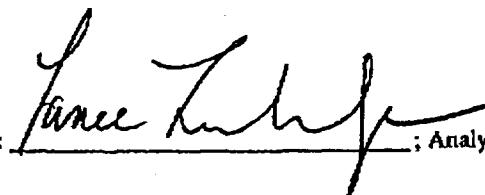

; Analyzed By:



Aleksandr Barengolts

Date: 8/11/02