

Materials Testing Lab Inc.
 NY Metropolitan Regional Office / Corporate Headquarters
 145 Sherwood Avenue, Farmingdale, NY 11735 (631) 815-1900 FAX (631) 815-1901
 www.materials-testing.com

Dmm
2/10/05

Client: Dept of Design & Construction
 30-30 Thompson Ave.
 Long Island City, N.Y. 11101
Project: DDC-C-1113

Report #: 04DDC-72777
Date: N/A
Break Date: 11/11/04
Contract: HWMWTCAIE

Page 1 of 1
Item #

CONCRETE FIELD DATA (ASTM C192)

Truck No.	Ticket No.	Batch Time	Disch. Time	Samp. Time	% Air Cont.	Slump (Inch)	Conc. Temp, F	Unit Wt. (PCF)	Field Set #	Design Strength (PSI)

Location(s) of Pour:


Supplier:
Weather:

Contractor:
Air Temp.


Inspector: Client
Total Yardage Placed:

COMPRESSIVE STRENGTH OF CONCRETE TEST CYLINDERS (ASTM C39) (6" D x 12" H)

Field #	Seal #	Date Cast	Date Tested	Age, Days	Cross-Sect. Area, (sq. in.)	Total Load (Lbs.)	Fracture Type	Strength (PSI)	Aging factor	Correct strength (PSI)	Comp.
1	1	N/A	11/11/04	28	28.27	150000	D	5306	1.00	5306	-
2	2	N/A	11/11/04	28	28.27	148000	E	5235	1.00	5235	-
3	3	N/A	11/11/04	28	28.27	157000	D	5554	1.00	5554	-
4	4	N/A	11/11/04	28	28.27	160000	E	5660	1.00	5660	-
5	5	N/A	11/11/04	28	28.27	156000	D	5518	1.00	5518	-
6	6	N/A	11/11/04	28	28.27	163000	E	5766	1.00	5766	-
7	7	N/A	11/11/04	28	28.27	155000	D	5483	1.00	5483	-
8	8	N/A	11/11/04	28	28.27	152000	E	5377	1.00	5377	-
9	9	N/A	11/11/04	28	28.27	161000	D	5695	1.00	5695	-
10	10	N/A	11/11/04	28	28.27	149000	E	5271	1.00	5271	-
11	11	N/A	11/11/04	28	28.27	144500	D	5111	1.00	5111	-
12	12	N/A	11/11/04	28	28.27	147000	E	5200	1.00	5200	-
13	13	N/A	11/11/04	28	28.27	154000	E	5447	1.00	5447	-

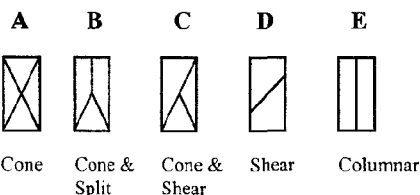

Submitted By: Materials Testing Lab, Inc.

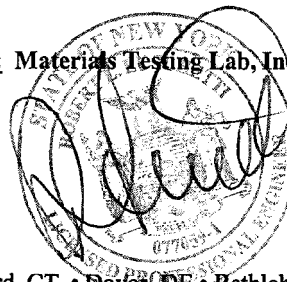

The above reported data is the property of the client. No reproduction of the above data without the sole permission of Materials Testing Lab, Inc.
 Materials Testing accepts no liability for work executed by others.

The MT Group: • New York City • Long Island • Edison, NJ • Wallingford, CT • Dover, DE • Bethlehem, PA

CITY_21MC100_007224254