

TAYLOR ENVIRONMENTAL GROUP, INC.

**Stuyvesant High School
345 Chambers Street
New York, NY**

3RD THROUGH 10TH FLOORS

Final Air Test Results (Asbestos and Lead)
Post General Cleaning Lead Wipe Sample Results
Unit Ventilator Lead Wipe Sample Results
HVAC Duct Lead Wipe Sample Results
Lead Personal (OSHA Air Monitoring Results)
Lead Area Air Monitoring Sample Results

**Project #: M477-15217
LLW#: 29881**

BOOK 1 OF 2

130A JERICO TPKE., FLORAL PARK, NY 11001 • PHONE (516) 358-2955 • FAX (516) 358-1780

07110

CITY_21MC100_008878284

TAYLOR ENVIRONMENTAL GROUP, INC.

**FINAL AIR TEST RESULTS
(LEAD AND ASBESTOS)
3RD THROUGH 10TH
FLOORS**

**PROJECT #: M477-15217
LLW#: 29881**

130A JERICO TPKE., FLORAL PARK, NY 11001 • PHONE (516) 358-2955 • FAX (516) 358-1780

07111


CITY_21MC100_008878285

08/10/2022 12:05 212-290-5538

ENSI ANALYTICAL, INC.

PAGE 62/72

WHITE: Office Copy YELLOW: Lab Copy PINK: Samples ORANGE: Site Copy

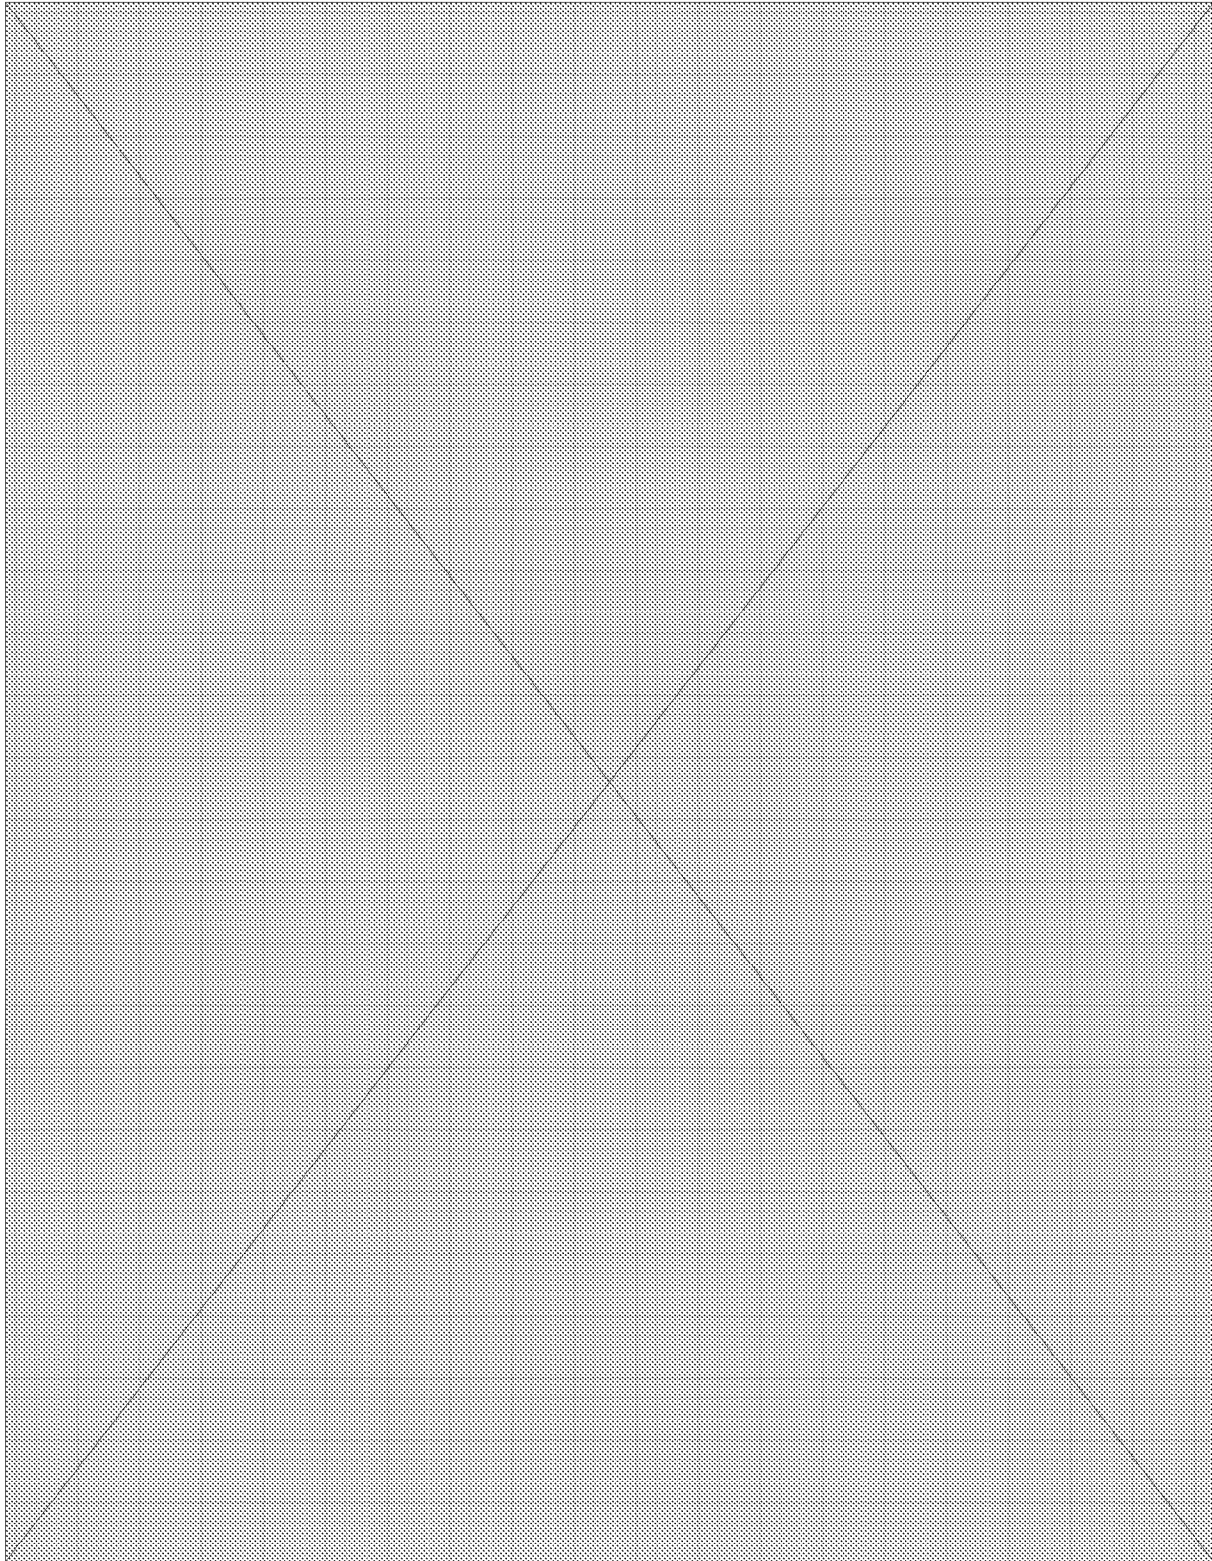

TAYLOR ENVIRONMENTAL GROUP				DAILY MONITORING SHEET AND CHAIN OF CUSTODY RECORD										PAGE 1 OF 1	
TECHNOLOGIST <i>Al. Korman</i>		CLIENT <i>NYCSCA</i>		SITE ADDRESS <i>Stuyvesant H.S.</i>				DATE DISMISSED <i>8-20-02</i>							
DATE SAMPLED <i>8/20/02</i>		CONTACT <i>HANID SAOUD</i>		WORK AREA <i>10th Floor</i>				DATE LOGGED							
ROUTINE/STANDARD <i>TEG- L-18</i>		PROJECT NO. <i>M477-15217-29881</i>		PROJECT MANAGER <i>Cazis McGowan</i>				DATE APPROVED / SIGNATURE							
SAMPLE & PUMP #	LABORATORY NO.	SAMPLE LOCATION, AREA & HEIGHT AND/OR EMPLOYEE		FLOW ON/OFF	TIME ON	TIME OFF	DURATION MINUTES	FLOW (AVERAGE)	LITERS	FIELDS	FIBERS	F/MM ²	F/CC		
10-L1		IWA ☐ DWA ☐	Room # 1039 South side	4	03:53	08:14	261	4	1044						
10-L2		IWA ☐ DWA ☐	Corridor by room # 1039	4	03:55	08:16	261	4	1044						
10-L3		IWA ☐ DWA ☐	Room # 1010 East side	4	04:01	08:18	257	4	1028						
10-L4		IWA ☐ DWA ☐	Corridor by room # 1001	4	04:07	08:20	253	4	1012						
10-L5		IWA ☐ DWA ☐	Room # 1001 Outside	4	04:09	08:21	252	4	1008						
FB-1		IWA ☐ DWA ☐	F/BANK-1												
FB-2		IWA ☐ DWA ☐	F/BANK-2												
		IWA ☐ DWA ☐													
		IWA ☐ DWA ☐													
		IWA ☐ DWA ☐													
		IWA ☐ DWA ☐													
		IWA ☐ DWA ☐													
		IWA ☐ DWA ☐													
ANALYST (SIGNATURE) <i>[Signature]</i> DATE <i>8/20/02</i> TIME <i>10:18</i>				RECEIVED / INITIALED DROP BOX (SIGNATURE) <i>[Signature]</i>				DATE <i>8/20/02</i> TIME <i>10:20</i>		BOARD PRE OSHA <i>[Signature]</i>					
ANALYST (SIGNATURE) <i>[Signature]</i> DATE <i>8/20/02</i> TIME <i>10:18</i>				RECEIVED BY (SIGNATURE) <i>[Signature]</i>				DATE <i>8/20/02</i> TIME <i>10:20</i>		BOARD PRE OSHA <i>[Signature]</i>					
ANALYST (SIGNATURE) <i>[Signature]</i> DATE <i>8/20/02</i> TIME <i>10:18</i>				RECEIVED BY (SIGNATURE) <i>[Signature]</i>				DATE <i>8/20/02</i> TIME <i>10:20</i>		BOARD PRE OSHA <i>[Signature]</i>					

21323

LOT # 1105117082
FATER MANUFACTURER

WHITE: Office Copy YELLOW: Lab Copy PINK: Samples ORANGE: Site Copy

07114

CITY_21MC100_008878288

ATC ASSOCIATES, INC

104 E 25th Street, 10th Floor

New York, NY 10010

Tel. 212-353-8280

Fax 212-353-8306

REPORT DATE: 08-20-02

CLIENT: Taylor Environmental Group, Inc.

PROJECT NAME: SCA/Stuyvesant HS
10th floor

PROJECT NUMBER: M477-15.17/29881

SAMPLED BY: Client

SAMPLE DATE: 08-20-02
DATE RECEIVED: 08-20-02
DATE ANALYZED: 08-20-02

SAMPLE MEDIA: Air Samples
ANALYSIS REQUIRED: Method NIOSH 7082

ANALYSIS RESULTS

SAMPLE ID	BATCH NO.	SAMPLE DESCRIPTION	LEAD CONCENTRATION ($\mu\text{g}/\text{m}^3$)	DETECTION LIMIT ($\mu\text{g}/\text{m}^3$)
10-L1	21323	Room 1039 South Side	<1.4	1.4
10-L2	21323	Corridor by Room 1039	<1.4	1.4
10-L3	21323	Room 1010 East Side	<1.5	1.5
10-L4	21323	Corridor by Room 1001	<1.5	1.5
10-L5	21323	Room 1001 North Side	<1.5	1.5
FB1	21323	Field Blank	<1.5 μg	1.5 μg
FB2	21323	Field Blank	<1.5 μg	1.5 μg

NOTE 1:

THE REPORTING LIMIT (RL) IS 3.0 μg

NOTE 2:

At the present time there are no regulatory levels or requirements for indoor airborne lead in area samples. However, OSHA has established an action level of 30 $\mu\text{g}/\text{m}^3$ and a permissible exposure level (PEL) of 50 $\mu\text{g}/\text{m}^3$ for personal samples.

NOTE 3:

Blank units are in μg

0744F

CITY_21MC100_008878289

ATC ASSOCIATES, INC
104 E 25th Street, 10th Floor
New York, NY 10010
Tel. 212-353-8280
Fax 212-353-8306

CERTIFICATION AND SIGNATURES

ANALYSIS PERFORMED BY: FEU

REPORT PREPARED BY: [Signature]

ATC certifies that this report is an accurate and authentic report of results obtained from the laboratory analysis.

QUALITY ASSURANCE COORDINATOR: [Signature]

LABORATORY DIRECTOR: [Signature]

ATC is accredited by the New York State Department of Health Environmental Laboratory Approval Program (ELAP) and by the American Industrial Hygiene Association (AIHA) to perform analysis of lead in paint, dust wipes, air and soil samples. (ELAP #10379), (AIHA #100229).

TAYLOR ENVIRONMENTAL GROUP

DAILY MONITORING SHEET AND CHAIN OF CUSTODY RECORD

PAGE 1 OF 1

TECHNICIAN <i>Rick McKenzie</i>	CLIENT <i>NYC SCA</i>	SITE ADDRESS <i>STUYVESANT H.S.</i>	DATE SUBMITTED <i>8/20/02</i>
DATE SAMPLED <i>8/20/02</i>	CONTACT <i>HANDS ON</i>	WORK AREA <i>9th Floor</i>	DATE LOGGED
PROJECT NO. <i>149 8722</i>	PROJECT ID <i>1477-15217-29831</i>	PROJECT MANAGER <i>Charles McElroy</i>	DATE APPROVED / SIGNATURE

SAMPLE & PUMP #	LABORATORY NO.	SAMPLE LOCATION, AREA & HEIGHT AND/OR EMPLOYEE	FLOW ON/OFF	TIME ON	TIME OFF	DURATION MINUTES	FLOW (AVERAGE)	LITERS	FIELDS	FIBERS	F/MM ²	F/CC
9-T1		IWA ☒ ROOM 939, AT South side OWA ☐	9/9	0410	0635	145	9	1305				
9-T2		IWA ☒ ROOM 940, AT NW side OWA ☐	9/9	0411	0636	145	9	1305				
9-T3		IWA ☒ CORRIDOR bet West entrance OWA ☐ & ROOM 931	9/9	0413	0639	146	9	1314				
9-T4		IWA ☒ ROOM 936, AT NE side OWA ☐	9/9	0414	0640	146	9.25	1350.5				
9-T5		IWA ☒ ROOM 927, AT north side OWA ☐	9/9	0416	0642	146	9	1314				
9-T6		IWA ☒ CORRIDOR AT ENTRANCE OWA ☐ TO STAIRCASE "W"	9/9	0417	0643	146	9	1314				
9-T7		IWA ☒ CORRIDOR, South of OWA ☐ ESCALATOR	9/9	0418	0644	146	9	1314				
9-T8		IWA ☒ CORRIDOR, West of OWA ☐ STAIRCASE "E"	9/9	0419	0645	146	9	1314				
9-T9		IWA ☒ ROOM 903, AT Center OWA ☐	9/9	0420	0647	147	9	1323				
9-T10		IWA ☒ ROOM 913, AT Center OWA ☐	9/8.5	0422	0649	147	8.25	1286.25				
FB-1		IWA ☐ F/BLANK-1 OWA ☐										
FB-2		IWA ☐ F/BLANK-2 OWA ☐										
SB-1		IWA ☐ S/BLANK OWA ☐										

RELINQUISHED TO TEG DROP BOX (SIGNATURE)	DATE	TIME	RECEIVED FROM TEG DROP BOX (SIGNATURE)	DATE	TIME
<i>[Signature]</i>	8/20/02	0750	<i>ATC</i>	8/20/02	8am
ANALYST (SIGNATURE)	DATE	TIME	COMMENTS		
<i>RRay</i>	8/20/02	11:45	Analyze 9-T1 thru 9-T10		

PCB	TEM
ROUND	PRE DURING POST
OSHA	DATE
NOTE: FILLER MANUFACTURED	


07117

WHITE: Office Copy

YELLOW: Lab Copy

PINK: Samples

ORANGE: Site Copy

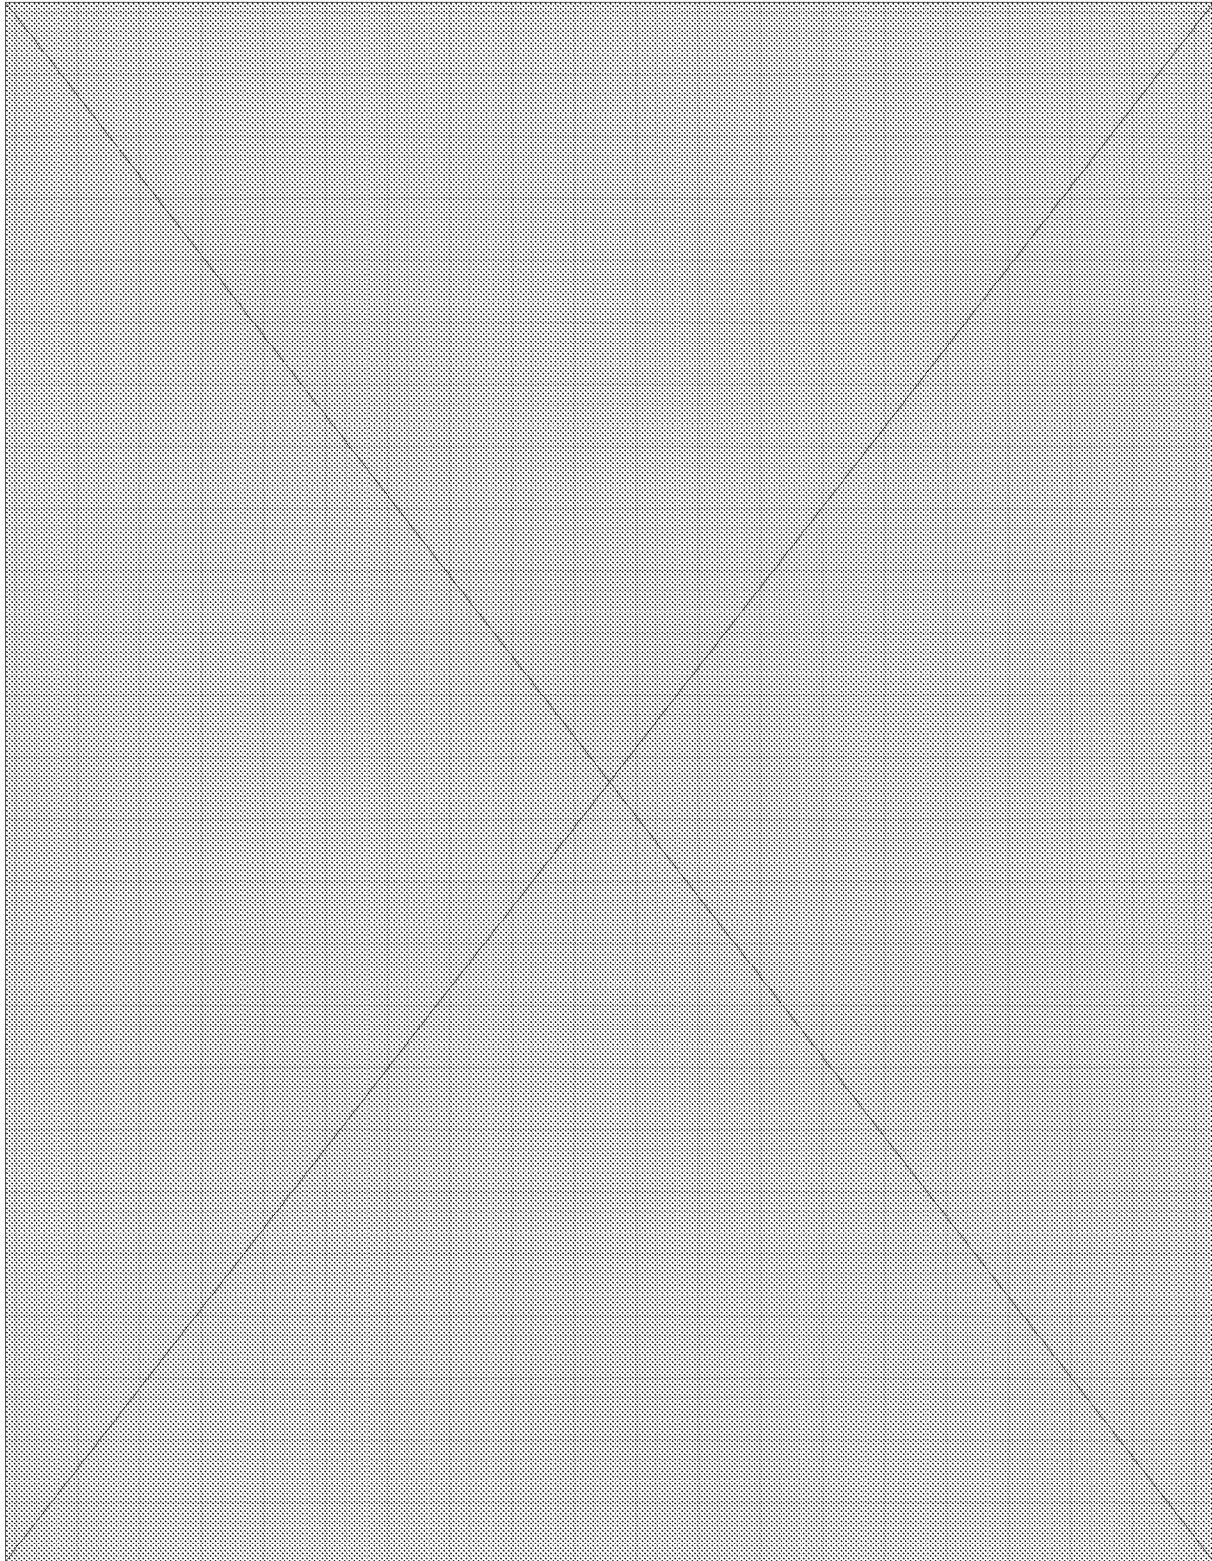

Attn: Taylor Environmental Group

Received: 8/20/02 8:00:00 AM
ATC Group #: 8722
Analysis Date: 8/20/02

Fax: (516) 358-1780 Phone:

Project: NYC SCA Project #: M477-15317-29881
Snuyvesant H. S., 9th Floor

**Asbestos Fiber Analysis by Transmission Electron Microscopy (TEM) Performed
by EPA 40 CFR Part 763 Final Rule (AHERA)**

Sample	Volume	Area Analyzed	Non Asb	Asbestos Type(s)	# Structures		Analytical Sensitivity (S/cc)	Asbestos Concentration		Notes
					0.5u-5 u	5u		(S/mm ²)	(S/cc)	
9-T8 8722 -8	1314.00	0.0674	0	None Detected	0	0	0.0043	<14.83	<0.0043	
9-T9 8722 -9	1323.00	0.0674	0	None Detected	0	0	0.0043	<14.83	<0.0043	
9-T10 8722 -10	1286.35	0.0674	0	None Detected	0	0	0.0044	<14.83	<0.0044	

ROMAN PEYSARKHOV

Analyzed by



MICHAEL A. GORYCKI, Ph.D.

Approved by

Disclaimer: The laboratory is not responsible for data reported in structures/cc, which is dependent on volume collected by non-laboratory personnel. This lab is only responsible for data reported in structures/mm². This report may not be reproduced, except in full, without written approval by ATC Associates Inc. This report may not be used to claim product endorsement by NVLAP or any other agency of the U.S. Government. This report relates only to the samples reported above. Quality control data (including 95% confidence limits and laboratory and analysis accuracy and precision) is available upon request.

Accredited for NVLAP PLW/TEM #101187-0, NY State ELAP #10879

Page 2 of 2

07119

CITY_21MC100_008878293

TAYLOR ENVIRONMENTAL GROUP

DAILY MONITORING SHEET AND CHAIN OF CUSTODY RECORD

PAGE 1 OF 1

TECHNICIAN <i>Mike McKenzie</i>		CLIENT NYC SCA		SITE ADDRESS SHOYUSANT H.S.		DATE SUBMITTED 8-20-02	
DATE SAMPLED 8/20/02		CONTACT HAMIL SWOOS		WORK AREA 9TH FLOOR		CALL NUMBER 21332	
METER NO. L-21		PROJECT NO. M447-15217-29861		PROJECT MANAGER C. McCLOWN		DATE APPROVED / SIGNATURE	

SAMPLE & PUMP #	LABORATORY NO.	SAMPLE LOCATION, AREA & HEIGHT AND/OR EMPLOYEE	FLOW ON/OFF	TIME ON	TIME OFF	DURATION MINUTES	FLOW (AVERAGE)	LITERS	FIELDS	FIBERS	F/MM ²	F/CC
9-L1		IWA ☐ CORRIDOR BETWEEN ROOMS 935 and 940	4/4	0412	0831	259	4	1036				
9-L2		IWA ☐ CORRIDOR, SOUTH OF ESCALATOR ENTRANCE	4/4	0417	0833	256	4	1024				
9-L3		IWA ☐ ROOM 911, AT EAST SIDE	4/4	0421	0834	253	4	1012				
9-L4		IWA ☐ CORRIDOR, NW SF STAIRCASE "E"	4/4	0424	0835	251	4	1004				
9-L5		IWA ☐ ROOM 902, AT NE SIDE	4/4	0425	0837	252	4	1008				
FB-1		IWA ☐ F/BLANK-1										
FB-2		IWA ☐ F/BLANK-2										
		IWA ☐										
		IWA ☐										
		IWA ☐										
		IWA ☐										
		IWA ☐										
		IWA ☐										
		IWA ☐										
		IWA ☐										

REFUSED SIGNATURE (SIGNATURE)	DATE	TIME	RECEIVED FROM (ED CHD) BOX (SIGNATURE)	DATE	TIME	CPD#
<i>[Signature]</i>	8-20-02	1037	ATC-ML	8/20/02	4 PM	
RECEIVED BY (SIGNATURE)	DATE	TIME	RECEIVED BY (SIGNATURE)	DATE	TIME	PCM TEM
<i>[Signature]</i>			<i>[Signature]</i>	8/24/02	1036	PRE DURING POST
ANALYST (SIGNATURE)	DATE	TIME	COMMENTS	OSHA		
			612711	LOTT, ELIEN/MAN/MADEUSER		

WHITE: Office Copy

YELLOW: Lab Copy

PINK: Samples

ORANGE: Site Copy

EMS INFORMATION RECEIVED

030211485

07120

CITY_21MC100_008878294

ATC ASSOCIATES, INC

104 E 25th Street, 10th Floor

New York, NY 10010

Tel. 212-353-8280

Fax 212-353-8306

REPORT DATE: 08-20-02
CLIENT: Taylor Environmental Group, Inc.
PROJECT NAME: SCA/Stuyvesant HS
9th Floor
PROJECT NUMBER: M477-15217/29881
SAMPLED BY: Client
SAMPLE DATE: 08-20-02
DATE RECEIVED: 08-20-02
DATE ANALYZED: 08-20-02
SAMPLE MEDIA: Air Samples
ANALYSIS REQUIRED: Method NIOSH 7082

ANALYSIS RESULTS

SAMPLE ID	BATCH NO.	SAMPLE DESCRIPTION	LEAD CONCENTRATION ($\mu\text{g}/\text{m}^3$)	DETECTION LIMIT ($\mu\text{g}/\text{m}^3$)
9-L1	21332	Corridor Between Rooms 935 and 940	<1.3	1.3
9-L2	21332	Corridor South of Escalator Entrance	<1.3	1.3
9-L3	21332	Room 911 at East Side	<1.5	1.5
9-L4	21332	Corridor NW of Staircase E	<1.5	1.5
9-L5	21332	Room 902 at NE Side	<1.5	1.5
FB1	21332	Field Blank	<1.5 μg	1.5 μg
FB2	21332	Field Blank	<1.5 μg	1.5 μg

NOTE 1:THE REPORTING LIMIT (RL) IS 3.0 μg **NOTE 2:**At the present time there are no regulatory levels or requirements for indoor airborne lead in area samples. However, OSHA has established an action level of 30 $\mu\text{g}/\text{m}^3$ and a permissible exposure level (PEL) of 50 $\mu\text{g}/\text{m}^3$ for personal samples.**NOTE 3:**Blank units are in μg **NOTE 4:**

Samples prepared by ESML

NOTE 5:

LCS 9.93 PPM; LCSd 10.09 PPM; RL VS 0.32 PPM; ME <0.045 PPM

07121

CITY_21MC100_008878295

ATC ASSOCIATES, INC

104 E 25th Street, 10th Floor

New York, NY 10010

Tel. 212-353-8280

Fax 212-353-8306

CERTIFICATION AND SIGNATURES

ANALYSIS PERFORMED BY:

dl

REPORT PREPARED BY:

WATO

ATC certifies that this report is an accurate and authentic report of results obtained from the laboratory analysis.

QUALITY ASSURANCE COORDINATOR:

WATO


LABORATORY DIRECTOR:

WATO

ATC is accredited by the New York State Department of Health Environmental Laboratory Approval Program (ELAP) and by the American Industrial Hygiene Association (AIHA) to perform analysis of lead in paint, dust wipes, air and soil samples. (ELAP #10279), (AIHA #100229).

07122

CITY_21MC100_008878296

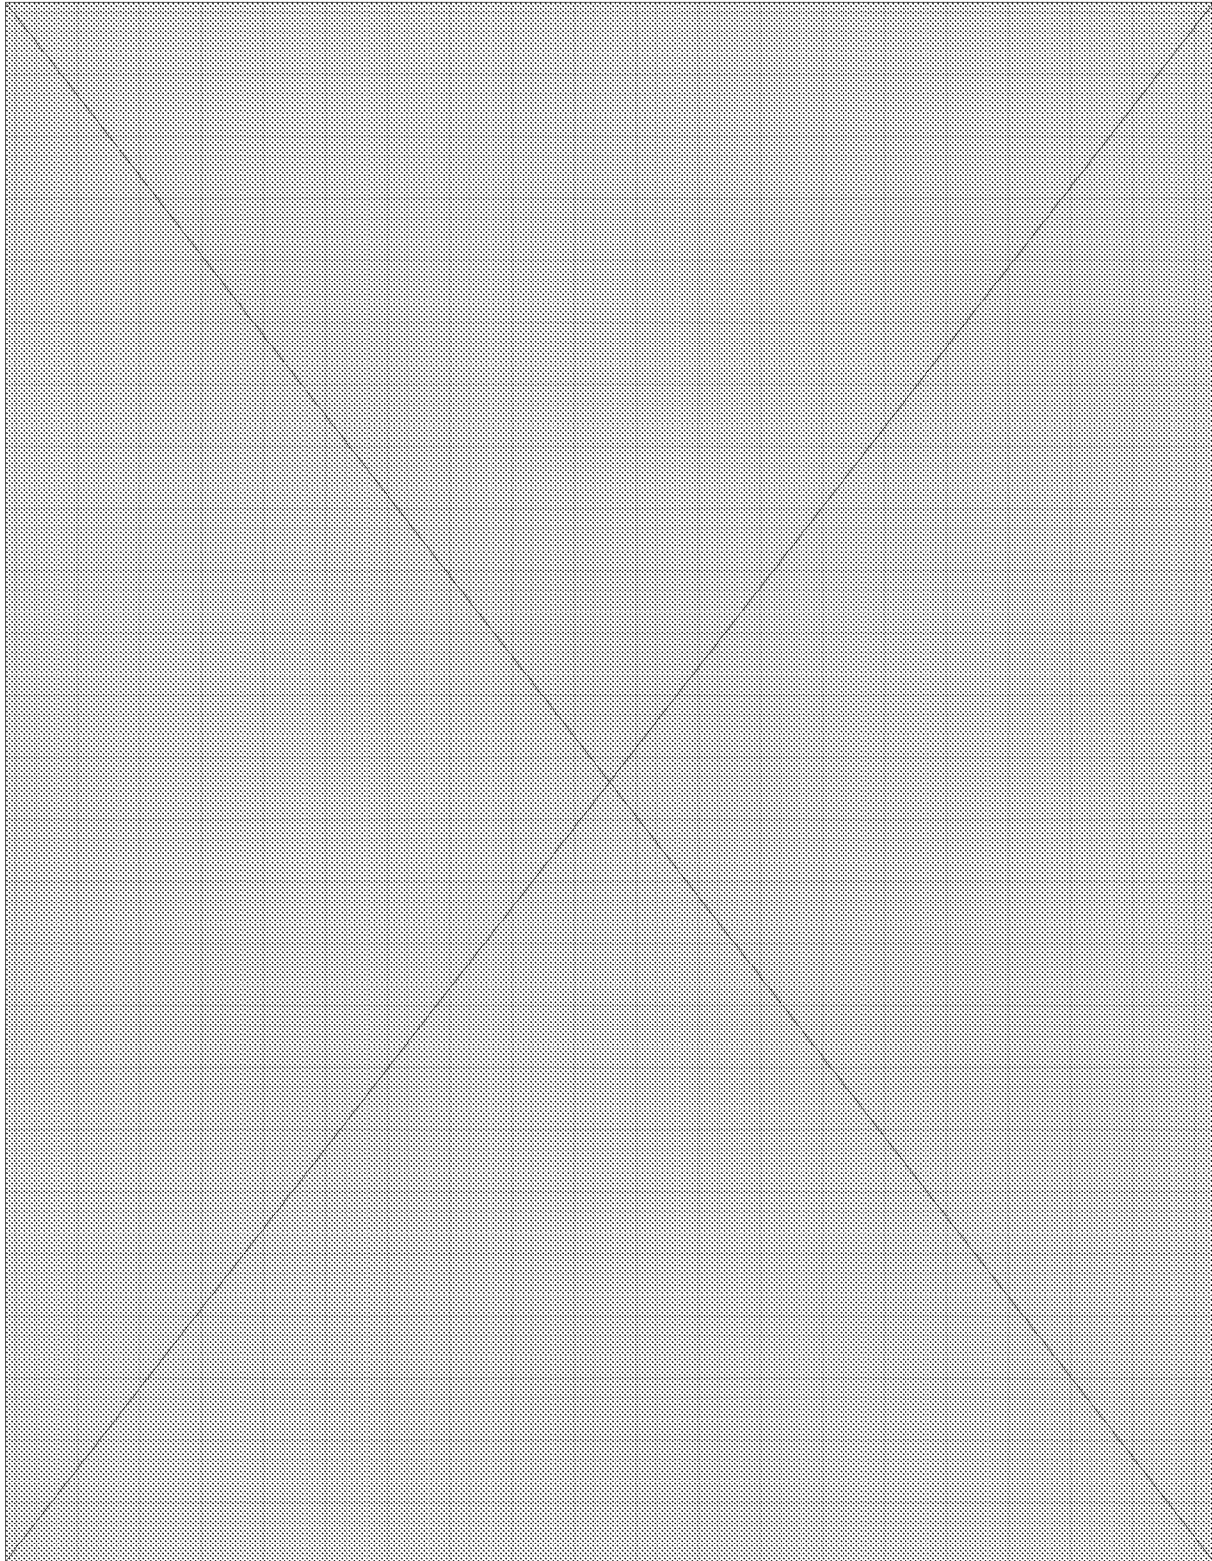

ATC Associates

104 East 25 Street, New York, NY 10010

Phone: (212) 353-8280 Fax: (212) 353-8306



Attn:

Taylor Environmental Group

Received: 8/20/02

8:00:00 AM

ATC Group #: 8721

Analysis Date: 8/20/02

Fax: (516) 358-1780

Phone:

Project: NYC SCA Project #: M477-15217-29881

Stuyvesant H.S. 8th Floor

**Asbestos Fiber Analysis by Transmission Electron Microscopy (TEM) Performed
by EPA 40 CFR Part 763 Final Rule (AHERA)**

Sample	Volume	Area Analyzed	Non Asb	Asbestos Type(s)	# Structures 0.5µ-5 µ	Analytical Sensitivity (S/cc)	Asbestos Concentration (S/mm ²)	Notes
8-T1 8721 -1	1283.50	0.0674	0	None Detected	0	0.0044	<14.83	<0.0044
8-T2 8721 -2	1341.00	0.0674	0	None Detected	0	0.0043	<14.83	<0.0043
8-T3 8721 -3	1333.00	0.0674	0	None Detected	0	0.0043	<14.83	<0.0043
8-T4 8721 -4	1314.00	0.0674	0	None Detected	0	0.0043	<14.83	<0.0043
8-T5 8721 -5	1359.00	0.0674	0	None Detected	0	0.0042	<14.83	<0.0042
8-T6 8721 -6	1341.00	0.0674	0	None Detected	0	0.0043	<14.83	<0.0043
8-T7 8721 -7	1275.00	0.0674	0	None Detected	0	0.0045	<14.83	<0.0045

ROMAN PEVSAKHOV

Analyzed by:

MICHAEL A. GORYCKI, Ph.D

Approved by:

Disclaimer: The laboratory is not responsible for data reported in structures/cc, which is dependent on volume collected by non-laboratory personnel. This lab is only responsible for data reported in structures/mm². This report may not be reproduced, except in full, without written approval by ATC Associates Inc. This report may not be used to claim product endorsement by NVLAP or any other agency of the U.S. Government. This report relates only to the samples reported above. Quality control data (including 95% confidence limits and laboratory and analysis accuracy and precision) is available upon request.

Accredited for NVLAP PLMTEM #101187-0, NY State ELAP #10279

Page 1 of 2

Attn: Taylor Environmental Group

Received: 8/20/02 5:00:00 AM
ATC Group #: 8721
Analysis Date: 8/20/02

Fax: (516) 358-1780 Phone:
Project: NYC SCA Project #: M477-15217-29881
Stuyvesant H. S. 8th Floor

**Asbestos Fiber Analysis by Transmission Electron Microscopy (TEM) Performed
by EPA 40 CFR Part 763 Final Rule (AHERA)**

Sample	Volume	Area Analyzed	Non Asb	Asbestos Type(s)	# Structures		Analytical Sensitivity (S/cc)	Asbestos Concentration		Notes
					0.5µ-5	5µ		(S/mm ²)	(S/cc)	
S-T8 8721 -8	1287.00	0.0674	0	None Detected	0	0	0.0044	<14.83	<0.0044	
S-T9 8721 -9	1330.00	0.0674	0	None Detected	0	0	0.0043	<14.83	<0.0043	
S-T10 8721 -10	1359.00	0.0674	0	None Detected	0	0	0.0042	<14.83	<0.0042	

ROMAN PEYSAKHOV

Analysed by:



MICHAEL A. GORYCKI, Ph.D

Approved by:

Disclaimer: The laboratory is not responsible for data reported in structures/cc, which is dependent on volume collected by non-laboratory personnel. This lab is only responsible for data reported in structures/mm². This report may not be reproduced, except in full, without written approval by ATC Associates Inc. This report may not be used to claim product endorsement by NPLAP or any other agency of the U.S. Government. This report relates only to the samples reported above. Quality control data (including 95% confidence limits and laboratory and analysis accuracy and precision) is available upon request.

Accredited for NPLAP PLM/TEM #101187-0, NY State ELAP #10879

TAYLOR ENVIRONMENTAL GROUP

DAILY MONITORING SHEET AND CHAIN OF CUSTODY RECORD

PAGE 1 OF 1

TECHNICIAN <i>N. Plonik</i>		CLIENT <i>NYC-SCA</i>		SITE ADDRESS <i>STUYVESANT H.S.</i>				DATE SUBMITTED <i>8-20-02</i>			
DATE SAMPLED <i>8/20/02</i>		CONTACT <i>HAMPTON Saver</i>		WORK AREA <i>8th Floor</i>				DATE LOGGED			
POTENTIAL HAZARD <i>L-21</i>		PROJECT NO. <i>M477-15217-29881</i>		PROJECT MANAGER <i>C. McElroy</i>				DATE APPROVED / SIGNATURE			

SAMPLE & PUMP #	LABORATORY NO.	SAMPLE LOCATION, AREA & HEIGHT AND/OR EMPLOYEE	FLOW ON/OFF	TIME ON	TIME OFF	DURATION MINUTES	FLOW (AVERAGE)	LITERS	FIELDS	FIBERS	F/PM ²	F/CC
8-L1		IWA ☐ Western hallway - outside OWA ☐ clrm 840	4/4	4:02	08:23	261	4	1044				
8-L2		IWA ☐ in hallway - 15 ft west from OWA ☐ escalators.	4/4	4:01	08:25	262	4	1048				
8-L3		IWA ☐ in clrm # 827 - NE part OWA ☐ of room	4/4	4:03	08:29	266	4	1064				
8-L4		IWA ☐ in rm # 826 - center of room OWA ☐	4/4	4:05	08:30	265	4	1060				
8-L5		IWA ☐ in eastern hallway - outside OWA ☐ rm # 804	4/4	4:06	08:37	261	4	1044				
FB-1		IWA ☐ F/BLANK - 1 OWA ☐										
FB-2		IWA ☐ F/BLANK - 2 OWA ☐										
		IWA ☐										
		IWA ☐										
		IWA ☐										
		IWA ☐										
		IWA ☐										
		IWA ☐										
		IWA ☐										

21322

RELEASED TO THE DRUG BOX (SIGNATURE) <i>[Signature]</i>	DATE <i>8-20-02</i>	TIME <i>10:18</i>	RECEIVED FROM THE DRUG BOX (SIGNATURE) <i>[Signature]</i>	DATE <i>8/20/02</i>	TIME <i>10:20</i>
RECEIVED BY (SIGNATURE)	DATE	TIME	RECEIVED BY (SIGNATURE)	DATE	TIME
ANALYST (SIGNATURE)	DATE	TIME	COMMENTS <i>6/12/02</i>	DATE	TIME

WHITE: Office Copy YELLOW: Lab Copy PINK: Samples GREEN: Chain of Custody

07126

CITY_21MC100_008878300

THE ASSOCIATES, INC.

104 E 25th Street, 10th Floor

New York, NY 10010

Tel. 212-353-8280

Fax 212-353-8306

REPORT DATE: 08-20-02
CLIENT: Taylor Environmental Group, Inc.
PROJECT NAME: SCA/Stuyvesant HS
8th floor
PROJECT NUMBER: M477-15217/29881
SAMPLED BY: Client
SAMPLE DATE: 08-20-02
DATE RECEIVED: 08-20-02
DATE ANALYZED: 08-20-02
SAMPLE MEDIA: Air Samples
ANALYSIS REQUIRED: Method NIOSH 7082

ANALYSIS RESULTS

SAMPLE ID	BATCH NO.	SAMPLE DESCRIPTION	LEAD CONCENTRATION ($\mu\text{g}/\text{m}^3$)	DETECTION LIMIT ($\mu\text{g}/\text{m}^3$)
8-L1	21322	Western Hallway Outside Classroom 840	<1.4	1.4
8-L2	21322	In Hallway 15 ft West from Escalators	<1.4	1.4
8-L3	21322	In Classroom 827 NE Part of Room	<1.4	1.4
8-L4	21322	In Rm 826 Center of Room	<1.4	1.4
8-L5	21322	In Eastern Hallway Outside Rm 804	<1.4	1.4
FB1	21322	Field Blank	<1.5 μg	1.5 μg
FB2	21322	Field Blank	<1.5 μg	1.5 μg

NOTE 1:

THE REPORTING LIMIT (RL) IS 3.0 μg

NOTE 2:


At the present time there are no regulatory levels or requirements for indoor airborne lead in area samples. However, OSHA has established an action level of 30 $\mu\text{g}/\text{m}^3$ and a permissible exposure level (PEL) of 50 $\mu\text{g}/\text{m}^3$ for personal samples.

NOTE 3:

Blank units are in μg

07127

CITY_21MC100_008878301

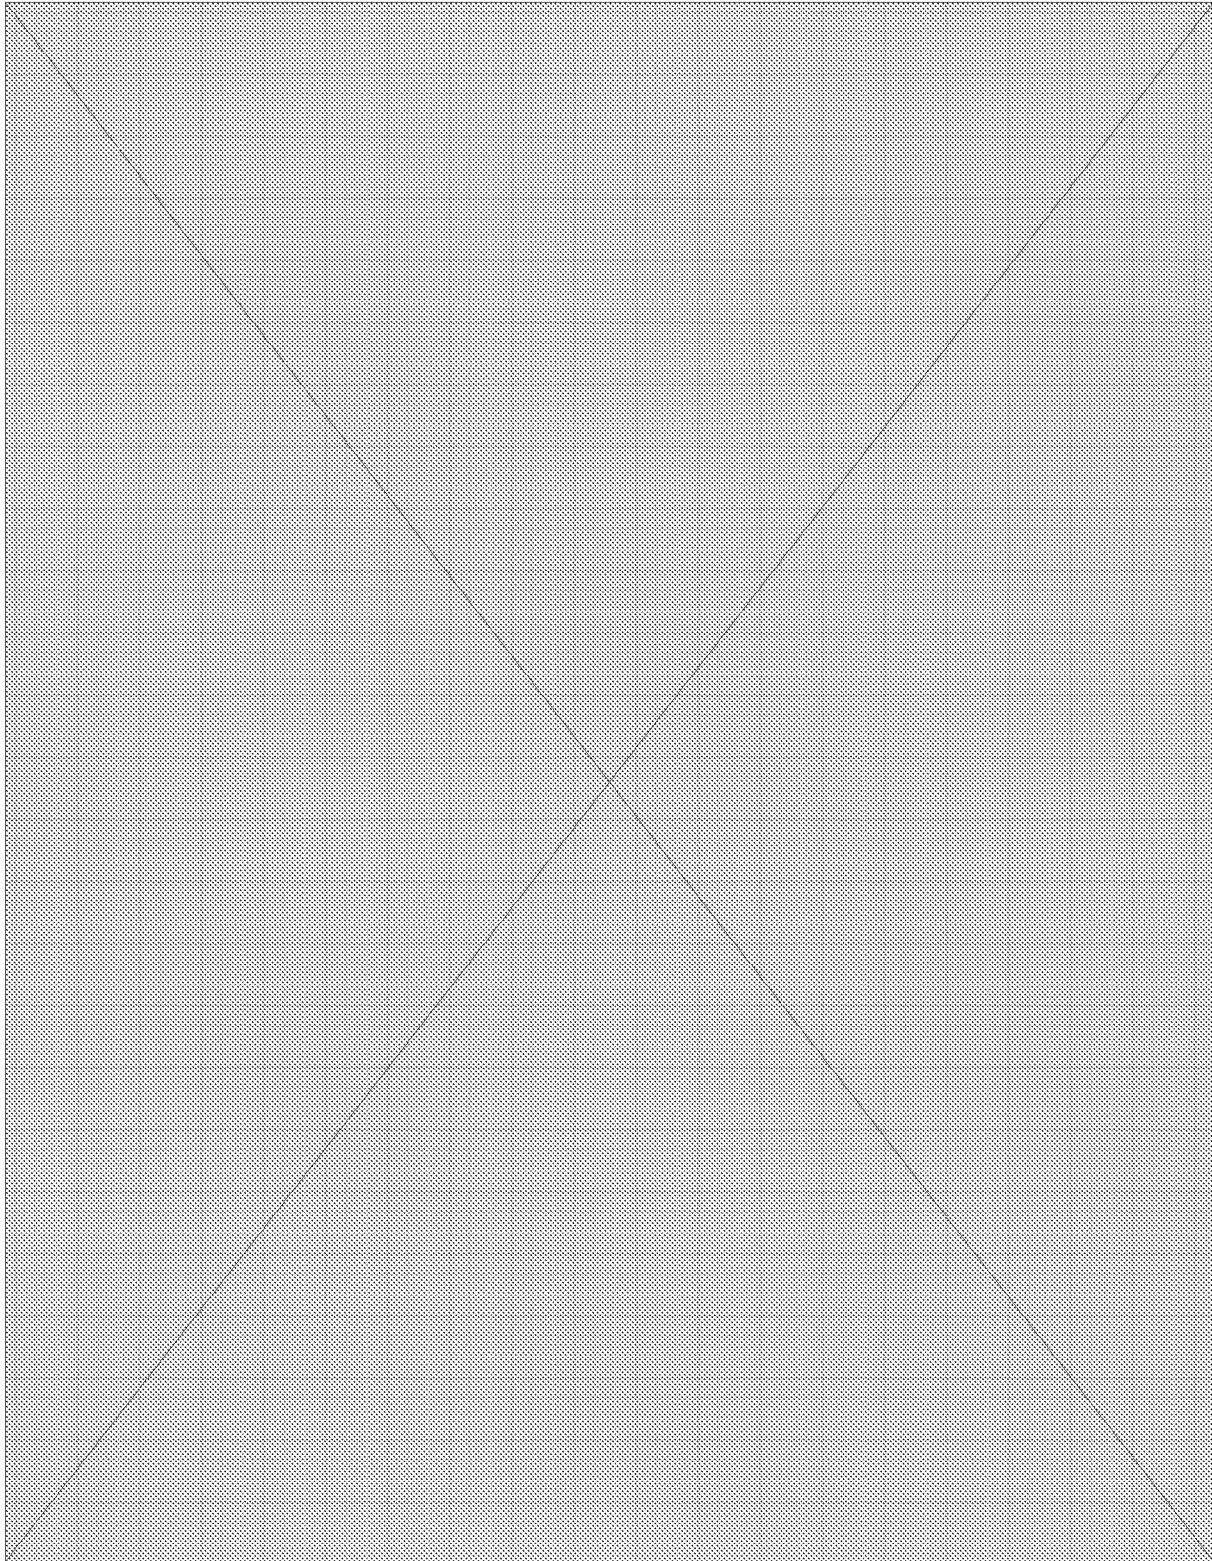

08/20/2002 11:51 212-290-2538

EMSL Analytical, Inc.

PAGE 01/01

EMSL Analytical, Inc.

397 West 39th Street, New York, NY 10018

Phone: 212-280-0651 Fax: 212-290-0658 Email: manhattanlab@emsl.com



Attn: Taylor Environmental Group, Inc.
 Floral Park Corporate Center
 130 Jericho Tpke.
 Floral Park, NY 11001
 Fax: (516) 258-1780 Phone: 516-358-2955
 Project: M477-15217-29881 / NYC SCA / STUYVESANT H.S. / 7TH
 FLOOR / POST

Customer ID: TAYL50
 Customer PO:
 Received: 08/20/02 7:24 AM
 EMSL Order: 030211479
 EMSL Project ID:
 Analysis Date: 8/20/02

**Asbestos Fiber Analysis by Transmission Electron Microscopy (TEM) Performed by
 EPA 40 CFR Part 763 Final Rule (AHERA)**


Sample	Volume	Area Analyzed	Non Ash	Asbestos Type(s)	# Structures ≥ 0.5µ < 5µ ≥ 5µ	Analytical Sensitivity (S/cc)	Asbestos Concentration (S/mm³) (S/cc)	Notes
7-T1 030211479-0001	1350.00	0.0625	1	None Detected		0.0045	<16.00 <0.0046	
7-T2 030211479-0002	1275.00	0.0625	0	None Detected		0.0048	<16.00 <0.0048	
7-T3 030211479-0003	1313.00	0.0625	0	None Detected		0.0047	<16.00 <0.0047	
7-T4 030211479-0004	1350.00	0.0625	0	None Detected		0.0046	<16.00 <0.0046	
7-T5 030211479-0005	1310.00	0.0625	0	None Detected		0.0047	<16.00 <0.0047	
7-T6 030211479-0006	1350.00	0.0625	0	None Detected		0.0046	<16.00 <0.0046	
7-T7 030211479-0007	1350.00	0.0625	0	None Detected		0.0046	<16.00 <0.0046	
7-T8 030211479-0008	1275.00	0.0625	0	None Detected		0.0048	<16.00 <0.0048	
7-T9 030211479-0009	1370.00	0.0625	0	None Detected		0.0045	<16.00 <0.0045	
7-T10 030211479-0010	1275.00	0.0625	0	None Detected		0.0048	<16.00 <0.0048	

Analyst(s)

Ghayath Elias (10)

Laboratory Manager
 or other approved signatory

Disclaimer: The laboratory is not responsible for data reported in structural use, which is dependent on volume collected by non-laboratory personnel. This lab is only responsible for data reported in structural use. This report may not be reproduced, except in full, without written approval by EMSL. This report must not be used to claim product endorsement by NYLAP or any agency of the U.S. Government. This report relates only to the samples reported above. Quality control data (including 95% confidence limits and laboratory and analyst accuracy and precision) is available upon request.
 Accredited for NYLAP PLY/TEM #101048-0, NY State ELAP #11620

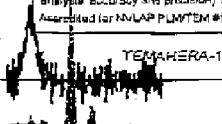

07129

TAYLOR ENVIRONMENTAL GROUP

DAILY MONITORING SHEET AND CHAIN OF CUSTODY RECORD

PAGE 1 OF 1

TECHNOLOGIST TERESA MICHALCZUK		CLIENT NYC-SCA		SITE ADDRESS 500 Vesey St.		DATE SAMPLED 08.20.02		DATE ISSUED 08.20.02	
CONTACT James Saxon		PROJECT NO. 1477-15217-29881		WORK AREA 7th Floor		DATE OF PROVED SIGNATURE		BATCH 21331	
PROVIDER NO. TEG L-16		PROJECT MANAGER C. McKeon							

SAMPLE & PUMP #	LABORATORY NO.	SAMPLE LOCATION, AREA & HEIGHT AND/OR EMPLOYEE	FLOW ON/OFF	TIME ON	TIME OFF	DURATION MINUTES	FLOW (AVERAGE)	LITERS	FIELDS	FIBERS	F/CM ²	F/CC
7-L1		IWA ☐ CORRIDOR WEST SIDE OWA ☐ BY ROOM 737	4/4	04.00	08.40	280	4	1120				
7-L2		IWA ☐ INSIDE ROOM 737 OWA ☐ SOUTH SIDE	4/4	04.04	08.42	278	4	1112				
7-L3		IWA ☐ CORRIDOR MIDDLE SIDE OWA ☐ BY ESCALATOR	4/4	04.05	08.44	279	4	1116				
7-L4		IWA ☐ CORRIDOR EAST SIDE OWA ☐ BY ROOM 707	4/4	04.08	08.45	277	4	1108				
7-L5		IWA ☐ INSIDE ROOM 702 # OWA ☐	4/4	04.09	08.46	277	4	1108				
FB-1		IWA ☐ F/BLANK-1 OWA ☐										
FB-2		IWA ☐ F/BLANK-2 OWA ☐										
		IWA ☐ OWA ☐										
		IWA ☐ OWA ☐										
		IWA ☐ OWA ☐										
		IWA ☐ OWA ☐										
		IWA ☐ OWA ☐										
		IWA ☐ OWA ☐										

REMOVED TO THE TOP OF THE BOX (SIGNATURE)		DATE 08.20.02	TIME 1037	RECEIVED FROM TEG DROP BOX (SIGNATURE) ATC LABS INC		DATE 8/20/02	TIME 4 PM	CIRCLE	
REMOVED TO THE TOP OF THE BOX (SIGNATURE) Terese Michalczuk		DATE 08.20.02	TIME	RECEIVED BY (SIGNATURE) TERESA MICHALCZUK		DATE 8/20/02	TIME 4 PM	CIRCLE	
ANALYST (SIGNATURE)		DATE	TIME	LABORATORY		NIOSH 7082		CIRCLE	
								PCB TEM	
								BORD PRE BURIED POST	
								OTHER	
								OTHER	

WHITE: Office Copy

YELLOW: Lab Copy

PINK: Samples

ORANGE: Site Copy

CITY_21MC100_008878304

ATC ASSOCIATES, INC.

104 E 25th Street, 10th Floor

New York, NY 10010

Tel. 212-353-8280

Fax 212-353-8306

REPORT DATE: 08-20-02
CLIENT: Taylor Environmental Group, Inc.
PROJECT NAME: SCA/Stuyvesant HS
 7th Floor
PROJECT NUMBER: M477-1521729881
SAMPLED BY: Client
SAMPLE DATE: 08-20-02
DATE RECEIVED: 08-20-02
DATE ANALYZED: 08-20-02
SAMPLE MEDIA: Air Samples
ANALYSIS REQUIRED: Method NIOSH 7082

ANALYSIS RESULTS

SAMPLE ID	BATCH NO.	SAMPLE DESCRIPTION	LEAD CONCENTRATION ($\mu\text{g}/\text{m}^3$)	DETECTION LIMIT ($\mu\text{g}/\text{m}^3$)
7-L1	21331	Corridor West Side by Rm 739	<1.3	1.3
7-L2	21331	Inside Rm 731 South Side	<1.3	1.3
7-L3	21331	Corridor Middle Side by Escalator	<1.3	1.3
7-L4	21331	Corridor East Side by Rm 707	<1.4	1.4
7-L5	21331	Inside Rm 702A	<1.4	1.4
FB1	21331	Field Blank	<1.5 μg	1.5 μg
FB2	21331	Field Blank	<1.5 μg	1.5 μg

NOTE 1:**THE REPORTING LIMIT (RL) IS 3.0 μg .****NOTE 2:**At the present time there are no regulatory levels or requirements for indoor airborne lead in area samples. However, OSHA has established an action level of 30 $\mu\text{g}/\text{m}^3$ and a permissible exposure level (PEL) of 50 $\mu\text{g}/\text{m}^3$ for personal samples.**NOTE 3:**Blank units are in μg **NOTE 4:**

Samples prepared by ESML

ATC ASSOCIATES, INC

104 E 25th Street, 10th Floor

New York, NY 10010

Tel. 212-353-8280

Fax 212-353-8306

CERTIFICATION AND SIGNATURES

ANALYSIS PERFORMED BY: ML


REPORT PREPARED BY: [Signature]

ATC certifies that this report is an accurate and authentic report of results obtained from the laboratory analysis.

QUALITY ASSURANCE COORDINATOR: [Signature]

LABORATORY DIRECTOR: [Signature]

ATC is accredited by the New York State Department of Health Environmental Laboratory Approval Program (ELAP) and by the American Industrial Hygiene Association (AIHA) to perform analysis of lead in paint, dust wipes, air and soil samples. (ELAP #10879), (AIHA #100229).

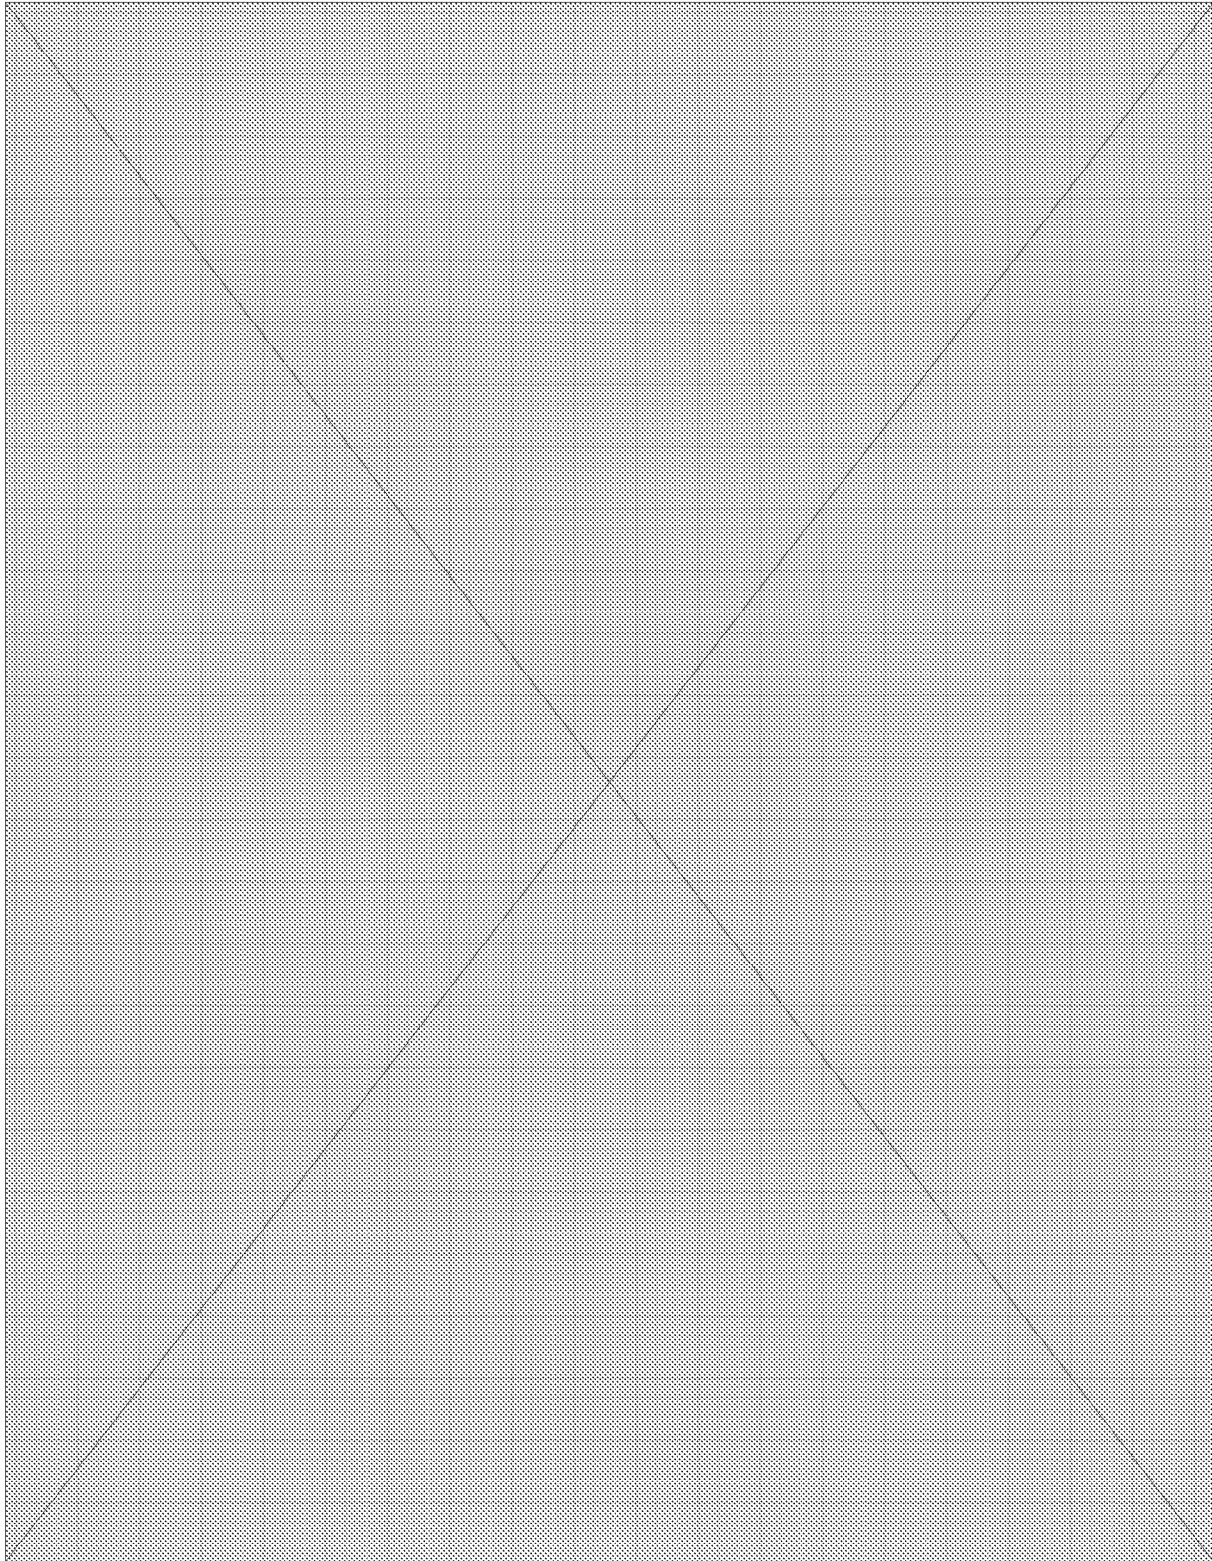

ATC Associates

104 East 25 Street, New York, NY 10010

Phone: (212) 353-8280 Fax: (212) 353-8306



Attn: Taylor Environmental Group

Received: 8/20/02 4:20:00 PM
ATC Group #: 8724
Analysis Date: 8/20/02

Fax: (516) 358-1780 Phone:
Project: NYC SCA Project #: M477-15217-29881
Stuyvesant H. S., 6th Floor

**Asbestos Fiber Analysis by Transmission Electron Microscopy (TEM) Performed
by EPA 40 CFR Part 763 Final Rule (AHERA)**

Sample	Volume	Area Analyzed	Non Asb	Asbestos Type(s)	# Structures		Analytical Sensitivity (fS/cc)	Asbestos Concentration		Notes
					0.5µ-5 µ	5µ		(fS/mm ²)	(fS/cc)	
6-T1 8724 -1	1530.00	0.0562	0	None Detected	0	0	0.0045	<17.79	<0.0045	
6-T2 8724 -2	1530.00	0.0562	0	None Detected	0	0	0.0045	<17.79	<0.0045	
6-T3 8724 -3	1620.00	0.0562	0	None Detected	0	0	0.0042	<17.79	<0.0042	
6-T4 8724 -4	1620.00	0.0562	0	None Detected	0	0	0.0042	<17.79	<0.0042	
6-T5 8724 -5	1620.00	0.0562	0	None Detected	0	0	0.0042	<17.79	<0.0042	
6-T6 8724 -6	1665.00	0.0562	0	None Detected	0	0	0.0041	<17.79	<0.0041	
6-T7 8724 -7	1432.00	0.0562	0	None Detected	0	0	0.0048	<17.79	<0.0048	

ROMAN PEYSAKHOV

Analyzed by: *R. Pey*

MICHAEL A. GORYCKI, Ph.D.

Approved by:

Disclaimer: The laboratory is not responsible for data reported in structures/cc which is dependent on volume collected by non-laboratory personnel. This lab is only responsible for data reported in structures/mm². This report may not be reproduced, except in full, without written approval by ATC Associates Inc. This report may not be used to claim product endorsement by NYS or any other agency of the U.S. Government. This report relates only to the samples reported above. Quality control data (including 95% confidence limits and laboratory and analyst accuracy and precision) is available upon request.

Accredited for NYS LAP PLANTEM #101157-0, NY State ELAP #10879

Page 1 of 2

07134

CITY_21MC100_008878308

Attn:

Taylor Environmental Group

Received: 8/20/02 4:20:00 PM

ATC Group #: 8724

Analysis Date: 8/20/02

Fax: (516) 358-1780 Phone:

Project: NYC SCA Project #: M477-15217-29881

Stuyvesant H. S., 6th Floor

**Asbestos Fiber Analysis by Transmission Electron Microscopy (TEM) Performed
by EPA 40 CFR Part 763 Final Rule (AHERA)**

Sample	Volume	Area Analyzed	Non Asb	Asbestos Type(s)	# Structures 0.1µ-5 µm	Analytical Sensitivity (S/cc)	Asbestos Concentration (S/mm ²)	Notes
6-T8 8724 -8	1611.00	0.0562	0	None Detected	0	0.0043	<17.79	<0.0043
6-T9 8724 -9	1611.00	0.0562	0	None Detected	0	0.0043	<17.79	<0.0043
6-T10 8724 -10	1566.25	0.0562	0	None Detected	0	0.0044	<17.79	<0.0044

ROMAN PEYSAKHOV

Analyzed by:



MICHAEL A. GORYCKI, Ph.D.

Approved by:

Disclaimer: The laboratory is not responsible for data reported in structures/cc, which is dependent on volume collected by non-laboratory personnel. This lab is only responsible for data reported in structures/mm². This report may not be reproduced, except in full, without written approval by ATC Associates Inc. This report may not be used to claim product endorsement by NVLAP or any other agency of the U.S. Government. This report relates only to the samples reported above. Quality control data (including 95% confidence limits and laboratory and analysis accuracy and precision) is available upon request.

Accredited for NVLAP PLM/TEM #101127-0, NY State ELAP #10879

Page 2 of 2

07125

TAYLOR ENVIRONMENTAL GROUP **DAILY MONITORING SHEET AND CHAIN OF CUSTODY RECORD** PAGE 1 OF 1

TECHNICIAN CARLOS JOFAT		CLIENT NYC-SCA		SITE ADDRESS St. DYVISA HS.		DATE SUBMITTED 8-20-02	
DATE SAMPLED 8-20-02		CONTACT HANES S4001		WORK AREA 6th Floor		DATE LOGGED	
POTENTIOMETER NO. 705 L-16		PROJECT NO. 1447-15217-29881		PROJECT MANAGER C. McElwain		DATE APPROVED / SIGNATURE	

SAMPLE & PUMP #	LABORATORY NO.	SAMPLE LOCATION, AREA & HEIGHT AND/OR EMPLOYEE	FLOW DN/UP	TIME ON	TIME OFF	DURATION MINUTES	FLOW (AVERAGE)	LITERS	FIELDS	FIBERS	F/MM ²	REMARKS
6-L1		IWA ☐ 6th FL CORRIDOR OWA ☐ 6th FL CORRIDOR	4	10 ¹⁰	1508	298	4	1192			21.3	
6-L2		IWA ☐ 6th FL CORRIDOR OWA ☐ 6th FL CORRIDOR	4	10 ¹²	1509	297	4	1188			21.3	
6-L3		IWA ☐ 6th FL CORRIDOR OWA ☐ TOP OF ESCALATOR W. STAIR	4	10 ¹⁴	1510	296	4	1184			21.3	
6-L4		IWA ☐ 6th FL CORRIDOR OWA ☐ @ EAST STAIR	4	10 ¹⁶	1511	295	4	1180			21.3	
6-L5		IWA ☐ 6th FL - GYMNASIUM (LABOR)	4	10 ¹⁸	1512	294	4	1176			21.3	
FB-1		IWA ☐ F/BLANK-1 OWA ☐ F/BLANK-1									21.5	
FB-2		IWA ☐ F/BLANK-2 OWA ☐ F/BLANK-2									21.5	
		IWA ☐										
		OWA ☐										
		IWA ☐										
		OWA ☐										
		IWA ☐										
		OWA ☐										
		IWA ☐										
		OWA ☐										

RELINQUISHED TO (SIGNATURE)	DATE	TIME	RECEIVED FROM (TED DROP BOX) (SIGNATURE)	DATE	TIME	CIRCLE
<i>[Signature]</i>	8/20/02	1705	<i>[Signature]</i>	8/20/02	5:00pm	FCM TEN
ACQUISITION BY (SIGNATURE)	DATE	TIME	RECEIVED BY (SIGNATURE)	DATE	TIME	BOARD PRE DURING POST
			<i>[Signature]</i>	8/20/02		OSHA
ANALYST (SIGNATURE)	DATE	TIME	COMMENTS	NIOSH 7082		
			6th FL T/A			

WHITE: Office Copy YELLOW: Lab Copy PINK: Samples ORANGE: SHU Copy

CITY_21MC100_008878310

ATC ASSOCIATES, INC

104 E 25th Street, 10th Floor

New York, NY 10010

Tel 212-353-8280

Fax 212-353-8306

REPORT DATE: 08-21-02
CLIENT: Taylor Environmental Group, Inc.
PROJECT NAME: SCA/Stuyvesant HS
 6th Floor
PROJECT NUMBER: M477-15217/29881
SAMPLED BY: Client
SAMPLE DATE: 08-20-02
DATE RECEIVED: 08-20-02
DATE ANALYZED: 08-20-02
SAMPLE MEDIA: Air Samples
ANALYSIS REQUIRED: Method NIOSH 7082

ANALYSIS RESULTS

SAMPLE ID	BATCH NO.	SAMPLE DESCRIPTION	LEAD CONCENTRATION ($\mu\text{g}/\text{m}^3$)	DETECTION LIMIT ($\mu\text{g}/\text{m}^3$)
6-L1	21333	6th Floor Corridor Adj. Rm 635	<1.4	1.4
6-L2	21333	Inside Rm 636 @ Chalk Board	<1.3	1.3
6-L3	21333	6th Floor Corridor Top of Escalator & W Stair	<1.3	1.3
6-L4	21333	6th Floor Corridor @ East Stair	<1.3	1.3
6-L5	21333	6th Floor Gymnasium (Large)	<1.3	1.3
FB1	21333	Field Blank	<1.5 μg	1.5 μg
FB2	21333	Field Blank	<1.5 μg	1.5 μg

NOTE 1:**THE REPORTING LIMIT (RL) IS 3.0 μg** **NOTE 2:**

At the present time there are no regulatory levels or requirements for indoor airborne lead in area samples. However, OSHA has established an action level of 30 $\mu\text{g}/\text{m}^3$ and a permissible exposure level (PEL) of 50 $\mu\text{g}/\text{m}^3$ for personal samples.

NOTE 3:Blank units are in μg

ATC ASSOCIATES, INC

104 E 25th Street, 10th Floor

New York, NY 10010

Tel. 212-353-8280

Fax 212-353-8306

CERTIFICATION AND SIGNATURES

ANALYSIS PERFORMED BY: HL

REPORT PREPARED BY: [Signature]

ATC certifies that this report is an accurate and authentic report of results obtained from the laboratory analysis.

QUALITY ASSURANCE COORDINATOR: [Signature]

LABORATORY DIRECTOR: [Signature]

ATC is accredited by the New York State Department of Health Environmental Laboratory Approval Program (ELAP) and by the American Industrial Hygiene Association (AIHA) to perform analysis of lead in paint, dust wipes, air and soil samples. (ELAP #10579). (AIHA #100229).

07426

TAYLOR ENVIRONMENTAL GROUP		DAILY MONITORING		EET 300 IN 4 US		DATE		TIME				
RECORDING	CLIENT	SITE ADDRESS	DATE SUBMITTED	DATE LOGGED	DATE APPROVED / SIGNATURE							
RECORDING: <u>CHRYSTOS JOHNS</u>	CLIENT: <u>NYC-SCA</u>	SITE ADDRESS: <u>SHOYUSANT H.S.</u>	DATE SUBMITTED: <u>8-20-02</u>	DATE LOGGED:	DATE APPROVED / SIGNATURE:							
DATE SHIPPED: <u>Aug-20, 2002</u>	CONTACT: <u>LAUREN SAGAN</u>	WORK AREA: <u>5th FLOOR</u>	PROJECT NO.: <u>N.Y.C. 15217-2986</u>	PRINCIPAL MANAGER: <u>C. McElroy</u>								
TEST/METER BRAND: <u>TSC 149</u>												
SAMPLE & PUMP #	LABORATORY NO.	SAMPLE LOCATION, AREA & HEIGHT AND/OR EMPLOYEE	FLOW UN/OFF	TIME ON	TIME OFF	DURATION MINUTES	FLOW (AVERAGE)	LITERS	FIELDS	FIBERS	F/MM ²	F/CC
5-T1		IWA ☒ 5th FLOOR OWA ☐ <u>Director's Hall / Corridor</u>	9/9	1110	1407	177	9	1593				
5-T2		IWA ☒ 5th FLOOR OWA ☐ <u>AN. Hall SERVING AREA</u>	9/8	1111	1408	177	8.5	154.5				
5-T3		IWA ☒ 5th FLOOR OWA ☐ <u>KITCHEN</u>	9/9	1112	1409	177	9	1593				
5-T4		IWA ☒ PM K531 OWA ☐ <u>Factory Dining</u>	9/9	1113	1411	178	9	1602				
5-T5		IWA ☒ 5th FL. Corridor OWA ☐ <u>o/s PM 6581</u>	9/7	1114	1412	178	8	1424				
5-T6		IWA ☒ 5th FL. Corridor OWA ☐ <u>NORTH STAIR E</u>	9/8.5	1115	1413	178	8.75	1557.5				
5-T7		IWA ☒ 5th FLOOR OWA ☐ <u>PM 501</u>	9/9	1116	1414	178	9	1602				
5-T8		IWA ☒ 5th FLOOR Corridor OWA ☐ <u>NORTH STAIR G</u>	9/9	1118	1415	177	9	1593				
5-T9		IWA ☒ PM 6583 OWA ☐	9/9	1119	1416	177	9	1593				
5-T10		IWA ☒ 5th FL. Corridor OWA ☐ <u>o/s PM 6581</u>	9/9	1120	1417	177	9	1593				
FB-1		IWA ☐ <u>FB BANK - 1</u> OWA ☐										
FB-2		IWA ☐ <u>FB BANK - 2</u> OWA ☐										
SB-1		IWA ☐ <u>SB BANK</u> OWA ☐										
RECEIVED BY (SIGNATURE): <u>Riley</u>		DATE: <u>8/20/02</u>	TIME: <u>16:20</u>	RECEIVED BY (SIGNATURE): <u>Riley</u>		DATE: <u>8/20/02</u>	TIME: <u>16:20</u>					
ANALYST (SIGNATURE): <u>Riley</u>		DATE: <u>8/20/02</u>	TIME: <u>21:30</u>	SCHEMATIC: <u>6-1P T-1</u>		ANALYST: <u>T-1 T-10</u>						
WHITE: Office Copy YELLOW: Lab Copy PINK: Samples ORANGE: Site Copy												

07139

CITY_21MC100_008878313

ATC Associates

104 East 25 Street, New York, NY 10010

Phone: (212) 353-8280

Fax: (212) 353-8306



Attn:

Taylor Environmental Group

Received: 8/20/02

4:20:00 PM

ATC Group #: 8723

Analysis Date: 8/20/02

Fax: (516) 358-1780

Phone:

Project: NYC SCA Project #: M477-15217-29881

Snayvasant H. S., 5th Floor

**Asbestos Fiber Analysis by Transmission Electron Microscopy (TEM) Performed
by EPA 40 CFR Part 763 Final Rule (AHERA)**

Sample	Volume	Area Analyzed	Non Asb	Asbestos Type(s)	% Structures		Analytical Sensitivity (S/cc)	Asbestos Concentration		Notes
					0.5µ-5	5µ		(S/mm ²)	(S/cc)	
S-T1 8723 -1	1593.00	0.0562	0	None Detected	0	0	0.0043	<17.79	<0.0043	
S-T2 8723 -2	1504.50	0.0562	0	None Detected	0	0	0.0046	<17.79	<0.0046	
S-T3 8723 -3	1593.00	0.0562	0	None Detected	0	0	0.0043	<17.79	<0.0043	
S-T4 8723 -4	1602.00	0.0562	0	None Detected	0	0	0.0043	<17.79	<0.0043	
S-T5 8723 -5	1424.00	0.0562	0	None Detected	0	0	0.0048	<17.79	<0.0048	
S-T6 8723 -6	1557.50	0.0562	0	None Detected	0	0	0.0044	<17.79	<0.0044	
S-T7 8723 -7	1602.00	0.0562	0	None Detected	0	0	0.0043	<17.79	<0.0043	

ROMAN PEVSAKHOV

Analyzed by:

MICHAEL A. GORYCKI, Ph.D

Approved by:

Disclaimer: The laboratory is not responsible for data reported in structures/ies, which is dependent on volume collected by non-laboratory personnel. This lab is only responsible for data reported in structures/ies. This report may not be reproduced, except in full, without written approval by ATC Associates Inc. This report may not be used to claim product endorsement by NVLAP or any other agency of the U.S. Government. This report relates only to the samples reported above. Quality control data (including 95% confidence limits and laboratory and analysis accuracy and precision) is available upon request.

Accredited for NVLAP PL/NTM #101187-D, NY State ELAP #10679

Page 1 of 2

Attn: Taylor Environmental Group

Received: 8/20/02 4:20:00 PM
ATC Group #: 8723
Analysis Date: 8/20/02

Fax: (516) 358-1780 Phone:
Project: NYC SCA Project #: M477-15217-29851
Stuyvesant H. S., 5th Floor

**Asbestos Fiber Analysis by Transmission Electron Microscopy (TEM) Performed
by EPA 40 CFR Part 763 Final Rule (ASHERA)**

Sample	Volume	Area Analyzed	Non Ash	Asbestos Type(s)	# Structures 0.5µm-5 µm	Analytical Sensitivity (S/cc)	Asbestos Concentration (S/mm ³) (S/cc)	Notes
S-T8 8723 -8	1592.00	0.0562	0	None Detected	0 0	0.0043	<17.79 <0.0043	
S-T9 8723 -9	1593.00	0.0562	0	None Detected	0 0	0.0043	<17.79 <0.0043	
S-T10 8723 -10	1593.00	0.0562	0	None Detected	0 0	0.0043	<17.79 <0.0043	

ROMAN PEYSAKHOV

Analyzed by: 

MICHAEL A. GORYCKI, Ph.D

Approved by:

Disclaimer: The laboratory is not responsible for data reported in structures, which is dependent on volume collected by non-laboratory personnel. This lab is only responsible for data reported in structures. This report may not be reproduced, except in full, without written approval by ATC Associates Inc. This report may not be used to claim product endorsement by NVLAP or any other agency of the U.S. Government. This report relates only to the samples reported above. Quality control data (including 95% confidence limits and laboratory and analyst accuracy and precision) is available upon request.

Accredited for NVLAP PLM/TEM #101187-0, NY State ELAP #10879

Page 2 of 2

TAYLOR ENVIRONMENTAL GROUP

12/22/11
DAILY MONITORING SHEET AND CHAIN OF CUSTODY RECORD

PAGE 1 OF 1

TECHNICIAN Capros John		CLIENT NYCSCA		SITE ADDRESS Stuyvesant HS.		DATE SUBMITTED 8-20-02	
DATE SAMPLED 8-20-02		COLLECTOR HAMID SWAY		WOMAN AREA 5th Floor		DATE LOGGED	
POTENTIOMETER NO. TGG L-16		PROJECT NO. M474-15217-29881		PROJECT MANAGER C. McLean		DATE APPROVED / SIGNATURE	

SAMPLE & PUMP #	LABORATORY NO.	SAMPLE LOCATION, AREA & HEIGHT AND/OR EMPLOYEE	FLOW ON/OFF	TIME ON	TIME OFF	DURATION MINUTES	FLOW (AVERAGE)	LITERS	FIELDS	FIBERS	F/MM ²	Fiber Count
5-L1		IWA ☐ Kitchen - Serving Area OWA ☐	4	1047	1513	266	4	106A			21.4	169
5-L2		IWA ☐ Cafeteria - Eating Area OWA ☐ - Corridor	4	1050	1514	264	4	105B			21.4	173
5-L3		IWA ☐ 5 th Floor Corridor OWA ☐ o/s Dining Room - W. Stair	4	1052	1515	263	4	1052			21.4	
5-L4		IWA ☐ 5 th Floor Corridor OWA ☐ AT Bottom of Esc.	4	1054	1516	262	4	1048			21.4	
5-L5		IWA ☐ Boys Locker Room OWA ☐ @ Locker # 2730	4	1058	1517	259	4	1036			21.4	
FB-1		IWA ☐ F/Boiler - 1 OWA ☐									21.5	
FB-2		IWA ☐ F/Boiler - 2 OWA ☐									21.5	
		IWA ☐										
		OWA ☐										
		IWA ☐										
		OWA ☐										
		IWA ☐										
		OWA ☐										
		IWA ☐										
		OWA ☐										
		IWA ☐										
		OWA ☐										

REINFORCED BY (SIGNATURE) <i>John Capros</i>	DATE 8-20-02	TIME 16:20	RECEIVED FROM (SIGNATURE) <i>Alvin 08/20 6p</i>	DATE 8/20/02	TIME 16:20	CHARGE PCM TEM
REINFORCED BY (SIGNATURE)	DATE	TIME	RECEIVED BY (SIGNATURE) <i>E. A. Gork...</i>	DATE	TIME	BGRD PRE DURING POST
ANALYST (SIGNATURE)	DATE	TIME	CONTENTS <i>CH211</i>	DATE 8/20/02	TIME 16:20	OSHA <i>647</i>

WHITE: Office Copy

YELLOW: Lab Copy

PINK: Samples

ORANGE: Site Copy

07147

CITY_21MC100_008878316

ATC ASSOCIATES, INC
104 E 25th Street, 10th Floor
New York, NY 10010
Tel 212-353-8280
Fax 212-353-8306

REPORT DATE: 08-21-02
CLIENT: Taylor Environmental Group, Inc.
PROJECT NAME: SCA/Stuyvesant HS
5th Floor
PROJECT NUMBER: M477-15217/29881
SAMPLED BY: Client
SAMPLE DATE: 08-20-02
DATE RECEIVED: 08-20-02
DATE ANALYZED: 08-20-02
SAMPLE MEDIA: Air Samples
ANALYSIS REQUIRED: Method NIOSH 7082

ANALYSIS RESULTS

SAMPLE ID	BATCH NO.	SAMPLE DESCRIPTION	LEAD CONCENTRATION ($\mu\text{g}/\text{m}^3$)	DETECTION LIMIT ($\mu\text{g}/\text{m}^3$)
S-L1	21334	Kitchen Serving Area	<1.4	1.4
S-L2	21334	Cafeteria Eating Area Center	<1.4	1.4
S-L3	21334	5th Floor Corridor O/S Dining Rm W. Stair	<1.4	1.4
S-L4	21334	5th Floor Corridor at Bottom of Esc.	<1.4	1.4
S-L5	21334	Boy's Locker Rm @ Locker #2730	<1.4	1.4
FB1	21334	Field Blank	<1.5 μg	1.5 μg
FB2	21334	Field Blank	<1.5 μg	1.5 μg

NOTE 1:

THE REPORTING LIMIT (RL) IS 3.0 μg

NOTE 2:

At the present time there are no regulatory levels or requirements for indoor airborne lead in area samples. However, OSHA has established an action level of 30 $\mu\text{g}/\text{m}^3$ and a permissible exposure level (PEL) of 50 $\mu\text{g}/\text{m}^3$ for personal samples.

NOTE 3:

Blank units are in μg

07143

CITY_21MC100_008878317

ATC ASSOCIATES, INC

104 E 25th Street, 10th Floor

New York, NY 10010

Tel. 212-353-8280

Fax 212-353-8306

CERTIFICATION AND SIGNATURES

ANALYSIS PERFORMED BY:

HCM

REPORT PREPARED BY:

[Signature]

ATC certifies that this report is an accurate and authentic report of results obtained from the laboratory analysis.

QUALITY ASSURANCE COORDINATOR:

[Signature]

LABORATORY DIRECTOR:

MM L.

ATC is accredited by the New York State Department of Health Environmental Laboratory Approval Program (ELAP) and by the American Industrial Hygiene Association (AIHA) to perform analysis of lead in paint, dust wipes, air and soil samples. (ELAP #10879), (AIHA #100229).

07144

CITY_21MC100_008878318

TAYLOR ENVIRONMENTAL GROUP

DAILY MONITORING SHEET AND CHAIN OF CUSTODY RECORD

PAGE 1 OF 1

TECHNICIAN Carlos John		CLIENT NYC SOL		SITE ADDRESS STUYVESANT H.S.		DATE SUBMITTED 8-20-02	
DATE SAMPLED AUG 20 2002		COLLECTOR David Sadow		WORK AREA 4th FLOOR		DATE LOGGED	
PROJECT NUMBER T-149		PROJECT NO. M474-15214-29881		PROJECT NUMBER C. McCROWN		DATE APPROVED / SIGNATURE	

SAMPLE & PUMP #	LABORATORY NO.	SAMPLE LOCATION, AREA & HEIGHT AND/OR EMPLOYEE	FLOW ON/OFF	TIME ON	TIME OFF	DURATION MINUTES	FLOW (AVERAGE)	LITERS	FIELDS	FIBERS	F/MM ²	F/CC
4-T1		IWA ☒ OWA ☐ Rm 439	9/9	1121	1421	180	9	1620				
4-T2		IWA ☒ OWA ☐ 4th Fl Corridor o/s Rm 432	9/9	1122	1422	180	9	1620				
4-T3		IWA ☒ OWA ☐ Rm 409	9/8	1123	1423	180	8.5	1530				
4-T4		IWA ☒ OWA ☐ 4th Fl Corridor WEST side of ESCALATOR	9/7.5	1124	1424	180	8.25	1485		03021	506	
4-T5		IWA ☒ OWA ☐ Rm 450	9/8	1125	1425	180	8.5	1530				
4-T6		IWA ☒ OWA ☐ 4th Fl Corridor o/s Rm 432	9/9	1126	1426	180	9	1620				
4-T7		IWA ☒ OWA ☐ 4th Fl Corridor EAST side of ESCALATOR	9/5	1127	1427	180	8	1440				
4-T8		IWA ☒ OWA ☐ 4th Fl Corridor North location # 4-427	9/9	1128	1428	180	9	1620				
4-T9		IWA ☒ OWA ☐ 4th Fl Corridor o/s Rm 401	9/8	1129	1429	180	8.5	1530				
4-T10		IWA ☒ OWA ☐ Rm 407	9/9	1130	1430	180	9	1620				
FB-1		IWA ☐ OWA ☐ FB Blank-1	/									
FB-2		IWA ☐ OWA ☐ FB Blank-2	/									
SB-1		IWA ☐ OWA ☐ SB Blank	/									

RECEIVED FROM TEG DROP BOX (SIGNATURE) David Sadow	DATE 8/20	TIME 1650	RECEIVED FROM TEG DROP BOX (SIGNATURE) Sadow	DATE 8/20/02	TIME 1452	☐ PCM ☐ BGRO ☐ OSHA	☒ ITEM ☐ PRE ☐ DURING ☐ POST
FIELDWORK BY (SIGNATURE)	DATE	TIME	RECEIVED BY (SIGNATURE) Sadow	DATE	TIME		
ANALYST (SIGNATURE)	DATE	TIME	COMMENTS 6 HE TA ANALYZE T-1 THROUGH T-10				

08/20/2002 20:36

012-250-1538

ENSL ANALYTICAL INC

PAGE 02/02

07145

CITY_21MC100_008878319

08/23/2002 22:55 212-290-2538

EMSL ANALYTICAL INC

PAGE 61/92

EMSL Analytical, Inc.

307 West 38th Street, New York, NY 10018

Phone: 212-290-0051 Fax: 212-290-0058 Email: manhattanlab@emsl.com



Attn: Taylor Environmental Group, Inc.
 Floral Park Corporate Center
 130 Jericho Tpke.
 Floral Park, NY 11001
 Fax: (516) 358-1760 Phone: 516-358-2855
 Project: M477-15217-29881 / NYC SCA / Stuyvesant H.S. / 4th
 Floor

Customer ID: TAYL50
 Customer PO:
 Received: 08/20/02 4:45 PM
 EMSL Order: 030211506
 EMSL Project ID:
 Analysis Date: 8/20/2002

**Asbestos Fiber Analysis by Transmission Electron Microscopy (TEM) Performed by
 EPA 40 CFR Part 763 Final Rule (AHERA)**

Sample	Volume	Area Analyzed	Non Asb	Asbestos Type(s)	# Structures $\geq 0.5\mu \times 5\mu$	Analytical Sensitivity (f/cc)	Asbestos Concentration (f/cc)	Notes
4-T1 030211506-0001	1820.00	0.0500	7	None Detected		0.0048	<20.00	<0.0048
4-T2 030211506-0002	1820.00	0.0500	0	None Detected		0.0048	<20.00	<0.0048
4-T3 030211506-0003	1530.00	0.0625	0	None Detected		0.0040	<16.00	<0.0040
4-T4 030211506-0004	1485.00	0.0625	0	None Detected		0.0041	<16.00	<0.0041
4-T5 030211506-0005	1530.00	0.0625	0	None Detected		0.0040	<16.00	<0.0040
4-T6 030211506-0006	1820.00	0.0500	0	None Detected		0.0048	<20.00	<0.0048
4-T7 030211506-0007	1440.00	0.0625	0	None Detected		0.0043	<16.00	<0.0043
4-T8 030211506-0008	1820.00	0.0500	0	None Detected		0.0048	<20.00	<0.0048
4-T9 030211506-0009	1530.00	0.0625	0	None Detected		0.0040	<16.00	<0.0040
4-T10 030211506-0010	1820.00	0.0500	0	None Detected		0.0048	<20.00	<0.0048

Analyst(s)

Jose Arriaga (10)

Laboratory Manager
 or other approved signatory

Disclaimer: The laboratory is not responsible for data reported in Structures, which is dependent on volume collected by non-laboratory personnel. This lab is only responsible for data received in structures/MP. This report may not be reproduced, except in full, without written approval by EMSL. This report must not be used to claim product endorsement by NVLAP or any agency of the U.S. Government. This report relates only to the samples reported above. Quality control data including 95% confidence limits and laboratory and analyst accuracy and precision is available upon request.
 Accredited for NVLAP PLU/TEM #101045-2, NY State GLAP #11506

YEMAHERA-1

1

07146

NYC-WTC_000231071

ATC ASSOCIATES, INC
104 E 25th Street, 10th Floor
New York, NY 10010
Tel 212-353-8280
Fax 212-353-8306

REPORT DATE: 08-21-02
CLIENT: Taylor Environmental Group, Inc.
PROJECT NAME: SCA/Stuyvesant HS
 4th Floor
PROJECT NUMBER: M477-15217/29881
SAMPLED BY: Client
SAMPLE DATE: 08-20-02
DATE RECEIVED: 08-20-02
DATE ANALYZED: 08-20-02
SAMPLE MEDIA: Air Samples
ANALYSIS REQUIRED: Method NIOSH 7082

ANALYSIS RESULTS

SAMPLE ID	BATCH NO.	SAMPLE DESCRIPTION	LEAD CONCENTRATION (µg/m³)	DETECTION LIMIT (µg/m³)
4-L1	21336	4th Floor Corridor @ Rm 440	<1.3	1.3
4-L2	21336	Rm 450 Robotics Conyer	<1.3	1.3
4-L3	21336	4th Floor Corridor @ Top of Esc. West Stair	<1.3	1.3
4-L4	21336	Rm 411 Computer Rm	<1.3	1.3
4-L5	21336	4th Floor Corridor @ East Stair Rm 401/402	<1.4	1.4
FB1	21336	Field Blank - NO FILTER	-	-
FB2	21336	Field Blank	<1.5 µg	1.5 µg

NOTE 1:

THE REPORTING LIMIT (RL) IS 3.0 µg

NOTE 2:

At the present time there are no regulatory levels or requirements for indoor airborne lead in area samples. However, OSHA has established an action level of 30 µg/m³ and a permissible exposure level (PEL) of 50 µg/m³ for personal samples.

NOTE 3:

Blank units are in µg

07148

CITY_21MC100_008878322

ATC ASSOCIATES, INC

104 E 25th Street, 10th Floor

New York, NY 10010

Tel. 212-353-8280

Fax 212-353-8306

CERTIFICATION AND SIGNATURES

ANALYSIS PERFORMED BY:

HCY

REPORT PREPARED BY:

[Signature]

ATC certifies that this report is an accurate and authentic report of results obtained from the laboratory analysis.

QUALITY ASSURANCE COORDINATOR:

[Signature]

LABORATORY DIRECTOR:

[Signature]

ATC is accredited by the New York State Department of Health Environmental Laboratory Approval Program (ELAP) and by the American Industrial Hygiene Association (AIHA) to perform analysis of lead in paint, dust wipes, air and soil samples. (ELAP #10879), (AIHA #100229).

07149

CITY_21MC100_008878323

TAYLOR ENVIRONMENTAL GROUP				DAILY MONITORING SHEET AND CHAIN OF CUSTODY RECORD				PAGE 1 OF 1				
TECHNICIAN G. POKRANER		CLIENT NYC-SCA		SITE ADDRESS 300 VEST AVE H.S.		DATE SUBMITTED 8-20-02						
DATE SAMPLED 8-20-02		CONTACT Luis SANTI		WORK AREA 3rd Floor		DATE LOGGED						
METER/ID T66-147		PROJECT NO. M477-15217-29888		PROJECT MANAGER C. McElroy		DATE APPROVED / SIGNATURE						
SAMPLE & PUMP #	LABORATORY NO.	SAMPLE LOCATION, AREA & HEIGHT AND/OR EMPLOYEE	FLOW ON/OFF	TIME ON	TIME OFF	DURATION MINUTES	FLOW (AVERAGE)	LITERS	FIELDS	FIBERS	F/MM ²	F/CC
3-T1		IWA ☒ OWA ☐ Room 336 - Corridor	8/8	1131	1434	183	8	1464				
3-T2		IWA ☒ OWA ☐ 3rd Fl. Corridor @ STAIRWELL "R"	8/8	1133	1435	182	8	1456				
3-T3		IWA ☒ OWA ☐ Room 350 - West side	8/8	1135	1436	181	8	1448				
3-T4		IWA ☒ OWA ☐ 3rd Fl. Corridor @ STAIR "W"	8/8	1137	1437	180	8	1440				
3-T5		IWA ☒ OWA ☐ 3rd Fl. Corridor o/s RM 315	8/9	1139	1438	179	8.5	1545		0302	11505	
3-T6		IWA ☒ OWA ☐ 3rd Fl. Corridor o/s GYM	8/8	1141	1439	178	8	1424				
3-T7		IWA ☒ OWA ☐ GYMNASIUM - SOUTH	8/8	1143	1440	177	8	1416				
3-T8		IWA ☒ OWA ☐ GYMNASIUM - NORTH	8/8	1145	1441	176	8	1408				
3-T9		IWA ☒ OWA ☐ Room 307 - East Side	8/8	1146	1442	176	8	1408				
3-T10		IWA ☒ OWA ☐ 3rd Fl. Corridor o/s RM 302	8/9	1148	1443	175	8.5	1487.5				
FB-1		IWA ☐ OWA ☐ F/BANK-1										
FB-2		IWA ☐ OWA ☐ F/BANK-2										
SB-1		IWA ☐ OWA ☐ S/BANK										
RECEIVED (NOTED DROP BOX SIGNATURE)		DATE	TIME	RECEIVED FROM (NOTED DROP BOX SIGNATURE)		DATE	TIME	GRADE				
<i>[Signature]</i>		8/20	1450	<i>[Signature]</i>		8/20/02	1446	PCM ☒ TEM ☒				
RECEIVED (NOTED DROP BOX SIGNATURE)		DATE	TIME	RECEIVED BY (SIGNATURE)		DATE	TIME	ROAD PRE DURING POST				
<i>[Signature]</i>		8/20/02		<i>[Signature]</i>		8/20/02	1446	ROAD ☐ PRE ☐ DURING ☐ POST ☐				
ANALYST (SIGNATURE)		DATE	TIME	COMMENTS		LOT #						
<i>[Signature]</i>		8/20/02		6 HZ TA		ANALYZE T-1 THROUGH T-10						

07150

08/20/2002 20:35 212-238-2538

ENSL ANALYTICAL INC

PAGE 02/02

RECEIVED

02 AUG 20 PM 4:46

WHITE: Office Copy YELLOW: Lab Copy PINK: Samples ORANGE: Site Copy

08/20/2002 08:35 212-298-2536

EMSL ANALYTICAL INC

PAGE 01/02

EMSL Analytical, Inc.

307 West 38th Street, New York, NY 10018

Phone: 212-298-0051 Fax: 212-298-0059 Email: manhattan@emsl.com



Attn: Taylor Environmental Group, Inc.
 Floral Park Corporate Center
 130 Jericho Tpke.
 Floral Park, NY 11001
 Fax: (516) 358-1780 Phone: 516-358-2955
 Project: M477-15217-29881 / NYC SCA / Stuyvesant H.S. 3rd Floor

Customer ID: TAYL50
 Customer PO:
 Received: 08/20/02 4:45 PM
 EMSL Order: Q30211505
 EMSL Project ID:

Analysis Date: 8/20/2002

**Asbestos Fiber Analysis by Transmission Electron Microscopy (TEM) Performed by
 EPA 40 CFR Part 763 Final Rule (AHERA)**


Sample	Volume	Area Analyzed	Non Asb	Asbestos Type(s)	# Structures ≥ 0.5µ < 5µ ≥ 5µ	Analytical Sensitivity (S/cc)	Asbestos Concentration (S/cc)	Notes
3-T1 30211505-0001	1464.00	0.0625	0	None Detected		0.0042	<16.00	<0.0042
3-T2 30211505-0002	1456.00	0.0625	0	None Detected		0.0042	<16.00	<0.0042
3-T3 30211505-0003	1448.00	0.0625	0	None Detected		0.0043	<16.00	<0.0043
3-T4 30211505-0004	1440.00	0.0625	0	None Detected		0.0043	<16.00	<0.0043
3-T5 30211505-0005	1521.50	0.0625	0	None Detected		0.0040	<16.00	<0.0040
3-T6 30211505-0006	1424.00	0.0625	0	None Detected		0.0043	<16.00	<0.0043
3-T7 30211505-0007	1416.00	0.0625	0	None Detected		0.0044	<16.00	<0.0044
3-T8 30211505-0008	1408.00	0.0625	0	None Detected		0.0044	<16.00	<0.0044
3-T9 30211505-0009	1408.00	0.0625	0	None Detected		0.0044	<16.00	<0.0044
3-T10 30211505-0010	1487.50	0.0625	0	None Detected		0.0041	<16.00	<0.0041

Analyst(s)


Roman Paysakhov (10)

 Laboratory Manager
 or other approved signatory

Disclaimer: The laboratory is not responsible for data reported in structures, which is dependent on volume collected by non-laboratory personnel. This lab is only responsible for data reported in structures. This report may not be reproduced, except in full, without written approval by EMSL. This report must not be used to claim product endorsement by NMLAP or any agency of the U.S. Government. This report relates only to the samples reported above. Quality control data (including 65% confidence limits and laboratory and analyst accuracy and precision) is available upon request.
 Accredited for NMLAP PLM/TEM #10104862, NY State ELAP #11505

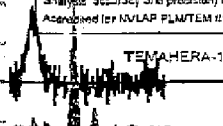

07151

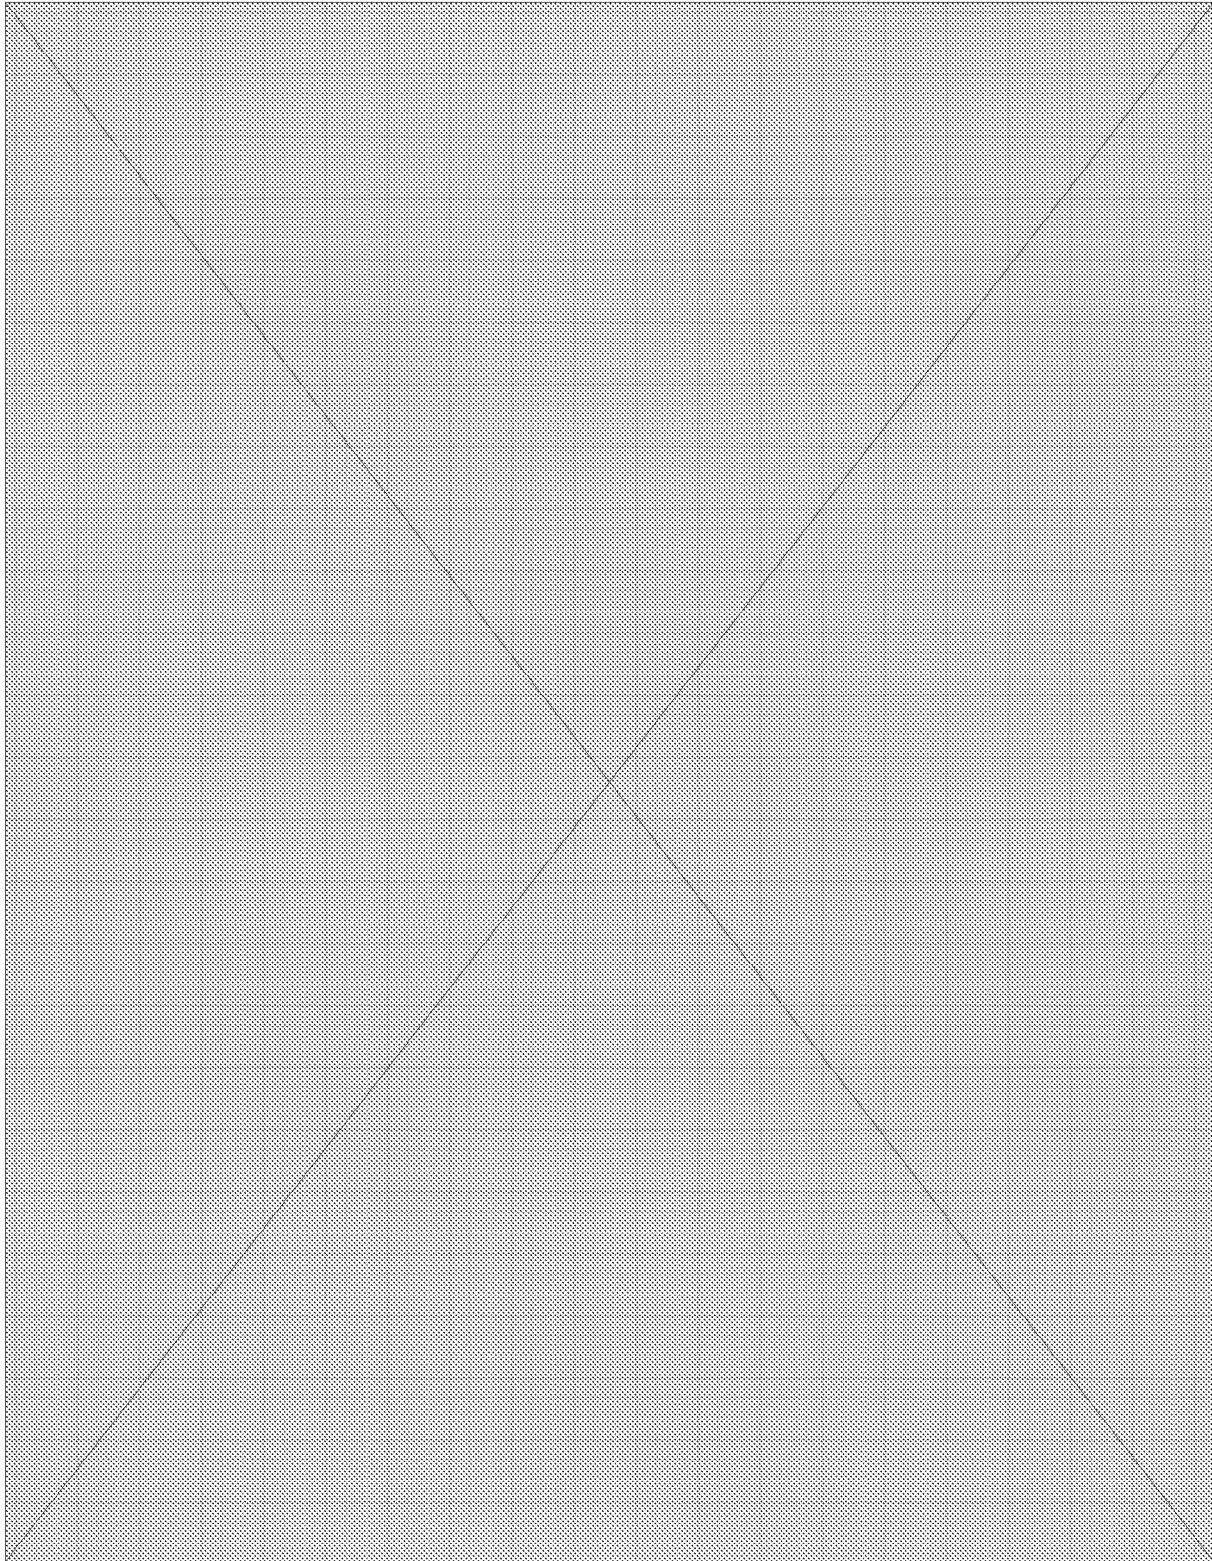

ATC ASSOCIATES, INC

104 E 25th Street, 10th Floor

New York, NY 10010

Tel. 212-353-8280

Fax 212-353-8306

REPORT DATE: 08-21-02
CLIENT: Taylor Environmental Group, Inc.
PROJECT NAME: SCA/Stuyvesant HS
 3rd Floor
PROJECT NUMBER: M477-15217/29881
SAMPLED BY: Client
SAMPLE DATE: 08-20-02
DATE RECEIVED: 08-20-02
DATE ANALYZED: 08-20-02
SAMPLE MEDIA: Air Samples
ANALYSIS REQUIRED: Method NIOSH 7062

ANALYSIS RESULTS

SAMPLE ID	BATCH NO.	SAMPLE DESCRIPTION	LEAD CONCENTRATION ($\mu\text{g}/\text{m}^3$)	DETECTION LIMIT ($\mu\text{g}/\text{m}^3$)
3-L1	21335	3rd Floor Corridor @ Rm C332	<1.9	1.9
3-L2	21335	Rm 351 Carpentry Shop	<1.9	1.9
3-L3	21335	3rd Floor Corridor at Bottom of Escalator P	<1.9	1.9
3-L4	21335	Large GYM Counter	<1.9	1.9
3-L5	21335	Rm 325 @ Storage Casings	<2.0	2.0
FB1	21335	Field Blank	<1.5 μg	1.5 μg
FB2	21335	Field Blank	<1.5 μg	1.5 μg

NOTE 1:
THE REPORTING LIMIT (RL) IS 3.0 μg

NOTE 2:
At the present time there are no regulatory levels or requirements for indoor airborne lead in area samples. However, OSHA has established an action level of 30 $\mu\text{g}/\text{m}^3$ and a permissible exposure level (PEL) of 50 $\mu\text{g}/\text{m}^3$ for personal samples.

NOTE 3:
Blank units are in μg

ATC ASSOCIATES, INC

104 E 25th Street, 10th Floor

New York, NY 10010

Tel. 212-353-8280

Fax 212-353-8306

CERTIFICATION AND SIGNATURES

ANALYSIS PERFORMED BY: HEU

REPORT PREPARED BY: [Signature]

ATC certifies that this report is an accurate and authentic report of results obtained from the laboratory analysis.

QUALITY ASSURANCE COORDINATOR: [Signature]

LABORATORY DIRECTOR: [Signature]

ATC is accredited by the New York State Department of Health Environmental Laboratory Approval Program (ELAP) and by the American Industrial Hygiene Association (AIHA) to perform analysis of lead in paint, dust wipes, air and soil samples. (ELAP #10879), (AIHA #100229).

07154

TAYLOR ENVIRONMENTAL GROUP, INC.

**POST GENERAL
CLEANING
LEAD WIPE SAMPLE
RESULTS
3RD THROUGH 10TH
FLOORS**

**PROJECT #: M477-15217
LLW#: 29881**

130A JERICO TPKE., FLORAL PARK, NY 11001 • PHONE (516) 358-2955 • FAX (516) 358-1780

07155

CITY_21MC100_008878329

TAYLOR ENVIRONMENTAL GROUP, INC.
130 JERICHO TPKE., FLORAL PARK, NY 11001

516-358-2955
Fax 516-358-1780

LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT

CLIENT NAME/ADDRESS NYC SCA		CONTACT: HAMID SAYOOS		SAMPLER SIGNATURE: <i>[Signature]</i>		DATE 7.28.02	TIME 0030	SAMPLE(S) SEALED ☒ YES / NO
PROJECT LOCATION: STUYVESANT HS 345 CHAMBERS ST. NY		PROJECT # M 477-15217-29881		SAMPLER NAME (PRINT): KIRK MC KEENZIE		CORRECT CONTAINER(S) ☒ YES / NO		
SAMPLE INFORMATION:				MATRIX (CIRCLE ONE): ☒ WIFE ☐ PAINT ☐ SOIL ☐ OTHER				
LABORATORY #	SAMPLE #	LOCATION	AREA #?	SURFACE MATERIAL				LAB RESULT
				WOOD	METAL	BRICK	OTHER	
	LW-01	ROOM 1010 - FLOOR 4' south of Center Wall Column	1				☒	< 9.0
	LW-02	ROOM 1010 - WORK Table Top 7' south of Center Wall Column	1				☒	
	LW-03	ROOM 1025 - FLOOR 3' of West End off corridor	1				☒	
	LW-04	ROOM 1025 - Student Desk Top - window row front	1	☒				
	LW-05	ROOM 1033 - FLOOR south side of NW column	1				☒	
	LW-06	ROOM 1033 - Drafting File Cabinet Top (NW corner cabinet)	1		☒			
	PBL-1	Field Blank						
	PBL-2	Field Blank						
FAX RESULTS TO TAYLOR 516-358-1780 212 406-2535				TURNAROUND REQUIRED: NORMAL ☐ STAT ☒ BY 7/29/02		COMMENTS / INSTRUCTIONS Q HR. TPT		
RELINQUISHED BY (SIGNATURE) <i>[Signature]</i>		DATE 7/29/02	PRINTED NAME Kirk McKeenzie		RECEIVED BY (SIGNATURE) <i>[Signature]</i>		DATE 7/29/02	PRINTED NAME
RELINQUISHED BY (SIGNATURE) <i>[Signature]</i>		DATE 7/28/02	PRINTED NAME TERESA MICHAEL		RECEIVED BY LAB (SIGNATURE) <i>[Signature]</i>		DATE 7/29/02	PRINTED NAME S. CL

07156

CITY_21MC100_008878330

ATC ASSOCIATES, INC
104 E 25th Street, 10th Floor
New York, NY 10010
Tel 212-353-8280
Fax 212-353-8306

REPORT DATE: 07-29-02
CLIENT: Taylor Environmental Group, Inc.
PROJECT NAME: SCA/Stuyvesant HS
 345 Chambers Street, NY
PROJECT NUMBER: M477-15217/25881
SAMPLED BY: Client
SAMPLE DATE: 07-28-02
DATE RECEIVED: 07-29-02
DATE ANALYZED: 07-29-02
SAMPLE MEDIA: Dust Wipe Sample
ANALYSIS REQUIRED: Method EPA 3050/7420

ANALYSIS RESULTS

SAMPLE ID	BATCH NO.	SAMPLE DESCRIPTION	LEAD CONCENTRATION ($\mu\text{g}/\text{ft}^2$)	DETECTION LIMIT ($\mu\text{g}/\text{ft}^2$)
LW-01	20725	Rm 1010 Floor 4' South of Center Wall Column	<9.0	9.0
LW-02	20725	Rm 1010 Work Table Top 7' South of Center Wall Column	<9.0	9.0
LW-03	20725	Rm 1025 Floor 3' of West Entrance, Off Corridor	<9.0	9.0
LW-04	20725	Rm 1025 Student Desk Top Window Row Front	<9.0	9.0
LW-05	20725	Rm 1033 Floor South Side of NW Column	<9.0	9.0
LW-06	20725	Rm 1033 Drafting File Cabinet Top (NW Corner Cabinet)	<9.0	9.0
FBL-1	20725	Field Blank	<9.0 μg	9.0 μg
FBL-2	20725	Field Blank	<9.0 μg	9.0 μg

NOTE 1:

THE REPORTING LIMIT (RL) IS 18.0 μg

NOTE 2:

HUD Guidelines for final clearance dust wipe samples: Floor 40 $\mu\text{g}/\text{ft}^2$, Window sills 250 $\mu\text{g}/\text{ft}^2$, Window wells 400 $\mu\text{g}/\text{ft}^2$, Exterior surfaces 800 $\mu\text{g}/\text{ft}^2$.

NOTE 3:

Blank units are in μg

07157

CITY_21MC100_008878331

ATC ASSOCIATES, INC

104 E 25th Street, 10th Floor

New York, NY 10010

Tel 212-353-8280

Fax 212-353-8306

CERTIFICATION AND SIGNATURES

ANALYSIS PERFORMED BY: JK

REPORT PREPARED BY: [Signature]

ATC certifies that this report is an accurate and authentic report of results obtained from the laboratory analysis.

QUALITY ASSURANCE COORDINATOR: [Signature]

LABORATORY DIRECTOR: [Signature]

ATC is accredited by the New York State Department of Health Environmental Laboratory Approval Program (ELAP) and by the American Industrial Hygiene Association (AIHA) to perform analysis of lead in paint, dust, wipes, air and soil samples. (ELAP #10879), (AIHA #100229).

07158

CITY_21MC100_008878332

TAYLOR ENVIRONMENTAL GROUP, INC.
130 JERICHO TPKE., FLORAL PARK, NY 11001

516-358-2955
Fax 516-358-1780

LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT

CLIENT NAME/ADDRESS <i>SCA Stuyvesant</i>		CONTACT: <i>Hamid Savji</i>		SAMPLER (SIGNATURE) <i>[Signature]</i>		DATE <i>7/29/02</i>	TIME <i>4:11</i>	SAMPLE(S) SEALED ☒ YES / NO
PROJECT LOCATION: <i>345 Chambers St</i>		PROJECT # <i>mt 77-152017/2088</i>		SAMPLER NAME (PRINT) <i>Retam</i>		CORRECT CONTAINER(S) ☒ YES / NO		
SAMPLE INFORMATION:				MATRIX (CIRCLE ONE): ☒ WIFE PAINT SOIL OTHER				
LABORATORY #	SAMPLE #	LOCATION	AREA (FT ²)	SURFACE MATERIAL				LAB RESULT
				WOOD	METAL	BRICK	OTHER	
	07	rm 1001 Floor w-2-19-7	1				1	49.0
	08	rm 1001 Desk	1				1	49.0
	09	rm 1002 Floor w-2-8-1	1				1	49.0
	10	rm 1002 Shelf	1		1			49.0
	11	rm 1003 Floor w-4-2-1	1				1	49.0
	12	rm 1003 Shelf	1		1			49.0
	13	rm 1004 Floor w-2-5-1	1				1	49.0
	14	rm 1004 Teachers Desk	1				1	49.0
TURNAROUND REQUIRED: NORMAL ☐ STAT ☒ BY <i>7/29/02</i>				COMMENTS / INSTRUCTIONS <i>6 HAT</i>				
RELINQUISHED BY (SIGNATURE) <i>[Signature]</i>		DATE <i>7/29/02</i>	PRINTED NAME <i>Retam</i>		RECEIVED BY (SIGNATURE) <i>R. Brondina</i>		DATE <i>7.29</i>	PRINTED NAME <i>R. Brondina</i>
RELINQUISHED BY (SIGNATURE)		DATE TIME	PRINTED NAME		RECEIVED BY LAB (SIGNATURE)		DATE TIME	PRINTED NAME

WHITE - OFFICE / YELLOW - LAB / PINK - CLIENT

07159

CITY_21MC100_008878333

TAYLOR ENVIRONMENTAL GROUP, INC.
130 JERICO TPKE., FLORAL PARK, NY 11001

516-358-2955
Fax 516-358-1780

LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT

CLIENT NAME/ADDRESS SEA 8 Bayview Ave 115		CONTACT: Nam's Sao		SAMPLER (SIGNATURE) [Signature]		DATE 7/24/02		TIME 4:14		SAMPLE(S) SEALED ☒ YES ☐ NO	
PROJECT LOCATION: 345 Chambers St		PROJECT # M477-152017-2988		SAMPLER NAME (PRINT) [Signature]						CORRECT CONTAINER(S) ☒ YES ☐ NO	
SAMPLE INFORMATION:				MATRIX (CIRCLE ONE): <u>WIFE</u> PAINT SOIL OTHER							
LABORATORY #	SAMPLE #	LOCATION	AREA (FT ²)	SURFACE MATERIAL				LAB RESULT			
				WOOD	METAL	BRICK	OTHER				
	15	rm 1005 Floor w. 2 3-1	1				1	49.0			
	16	rm 1005 Shell	1		1			49.0			
	17	rm 1006 Floor w. 8 8-8	1				1	49.0			
	18	rm 1006 table	1				1	49.0			
	19	rm 1007 Floor w. 4 4-2	1				1	49.0			
	20	rm 1003 Desk	1				1	49.0			
	21	rm 1039 A Floor w. 2 3-3	1				1	49.0			
	22	rm 1039 A Shell	1		1			49.0			
				TURNAROUND REQUIRED: NORMAL ☐ STAT ☒ BY 6pm		COMMENTS / INSTRUCTIONS					
RELINQUISHED BY (SIGNATURE) [Signature]		DATE 7/24/02 TIME 4:50 PM		PRINTED NAME Petrakis		RECEIVED BY (SIGNATURE) R. Drondina		DATE 7/29		PRINTED NAME R. Drondina	
RELINQUISHED BY (SIGNATURE)		DATE TIME		PRINTED NAME		RECEIVED BY LAB (SIGNATURE)		DATE TIME		PRINTED NAME	

WHITE - OFFICE / YELLOW - LAB / PINK - CLIENT


07160

CITY_21MC100_008878334

20744

LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT

WHITE - OFFICE / YELLOW - LAB / PINK - CLIENT

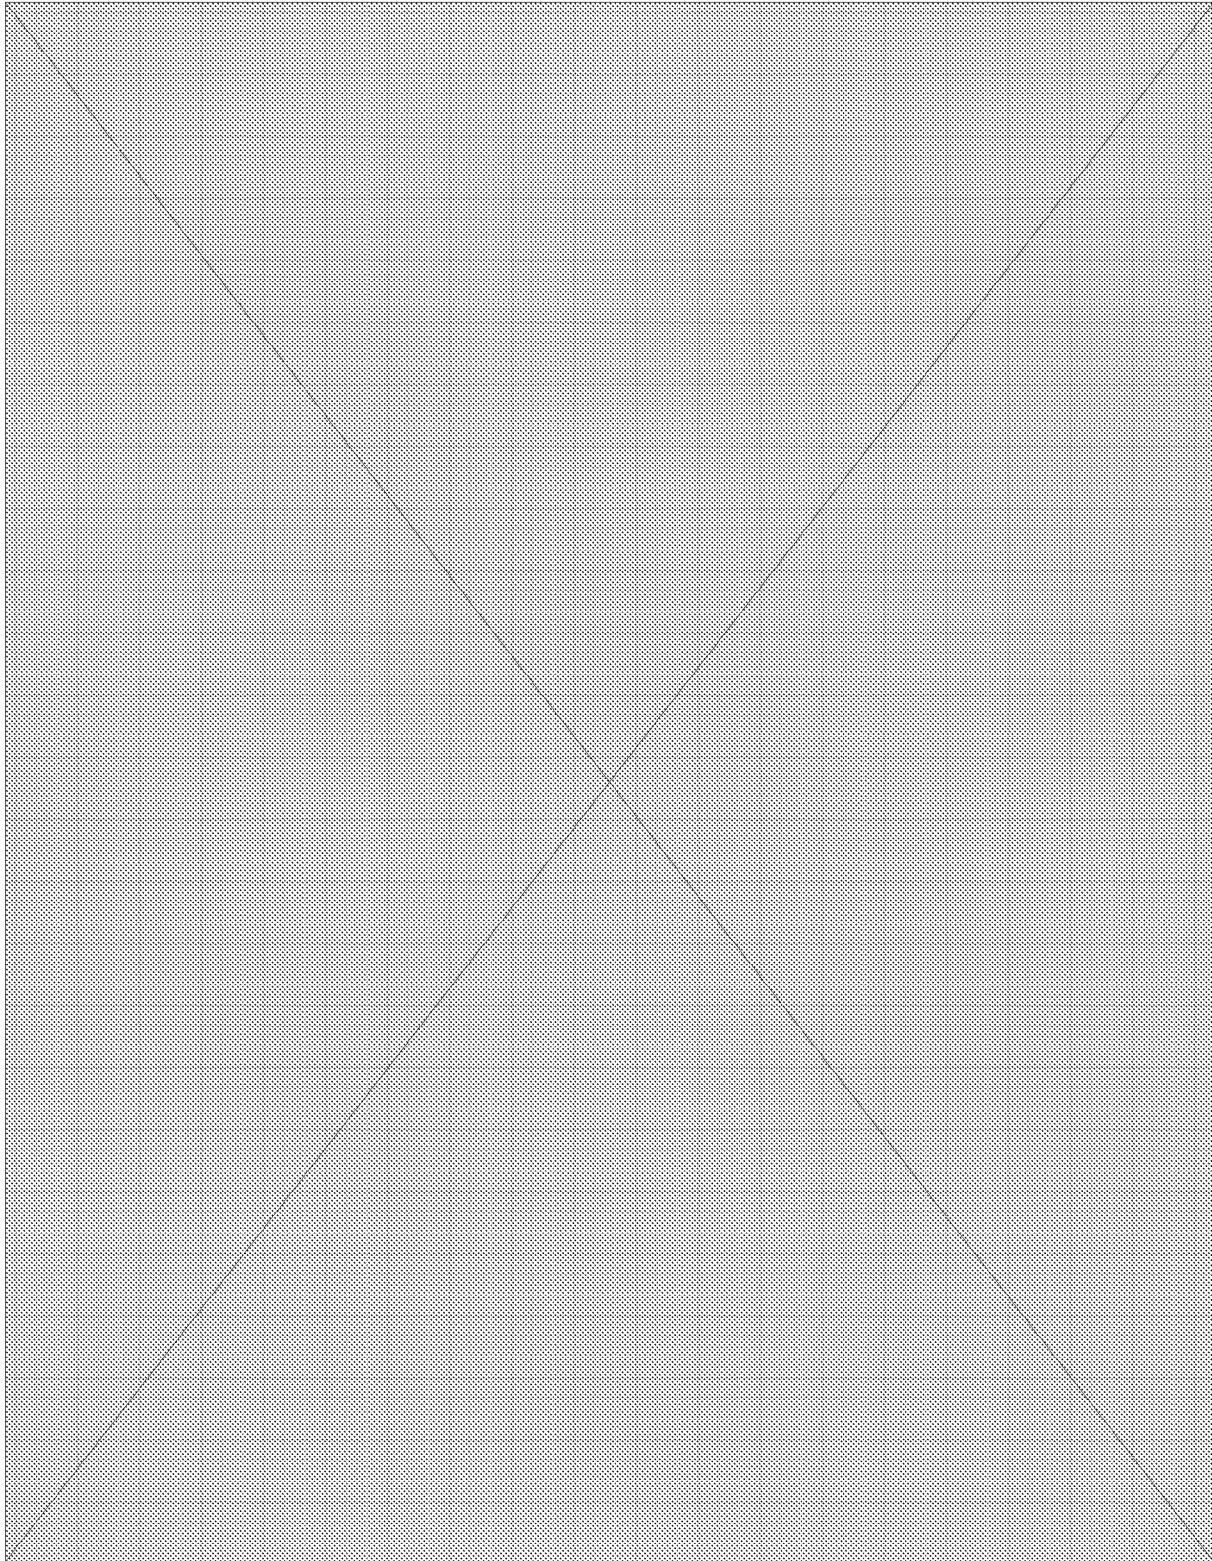

ATC ASSOCIATES, INC
 104 E 25th Street, 10th Floor
 New York, NY 10010
 Tel. 212-353-8280
 Fax 212-353-8306

REPORT DATE: 07-30-02
 CLIENT: Taylor Environmental Group, Inc.
 PROJECT NAME: SCA/Stuyvesant HS
 345 Chambers Street, NY
 PROJECT NUMBER: M477-15217/29881
 SAMPLED BY: Client
 SAMPLE DATE: 07-29-02
 DATE RECEIVED: 07-29-02
 DATE ANALYZED: 07-29-02
 SAMPLE MEDIA: Dust Wipe Sample
 ANALYSIS REQUIRED: Method EPA 3050/7420

ANALYSIS RESULTS

SAMPLE ID	BATCH NO.	SAMPLE DESCRIPTION	LEAD CONCENTRATION ($\mu\text{g}/\text{ft}^2$)	DETECTION LIMIT ($\mu\text{g}/\text{ft}^2$)
07	20744	Rm 1001 Floor W2 19-7	<9.0	9.0
08	20744	Rm 1001 Desk	<9.0	9.0
09	20744	Rm 1002 Floor W-2 8-1	<9.0	9.0
10	20744	Rm 1002 Shelf	<9.0	9.0
11	20744	Rm 1003 Floor W-4 2-1	<9.0	9.0
12	20744	Rm 1003 Floor Shelf	<9.0	9.0
13	20744	Rm 1004 Floor W-2 5-1	<9.0	9.0
14	20744	Rm 1004 Teachers Desk	<9.0	9.0
15	20744	Rm 1005 Floor W-2 5-1	<9.0	9.0
16	20744	Rm 1005 Shelf	<9.0	9.0
17	20744	Rm 1006 Floor W-3 3-3	<9.0	9.0
18	20744	Rm 1006 Table	<9.0	9.0
19	20744	Rm 1007 Floor W4 4-2	<9.0	9.0
20	20744	Rm 1007 Desk	<9.0	9.0
21	20744	Rm 1039A Floor W2 3-3	<9.0	9.0

07163

CITY_21MC100_008878337

ATC ASSOCIATES, INC
104 E 25th Street, 10th Floor
New York, NY 10010
Tel. 212-353-8280
Fax 212-353-8306

22	20744	Rm 1039A Shelf	<9.0	9.0
23	20744	Rm 1039 Floor W1 1-1	<9.0	9.0
24	20744	Rm 1039 Table	<9.0	9.0
FB-3	20744	Field Blank	<9.0 µg	9.0 µg
FB-4	20744	Field Blank	<9.0 µg	9.0 µg

NOTE 1:

THE REPORTING LIMIT (RL) IS 18.0 µg

NOTE 2:

HUD Guidelines for final clearance dust wipe samples: Floor 40 µg/ft², Window sills 250 µg/ft², Window wells 400 µg/ft², Exterior surfaces 800 µg/ft².

NOTE 3:

Blank units are in µg

CERTIFICATION AND SIGNATURES

ANALYSIS PERFORMED BY: RD

REPORT PREPARED BY: [Signature]

ATC certifies that this report is an accurate and authentic report of results obtained from the laboratory analysis.

QUALITY ASSURANCE COORDINATOR: [Signature]

LABORATORY DIRECTOR: [Signature]


ATC is accredited by the New York State Department of Health Environmental Laboratory Approval Program (ELAP) and by the American Industrial Hygiene Association (AIHA) to perform analysis of lead in paint, dust wipes, air and soil samples. (ELAP #10879), (AIHA #100229).

07164

TAYLOR ENVIRONMENTAL GROUP, INC.
130 JERICHO TPKE., FLORAL PARK, NY 11001

516-358-2955
Fax 516-358-1780

LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT

CLIENT NAME/ADDRESS SCA		CONTACT: Hamid Savoy		SAMPLER (SIGNATURE) AL. KAZANOV		DATE 7/29/02	TIME 0100	SAMPLE(S) SEALED (YES) NO
PROJECT LOCATION: Stuyvesant H.S.		PROJECT # M477-15217/29881		SAMPLER NAME (PRINT) AL. KAZANOV		CORRECT CONTAINER(S) (YES) NO		
SAMPLE INFORMATION:				MATRIX (CIRCLE ONE): (WIPE) PAINT SOIL OTHER				
LABORATORY #	SAMPLE #	LOCATION	AREA (FT ²)	SURFACE MATERIAL WOOD METAL BRICK OTHER				LAB RESULT
	RW-01	Room #1017A Work table	1	X				49.0
	RW-02	Room #1017A floor by Universt	1				X	9.0
	RW-03	Room #1017 White table by the entrance	1	X				49.0
	RW-04	Room #1017 floor by TV set	1				X	49.0
	RW-05	Room #1024A Scanner desk	1	X				49.0
	RW-06	Room #1024A floor by Entrance	1				X	49.0
	RW-07	Teacher desk (table) Room #1024 floor.	1	X				49.0
	RW-08	by the black board	1				X	49.0
Fax results to Taylor at: (212) 406-2535				TURNAROUND REQUIRED. NORMAL ☐ STAT ☒ BY 1/1			COMMENTS / INSTRUCTIONS 642 F.A.P.	
RELINQUISHED BY (SIGNATURE) 	DATE 7/29/02 TIME 01:00	PRINTED NAME AL. KAZANOV		RECEIVED BY (SIGNATURE) R. Drudina			DATE 7.29 TIME 01:00	PRINTED NAME R. Drudina
RELINQUISHED BY (SIGNATURE)	DATE TIME	PRINTED NAME		RECEIVED BY LAB (SIGNATURE)			DATE TIME	PRINTED NAME 1

WHITE - OFFICE / YELLOW - LAB / PINK - CLIENT

07165

CITY_21MC100_008878339

TAYLOR ENVIRONMENTAL GROUP, INC.
130 JERICHO TPKE., FLORAL PARK, NY 11001

516-358-2755
Fax 516-358-1780

LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT

CLIENT NAME/ADDRESS SCA		CONTACT: Hamid Savoj		SAMPLER (SIGNATURE) <i>[Signature]</i>		DATE 7/24/02	TIME 0100	SAMPLE(S) SEaled (YES) / NO
PROJECT LOCATION: Stuyvesant H.S.		PROJECT # M477-15217 / 29881		SAMPLER NAME (PRINT) AL. Karaman		CORRECT CONTAINER(S) (YES) / NO		
SAMPLE INFORMATION:		LOCATION		MATRIX (CIRCLE ONE): (WIPE) PAINT SOIL OTHER		LAB RESULT mg/kg		
LABORATORY #	SAMPLE #	LOCATION		AREA (FT ²)	SURFACE MATERIAL WOOD METAL BRICK OTHER			
	RW-09	Room # C1021 Electrical equipment shelf		1		X		11.3
	RW-10	Room # C1021 floor by entrance		1			X	49.0
	RW-11	Room # C1023 floor by the wall electrical panel		1			X	49.0
	RW-12	Room # 1026 top of the safety storage cabinet		1		X		49.0
	RW-13	Room # 1026 floor by the entrance		1			X	49.0
	RW-14	Room # 1027 floor by the entrance		1			X	49.0
	RW-15	Room # 1029 Bathroom floor by sink		1			X	49.0
	RW-16	Room # 1031 Bathroom floor by entrance		1			X	49.0
Fax results to PayCom at: (612) 406-2535				TURNAROUND REQUIRED: NORMAL ☐ STAT ☒ BY 1 / 1		COMMENTS / INSTRUCTIONS 6 hr P.A.P.		
RELINQUISHED BY (SIGNATURE) <i>[Signature]</i>		DATE 7/24/02	PRINTED NAME AL. Karaman	RECEIVED BY (SIGNATURE) <i>[Signature]</i>		DATE 7.28	PRINTED NAME R. Diodice	
RELINQUISHED BY (SIGNATURE)		DATE	PRINTED NAME	RECEIVED BY LAB (SIGNATURE)		DATE	PRINTED NAME	
		TIME				TIME		

WHITE - OFFICE / YELLOW - LAB / PINK - CLIENT

07166

CITY_21MC100_008878340

CITY_21MC100_008878341

ATC ASSOCIATES, INC
104 E 25th Street, 10th Floor
New York, NY 10010
Tel. 212-353-8280
Fax 212-353-8306

REPORT DATE: 07-30-02
CLIENT: Taylor Environmental Group, Inc.
PROJECT NAME: SCA/Stuyvesant HS
 345 Chambers Street, NY
PROJECT NUMBER: M477-15217/29881
SAMPLED BY: Client
SAMPLE DATE: 07-29-02
DATE RECEIVED: 07-29-02
DATE ANALYZED: 07-29-02
SAMPLE MEDIA: Dust Wipe Sample
ANALYSIS REQUIRED: Method EPA 3050/7420

ANALYSIS RESULTS

SAMPLE ID	BATCH NO.	SAMPLE DESCRIPTION	LEAD CONCENTRATION (µg/ft²)	DETECTION LIMIT (µg/ft²)
RW-01	20757	Rm 1017A Work Table	<9.0	9.0
RW-02	20757	Rm 1017A Floor by Unitvent	<9.0	9.0
RW-03	20757	Rm 1017 White Table by the Entrance	<9.0	9.0
RW-04	20757	Rm 1017 Floor by TV Set	<9.0	9.0
RW-05	20757	Rm 1024A Scanner Desk	<9.0	9.0
RW-06	20757	Rm 1024A Floor by Entrance	<9.0	9.0
RW-07	20757	Rm 1024 Teacher Desk (Table)	<9.0	9.0
RW-08	20757	Rm 1024 Floor by the Blackboard	<9.0	9.0
RW-09	20757	Rm C1021 Electrical Equipment Shelf	11.3	9.0
RW-10	20757	Rm C1021 Floor by Entrance	<9.0	9.0
RW-11	20757	Rm C1023 Floor by the Wall Electrical Panel	<9.0	9.0
RW-12	20757	Rm 1026 Top of the Safety Storage Cabinet	<9.0	9.0
RW-13	20757	Rm 1026 Floor by the Entrance	<9.0	9.0
RW-14	20757	Rm 1027 Floor by the Entrance	<9.0	9.0
RW-15	20757	Rm 1029 Bathroom Floor by Sink	<9.0	9.0

ATC ASSOCIATES, INC

104 E 25th Street, 10th Floor

New York, NY 10010

Tel. 212-353-8280

Fax 212-353-8306

RW-16	20757	Rm. 1031 Bathroom Floor by Entrance	<9.0	9.0
RW-17	20757	Rm. 1030 Bathroom Floor by the Sink's	<9.0	9.0
RW-18	20757	Rm. 1034 Bathroom Floor by the Entrance	<9.0	9.0
RW-19	20757	Rm. 1032 Slop Sink Floor by Entrance	<9.0	9.0
RW-20	20757	Corridor by Rm 1039 Floor	<9.0	9.0
RW-21	20757	Corridor by Rm 1017 Floor	<9.0	9.0
RW-22	20757	Corridor by Rm 1005 Floor	<9.0	9.0
RW-23	20757	Field Blank	<9.0 µg	9.0 µg
RW-24	20757	Field Blank	<9.0 µg	9.0 µg

NOTE 1:**THE REPORTING LIMIT (RL) IS 18.0 µg****NOTE 2:**HUD Guidelines for final clearance dust wipe samples: Floor 40 µg/ft², Window sills 250 µg/ft², Window wells 400 µg/ft², Exterior surfaces 800 µg/ft².**NOTE 3:**

Blank units are in µg

CERTIFICATION AND SIGNATURESANALYSIS PERFORMED BY: FDREPORT PREPARED BY: [Signature]

ATC certifies that this report is an accurate and authentic report of results obtained from the laboratory analysis.

QUALITY ASSURANCE COORDINATOR: [Signature]LABORATORY DIRECTOR: [Signature]

ATC is accredited by the New York State Department of Health Environmental Laboratory Approval Program (ELAP) and by the American Industrial Hygiene Association (AIHA) to perform analysis of lead in paint, dust wipes, air and soil samples. (ELAP #10879), (AIHA #100229).

TAYLOR ENVIRONMENTAL GROUP, INC.
130 JERICHO TPKE., FLORAL PARK, NY 11001

#20760

516-358-2955
Fax 516-358-1700

LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT									
CLIENT NAME/ADDRESS SCA Stuyvesant			CONTACT Hamed Sami		SAMPLER (SIGNATURE) [Signature]		DATE 7/30/02	TIME 8:30	SAMPLE(S) SEALED ☒ YES ☐ NO
PROJECT LOCATION 345 Chambers St			PROJECT # m177-15047/2989		SAMPLER NAME (PRINT) Petra		CORRECT CONTAINER(S) ☒ YES ☐ NO		
SAMPLE INFORMATION:					MATRIX (CIRCLE ONE): ☒ WIFE ☐ PAINT ☐ SOIL ☐ OTHER				
LABORATORY #	SAMPLE #	LOCATION	AREA (FT ²)	SURFACE MATERIAL				LAB RESULT	
				WOOD	METAL	BRICK	OTHER		
	01	rm 1009 Floor w/ 3-1	1				A		
	02	rm 1009 wood deck	1	X					
	03	rm 209 univert rear 2nd	1		X				
	04	rm 1010 A Floor w/ 3-1	1				X		
	05	rm 1010 B Shelf	1		X				
	FB-1	Field Blk							
	FB-2	Field Blk							
Fax 516358 2955 212-400-2535					TURNAROUND REQUIRED: NORMAL ☐ STAT ☐ BY [Signature]			COMMENTS / INSTRUCTIONS	
RELINQUISHED BY (SIGNATURE) [Signature]		DATE 7/31/02	PRINTED NAME Petra		RECEIVED BY (SIGNATURE) [Signature]		DATE 8/2/02	PRINTED NAME Walter Plomb	
RELINQUISHED BY (SIGNATURE) [Signature]		DATE 8/2/02	PRINTED NAME		RECEIVED BY LAB (SIGNATURE)		DATE	PRINTED NAME	

07170

WHITE - OFFICE / YELLOW - LAB / PINK - CLIENT

CITY_21MC100_008878344

ATC ASSOCIATES, INC

104 E 25th Street, 10th Floor

New York, NY 10010

Tel. 212-353-8280

Fax 212-353-8306

REPORT DATE: 07-30-02
CLIENT: Taylor Environmental Group, Inc.
PROJECT NAME: SCA/Stuyvesant HHS
345 Chambers Street, NY
PROJECT NUMBER: M477-15217/29851
SAMPLED BY: Client
SAMPLE DATE: 07-30-02
DATE RECEIVED: 07-30-02
DATE ANALYZED: 07-30-02
SAMPLE MEDIA: Dust Wipe Sample
ANALYSIS REQUIRED: Method EPA 3050/7420

ANALYSIS RESULTS

SAMPLE ID	BATCH NO.	SAMPLE DESCRIPTION	LEAD CONCENTRATION ($\mu\text{g}/\text{ft}^2$)	DETECTION LIMIT ($\mu\text{g}/\text{ft}^2$)
01	20760	Rm 1009 Floor W7 3-1	23.4	9.0
02	20760	Rm 1009 Wood Desk	<9.0	9.0
03	20760	Rm 209 Unitvent Rear Panel	20.1	9.0
04	20760	Rm 1010A Floor W1 3-1	<9.0	9.0
05	20760	Rm 1010A Shelf	<9.0	9.0
FB-1	20760	Field Blank	<9.0 μg	9.0 μg
FB-2	20760	Field Blank	<9.0 μg	9.0 μg

NOTE 1:

THE REPORTING LIMIT (RL) IS 18.0 μg

NOTE 2:

HUD Guidelines for final clearance dust wipe samples: Floor 40 $\mu\text{g}/\text{ft}^2$, Window sills 250 $\mu\text{g}/\text{ft}^2$, Window wells 400 $\mu\text{g}/\text{ft}^2$, Exterior surfaces 800 $\mu\text{g}/\text{ft}^2$.

NOTE 3:

Blank units are in μg

Q1	DATE 7/30/02	TIME	SAMPLE(S) SEALED	YES NO
Q2	DATE 7/30/02	TIME	CORRECT CONTAINER(S)	YES / NO
ONE: <u>SOITE</u>	PAINT	SOIL	OTHER	
SURFACE MATERIAL				
WOOD	METAL	BRICK	OTHER	
				LAB RESULT
				29.0
				29.0
				29.0
COMMENTS / INSTRUCTIONS				
REQUIRED: <u>1</u> BY <u>1</u>				
SIGNATURE	DATE 7.30.02	PRINTED NAME		
<u>LEAF H. R.</u>	TIME 17.40	<u>R. Arndina</u>		
BY (SIGNATURE)	DATE	PRINTED NAME		
	TIME			
CLIENT: <u>Call CHARIS H. Bigham will be</u>				

REPORT DATE:	07-31-02
CLIENT:	Taylor Environmental Group, Inc.
PROJECT NAME:	SCA/Shyvesant HS 345 Chambers Street, NY
PROJECT NUMBER:	M477-15217/29881
SAMPLED BY:	Client
SAMPLE DATE:	07-30-02
DATE RECEIVED:	07-30-02
DATE ANALYZED:	07-30-02
SAMPLE MEDIA:	Dust Wipe Sample
ANALYSIS REQUIRED:	Method EPA 3050/7420

SAMPLE ID	BATCH NO.	SAMPLE DESCRIPTION	LEAD CONCENTRATION (µg/ft²)	DETECTIVE LIMIT (µg/ft²)
LW-01	20786	Rm 1009 Floor W7 3-1	<9.0	9.0
FBL-1	20786	Field Blank	<9.0 µg	9.0 µg
FBL-2	20786	Field Blank	<9.0 µg	9.0 µg

ATC ASSOCIATES, INC
104 E 25th Street, 10th Floor
New York, NY 10010
Tel. 212-353-8280
Fax 212-353-8306

REPORT DATE: 07-31-02
CLIENT: Taylor Environmental Group, Inc.
PROJECT NAME: SCA/Shuyvesant HS
345 Chambers Street, NY
PROJECT NUMBER: M477-15217/29881
SAMPLED BY: Client
SAMPLE DATE: 07-30-02
DATE RECEIVED: 07-30-02
DATE ANALYZED: 07-30-02
SAMPLE MEDIA: Dust Wipe Sample
ANALYSIS REQUIRED: Method EPA 3050/7420

ANALYSIS RESULTS

SAMPLE ID	BATCH NO.	SAMPLE DESCRIPTION	LEAD CONCENTRATION ($\mu\text{g}/\text{ft}^2$)	DETECTION LIMIT ($\mu\text{g}/\text{ft}^2$)
LW-01	20786	Rm 1009 Floor W7 3-1	<9.0	9.0
FBL-1	20786	Field Blank	<9.0 μg	9.0 μg
FBL-2	20786	Field Blank	<9.0 μg	9.0 μg

NOTE 1:

THE REPORTING LIMIT (RL) IS 18.0 μg

NOTE 2:

HUD Guidelines for final clearance dust wipe samples: Floor 40 $\mu\text{g}/\text{ft}^2$, Window sills 250 $\mu\text{g}/\text{ft}^2$, Window wells 400 $\mu\text{g}/\text{ft}^2$, Exterior surfaces 300 $\mu\text{g}/\text{ft}^2$.

NOTE 3:

Blank units are in μg

CERTIFICATION AND SIGNATURES

ANALYSIS PERFORMED BY: RD

REPORT PREPARED BY: [Signature]

ATC certifies that this report is an accurate and authentic report of results obtained from the laboratory analysis.

QUALITY ASSURANCE COORDINATOR: [Signature]

LABORATORY DIRECTOR: [Signature]

ATC is accredited by the New York State Department of Health Environmental Laboratory Approval Program (ELAP) and by the American Industrial Hygiene Association (AIHA) to perform analysis of lead in paint, dust wipes, air and soil samples. (ELAP #10879), (AIHA #100228).

07173

CITY_21MC100_008878347

TAYLOR ENVIRONMENTAL GROUP, INC.
130 JERICHO TPKE., FLORAL PARK, NY 11001

030210496

516-358-2955
Fax 516-358-1700

08/02/2002 21:22

212-298-2538

EMSL ANALYTICAL, INC.

PAGE 24/26

LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT

CLIENT NAME/ADDRESS SCA		CONTACT: Hamid Saoud		SAMPLER (SIGNATURE) <i>[Signature]</i>		DATE 8/02/02		TIME		SAMPLE(S) SEALED (YES) / NO	
PROJECT LOCATION: Stuyvesant H.S.		PROJECT # M477-45217/29881		SAMPLER NAME (PRINT) AL. KAZANOV						CORRECT CONTAINER(S) (YES) / NO	
SAMPLE INFORMATION:				MATRIX (CIRCLE ONE): (WIFE) PAINT SOIL OTHER							
LABORATORY #	SAMPLE #	LOCATION	AREA (FT ²)	SURFACE MATERIAL WOOD METAL BRICK OTHER				LAB RESULT			
	W-01	Room # 939 Teachers table Lower End.	1	ALL				X	110.0		
	W-02	Room # 939 Stair By window Unvented	1					X	110.0		
	W-03	Room # 935 Teachers table Lower End.	1					X	110.0		
	W-04	Room # 935 Stair By west side entrance	1					X	110.0		
	W-05	Room # 931 Teachers table	1					X	110.0		
	W-06	Room # 931 Stair S-E corner.	1					X	110.0		
	W-07	Room # 929 Book shelf By entrance	1			X			110.0		
	W-08	Room # 929 Stair By window.	1					X	110.0		
Fax Results to Taylor on site (212) 406-2535				TURNAROUND REQUIRED: NORMAL ☐ STAT ☐ BY 1 / 1				COMMENTS / INSTRUCTIONS 6 hr TAT			
RELINQUISHED BY (SIGNATURE) <i>[Signature]</i>		DATE 8/02/02		PRINTED NAME AL. KAZANOV		RECEIVED BY (SIGNATURE) <i>[Signature]</i>		DATE 8-2-02		PRINTED NAME JOSE ALMAGRA	
RELINQUISHED BY (SIGNATURE) <i>[Signature]</i>		DATE 8/2/02		PRINTED NAME		RECEIVED BY LAB (SIGNATURE)		DATE		PRINTED NAME	

WHITE - OFFICE / YELLOW - LAB / PINK - CLIENT

07474

CITY_21MC100_008878348

TAYLOR ENVIRONMENTAL GROUP, INC.
130 JERICHO TURNpike, FLORAL PARK, NY 11001

030210496

516-358-2955
Fax 516-358-1780

08/02/2002 21:22

212-238-2538

ENL ANALYTICAL INC

PAGE 05/05


LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT

CLIENT NAME/ADDRESS SCA		CONTACT: Harold Savas		SAMPLER SIGNATURE: <i>[Signature]</i>	DATE 8/02/02	TIME	SAMPLE(S) SEALED (YES) NO	
PROJECT LOCATION: Stuyvesant H.S.		PROJECT # W1477-15217/29881		SAMPLER NAME (PRINT) Al. Kanan		CORRECT CONTAINER(S) (YES) NO		
SAMPLE INFORMATION:				MATRIX (CIRCLE ONE): (WIFE) PAINT SOIL OTHER				
LABORATORY #	SAMPLE #	LOCATION	AREA (FT ²)	SURFACE MATERIAL				LAB RESULT
				WOOD	METAL	BRICK	OTHER	
	W-09	Room # 927 Table By S-E side window	1				X	<10.0
	W-10	Room # 927 Floor by Teacher table	1				X	12.0
	W-11	Room # 926 Book shelf By the black board	1	X				<10.0
	W-12	Room # 926 Floor By the window	1				X	<10.0
	W-13	Room # 930 Bathroom floor By the sink	1				X	<10.0
	W-14	Room # 934 Girls Bathroom Floor By Entrance	1				X	<10.0
	W-15	Room # 935 Student desk By N-E side entrance	1				X	<10.0
	W-16	Room # 936 Floor By East side Teacher desk	1				X	<10.0
TURNAROUND REQUIRED:				COMMENTS / INSTRUCTIONS				
NORMAL ☐ STAT ☐ BY 1/1				6 hr TAP				
REINQUISHED BY (SIGNATURE) <i>[Signature]</i>		DATE 8/02/02		PRINTED NAME Al. Kanan		RECEIVED BY (SIGNATURE) <i>[Signature]</i>		DATE 8-2-02
REINQUISHED BY (SIGNATURE) <i>[Signature]</i>		DATE		PRINTED NAME		RECEIVED BY LAB (SIGNATURE) <i>[Signature]</i>		DATE 4/24/04
		TIME						TIME

WHITE - OFFICE / YELLOW - LAB / PINK - CLIENT

07175

CITY_21MC100_008878349

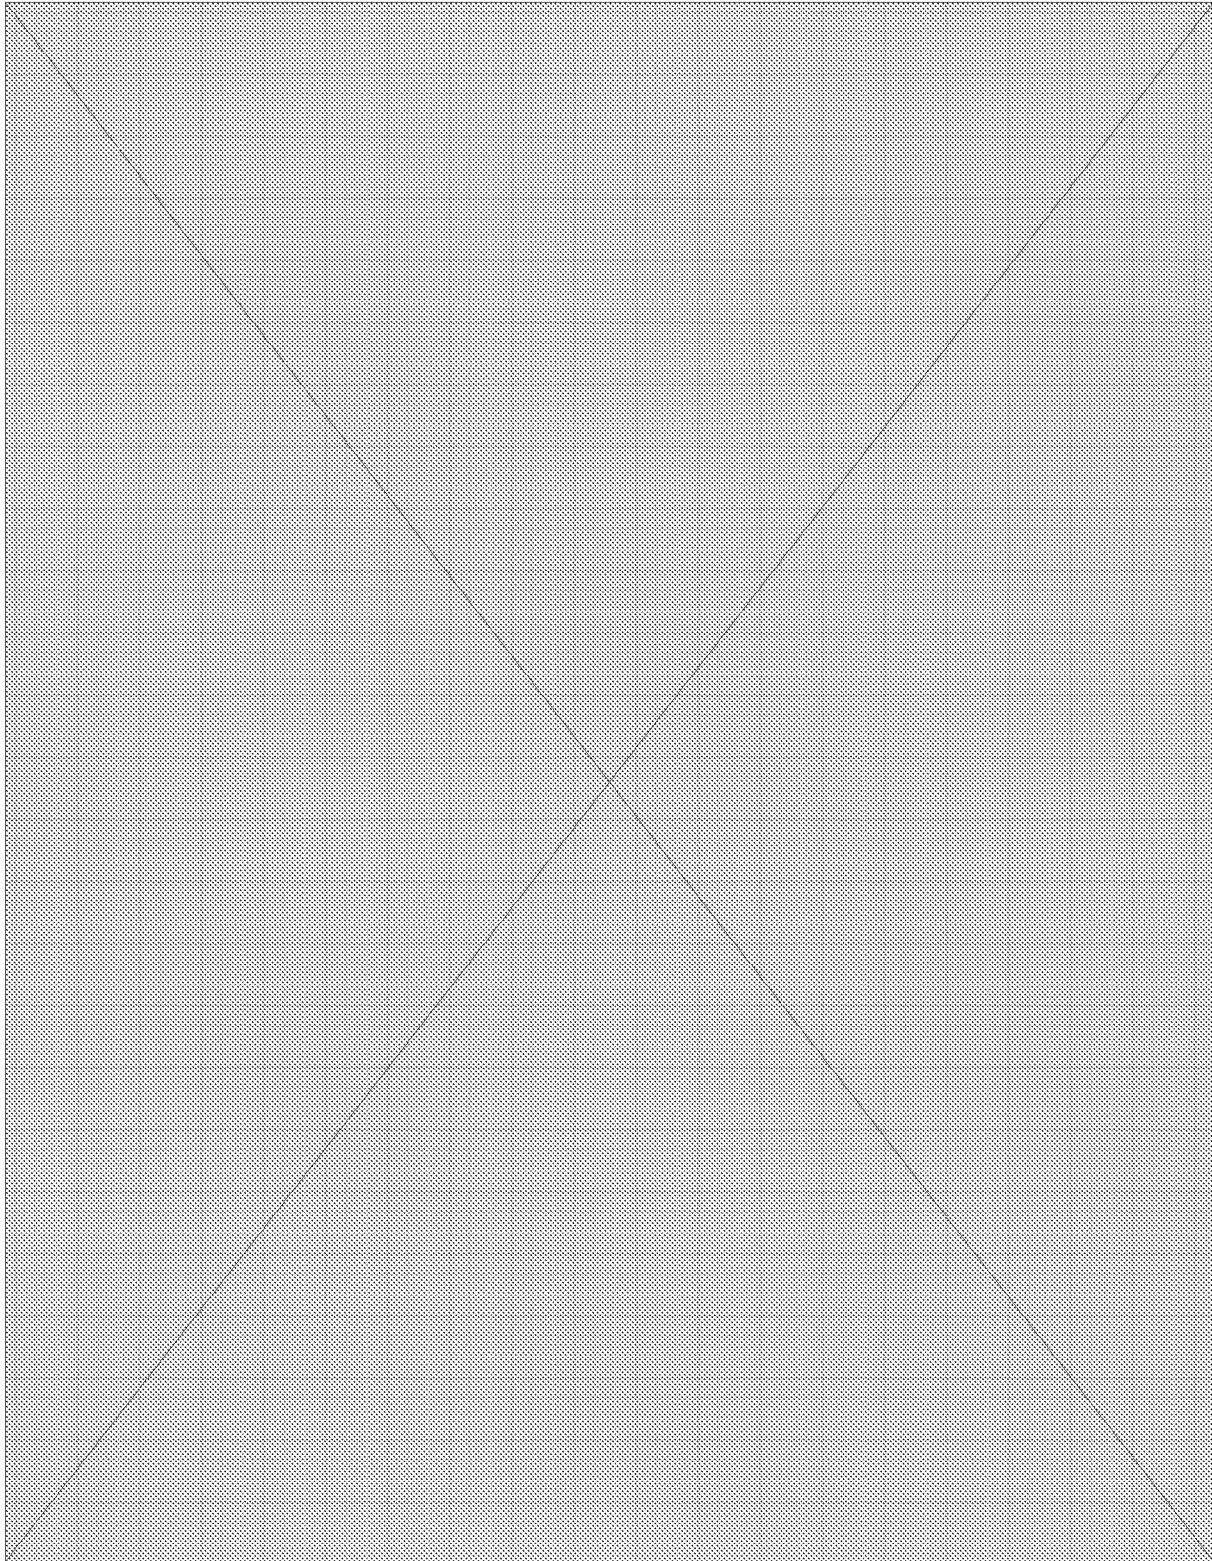

08/02/2002 21:22 212-298-2538

EMSL ANALYTICAL INC

PAGE 01/26

EMSL Analytical, Inc.

307 West 38th Street, New York, NY 10018

Phone: 212-293-0051 Fax: 212-293-0058 Email: manhattanlab@emsl.com

EMSL

Attn: Taylor Environmental Group, Inc.
 Floral Park Corporate Center
 130 Jericho Tpke.
 Floral Park, NY 11001

Fax: (516) 358-1780 Phone: 516-358-2955

Project: M477 - 15217/ 29881/ SCA / Stuyvesant H.S.

Customer ID: TAYL50

Customer PO:


Received: 08/02/02 4:24 PM

EMSL Order: 030210496

EMSL Project ID:

Lead in Wipes by Flame AAS (SW 846, 7420)

Client Sample Description	Lab ID	Analyzed	Area Sampled	Lead Concentration	Notes
W-01 Room #928 Teachers Table Lower End	0001	8/2/2002	144 in ²	<10.0 µg/ft ²	
W-02 Room #939 Floor by Window Univent	0002	8/2/2002	144 in ²	<10.0 µg/ft ²	
W-03 Room #935 Teachers Table Lower End	0003	8/2/2002	144 in ²	<10.0 µg/ft ²	
W-04 Room #935 Floor by West Side Entrance	0004	8/2/2002	144 in ²	<10.0 µg/ft ²	
W-05 Room #931 Teacher Table	0005	8/2/2002	144 in ²	<10.0 µg/ft ²	
W-06 Room #631 Floor S-E Corner	0006	8/2/2002	144 in ²	<10.0 µg/ft ²	
W-07 Room #929 Book Shelf By Entrance	0007	8/2/2002	144 in ²	<10.0 µg/ft ²	
W-08 Room #929 Floor by Window	0008	8/2/2002	144 in ²	<10.0 µg/ft ²	
W-09 Room #927 Table by S-E Side Window	0009	8/2/2002	144 in ²	<10.0 µg/ft ²	
W-10 Room #927 Floor by Teacher Table	0010	8/2/2002	144 in ²	12.0 µg/ft ²	
W-11 Room #926 Book Shelf by the Black Cord	0011	8/2/2002	144 in ²	<10.0 µg/ft ²	
W-12 Room #926 Floor by the Window	0012	8/2/2002	144 in ²	<10.0 µg/ft ²	
W-13 Room #930 Bathroom Floor by the Sink	0013	8/2/2002	144 in ²	<10.0 µg/ft ²	
W-14 Room #934 Gens Bathroom Floor by Entrance	0014	8/2/2002	144 in ²	<10.0 µg/ft ²	
W-15 Room #935 Student Desk by N-E side Entrance	0015	8/2/2002	144 in ²	<10.0 µg/ft ²	
W-16 Room #936 Floor by East side Teacher Desk	0016	8/2/2002	144 in ²	<10.0 µg/ft ²	
W-17 Room #938 Teacher Desk by the Window	0017	8/2/2002	144 in ²	<10.0 µg/ft ²	


 Laboratory Manager
 or other approved signatory

Reporting limit is 10 µg/ft²
 ACCREDITATIONS: AHA Environmental Lab. Laboratory Approval Program #102581

Page 1 of 2

CITY_21MC100_008878351

08/02/2002 21:22 212-290-2536

EMSL ANALYTICAL INC

PAGE 02/05

EMSL Analytical, Inc.

307 West 38th Street, New York, NY 10018

Phone: 212-290-0051 Fax: 212-290-0058 Email: manhattanlab@emsl.com



Attn: Taylor Environmental Group, Inc.
Floral Park Corporate Center
130 Jericho Tpke.
Floral Park, NY 11001

Fax: (516) 358-1780 Phone: 516-358-2955

Project: M477 - 152171 29851/ SCA / Stuyvesant H.S.

Customer ID: TAYL50

Customer PO:

Received: 08/02/02 4:24 PM

EMSL Order: 030210495

EMSL Project ID:

Lead in Wipes by Flame AAS (SW 846, 7420)

Client Sample Description	Lab ID	Analyzed	Area Sampled	Lead Concentration	Notes
W-18 Room #938 Floor by the Entrance	0018	8/2/2002	144 in²	<10.0 µg/ft²	
W-19 Room #940 Teacher Desk Lower End	0019	8/2/2002	144 in²	<10.0 µg/ft²	
W-20 Room #940 Floor by N-W side Window	0020	8/2/2002	144 in²	<10.0 µg/ft²	

Laboratory Manager
or other approved signatory

Reporting limit is 10 µg/wipe
ACCREDITATIONS: Alpha Environmental Lead Laboratory Approval Program #100551

Page 2 of 2

07476

CITY_21MC100_008878352

08/02/2002 21:22 212-298-2538

EMSL ANALYTICAL INC

PAGE 23/06

EMSL Analytical, Inc.

307 West 38th Street, New York, NY 10018

Phone: 212-298-0051 Fax: 212-298-0058 Email: manhattanlab@emsl.com



Attn: Taylor Environmental Group, Inc.
Floral Park Corporate Center
130 Jericho Tpke.
Floral Park, NY 11001

Fax: (516) 358-1780

Phone: 516-358-2855

Project: M477 - 15217/ 29831/ SCA / Stuyvesant H.S.

Customer ID: TAYL50

Customer PO:

Received: 08/02/02 4:24 PM

EMSL Order: 030210498

EMSL Project ID:

Lead in Wipes by Flame AAS (SW 846, 7420)

Client Sample Description	Lab ID	Analyzed	Area Sampled	Lead Concentration	Notes
W-21 F/B	0021	8/2/2002	n/a	<10.0 µg/wipe	
W-22 F/B	0022	8/2/2002	n/a	<10.0 µg/wipe	

Laboratory Manager
or other approved signatory

Reporting limit is 10 µg/wipe
ACCREDITATIONS: NIA Environmental Lab Laboratory Approval Program #102581

Page 2 of 2

07179

TAYLOR ENVIRONMENTAL GROUP, INC.
130 JERICHO TPKE., FLORAL PARK, NY 11001

20872

516-358-2955
Fax 516-358-1780




LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT									
CLIENT NAME/ADDRESS SCA			CONTACT: Hamid Sa'ar		SAMPLER (SIGNATURE) <i>[Signature]</i> DATE 8/02/02 TIME		SAMPLE(S) - ☒ YES / NO SEALED		
PROJECT LOCATION: Stuyvesant H.S.			PROJECT # #477-25217/29881		SAMPLER NAME (PRINT) AL. KARRAKOV		CORRECT CONTAINER(S) ☒ YES / NO		
SAMPLE INFORMATION:					MATRIX (CIRCLE ONE): ☒ TAPE PAINT SOIL OTHER				
LABORATORY #	SAMPLE #	LOCATION	AREA (FT ²)	SURFACE MATERIAL WOOD METAL BRICK OTHER				LAB RESULT 148/112	
	W-23	Room # C932 SLAP SINK Floor by the entrance	1				X	49.0	
	W-24	Room # 902 Teacher desk by the sink.	1				X	49.0	
	W-25	Room # 902 floor N-E side corner	1				X	49.0	
	W-26	Room # 901 Principal table	1				X	49.0	
	W-27	Room # 901 floor by the entrance	1				X	49.0	
	W-28	Room # 903A, Table by the entrance	1				X	49.0	
	W-29	Room # 905A floor by the windows.	1				X	49.0	
	W-30	Room # 903 Computer table	1				X	49.0	
Fax results to Taylor: (212) 406-2535					TURNAROUND REQUIRED: NORMAL ☐ STAT ☐ BY 1/1		COMMENTS / INSTRUCTIONS 6 hr V.A.T.		
RELINQUISHED BY (SIGNATURE) <i>[Signature]</i>		DATE 8/02/02	PRINTED NAME AL. KARRAKOV		RECEIVED BY (SIGNATURE) <i>[Signature]</i>		DATE 8.2.02	PRINTED NAME	
RELINQUISHED BY (SIGNATURE) <i>[Signature]</i>		DATE 8.02.02	PRINTED NAME TORON MICHAEL V.		RECEIVED BY LAB (SIGNATURE)		DATE	PRINTED NAME	

07180

CITY_21MC100_008878354

516-358-2955
Fax 516-358-1780

[illegible]

CLIENT NAME/ADDRESS		CONTACT:		SAMPLER (SIGNATURE)		DATE	TIME	SAMPLE(S) SEALED		YES / NO	
SCA		Hamid Savoy				8/6/02				☒ YES / ☐ NO	
PROJECT LOCATION:		PROJECT #		SAMPLER NAME (PRINT)		CORRECT CONTAINER(S)		YES / NO			
Stuyvesant H.S.		M477-15217/29881		Ali Karanov				☒ YES / ☐ NO			
SAMPLE INFORMATION:		LOCATION		MATRIX (CIRCLE ONE):		PAINT		SOIL		OTHER	
LABORATORY #	SAMPLE #			AREA (FT ²)	SURFACE MATERIAL				LAB RESULT		
					WOOD	METAL	BRICK	OTHER			
		Room #903	floor	1				X	49.0		
	W-31	by the oven table.									
		Room #907	computer table	1				X	49.0		
	W-32										
		Room #907	floor	1				X	12.2		
	W-33	by the windows									
		Room #907 A	floor	1				X	49.0		
	W-34	by the entrance.									
		Room #907 B		1		X			49.0		
	W-35	Top of refrigerator									
		Room #907 B		1				X	49.0		
	W-36	floor by the window									
	W-37	F/B							49.0		
	W-38	F/B							49.0		
Fax results to Taylor on site; (212) 406-2555				TURNAROUND REQUIRED:				COMMENTS / INSTRUCTIONS			
				NORMAL ☐ STAT ☐ BY 1/1				64h STAT.			
RELINQUISHED BY (SIGNATURE)		DATE 8/6/02		PRINTED NAME		RECEIVED BY (SIGNATURE)		DATE 8.2.02		PRINTED NAME	
		TIME		Ali Karanov				TIME 16.00			
RELINQUISHED BY (SIGNATURE)		DATE 8.02.02		PRINTED NAME		RECEIVED BY LAB (SIGNATURE)		DATE		PRINTED NAME	
		TIME 16-		Tanya Mchikina				TIME			

WHITE - OFFICE / YELLOW - LAB / PINK - CLIENT

07181

ATC ASSOCIATES, INC

104 E 25th Street, 18th Floor

New York, NY 10010

Tel. 212-353-8280

Fax 212-353-8306

REPORT DATE: 08-05-02
CLIENT: Taylor Environmental Group, Inc.
PROJECT NAME: SCA/Stuyvesant HS
 345 Chambers Street, NY
PROJECT NUMBER: M477-15217/29881
SAMPLED BY: Client
SAMPLE DATE: 08-02-02
DATE RECEIVED: 08-02-02
DATE ANALYZED: 08-02-02
SAMPLE MEDIA: Dust Wipe Sample
ANALYSIS REQUIRED: Method EPA 3050/7420

ANALYSIS RESULTS

SAMPLE ID	BATCH NO.	SAMPLE DESCRIPTION	LEAD CONCENTRATION (µg/l')	DETECTION LIMIT (µg/l')
W-23	20872	Rm 923 Slop Sink Floor by the Entrance	<9.0	9.0
W-24	20872	Rm 902 Teacher Desk by the Sink	<9.0	9.0
W-25	20872	Rm 902 Floor NE Side Corner	<9.0	9.0
W-26	20872	Rm 901 Principal Table	<9.0	9.0
W-27	20872	Rm 901 Floor by the Entrance	<9.0	9.0
W-28	20872	Rm 903A Table by the Entrance	<9.0	9.0
W-29	20872	Rm 903A Floor by the Window	<9.0	9.0
W-30	20872	Rm 903 Computer Table	<9.0	9.0
W-31	20872	Rm 903 Floor by the Oven Table	<9.0	9.0
W-32	20872	Rm 907 Computer Table	<9.0	9.0
W-33	20872	Rm 907 Floor by the Windows	12.2	9.0
W-34	20872	Rm 907A Floor by the Entrance	<9.0	9.0
W-35	20872	Rm 907B Top of Refrigerator	<9.0	9.0
W-34	20872	Rm 907B Floor by the Window	<9.0	9.0
W-37	20872	Field Blank	<9.0 µg	9.0 µg
W-38	20872	Field Blank	<9.0 µg	9.0 µg

ATC ASSOCIATES, INC
104 E 25th Street, 10th Floor
New York, NY 10010
Tel. 212-353-8288
Fax 212-353-8306

NOTE 1:

THE REPORTING LIMIT (RL) IS 18.0 µg

NOTE 2:

HUD Guidelines for final clearance dust wipe samples: Floor 40 µg/ft², Window sills 250 µg/ft²,
Window walls 400 µg/ft², Exterior surfaces 800 µg/ft².

NOTE 3:

Blank units are in µg

CERTIFICATION AND SIGNATURES

ANALYSIS PERFORMED BY: RD

REPORT PREPARED BY: [Signature]

ATC certifies that this report is an accurate and authentic report of results obtained from the laboratory analysis.

QUALITY ASSURANCE COORDINATOR: ms

LABORATORY DIRECTOR: M.L.

ATC is accredited by the New York State Department of Health Environmental Laboratory Approval Program (ELAP) and by the American Industrial Hygiene Association (AIHA) to perform analysis of lead in paint, dust wipes, air and soil samples. (ELAP #16879), (AIHA #150229).

07183

CITY_21MC100_008878357

TAYLOR ENVIRONMENTAL GROUP, INC.
130 JERICHO TPKE., FLORAL PARK, NY 11001

516-358-2955
Fax 516-358-1780

70892

LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT

CLIENT NAME/ADDRESS SCA		CONTACT: Harold Santos		SAMPLER (SIGNATURE) <i>[Signature]</i>	DATE 8/10/02	TIME	SAMPLE(S) SEALED YES ☒ NO ☐	
PROJECT LOCATION: Schuyler H.S.		PROJECT # HA477-15217/29881		SAMPLER NAME (PRINT) AL. KARAKOU	CORRECT CONTAINER(S) YES ☒ NO ☐			
SAMPLE INFORMATION:				MATRIX (CIRCLE ONE): ☒ DUST ☐ PAINT ☐ SOIL ☐ OTHER				
LABORATORY #	SAMPLE #	LOCATION	AREA (FT ²)	SURFACE MATERIAL				LAB RESULT
				WOOD	METAL	BRICK	OTHER	
	W-01	Room # 911 Teacher table Lower End	1				X	29.0
	W-02	Room # 911 floor by the TV set	1				X	
	W-03	Room # 913 Table by Emergency shower	1				X	
	W-04	Room # 913 floor S-E corner	1				X	
	W-05	Room # 925 Teacher desk	1				X	
	W-06	Room # 925 floor by S-W side window	1				X	
	W-07	Room # 925 B Table by the entrance	1				X	
	W-08	Room # 925 B floor by the entrance	1				X	
Pay results to Taylor (212) 408-2575				TURNAROUND REQUIRED: NORMAL ☐ STAT ☐ BY 1/1		COMMENTS / INSTRUCTIONS 6 hr TAT		
RELINQUISHED BY (SIGNATURE) <i>[Signature]</i>		DATE 8/13/02 PRINTED NAME AL. KARAKOU		RECEIVED BY (SIGNATURE) <i>[Signature]</i>		DATE 8/13/02 PRINTED NAME		
RELINQUISHED BY (SIGNATURE) <i>[Signature]</i>		DATE 8/13/02 PRINTED NAME AL. KARAKOU		RECEIVED BY LAB (SIGNATURE) <i>[Signature]</i>		DATE 8/13/02 PRINTED NAME		

WHITE - OFFICE / YELLOW - LAB / PINK - CLIENT

07184



CITY_21MC100_008878358

TAYLOR ENVIRONMENTAL GROUP, INC.
130 JERICHO TPKE., FLORAL PARK, NY 11001

20892

516-358-2955
Fax 516-358-1780


LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT

CLIENT NAME/ADDRESS SCA		CONTACT: Hamid Savar		SAMPLER SIGNATURE 	DATE 8/03/02	TIME	SAMPLE(S) SEALED ☒ YES ☐ NO	
PROJECT LOCATION: Stuyvesant H.S.		PROJECT # M 477-15217 / 29881		SAMPLER NAME (PRINT) AL. KAGAN		CORRECT CONTAINER(S) ☒ YES ☐ NO		
SAMPLE INFORMATION				MATRIX (CIRCLE ONE): ☒ WIFE ☐ PAINT ☐ SOIL ☐ OTHER				
LABORATORY #	SAMPLE #	LOCATION	AREA (FT ²)	SURFACE MATERIAL				LAB RESULT
				WOOD	METAL	BRICK	OTHER	
	W-09	Room # C923 floor By the Entrance	1				X	29.0
	W-10	Room # C921 floor By the Entrance	1				X	
	W-11	Room # 909 Table Computer table	1				X	
	W-12	Room # 905 floor By the Entrance	1				X	
	W-13	Corridor floor By room # 939	1				X	
	W-14	Corridor floor By room # C921	1				X	
	W-15	Corridor floor By room # 905	1				X	
	W-16	F/B						
Fax results to Taylor (212) 408-2535				TURNAROUND REQUIRED: NORMAL ☐ STAT ☐ BY 1/1		COMMENTS / INSTRUCTIONS 6 hr T.A.T.		
RELINQUISHED BY (SIGNATURE) 		DATE 8/02/02 TIME 4	PRINTED NAME AL. KAGAN		RECEIVED BY (SIGNATURE) 		DATE TIME	PRINTED NAME
RELINQUISHED BY (SIGNATURE) 		DATE 8/3/02 TIME 4:30 PM	PRINTED NAME		RECEIVED BY LAB (SIGNATURE) 		DATE 8/3/02 TIME	PRINTED NAME

WHITE - OFFICE / YELLOW - LAB / BLUE - FIELD

11/9/02

CITY_21MC100_008878359

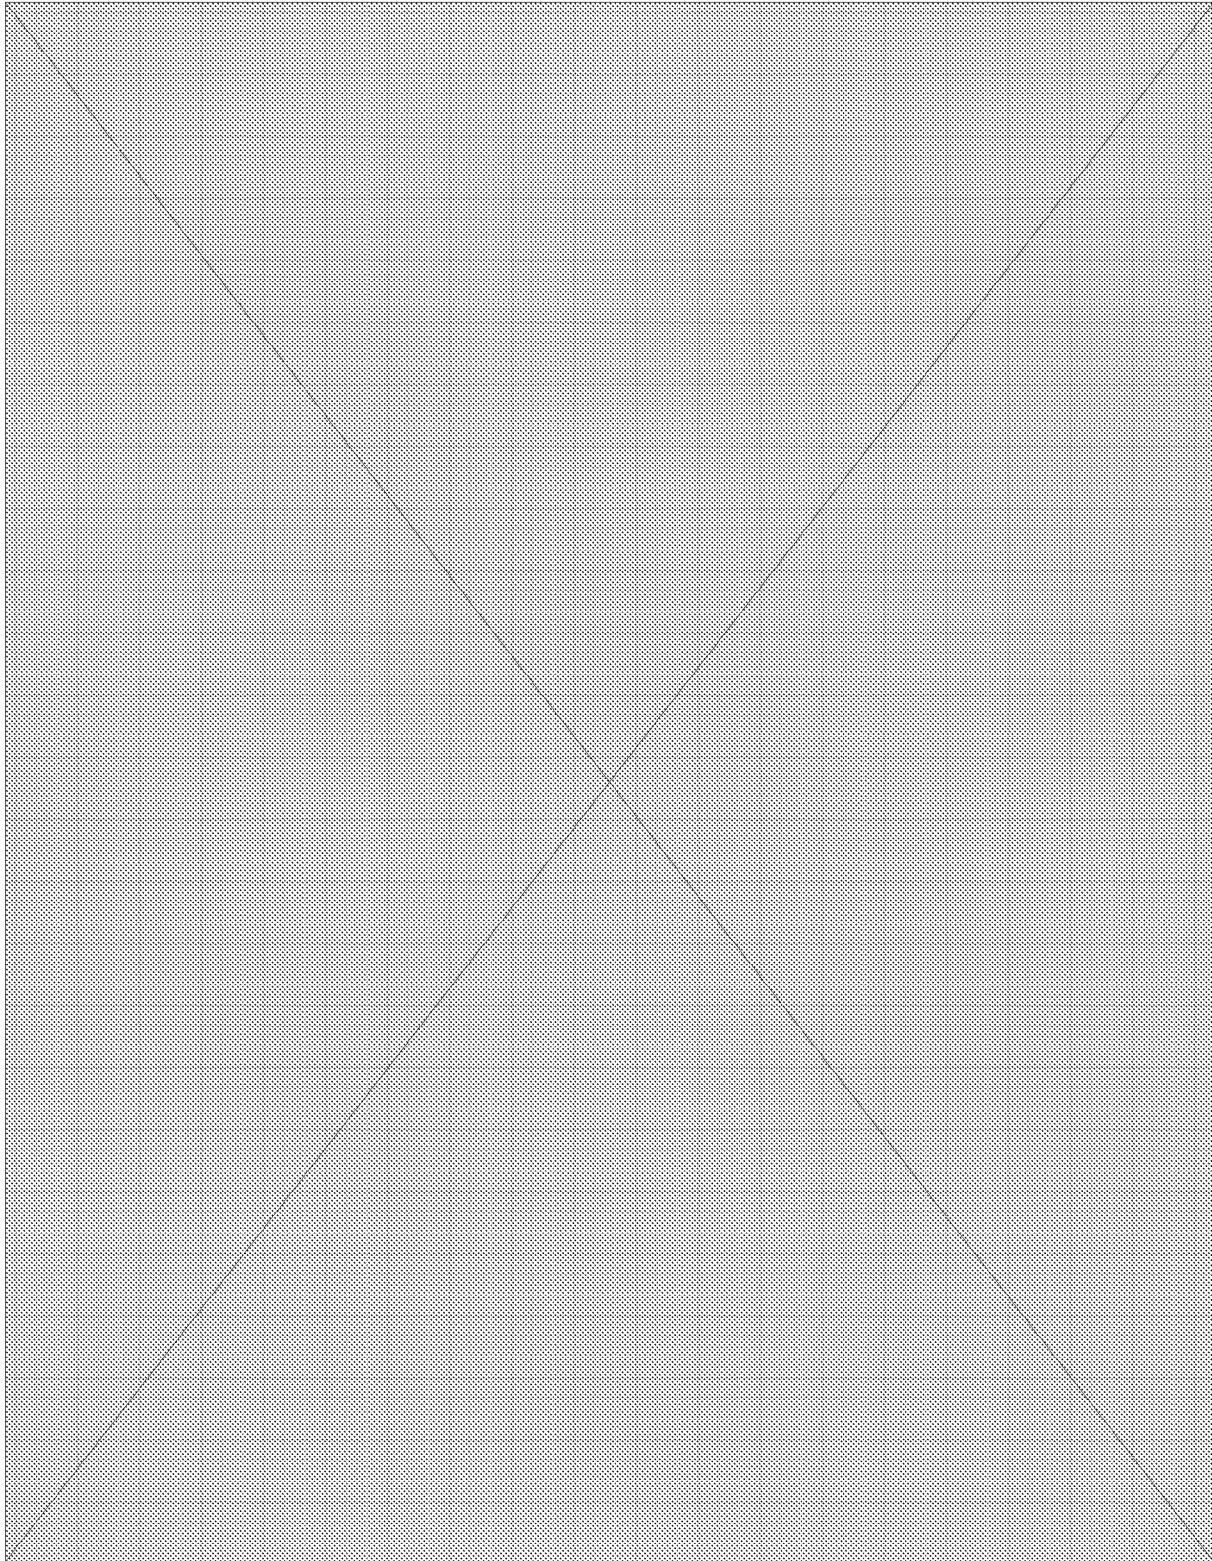

ATC ASSOCIATES, INC
 104 E 25th Street, 10th Floor
 New York, NY 10010
 Tel. 212-353-8280
 Fax 212-353-8306

REPORT DATE: 08-05-02
CLIENT: Taylor Environmental Group, Inc.
PROJECT NAME: SCA/Stuyvesant HS
 345 Chambers Street, NY
PROJECT NUMBER: M477-15217/29881
SAMPLED BY: Client
SAMPLE DATE: 08-03-02
DATE RECEIVED: 08-03-02
DATE ANALYZED: 08-03-02
SAMPLE MEDIA: Dust Wipe Sample
ANALYSIS REQUIRED: Method EPA 3050/7420

ANALYSIS RESULTS

SAMPLE ID	BATCH NO.	SAMPLE DESCRIPTION	LEAD CONCENTRATION ($\mu\text{g}/\text{ft}^2$)	DETECTION LIMIT ($\mu\text{g}/\text{ft}^2$)
W-01	20892	Rm 911 Teacher Table Lower End	<9.0	9.0
W-02	20892	Rm 911 Floor by the TV Set	<9.0	9.0
W-03	20892	Rm 913 Table by Emergency Shower	<9.0	9.0
W-04	20892	Rm 913 Floor SE Corner	<9.0	9.0
W-05	20892	Rm 925 Teacher Desk	<9.0	9.0
W-06	20892	Rm 925 Floor by SW Side Window	<9.0	9.0
W-07	20892	Rm 925B Table by the Entrance	<9.0	9.0
W-08	20892	Rm 925B Floor by the Entrance	<9.0	9.0
W-09	20892	Rm C923 Floor by the Entrance	<9.0	9.0
W-10	20892	Rm C932 Floor by the Entrance	<9.0	9.0
W-11	20892	Rm 909 Table Computer Table	<9.0	9.0
W-12	20892	Rm 909 Floor by the Entrance	<9.0	9.0
W-13	20892	Corridor Floor by Rm 939	<9.0	9.0
W-14	20892	Corridor Floor by Rm C921	<9.0	9.0
W-15	20892	Corridor Floor by Rm 905	<9.0	9.0
W-16	20892	Field Blank	<9.0 μg	9.0 μg
W-17	20892	Field Blank	<9.0 μg	9.0 μg

ATC ASSOCIATES, INC
104 E 25th Street, 10th Floor
New York, NY 10010
Tel. 212-353-8280
Fax 212-353-8306

NOTE 1:
THE REPORTING LIMIT (RL) IS 18.9 µg
NOTE 2:
HUD Guidelines for final clearance dust wipe samples: Floor 40 µg/ft², Window sills 250 µg/ft²,
Window wells 400 µg/ft², Exterior surfaces 800 µg/ft².
NOTE 3:
Blank units are in µg

CERTIFICATION AND SIGNATURES

ANALYSIS PERFORMED BY: EL

REPORT PREPARED BY: [Signature]

ATC certifies that this report is an accurate and authentic report of results obtained from the laboratory analysis.

QUALITY ASSURANCE COORDINATOR: [Signature]

LABORATORY DIRECTOR: [Signature]

ATC is accredited by the New York State Department of Health Environmental Laboratory Approval Program (ELAP) and by the American Industrial Hygiene Association (AIHA) to perform analysis of lead in paint, dust wipes, air and soil samples. (ELAP #10879), (AIHA #100229).

07400

CITY_21MC100_008878362

TAYLOR ENVIRONMENTAL GROUP, INC.
130 JERICHO TPKE., FLORAL PARK, NY 11001

030210967

1 of 1

516-358-2955
Fax 516-358-1780

08/10/2002 09:48 212-298-2538

EMEL ANALYTICAL INC

FORM 1-7-00

LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT											
CLIENT NAME/ADDRESS NJC SCA			CONTACT HANIS SAUDI		SAMPLER SIGNATURE <i>[Signature]</i>		DATE 8/9/02		TIME 11:00		
PROJECT LOCATION Stuyvesant H.S. 345 Chambers St NY			PROJECT # M477-1527-2988		SAMPLER NAME/PRINT Kirk McKenzie		SAMPLE(S) SEALED (YES) / NO		CORRECT CONTAINER(S) (YES) / NO		
SAMPLE INFORMATION:					MATRIX (CIRCLE ONE): (VAPE) PAINT SOIL OTHER						
LABORATORY #			SAMPLE #		LOCATION		AREA (FT ²)		SURFACE MATERIAL		
									WOOD METAL BRICK OTHER		
			LW-01		ROOM 907A (Chem. Storage) FLOOR - EAST OF ENTRANCE		1		X		
			LW-02		ROOM 907A (Chem. Storage) SE Shelf Top		1		X		
			FBL-1		Field Blank						
			FBL-2		Field Blank						
FAX TO 212-406-2535 & 516-358-1780					TURNAROUND REQUIRED: NORMAL ☐ STAT ☐ BY 1/1			COMMENTS / INSTRUCTIONS 6 HR. TAY			
RELINQUISHED BY (SIGNATURE) <i>[Signature]</i>			DATE 8/10/02		PRINTED NAME Kirk McKenzie			RECEIVED BY (SIGNATURE) <i>[Signature]</i>		DATE 8/10/02	
			TIME 0115							PRINTED NAME	
RELINQUISHED BY (SIGNATURE) <i>[Signature]</i>			DATE 8/10/02		PRINTED NAME Gary McKen			RECEIVED BY LAB (SIGNATURE) <i>[Signature]</i>		DATE 8/10/02	
			TIME 0500							PRINTED NAME	

RECEIVED
02 AUG 10 AM 5:08
[Signature]
EMEL ANALYTICAL INC

07180

CITY_21MC100_008878363

08/10/2002 09:48 212-290-2538

EMSL ANALYTICAL INC

PAGE 13/14

EMSL Analytical, Inc.

307 West 28th Street, New York, NY 10013

Phone: 212-290-0051 Fax: 212-290-0058 Email: manhattanlab@emsl.com



Attn: Taylor Environmental Group, Inc.
Floral Park Corporate Center
130 Jericho Tpke.
Floral Park, NY 11001

Fax: (516) 358-1780 Phone: 516-358-2955

Project: NYC SCA/Stuyvesant H.S. 345 Chambers St., New York,
N.Y. JM477-15217-29881.

Customer ID: TAYL50

Customer PO:


Received: 08/10/02 8:54 AM

EMSL Order: 030210967

EMSL Project ID:

Lead in Wipes by Flame AAS (SW 846, 7420)

Client Sample Description	Lab ID	Analyzed	Area Sampled	Lead Concentration	Notes
LW-01 Room 907A (Chem. Storage) Floor. East of Entrance.	0001		144 in²	11.0 µg/R²	
LW-02 Room 907A (Chem. Storage) SE Shelf Top	0002		144 in²	<10.0 µg/R²	
FBL-1 Field blank	0003		n/a	<10.0 µg/wipe	
FBL-2 Field blank	0004		n/a	<10.0 µg/wipe	


Laboratory Manager
or other approved signatory


Reporting time is 10 µg/wipe

ACCREDITATIONS: AHA Environmental Lead Laboratory Approval Program #102581

Page 1 of 1

07190

CITY_21MC100_008878364

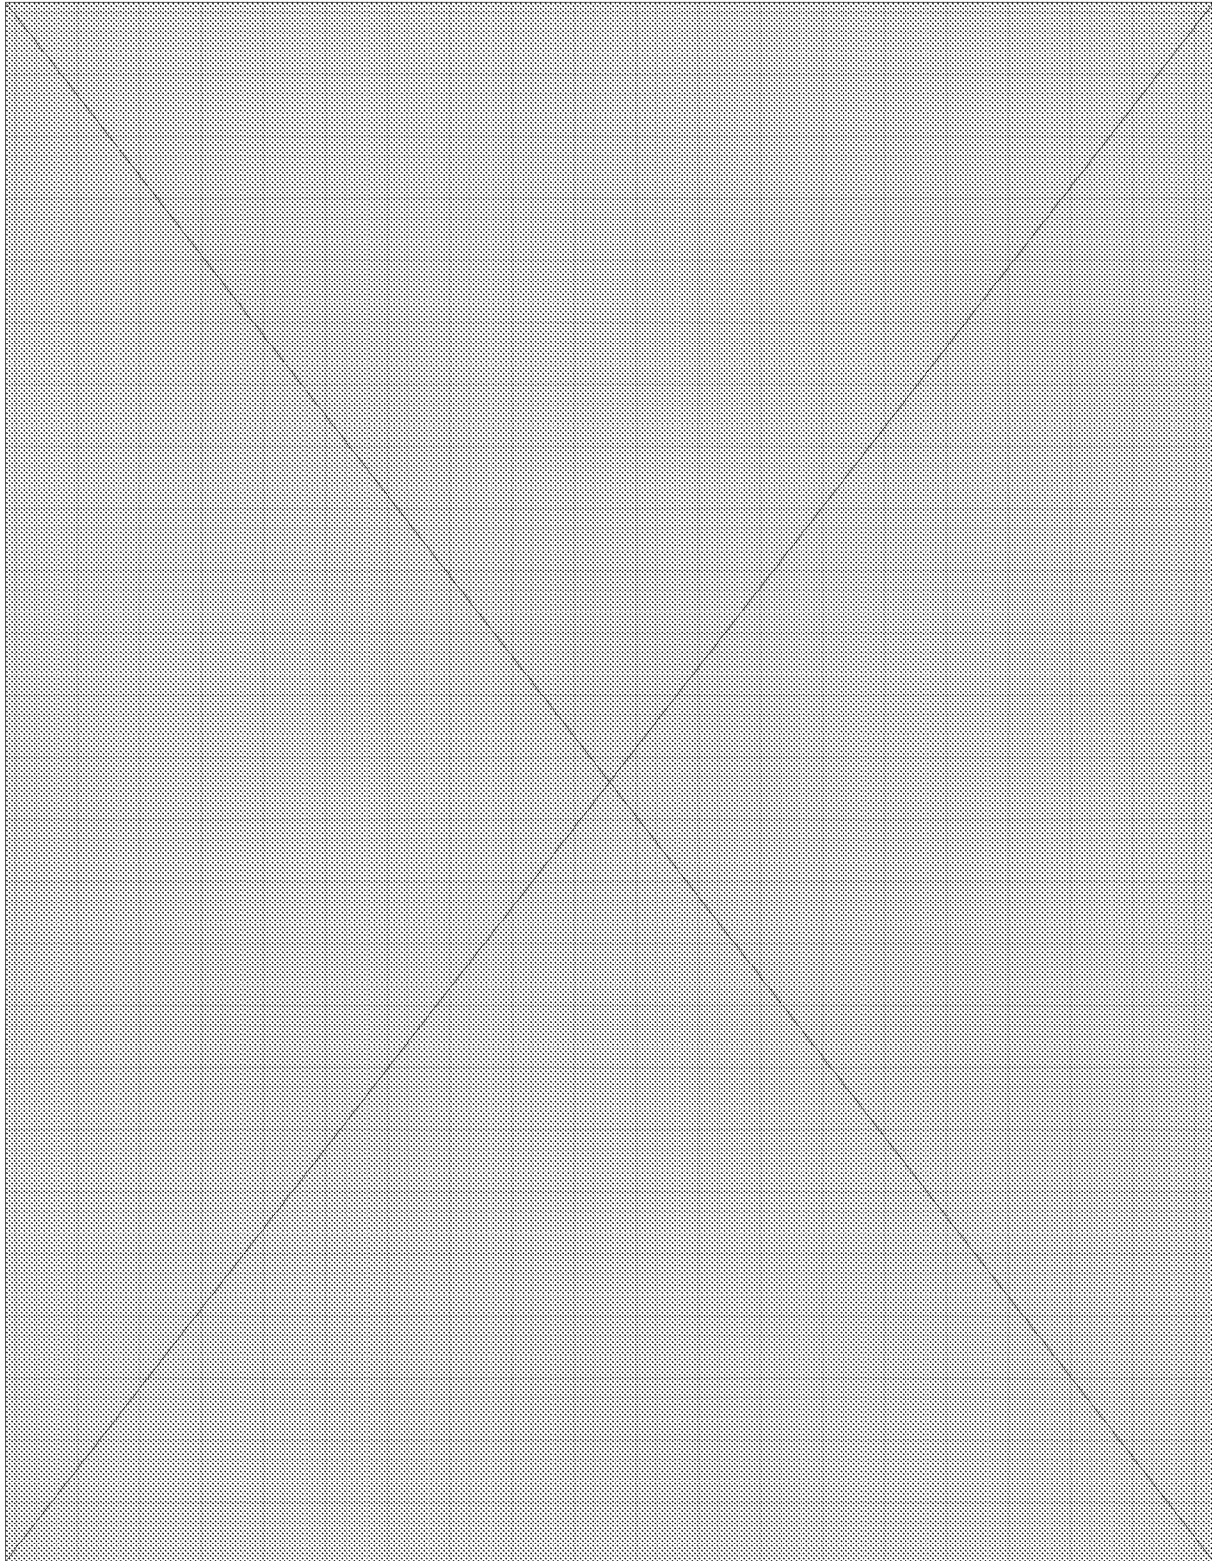

ATC ASSOCIATES, INC

104 E 25th Street, 10th Floor

New York, NY 10010

Tel. 212-353-8280

Fax 212-353-8306

REPORT DATE: 08-12-02

CLIENT: Taylor Environmental Group, Inc.

PROJECT NAME: SCA/Stuyvesant HS
345 Chambers Street, NY

PROJECT NUMBER: M477-15217-29881

SAMPLED BY: Client

SAMPLE DATE: 08-09-02
DATE RECEIVED: 08-09-02
DATE ANALYZED: 08-09-02

SAMPLE MEDIA: Dust Wipe Sample
ANALYSIS REQUIRED: Method EPA 3050/7420

ANALYSIS RESULTS

SAMPLE ID	BATCH NO.	SAMPLE DESCRIPTION	LEAD CONCENTRATION ($\mu\text{g}/\text{ft}^2$)	DETECTION LIMIT ($\mu\text{g}/\text{ft}^2$)
LW-01	21040	Rm 925A Shelf Right Side of the Entrance	<9.0	9.0
LW-02	21040	Rm 925A Floor by the Sink	<9.0	9.0
FB-1	21040	Field Blank	<9.0 μg	9.0 μg
FB-2	21040	Field Blank	<9.0 μg	9.0 μg

NOTE 1:

THE REPORTING LIMIT (RL) IS 18.0 μg

NOTE 2:

HUD Guidelines for final clearance dust wipe samples: Floor 40 $\mu\text{g}/\text{ft}^2$, Window sills 250 $\mu\text{g}/\text{ft}^2$.Window wells 400 $\mu\text{g}/\text{ft}^2$, Exterior surfaces 800 $\mu\text{g}/\text{ft}^2$.

NOTE 3:

Blank units are in μg **CERTIFICATION AND SIGNATURES**ANALYSIS PERFORMED BY: RPREPORT PREPARED BY: TJ

ATC certifies that this report is an accurate and authentic report of results obtained from the laboratory analysis.

QUALITY ASSURANCE COORDINATOR: WJSLABORATORY DIRECTOR: AMC

ATC is accredited by the New York State Department of Health Environmental Laboratory Approval Program (ELAP) and by the American Industrial Hygiene Association (AIHA) to perform analysis of lead in paint, dust wipes, air and soil samples. (ELAP #10879), (AIHA #100229).

07400

PAGE 05/07

EML ANALYTICAL INC

9557-9557-712

37:25 2002/08/07/83

TAYLOR ENVIRONMENTAL GROUP, INC.
130 JERICHO TPKE., FLORAL PARK, NY 11001

0250210610

18 13

516-358-2955


Fax 516-358-1780

LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT

CLIENT NAME/ADDRESS NYC SCA		CONTACT: Hamid Savoj		SAMPLE(S) SIGNATURE [Signature]	DATE 8/4/02	TIME	SAMPLE(S) SEALED (YES) NO	
PROJECT LOCATION: Stuyvesant H.S.		PROJECT # 1477-15217-29881		SAMPLE NAME (PRINT) Kirk McKenzie		CORRECT CONTAINER(S) (YES) NO		
SAMPLE INFORMATION:				MATRIX (CIRCLE ONE): (WIPE) PAINT SOIL OTHER				
LABORATORY #	SAMPLE #	LOCATION	AREA (FT ²)	SURFACE MATERIAL				LAB RESULT
				WOOD	METAL	BRICK	OTHER	
	LW-01	ROOM 829 - FLOOR 3' West window & 2' West wall	1				X	11.0
	LW-02	ROOM 829 - Table with END OF Lab Table	1				X	<10.0
	LW-03	ROOM 833 - FLOOR CENTER ISLE - 1st FLOOR	1				X	<10.0
	LW-04	ROOM 833 - DESK FRONT DESK - North side	1				X	<10.0
	LW-05	ROOM 835 - FLOOR 3' East ENTRANCE	1				X	<10.0
	LW-06	ROOM 835 - DESK REAR DESK - CENTER	1				X	13.0
	LW-07	ROOM 837 - FLOOR between Lab Table & East wall	1				X	<10.0
	LW-08	ROOM 837 - Table Lab Table center	1				X	<10.0
FAX Results to 212-406-2535 & 516-358-1780				TURNAROUND REQUIRED: NORMAL ☐ STAT ☐ BY 1/1		COMMENTS / INSTRUCTIONS 6 HR TAT		
RELINQUISHED BY (SIGNATURE) [Signature]		DATE 8/5/02	PRINTED NAME Kirk McKenzie		RECEIVED BY (SIGNATURE) [Signature]		DATE 8/5/02	PRINTED NAME
RELINQUISHED BY (SIGNATURE) [Signature]		DATE 8/5/02	PRINTED NAME TERESA MCMAZUR		RECEIVED BY LAB (SIGNATURE) [Signature]		DATE 8/5/02	PRINTED NAME

WHITE - OFFICE / YELLOW - LAB / PINK - CLIENT

CITY_21MC100_008878367

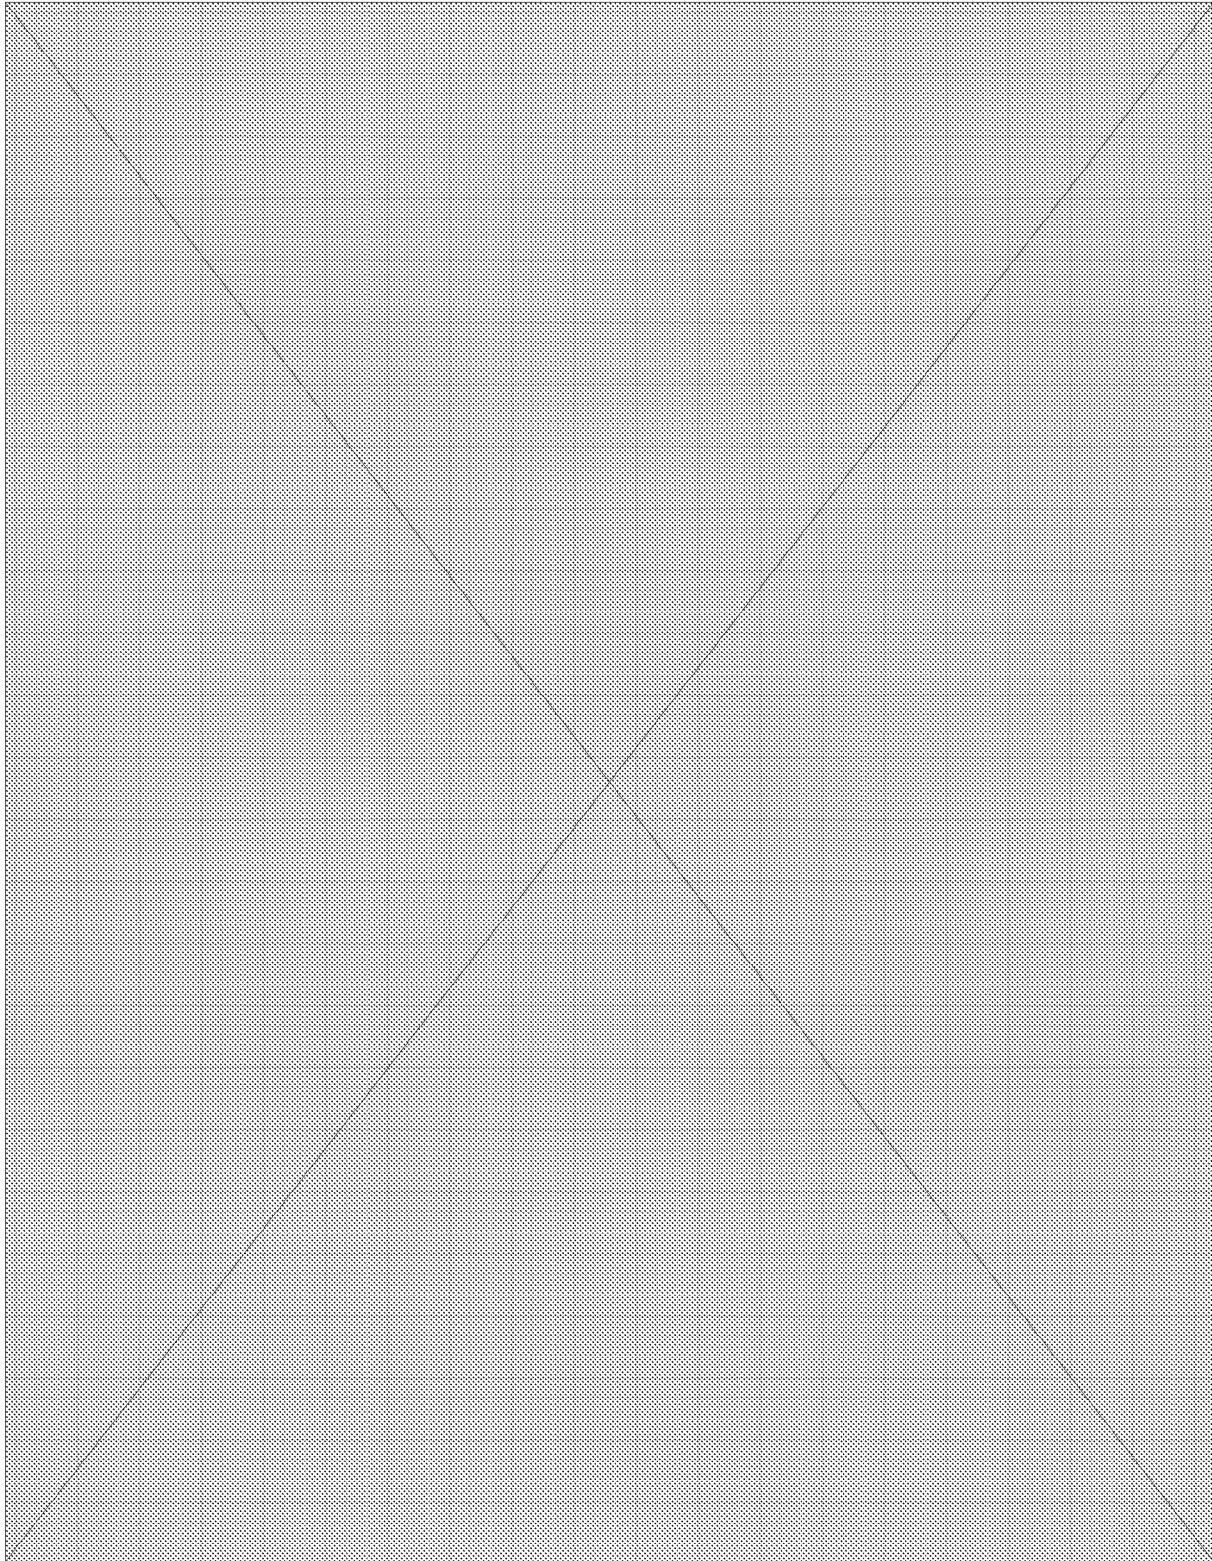

030210610 383
516-358-2955
Fax 516-358-1780

TAYLOR ENVIRONMENTAL GROUP, INC.
133 JERICHO TURNPIKE, FLORENCE PARK, NY 11001

LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT

CLIENT NAME/ADDRESS NYC SLA		CONTACT: HANNAH C. PANG		SAMPLER SIGNATURE <i>[Signature]</i>	DATE 8/4/02	TIME	SAMPLE(S) SEALED (YES) / NO
PROJECT LOCATION: Stuyvesant H.S. 345 Chambers ST. NY		PROJECT # M477-1527-29881		SAMPLER NAME (PRINT) KIRK M. KENZIE		CORRECT CONTAINER(S) (YES) / NO	
SAMPLE INFORMATION:							
LABORATORY #	SAMPLE #	LOCATION	AREA (FP)	SURFACE MATERIAL WOOD METAL BRICK OTHER		LAB RESULT ug/l	
	LW-17	ROOM 826 - FLOOR					12.0
	LW-18	ROOM 826 - TOP of					18.0
	LW-19	File Cabinet - West side					11.0
	LW-20	Room 834 - Bathroom					<10.0
	LW-21	Room 834 - Entrance					<10.0
	FBL-1	Field Blank					
	FBL-2	Field Blank					
	FBL-3	Field Blank					

RELINQUISHED BY (SIGNATURE) <i>[Signature]</i>	DATE 8/1/02	PRINTED NAME KIRK M. KENZIE	RECEIVED BY (SIGNATURE) <i>[Signature]</i>	DATE 8-5-02	PRINTED NAME JOHN [Signature]
RELINQUISHED BY (SIGNATURE) <i>[Signature]</i>	DATE 8-5-02	PRINTED NAME JOHN [Signature]	RECEIVED BY LAB (SIGNATURE)	DATE	PRINTED NAME

COMMENTS / INSTRUCTIONS
6 HZ 797

RECEIVED
8/5/02

06/05/2002 07:25 212-290-2538

EMSL ANALYTICAL INC

Page 03/03

EMSL Analytical, Inc.

307 West 38th Street, New York, NY 10013

Phone: 212-290-0051 Fax: 212-290-0055 Email: manhattanlab@emsl.com



Attn: Taylor Environmental Group, Inc.
 Floral Park Corporate Center
 130 Jericho Tpke.
 Floral Park, NY 11001

Fax: (516) 358-1780 Phone: 516-358-2955

Project: NYC SCA/M477-15217-27891/Stuyvesant H.S./345
 Chambers St., New York, N.Y.

Customer ID: TAYL50

Customer PO:

Received: 06/05/02 7:08 AM

EMSL Order: 030210810

EMSL Project ID:

Lead in Wipes by Flame AAS (SW 846, 7420)

Client Sample Description	Lab ID	Analyzed	Area Sampled	Lead Concentration	Notes
LW-01 Room 829-Floor 3' of West Unit Vent & 2' West Wall	0001		144 in ²	11.0 µg/ft ²	
LW-02 Room 829-Table North End of Lab Table	0002		144 in ²	<10.0 µg/ft ²	
LW-03 Room 833-Floor Center Isle-1st Tier	0003		144 in ²	<10.0 µg/ft ²	
LW-04 Room 833-Desk Front Desk-North Side	0004		144 in ²	<10.0 µg/ft ²	
LW-05 Room 835-Floor 3' of East Entrance	0005		144 in ²	<10.0 µg/ft ²	
LW-06 Room 835-Desk Rear Desk-Center	0006		144 in ²	13.0 µg/ft ²	
LW-07 Room 837-Floor Between Lab Table & East Wall	0007		144 in ²	<10.0 µg/ft ²	
LW-08 Room 837-Table Lab Table Center	0008		144 in ²	<10.0 µg/ft ²	
LW-09 Room 839-Floor 3' of West Entrance	0009		144 in ²	15.0 µg/ft ²	
LW-10 Room 839-Desk Front South Side	0010		144 in ²	12.0 µg/ft ²	
LW-11 Room 840-Floor Below East Cabinet	0011		144 in ²	<10.0 µg/ft ²	
LW-12 Room 840-Desk Teacher's Center	0012		144 in ²	10.0 µg/ft ²	
LW-13 Room 838-Floor East Side of East Unit Vent	0013		144 in ²	<10.0 µg/ft ²	
LW-14 Room 838-File Cabinet Top at (E. File Cab.)	0014		144 in ²	<10.0 µg/ft ²	
LW-15 Room 836-Floor-2' South of Center Wall Column	0015		144 in ²	<10.0 µg/ft ²	
LW-16 Room 838-Teacher's Desk Center	0016		144 in ²	13.0 µg/ft ²	
LW-17 Room 825-Floor 3' of	0017		144 in ²	12.0 µg/ft ²	

Eric B. B. B.
 Laboratory Manager
 or other approved signatory

Reporting limit is 10 µg/wipe
 ACCREDITATIONS: AHA Environmental Lead Laboratory Approval Program #102521

Page 1 of 2

07196

CITY_21MC100_008878370

08/05/2002 07:35 212-298-2538

EMSL ANALYTICAL INC

PAGE 89/07

EMSL Analytical, Inc.

307 West 38th Street, New York, NY 10013

Phone: 212-290-0051 Fax: 212-290-0058 Email: manhattanlab@emsl.com




Attn: Taylor Environmental Group, Inc.
Floral Park Corporate Center
130 Jericho Tpke.
Floral Park, NY 11001
Fax: (516) 358-1780 Phone: 516-358-2655
Project: NYC SCA/M477-15217-27881/Stuyvesant H.S./345
Chambers St., New York, N.Y.

Customer ID: TAYLSD
Customer PO:
Received: 08/05/02 7:03 AM
EMSL Order: 030210810
EMSL Project ID:

Lead in Wipes by Flame AAS (SW 846, 7420)

Client Sample Description	Lab ID	Analyzed	Area Sampled	Lead Concentration	Notes
Entrance					
LW-18 Room 825-Top OF File Cabinet-West Side	0018		144 in ²	18.0 µg/in ²	
LW-19 Room 830-Bathroom Floor-Center Room	0019		144 in ²	11.0 µg/in ²	
LW-20 Room 834-Bathroom Floor, 3' of Entrance	0020		144 in ²	<10.0 µg/in ²	
LW-21 Corridor Floor-Between Rooms 836 & 839	0021		144 in ²	<10.0 µg/in ²	
FBL-1 Field blank	0022		n/a	<10.0 µg/wipe	
FBL-2 Field blank	0023		n/a	<10.0 µg/wipe	
FBL-3 Field blank	0024		n/a	<10.0 µg/wipe	


Erin Blaylock
Laboratory Manager
or other approved signatory

Reporting limit is 10 µg/wipe
ACCREDITATIONS: ANA Environmental Lead Laboratory Approval Program #102581

Page 2 of 2

07197

CITY_21MC100_008878371

TAYLOR ENVIRONMENTAL GROUP, INC.
130 JERICHO TPKE., FLORAL PARK, NY 11001

20949

516-358-2955

Fax 516-358-1780

LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT

CLIENT NAME/ADDRESS SCA		CONTACT Hamid Savas	SAMPLER (SIGNATURE) <i>[Signature]</i>	DATE 8/5/02	TIME	SAMPLE(S) SEALED (YES) NO
PROJECT LOCATION: Stuyvesant H.S.		PROJECT # M477-15217/29881	SAMPLER NAME (PRINT) AL. Kazanov	CORRECT CONTAINER(S) (YES) NO		
SAMPLE INFORMATION:		MATRIX (CIRCLE ONE): (WIP) PAINT SOIL OTHER		LAB RESULT, ug/ft²		
LABORATORY #	SAMPLE #	LOCATION	AREA (FT ²)	SURFACE MATERIAL WOOD METAL BRICK OTHER		LAB RESULT, ug/ft²
	W-01	Room # 813 floor by entrance	1		X	49.0
	W-02	Room # 813 A floor by the sink	1		X	49.0
	W-03	Room # 812 B floor by entrance	1		X	49.0
	W-04	Room # 817 Table by the entrance	1		X	49.0
	W-05	Room # 817 Floor S-W corner	1		X	49.0
	W-06	Room # 817 A TV stand middle of the room	1	X		49.0
	W-07	Room # 817 A floor by the entrance	1		X	49.0
	W-08	Room # 827 A TV stand middle of the room	1	X		49.0

TURNAROUND REQUIRED:

NORMAL ☐ STAT ☐ BY **1/1**

COMMENTS / INSTRUCTIONS


6 hr T.A.T.

RELINQUISHED BY (SIGNATURE) <i>[Signature]</i>	DATE 8/5/02	PRINTED NAME AL. Kazanov	RECEIVED BY (SIGNATURE) <i>[Signature]</i>	DATE	PRINTED NAME
RELINQUISHED BY (SIGNATURE) <i>[Signature]</i>	DATE 8/6/02	PRINTED NAME G. McKerr	RECEIVED BY LAB (SIGNATURE) <i>[Signature]</i>	DATE 8/6/02	PRINTED NAME R. Droudina

WHITE - OFFICE / YELLOW - LAB / PINK - CLIENT

07198

CITY_21MC100_008878372

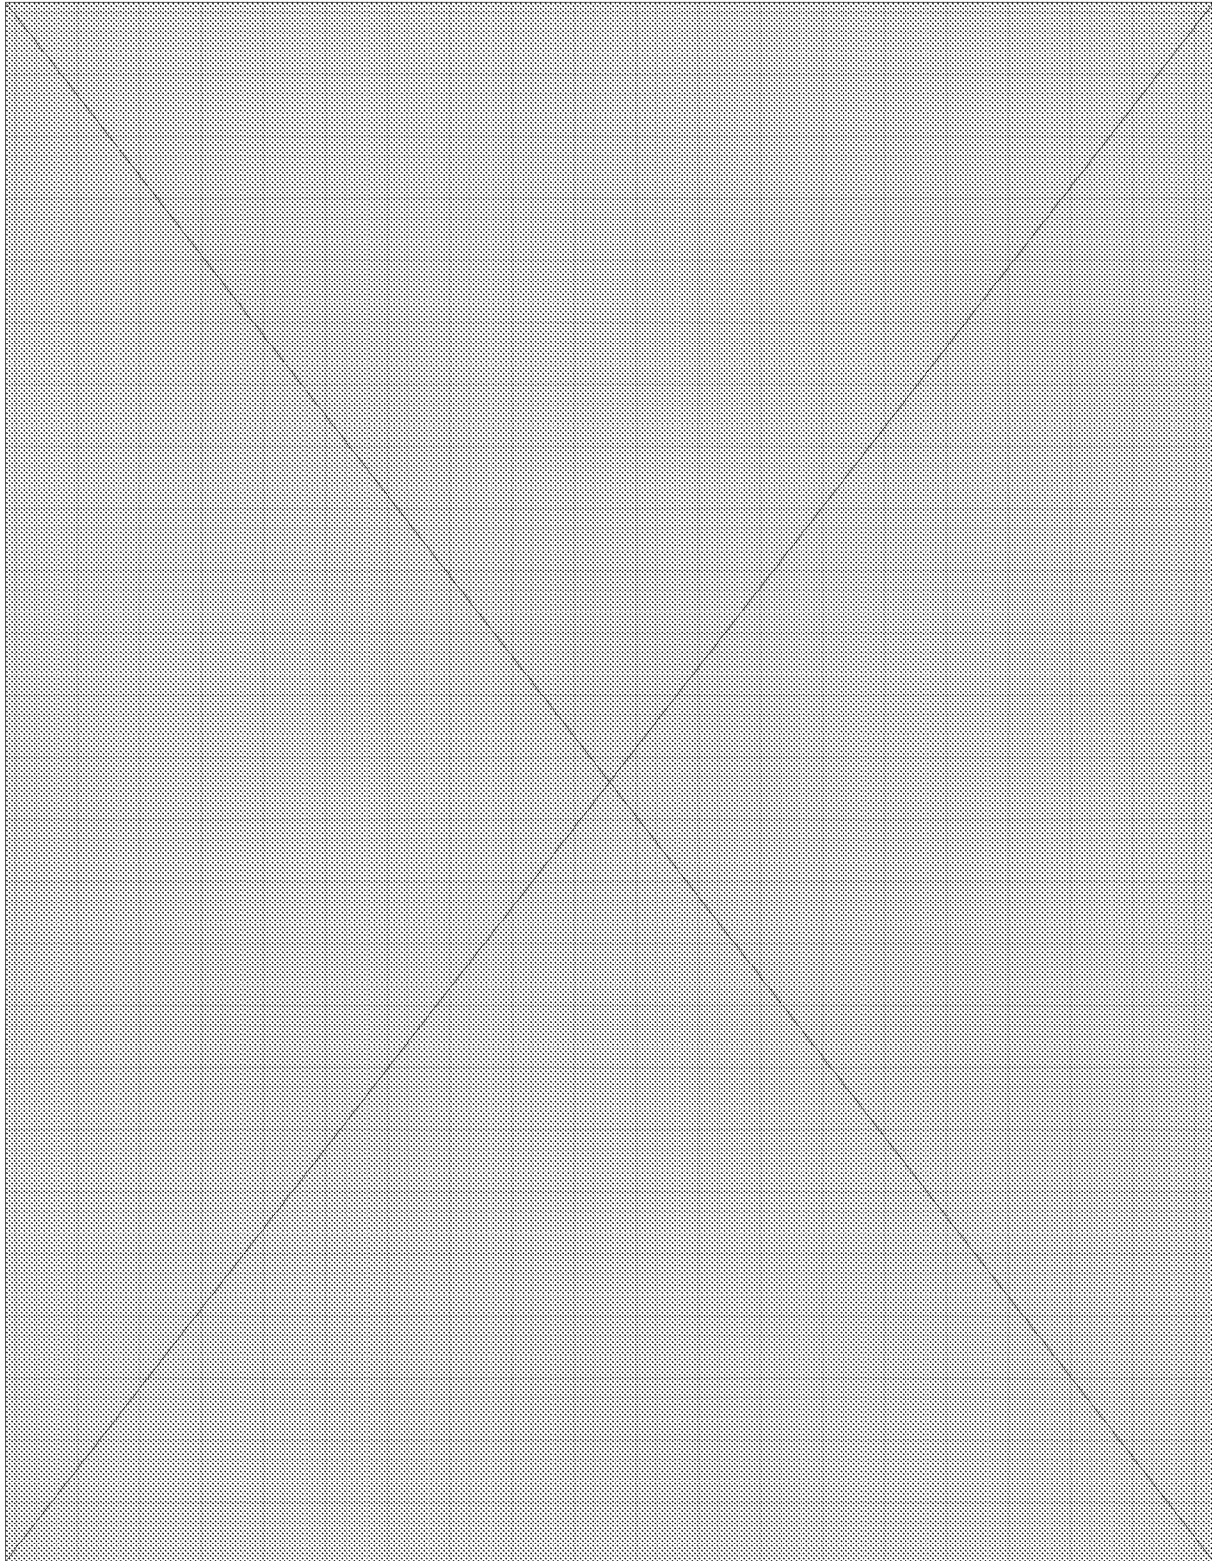

ATC ASSOCIATES, INC
104 E 25th Street, 10th Floor
New York, NY 10010
Tel 212-353-8280
Fax 212-353-8306

REPORT DATE: 08-07-02
CLIENT: Taylor Environmental Group, Inc.
PROJECT NAME: SCA/Stuyvesant HS
345 Chambers Street, NY
PROJECT NUMBER: M477-15217/29881
SAMPLED BY: Client
SAMPLE DATE: 08-05-02
DATE RECEIVED: 08-06-02
DATE ANALYZED: 08-06-02
SAMPLE MEDIA: Dust Wipe Sample
ANALYSIS REQUIRED: Method EPA 3050/7420

ANALYSIS RESULTS

SAMPLE ID	BATCH NO.	SAMPLE DESCRIPTION	LEAD CONCENTRATION ($\mu\text{g}/\text{ft}^2$)	DETECTION LIMIT ($\mu\text{g}/\text{ft}^2$)
W-01	20949	Room #813 Floor by Entrance	<9.0	9.0
W-02	20949	Room #813A Floor by Sink	<9.0	9.0
W-03	20949	Room #815B Floor by Entrance	<9.0	9.0
W-04	20949	Room #817 Table by Entrance	<9.0	9.0
W-05	20949	Room #817 Floor SW Corner	<9.0	9.0
W-06	20949	Room #817A TV Stand Middle of Room	<9.0	9.0
W-07	20949	Room #817A Floor by Entrance	<9.0	9.0
W-08	20949	Room #827A TV Stand Middle of Room	<9.0	9.0
W-09	20949	Room #827A Floor by Entrance	<9.0	9.0
W-10	20949	Room #827 Teacher Table Lower End	<9.0	9.0
W-11	20949	Room #827 Floor by Middle Window	<9.0	9.0
W-12	20949	Room #815 Teacher Table Lower End	<9.0	9.0
W-13	20949	Room #815 Floor by SE Side Window	<9.0	9.0

07200

ATC ASSOCIATES, INC
 104 E 25th Street, 10th Floor
 New York, NY 10010
 Tel. 212-353-8280
 Fax 212-353-8306

W-14	20949	Field Blank	<9.0 µg	9.0 µg
W-15	20949	Field Blank	<9.0 µg	9.0 µg

NOTE 1:

THE REPORTING LIMIT (RL) IS 15.0 µg

NOTE 2:

HUD Guidelines for final clearance dust wipe samples: Floor 40 µg/ft², Window sills 250 µg/ft².

Window walls 400 µg/ft², Exterior surfaces 800 µg/ft²

NOTE 3:

Blank units are in µg

CERTIFICATION AND SIGNATURES

ANALYSIS PERFORMED BY: _____

REPORT PREPARED BY: _____

ATC certifies that this report is an accurate and authentic report of results obtained from the laboratory analysis.

QUALITY ASSURANCE COORDINATOR: _____

LABORATORY DIRECTOR: _____

ATC is accredited by the New York State Department of Health Environmental Laboratory Approval Program (ELAP) and by the American Industrial Hygiene Association (AIHA) to perform analysis of lead in paint, dust wipes, air and soil samples. (ELAP #10879), (AIHA #100229).

07201

CITY_21MC100_008878375

TAYLOR ENVIRONMENTAL GROUP, INC.
130 JERICHO TPKE., FLORAL PARK, NY 11001

030210730

516-358-2955
Fax 516-358-1789

08/07/2002 09:45 212-258-2536

ENGL ANALYTICAL INC

PAGE 24/28

LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT

CLIENT NAME/ADDRESS NYC SCA		CONTACT HARID SAVOJ	SAMPLER SIGNATURE <i>Carlos</i>	DATE 8-6-02	TIME	SAMPLE(S) SEALED ☒ YES / ☐ NO	
PROJECT LOCATION STUYVESANT H.S.		PROJECT # H477-15217/24881	SAMPLER NAME (PRINT) CARLOS FORAT		CORRECT CONTAINER(S) ☒ YES / ☐ NO		
SAMPLE INFORMATION:		MATRIX (CIRCLE ONE) ☒ VAPE ☐ PAINT ☐ SOIL ☐ OTHER					
LABORATORY #	SAMPLE #	LOCATION	AREA (FT ²)	SURFACE MATERIAL WOOD ☐ METAL ☐ BRICK ☐ OTHER			
	LW-01	ROOM # 801 Floor by window.	1 FT			FL Tile	12.0
	LW-02	ROOM # 801 DESK by Entrance	1 FT	X			<10.0
	LW-03	ROOM # 802 FLOOR by Entrance.	1 FT			tile	<10.0
	LW-04	ROOM # 802 TABLE by Entrance	1 FT	X			<10.0
	LW-05	ROOM # 802A FLOOR AT CENTER	1 FT			tile	<10.0
	LW-06	ROOM # 802A TABLE by Windows.	1 FT	X			<10.0
	LW-07	ROOM # 802B FLOOR AT CENTER	1 FT			tile	<10.0
	LW-08	ROOM # 802B TABLE by window	1 FT	X			11.0
TURNAROUND REQUIRED: NORMAL ☐ STAT ☐ BY 1/1			COMMENTS / INSTRUCTIONS				
RELINQUISHED BY (SIGNATURE) <i>Carlos</i>	DATE 8-6-02 TIME 1752	PRINTED NAME	RECEIVED BY (SIGNATURE) <i>gkty</i>		DATE 8/6/02 TIME 5540	PRINTED NAME	
RELINQUISHED BY (SIGNATURE)	DATE TIME	PRINTED NAME	RECEIVED BY LAB (SIGNATURE)		DATE TIME	PRINTED NAME	

07202

CITY_21MC100_008878376

TAYLOR ENVIRONMENTAL GROUP, INC.
130 JERICHO TPKE., FLORAL PARK, NY 11001

030210730

516-358-2955
Fax 516-358-1780

05/07/2002 08:45 212-298-2538

ENSL ANALYTICAL INC

PAGE 03/03


LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT

CLIENT NAME/ADDRESS NYC SCA		CONTACT HAMID SAUDJ.		SAMPLER (SIGNATURE) <i>[Signature]</i>		DATE 8-6-02		TIME		SAMPLE(S) SEALED ☒ YES ☐ NO	
PROJECT LOCATION: STUYVESANT H.S.		PROJECT # H477-15217 / 29881		SAMPLER NAME (PRINT) CARLOS JORDAN						CORRECT CONTAINER(S) ☒ YES ☐ NO	
SAMPLE INFORMATION:				MATRIX (CIRCLE ONE) ☒ WIRE ☐ PAINT ☐ SOIL ☐ OTHER							
LABORATORY #	SAMPLE #	LOCATION		AREA (FT ²)	SURFACE MATERIAL WOOD METAL BRICK OTHER				LAB RESULT <i>[Signature]</i>		
	LW-09	ROOM # 802C Floor by entrance		1					✓	13.0	
	LW-10	ROOM # 802C by Book Shelf		1		✓				<10.0	
	LW-11	ROOM # 803 Floor AT center		4					Tile	<10.0	
	LW-12	ROOM # 803 Table center by window		1	✓					<10.0	
	LW-13	ROOM # 807 Floor AT center		4					Tile	<10.0	
	LW-14	ROOM # 807 Table AT center on book		1	✓					<10.0	
	LW-15	ROOM # 807A Floor AT center		1					Tile	<10.0	
	LW-16	ROOM # 807A - Book Shelf AT left side		1		✓				<10.0	
				TURNAROUND REQUIRED: NORMAL ☐ STAT ☐ BY / /				COMMENTS / INSTRUCTIONS			
RELINQUISHED BY (SIGNATURE) <i>[Signature]</i>		DATE 8-6-02 TIME 1752		PRINTED NAME		RECEIVED BY (SIGNATURE) <i>[Signature]</i>		DATE 8/6/02 TIME 536 PM		PRINTED NAME	
RELINQUISHED BY (SIGNATURE)		DATE		PRINTED NAME		RECEIVED BY LAB (SIGNATURE)		DATE		PRINTED NAME	
		TIME						TIME			

WHITE - OFFICE / YELLOW - LAB / PINK - CLIENT

07203

CITY_21MC100_008878377

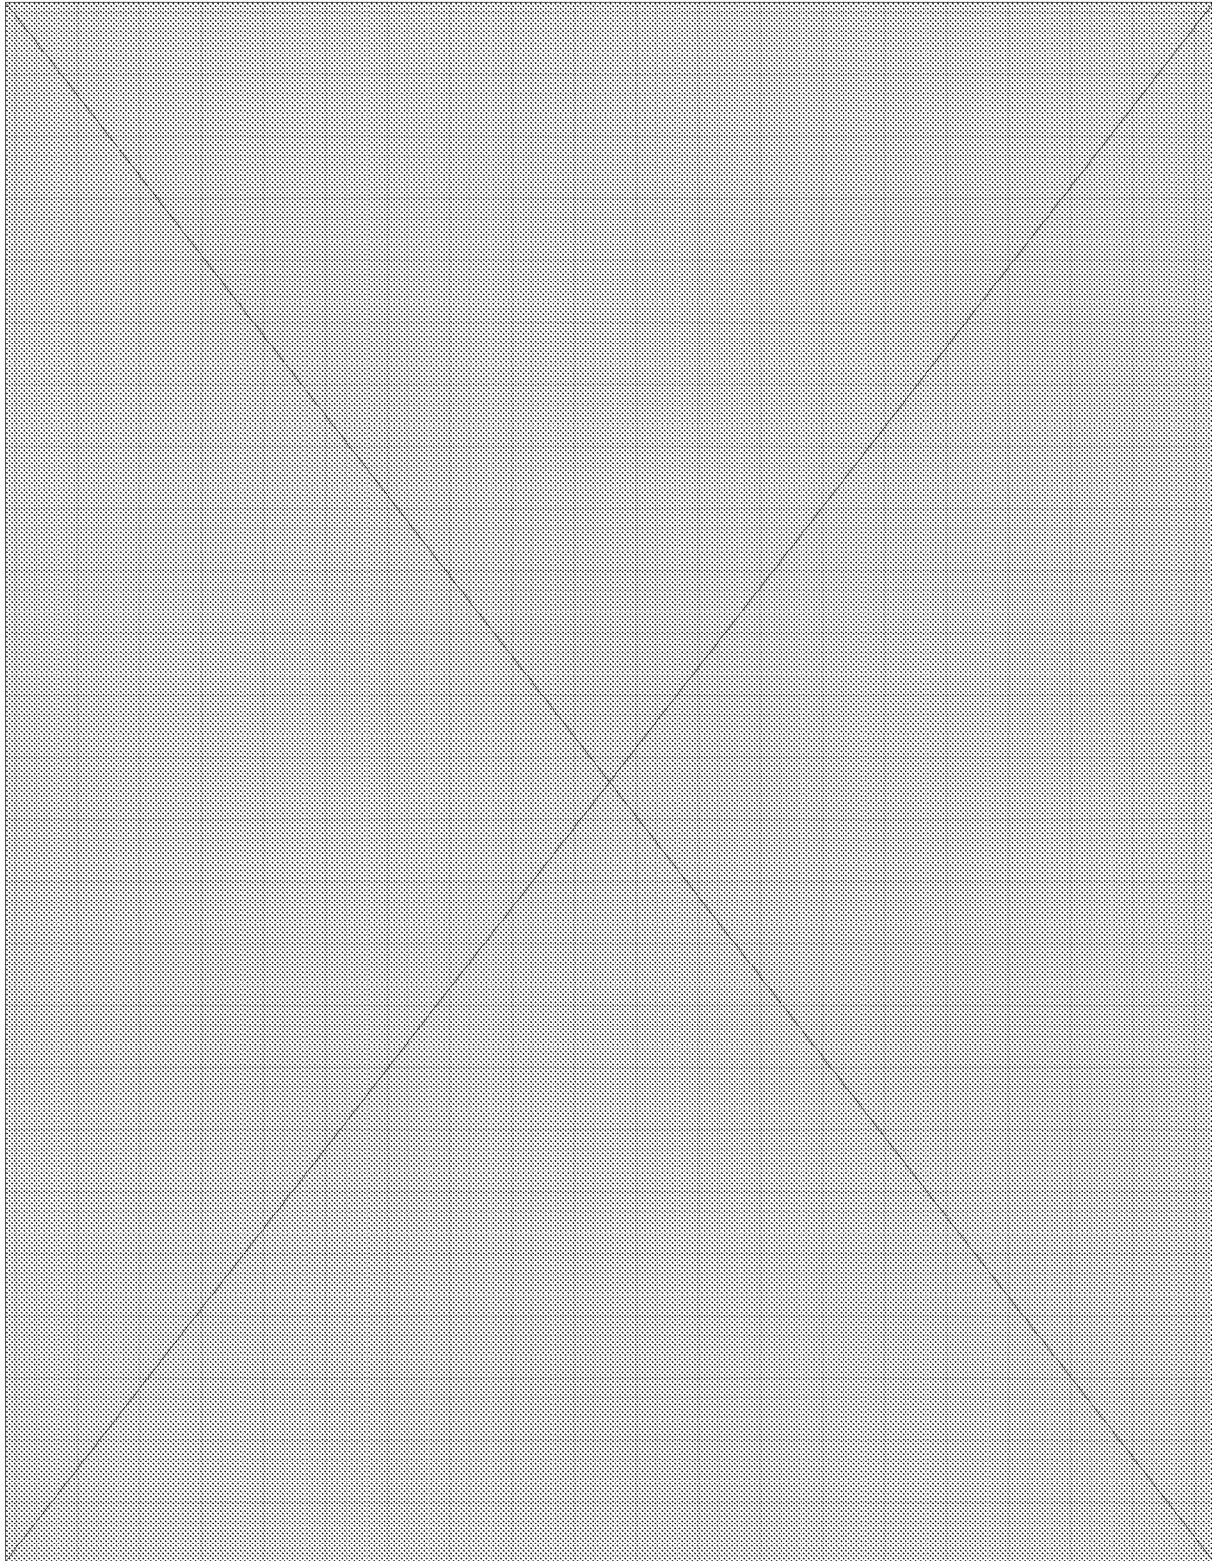

TAYLOR ENVIRONMENTAL GROUP, INC.
130 JERICHO TPKE., FLORAL PARK, NY 11001

030210730

516-358-2955
Fax 516-358-1780

08/07/2002 08:45 212-298-2538

ENSL ANALYTICAL INC

PAGE 07/38

LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT

CLIENT NAME/ADDRESS NYC SOA		CONTACT: HAROLD SAVOJ		SAMPLER (SIGNATURE) <i>[Signature]</i>	DATE 8-6-02	TIME	SAMPLE(S) SEALED ☒ YES ☐ NO	
PROJECT LOCATION: STANQUASAT H.S.		PROJECT # H477-15217/29881		SAMPLER NAME (PRINT) CARLOS TORRES			CORRECT CONTAINER(S) ☒ YES ☐ NO	
SAMPLE INFORMATION:				MATRIX (CIRCLE ONE): ☒ W/PE ☐ PAINT ☐ SOIL ☐ OTHER				
LABORATORY #	SAMPLE #	LOCATION	AREA (FT ²)	SURFACE MATERIAL				LAB RESULT
				WOOD	METAL	BRICK	OTHER	
	LW-25	ROOM # 821 Floor AT CENTER	1 FT ²				☒	<10.0
	LW-26	ROOM # 821 AT STAND AT CENTER OF ROOM	1 FT ²		☒			<10.0
	FB-01	FIELD BLANK						-
	FB-02	↓						-
	FB-03	↓						-
	LW-27	8 FL CORRIDOR IN FRONT OF STAIRWELL E	1 FT ²					<10.0
	LW-28	8 FL CORRIDOR by ROOM # 815	1 FT ²					<10.0
				TURNAROUND REQUIRED: NORMAL ☐ STAT ☐ BY 1/1				COMMENTS / INSTRUCTIONS
RELINQUISHED BY (SIGNATURE) <i>[Signature]</i>		DATE 8-6-02	PRINTED NAME	RECEIVED BY (SIGNATURE) <i>[Signature]</i>		DATE 8/6/02	PRINTED NAME	
RELINQUISHED BY (SIGNATURE)		TIME 1:52		RECEIVED BY LAB (SIGNATURE)		TIME 5:32		

WHITE - OFFICE / YELLOW - LAB / PINK - CLIENT

07205

CITY_21MC100_008878379

TAYLOR ENVIRONMENTAL GROUP, INC.
130 JERICHO TPKE., FLORAL PARK, NY 11001

030210730

516-358-2955
Fax 516-358-1780

08/07/2002 08:45

212-298-0538

ENGL ANALYTICAL INC

PAGE 08/08

LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT

CLIENT NAME/ADDRESS NYCSCA		CONTACT HAN DY SAVOY		SAMPLER (SIGNATURE) <i>Carla...</i>	DATE 8-6-02	TIME	SAMPLE(S) SEALED YES NO	
PROJECT LOCATION: Stuyvesant HS CHAMBERS ST. NY, NY		PROJECT # H474-15217/79881		SAMPLER NAME (PRINT) CABLOS J. TORAT		CORRECT CONTAINER(S) YES NO		
SAMPLE INFORMATION:				MATRIX (CIRCLE ONE): WIFE PAINT SOIL OTHER				
LABORATORY #	SAMPLE #	LOCATION	AREA (FT ²)	SURFACE MATERIAL				LAB RESULT
				WOOD	METAL	BRICK	OTHER	
	LW-29	Room C821 - Floor Center	11				✓	<10.0
	LW-30	Room C823 - Floor Center	1				✓	<10.0
	LW-31	Room C828 (Barrister Blvd Lobby) Floor - center	1				✓	<10.0
	LW-32	Room C832 - Elev. shaft Floor - center	1				✓	<10.0
	FB-4	Field Blank						-
				TURNAROUND REQUIRED: NORMAL ☐ STAT ☐ BY 11				COMMENTS / INSTRUCTIONS
RELINQUISHED BY (SIGNATURE) <i>Carla...</i>		DATE 8-6-02 TIME 1152	PRINTED NAME		RECEIVED BY (SIGNATURE) <i>[Signature]</i>		DATE 8/6/02 TIME 550pm	PRINTED NAME
RELINQUISHED BY (SIGNATURE)		DATE TIME	PRINTED NAME		RECEIVED BY LAB (SIGNATURE)		DATE TIME	PRINTED NAME

WHITE - OFFICE / YELLOW - LAB / PINK - CLIENT

CITY_21MC100_008878380

08/07/2002 08:46 212-290-2538

EMSL ANALYTICAL INC

PAGE 01/06

EMSL Analytical, Inc.

307 West 35th Street, New York, NY 10018

Phone: 212-290-0051 Fax: 212-290-0058 Email: manhattanlab@emsl.com



Attn: Taylor Environmental Group, Inc.
 Floral Park Corporate Center
 130 Jericho Turnpike
 Floral Park, NY 11001

Fax: (516) 358-1780

Phone: 516-358-2955

Project: M-477-15217/29881/NYC SCA/ STUYVESANT H.S.

Customer ID: TAYL50

Customer PO:

Received: 08/06/02 5:55 PM

EMSL Order: 020210730

EMSL Project ID:

Lead in Wipes by Flame AAS (SW 846, 7420)

Client Sample Description	Lab ID	Analyzed	Area Sampled	Lead Concentration	Notes
LW-01 ROOM #801 FLOOR BY WINDOW	0001		144 in ²	12.0 µg/ft ²	
LW-02 ROOM #801 DESK BY ENTRANCE	0002		144 in ²	<10.0 µg/ft ²	
LW-03 ROOM #802 FLOOR BY ENTRANCE	0003		144 in ²	<10.0 µg/ft ²	
LW-04 ROOM #802 TABLE BY ENTRANCE	0004		144 in ²	<10.0 µg/ft ²	
LW-05 ROOM #802A FLOOR AT CENTER	0005		144 in ²	<10.0 µg/ft ²	
LW-06 ROOM #802A TABLE BY WINDOWS	0006		144 in ²	<10.0 µg/ft ²	
LW-07 ROOM #802B FLOOR AT CENTER	0007		144 in ²	<10.0 µg/ft ²	
LW-08 ROOM #802B TABLE BY WINDOW	0008		144 in ²	11.0 µg/ft ²	
LW-09 ROOM #802C FLOOR BY ENTRANCE	0009		144 in ²	13.0 µg/ft ²	
LW-10 ROOM #802C BY BOOK SHELF	0010		144 in ²	<10.0 µg/ft ²	
LW-11 ROOM #803 FLOOR AT CENTER	0011		144 in ²	<10.0 µg/ft ²	
LW-12 ROOM #803 TABLE CENTER BY WINDOW	0012		144 in ²	<10.0 µg/ft ²	
LW-13 ROOM #807 FLOOR AT CENTER	0013		144 in ²	<10.0 µg/ft ²	
LW-14 ROOM #807 TABLE AT CENTER OF ROOM	0014		144 in ²	<10.0 µg/ft ²	
LW-15 ROOM #807A FLOOR AT CENTER	0015		144 in ²	<10.0 µg/ft ²	
LW-16 ROOM #807A BOOK SHELF AT LEFT SIDE	0016		144 in ²	<10.0 µg/ft ²	
LW-17 ROOM #811 FLOOR BY ENTRANCE	0017		144 in ²	<10.0 µg/ft ²	

Eric B. Joo
 Laboratory Manager
 or other approved signatory

Respiratory limit is 10 µg/m³

ACCREDITATIONS: AIHA/NIOSH/NIH Lead Laboratory Approval Program #10581

Page 1 of 3

07207

08/37/2002 08:45 212-290-2536

EMSL ANALYTICAL INC

PAGE 02/08

EMSL Analytical, Inc.

307 West 38th Street, New York, NY 10018

Phone: 212-250-0051 Fax: 212-250-0052 Email: manhattanlab@emsl.com



Attn: Taylor Environmental Group, Inc.
 Floral Park Corporate Center
 130 Jericho Tpke.
 Floral Park, NY 11001

Fax: (516) 358-1780

Phone: 516-358-2955

Project: M-477-16217/ 23881/ NYC SCAT STUYVESANT H.S.

Customer ID: TAYL50

Customer PO:

Received: 08/08/02 5:58 PM

EMSL Order: 030210730

EMSL Project ID:

Lead in Wipes by Flame AAS (SW 846, 7420)

Client Sample Description	Lab ID	Analyzed	Area Sampled	Lead Concentration	Notes
LW-18 ROOM #811 TABLE AT CENTER OF ROOM	0018		144 in ²	<10.0 µg/ft ²	
LW-19 ROOM #804 FLOOR AT CENTER	0019		144 in ²	<10.0 µg/ft ²	
LW-20 ROOM #804 DESK AT CENTER	0020		144 in ²	13.0 µg/ft ²	
LW-21 ROOM #805 FLOOR AT CENTER	0021		144 in ²	10.0 µg/ft ²	
LW-22 ROOM #809 TABLE BY ENTRANCE	0022		144 in ²	<10.0 µg/ft ²	
LW-23 ROOM #823 FLOOR AT CENTER	0023		144 in ²	<10.0 µg/ft ²	
LW-24 ROOM #823 ELECTRIC PANEL COMP. AT LEFT SIDE TOP	0024		144 in ²	<10.0 µg/ft ²	
LW-25 ROOM #821 FLOOR AT CENTER	0025		144 in ²	<10.0 µg/ft ²	
LW-26 ROOM #821 AT STAND AT CENTER OF ROOM	0026		144 in ²	<10.0 µg/ft ²	
FB-01 Field blank	0027		n/a	<10.0 µg/wipe	
FB-02 Field blank	0028		n/a	<10.0 µg/wipe	
FB-03 Field blank	0029		n/a	<10.0 µg/wipe	
LW-27 8 FL CORRIDOR IN FRONT OF STAIRWELL E	0030		144 in ²	<10.0 µg/ft ²	
LW-28 8 FL CORRIDOR BY ROOM #815	0031		144 in ²	<10.0 µg/ft ²	
LW-29 ROOM C821-FLOOR CENTER	0032		144 in ²	<10.0 µg/ft ²	
LW-30 ROOM C823-FLOOR CENTER	0033		144 in ²	<10.0 µg/ft ²	
LW-31 ROOM C828 (SERVICE ELEV. LOBBY) FLOOR-CENTER	0034		144 in ²	<10.0 µg/ft ²	
LW-32 ROOM C832 SLOP SINK	0035		144 in ²	<10.0 µg/ft ²	


Emil B. [Signature]
 Laboratory Manager
 or other approved signatory

Reporting limit is 10 µg/wipe

ACCREDITATIONS: AIAA Environmental Lead Laboratory Approval Program #102581

Page 2 of 2

07208

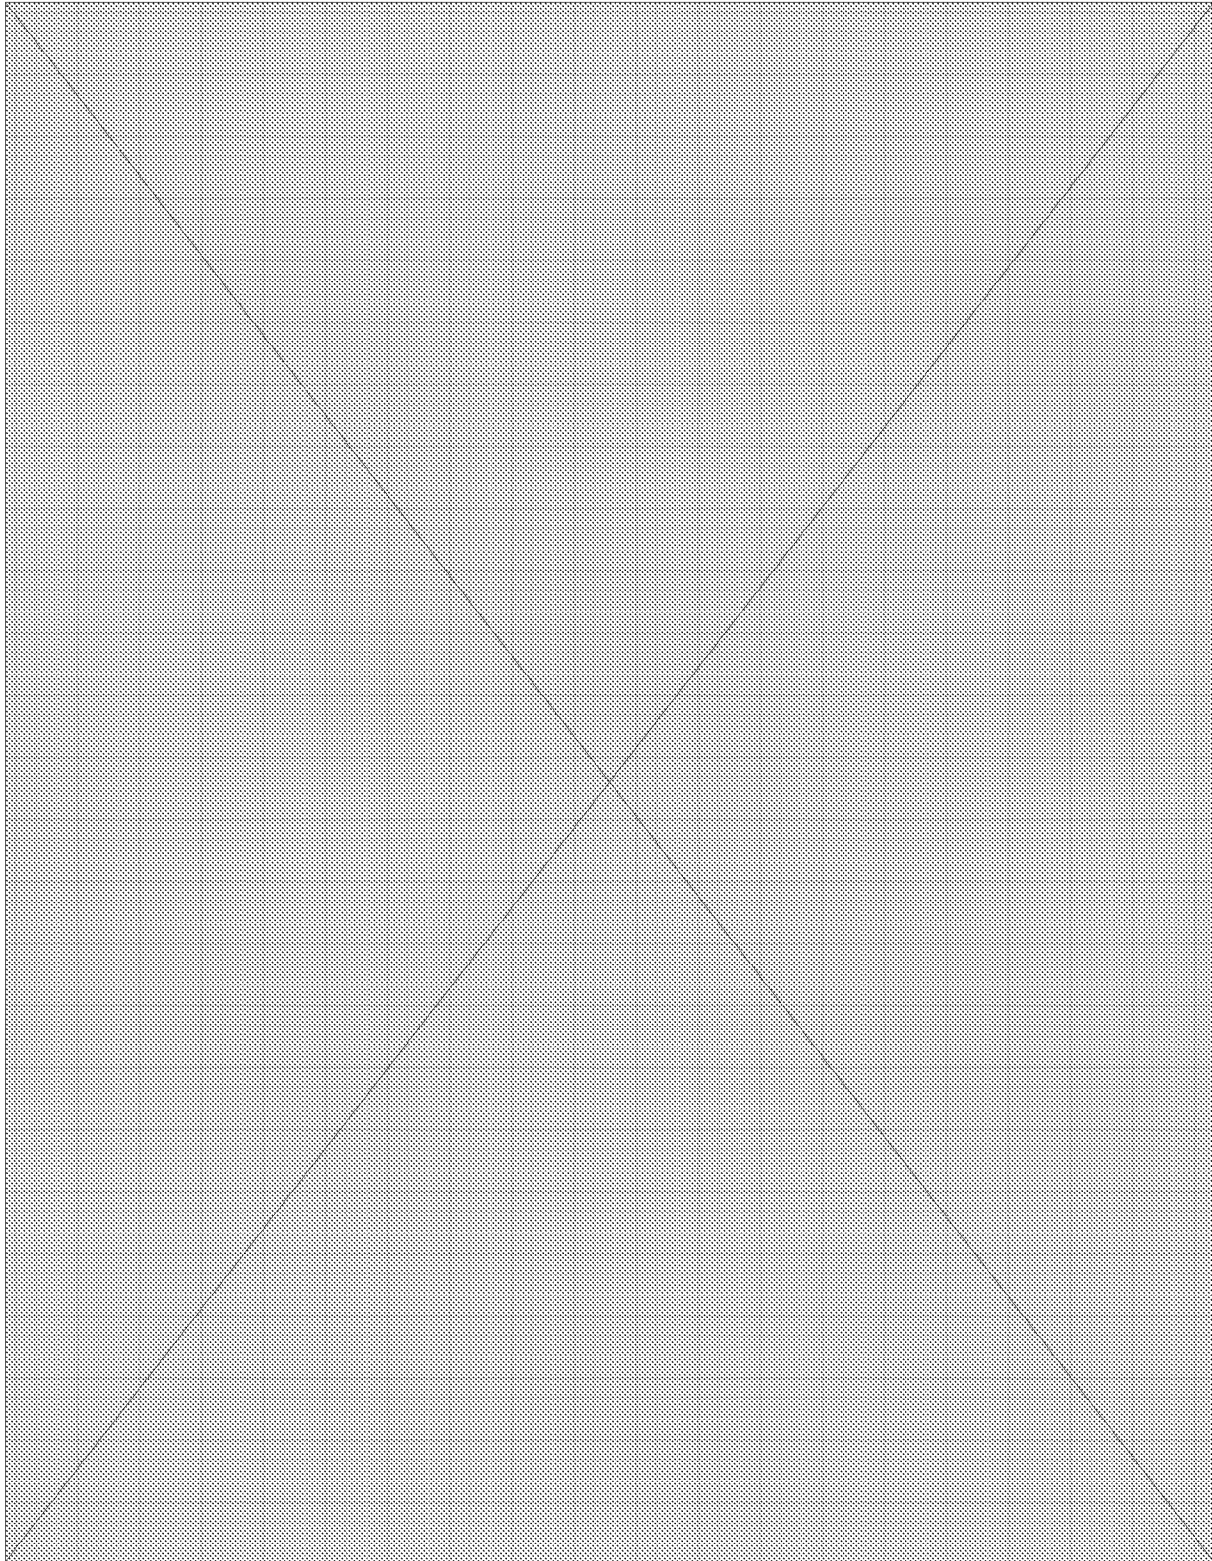

TAYLOR ENVIRONMENTAL GROUP, INC.
130 JERICHO TPKE., FLORAL PARK, NY 11001

21001 R9 108

516-358-2955
Fax 516-358-1780

LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT

CLIENT NAME/ADDRESS NYC SCA		CONTACT HANID SANDI		SAMPLER SIGNATURE <i>[Signature]</i>		DATE 8/7/02	TIME	SAMPLE(S) SEALED (YES) NO
PROJECT LOCATION: Stuyvesant H.S. 345 Chambers St NY		PROJECT # 1477-15217-29881		SAMPLER NAME (PRINT) LICK McKenzie				CORRECT CONTAINER(S) (YES) NO
MATRIX (CIRCLE ONE): (PAVE) PAINT SOIL OTHER								
SAMPLE INFORMATION:			AREA (FT ²)	SURFACE MATERIAL				LAB RESULT, $\mu\text{g}/\text{ft}^2$
LABORATORY #	SAMPLE #	LOCATION		WOOD	METAL	BRICK	OTHER	
	LW-01	ROOM 704 - Floor Center of Room	1				X	49.0
	LW-02	Room 704 - Table Top Center of EAST LAB Table	1				X	49.0
	LW-03	Room 702 - Floor 3' of Unifert	1				X	49.0
	LW-04	Room 702 - Table Top Computer Table	1				X	49.0
	LW-05	Room 702 A - Floor Center of Room	1				X	49.0
	LW-06	Room 702 A - Metal Shelf East side of Room	1		X			49.0
	LW-07	Room 701 - Floor 3' of Entrance	1				X	49.0
	LW-08	Room 701 A - Table Top Center Table	1				X	49.0
FAX TO 212-406-2525 & 516-358-1780				TURNAROUND REQUIRED: NORMAL ☐ STAT ☐ BY 1/1			COMMENTS / INSTRUCTIONS 6 HR TAT	
RELINQUISHED BY (SIGNATURE) <i>[Signature]</i>		DATE 8/7/02	PRINTED NAME LICK McKenzie		RECEIVED BY (SIGNATURE) <i>[Signature]</i>		DATE 8.7.2	PRINTED NAME
RELINQUISHED BY (SIGNATURE)		DATE	PRINTED NAME		RECEIVED BY LAB (SIGNATURE) R. Brondina		DATE 8.7.2	PRINTED NAME R. Brondina

WHITE - OFFICE / YELLOW - LAB / PINK - CLIENT

ATLANTA ENVIRONMENTAL GROUP, INC.
130 JERICHO TPKE., FLORAL PARK, NY 11001

516-358-7955
FAX 516-358-1780

LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT

CLIENT NAME/ADDRESS NYC SLA		CONTACT: HAMID SAVOJ		SAMPLER SIGNATURE: <i>[Signature]</i>	DATE 8/7/02	TIME	SAMPLE(S) SEALED (YES) / NO
PROJECT LOCATION: Stuyvesant H.S.		PROJECT # 1477-1527-2988/		SAMPLER NAME (PRINT): LIPK M-Lewin		CORRECT CONTAINER(S) (YES) / NO	
SAMPLE INFORMATION:				MATRIX (CIRCLE ONE): (WIFE) PAINT SOIL OTHER			
LABORATORY #	SAMPLE #	LOCATION		AREA (FT ²)	SURFACE MATERIAL WOOD METAL BRICK OTHER		LAB RESULT, ug/g
	LW-09	ROOM 703 - FLOOR 2' west of NE unit vent		1	X		49.0
	LW-10	ROOM 703 - Table Top FRONT (Teach) Lab Table		1	X		49.0
	LW-11	ROOM 707 - FLOOR 8' of ENTRANCE		1	X		49.0
	LW-12	ROOM 707 - Table Top Center Lab Table		1	X		49.0
	LW-13	ROOM 709 - FLOOR 2' west of EAST cabinet		1	X		49.0
	LW-14	ROOM 709 - Sink Top of NE Lab Sink		1	X		49.0
	LW-15	ROOM 701A - FLOOR Center of Room		1	X		49.0
	LW-16	ROOM 701A - Top of EAST Center File Cabinet		1	X		49.0
				TURNAROUND REQUIRED: NORMAL ☐ STAT ☐ BY 1/1		COMMENTS / INSTRUCTIONS 6 HR TAT	
RELINQUISHED BY (SIGNATURE) <i>[Signature]</i>		DATE 8/7/02 TIME 00:45	PRINTED NAME LIPK M-Lewin	RECEIVED BY (SIGNATURE)		DATE	PRINTED NAME
RELINQUISHED BY (SIGNATURE)		DATE	PRINTED NAME	RECEIVED BY LAB (SIGNATURE) R. Brundina		DATE 8.8.02 TIME 00:45	PRINTED NAME R. Brundina

WHITE - OFFICE / YELLOW - LAB / PINK - CLIENT

07211

CITY_21MC100_008878385

TAYLOR ENVIRONMENTAL GROUP, INC.
130 JERICHO TPKE., FLORAL PARK, NY 11001

516-358-2955
Fax 516-358-1780

LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT

CLIENT NAME/ADDRESS NYC SCA		CONTACT Harold Sandoz		SAMPLER(S) SIGNATURE(S) <i>[Signature]</i>		DATE 8/1/02	TIME	SAMPLE(S) SEALED (YES) NO
PROJECT LOCATION: Stuyvesant H.S. 345 Chambers St. N.Y.		PROJECT # M477-15217-29881		SAMPLER NAME (PRINT) LIRL McKenzie				CORRECT CONTAINER(S) (YES) NO
SAMPLE INFORMATION:				MATRIX (CIRCLE ONE): (PAINT) PAINT SOIL OTHER				
LABORATORY #	SAMPLE #	LOCATION	AREA (FT ²)	SURFACE MATERIAL				LAB RESULT
				WOOD	METAL	BRICK	OTHER	
	FBL-1	Field Blank						49.0
	FBL-2	Field Blank						49.0
				TURNAROUND REQUIRED: NORMAL ☐ STAT ☐ BY 1/1			COMMENTS / INSTRUCTIONS 6 HR TAG	
RELINQUISHED BY (SIGNATURE) <i>[Signature]</i>		DATE 8/8/02	PRINTED NAME LIRL McKenzie	RECEIVED BY (SIGNATURE) <i>[Signature]</i>		DATE 8.8.02	PRINTED NAME	
RELINQUISHED BY (SIGNATURE)		DATE	PRINTED NAME	RECEIVED BY LAB (SIGNATURE) R. Brundina		DATE 8.8.02	PRINTED NAME R. Brundina	

WHITE - OFFICE / YELLOW - LAB / PINK - CLIENT

07212

CITY_21MC100_008878386

ATC ASSOCIATES, INC
104 E 25th Street, 10th Floor
New York, NY 10010
Tel. 212-353-8280
Fax 212-353-8306

REPORT DATE: 08-08-02
CLIENT: Taylor Environmental Group, Inc.
PROJECT NAME: SCA/Stuyvesant HS
 343 Chambers Street, NY
PROJECT NUMBER: M477-15217-29881
SAMPLED BY: Client
SAMPLE DATE: 08-07-02
DATE RECEIVED: 08-08-02
DATE ANALYZED: 08-08-02
SAMPLE MEDIA: Dust Wipe Sample
ANALYSIS REQUIRED: Method EPA 3050/7420

ANALYSIS RESULTS

SAMPLE ID	BATCH NO.	SAMPLE DESCRIPTION	LEAD CONCENTRATION ($\mu\text{g}/\text{ft}^2$)	DETECTION LIMIT ($\mu\text{g}/\text{ft}^2$)
LW-01	21001	Room 704 - Floor, Center of Room	<9.0	9.0
LW-02	21001	Room 704 - Table Top, Center of Lab Table	<9.0	9.0
LW-03	21001	Room 702 - Floor, 3' of Unit Vent	<9.0	9.0
LW-04	21001	Room 702 - Table Top, Computer Table	<9.0	9.0
LW-05	21001	Room 702A - Floor, Center of Room	<9.0	9.0
LW-06	21001	Room 702A - Metal Shaft, E side of Room	<9.0	9.0
LW-07	21001	Room 701 - Floor, 3' of Entrance	<9.0	9.0
LW-08	21001	Room 701 - Table Top, Center Table	<9.0	9.0
LW-09	21001	Room 703 - Floor, 2' W of NE Unit Vent	<9.0	9.0
LW-10	21001	Room 703 - Table Top, Front (Teachers) Lab Table	<9.0	9.0
LW-11	21001	Room 707 - Floor, 3' of Entrance	<9.0	9.0
LW-12	21001	Room 707 - Table Top, Center Lab Table	<9.0	9.0


ATC ASSOCIATES, INC
 104 E 25th Street, 10th Floor
 New York, NY 10010
 Tel. 212-353-8280
 Fax 212-353-8306

LW-15	21001	Room 701A - Floor, Center of Room	<9.0	9.0
LW-16	21001	Room 701A - Top of E Center File Cabinet	<9.0	9.0
FB-1	21001	Field Blank	<9.0 µg	9.0 µg
FB-2	21001	Field Blank	<9.0 µg	9.0 µg


NOTE 1:
 THE REPORTING LIMIT (RL) IS 18.0 µg
 NOTE 2:
 HUD Guidelines for final clearance dust wipe samples: Floor 40 µg/ft², Window sills 250 µg/ft²,
 Window wells 400 µg/ft², Exterior surfaces 800 µg/ft².
 NOTE 3:
 Blank units are in µg


CERTIFICATION AND SIGNATURES

ANALYSIS PERFORMED BY: 

REPORT PREPARED BY: 

ATC certifies that this report is an accurate and authentic report of results obtained from the laboratory analysis.

QUALITY ASSURANCE COORDINATOR: 

LABORATORY DIRECTOR: 

ATC is accredited by the New York State Department of Health Environmental Laboratory Approval Program (ELAP) and by the American Industrial Hygiene Association (AIHA) to perform analysis of lead in paint, dust wipes, air and soil samples. (ELAP #10679), (AIHA #100229).

07214

TAYLOR ENVIRONMENTAL GROUP, INC.
130 JERICHO TPKE., FLORAL PARK, NY 11001

21023

1 of 3
516-358-2955
Fax 516-358-1780

LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT

CLIENT NAME/ADDRESS NYC SLA		CONTACT: HAMID SAVOJ		SAMPLED (SIGNATURE) <i>[Signature]</i>	DATE 8/8/02	TIME	SAMPLE(S) SEALED ☒ YES ☐ NO	
PROJECT LOCATION: Stuyvesant HS 345 Chambers ST. NY		PROJECT # M477-15217-29881		SAMPLER NAME (PRINT) Kirk McKenzie			CORRECT CONTAINER(S) ☒ YES ☐ NO	
SAMPLE INFORMATION:				MATRIX (CIRCLE ONE): ☒ WITE ☐ PAINT ☐ SOIL ☐ OTHER				
LABORATORY #	SAMPLE #	LOCATION	AREA (FT ²)	SURFACE MATERIAL				LAB RESULT µg/ft²
				WOOD	METAL	BRICK	OTHER	
	LW-01	ROOM 711 - FLOOR Center of Bathroom	1				X	29.0
	LW-02	ROOM 713 - FLOOR Center of Bathroom	1				X	29.0
	LW-03	ROOM 705 - FLOOR 3' north of South wall cabinet	1				X	29.0
	LW-04	ROOM 705 - Table Top North side Lab Table	1				X	29.0
	LW-05	ROOM 713 - FLOOR	1				X	29.0
	LW-06	ROOM 715 - Desk Top SE Desk	1				X	29.0
	LW-07	ROOM 717 - FLOOR 3' of MAIN ENTRANCE	1				X	29.0
	LW-08	ROOM 717 - Table Top Teacher's Table	1				X	29.0
TURNAROUND REQUIRED: NORMAL ☐ STAT ☐ BY 1/1				COMMENTS / INSTRUCTIONS 6 HR TAT				
RELINQUISHED BY (SIGNATURE) <i>[Signature]</i>		DATE 8/9/02	PRINTED NAME Kirk McKenzie	RECEIVED BY (SIGNATURE) <i>[Signature]</i>		DATE 8.9.02	PRINTED NAME W. Houl	
TIME 04:30				TIME 4:32				
RELINQUISHED BY (SIGNATURE) <i>[Signature]</i>		DATE 8.9.02	PRINTED NAME W. Houl	RECEIVED BY LAB (SIGNATURE) AK by A. Elbert		DATE 8.9.02	PRINTED NAME A. Elbert	
TIME 5:00				TIME 5:05				

WHITE - OFFICE / YELLOW - LAB / PINK - CLIENT

TAYLOR ENVIRONMENTAL GROUP, INC.
130 JERICHO TPKE., FLORAL PARK, NY 11001


#21023

516-358-2955
Fax 516-358-1780

LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT

CLIENT NAME/ADDRESS NYC SLA		CONTACT: Hamid Savai		SAMPLER SIGNATURE <i>[Signature]</i>	DATE 8/8/02	TIME	SAMPLE(S) SEALED (YES) NO	
PROJECT LOCATION: Stuyvesant H.S.		PROJECT # M477-15217-29881		SAMPLER NAME (PRINT) Kirk McLeur		CORRECT CONTAINER(S) (YES) NO		
345 Chambers ST. NY				MATRIX (CIRCLE ONE): (WIPE) PAINT SOIL OTHER				
SAMPLE INFORMATION:			AREA (FT ²)	SURFACE MATERIAL				LAB RESULT µg/ft²
LABORATORY #	SAMPLE #	LOCATION		WOOD	METAL	BRICK	OTHER	
	LW-09	ROOM 719 - FLOOR					X	29.0
	LW-10	ROOM 719 - Book Shelf EAST side			X			29.0
	LW-11	ROOM C-721 - FLOOR WEST side center					X	29.0
	LW-12	ROOM 727 - FLOOR 21' of west unit vent					X	29.0
	LW-13	ROOM 727 - Table Top WEST SIDE table					X	29.0
	LW-14	ROOM 727A - FLOOR Center of Room					X	29.0
	LW-15	ROOM 727A - Shelf North side shelf			X			29.0
	LW-16	ROOM 728 - FLOOR Center of Room					X	29.0
			TURNAROUND REQUIRED: NORMAL ☐ STAT ☐ BY 1/1			COMMENTS / INSTRUCTIONS 6 HR TAT		
RELINQUISHED BY (SIGNATURE) <i>[Signature]</i>		DATE 8/7/02	PRINTED NAME Kirk McLeur	RECEIVED BY (SIGNATURE) <i>[Signature]</i>		DATE 8.7.02	PRINTED NAME W. [Signature]	
		TIME 0430				TIME 4:30		
RELINQUISHED BY (SIGNATURE) <i>[Signature]</i>		DATE 8.7.02	PRINTED NAME W. [Signature]	RECEIVED BY LAB (SIGNATURE) <i>[Signature]</i>		DATE 08.09.02	PRINTED NAME A. Elbert	
		TIME 5:15				TIME 5:15		

WHITE - OFFICE / YELLOW - LAB / PINK - CLIENT

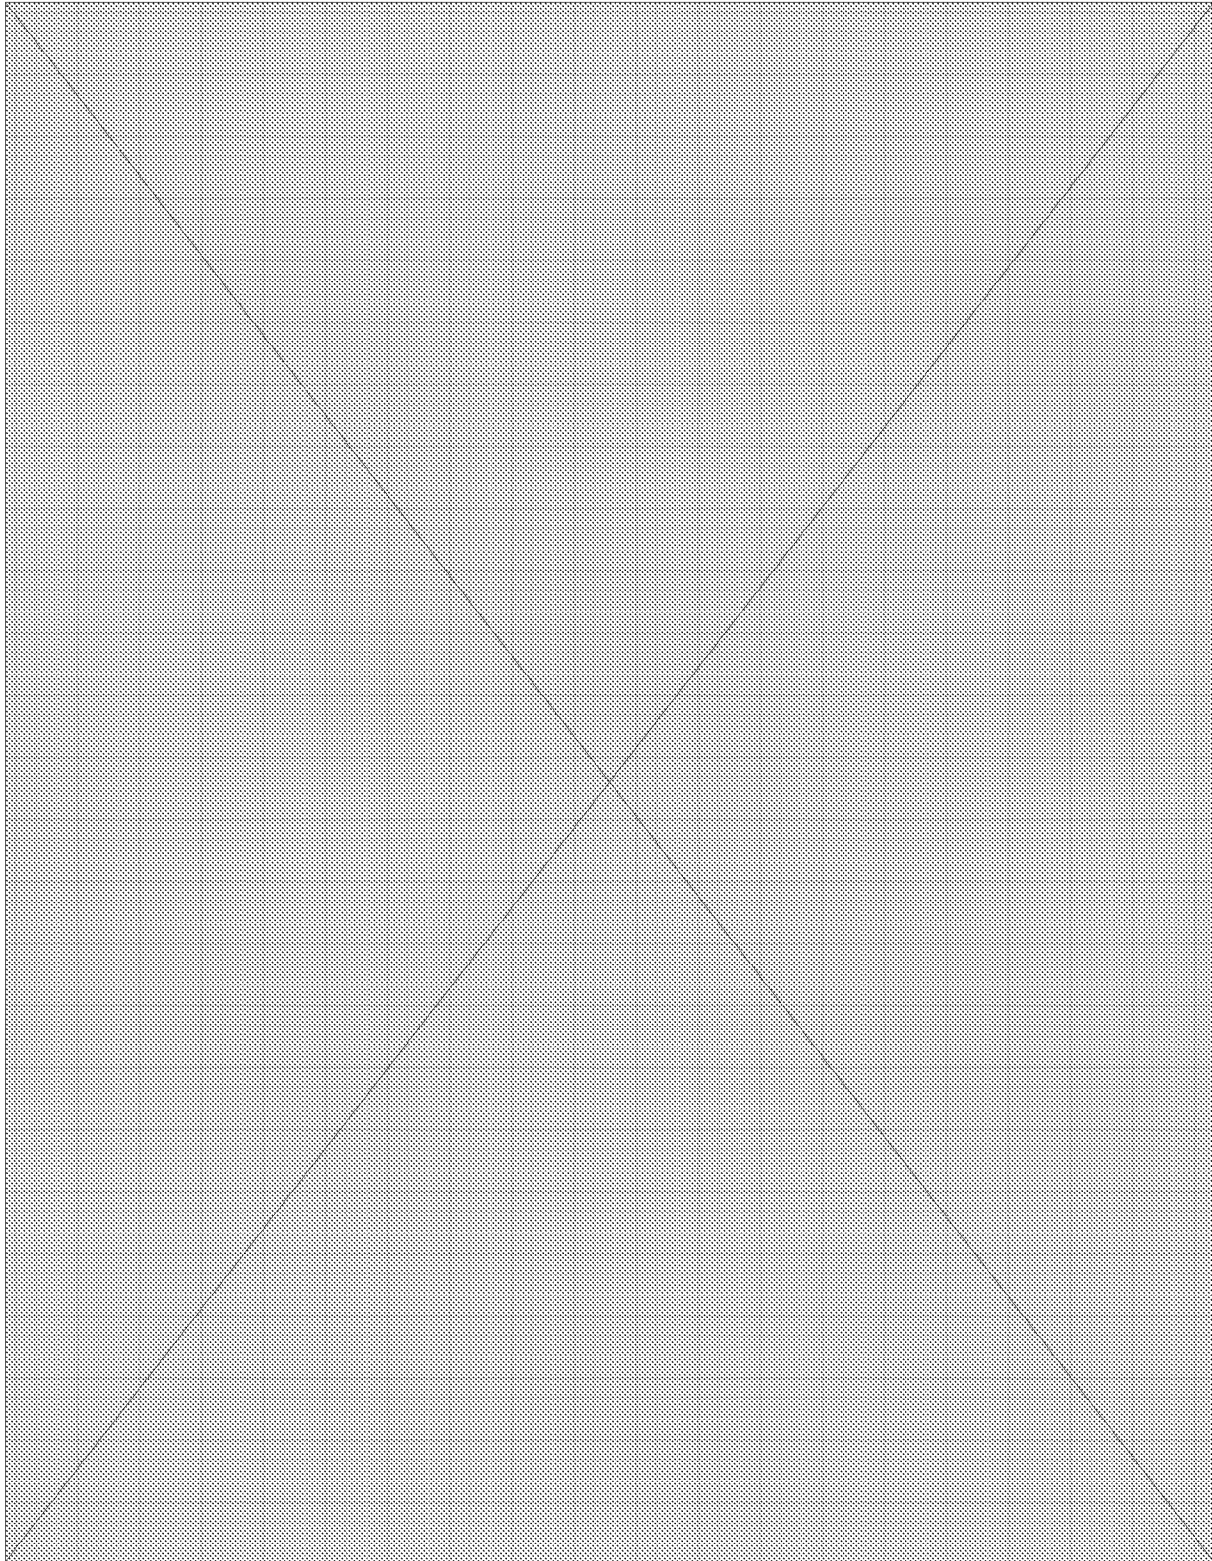

ATC ASSOCIATES, INC
 104 E 25th Street, 10th Floor
 New York, NY 10010
 Tel. 212-353-8280
 Fax 212-353-8306

REPORT DATE: 08-09-02
CLIENT: Taylor Environmental Group, Inc.
PROJECT NAME: SCA/Stuyvesant HS
 345 Chambers Street, NY
PROJECT NUMBER: M477-15217-29881
SAMPLED BY: Client
SAMPLE DATE: 08-08-02
DATE RECEIVED: 08-09-02
DATE ANALYZED: 08-09-02
SAMPLE MEDIA: Dust Wipe Sample
ANALYSIS REQUIRED: Method EPA 3050/7420

ANALYSIS RESULTS

SAMPLE ID	BATCH NO.	SAMPLE DESCRIPTION	LEAD CONCENTRATION (ug/ft ²)	DETECTION LIMIT (ug/ft ²)
LW-01	21023	Rm 711 Floor Center of Bathroom	<9.0	9.0
LW-02	21023	Rm 713 Floor Center of Bathroom	<9.0	9.0
LW-03	21023	Rm 705 Floor 5' North of South Wall Cabinet	<9.0	9.0
LW-04	21023	Rm 705 Table Top North Side Lab Table	<9.0	9.0
LW-05	21023	Rm 715 Floor	<9.0	9.0
LW-06	21023	Rm 715 Desk Top SE Desk	<9.0	9.0
LW-07	21023	Rm 717 Floor 3' of Main Entrance	<9.0	9.0
LW-08	21023	Rm 717 Table Top Teachers Table	<9.0	9.0
LW-09	21023	Rm 719 Floor 6' of Entrance	<9.0	9.0
LW-10	21023	Rm 719 Book Shelf East Side	<9.0	9.0
LW-11	21023	Rm C721 Floor West Side Center	<9.0	9.0
LW-12	21023	Rm 727 Floor 2' of West Unit Vent	<9.0	9.0
LW-13	21023	Rm 727 Table Top West Sink Table	<9.0	9.0
LW-14	21023	Rm 727A Floor Center of Room	<9.0	9.0
LW-15	21023	Rm 727A Shelf North Side Shelf	<9.0	9.0

07518

ATC ASSOCIATES, INC

104 E 25th Street, 10th Floor

New York, NY 10010

Tel. 212-353-8280

Fax 212-353-8306

LW-16	21023	Rm 728 Floor Center of Room	<9.0	9.0
LW-17	21023	Rm 726 Floor	<9.0	9.0
LW-18	21023	Rm 726 Floor Table Top SW Side of Room	<9.0	9.0
LW-19	21023	Rm C728 Floor Service Elev. Lobby	<9.0	9.0
LW-20	21023	Rm 730 Floor Center of Bathroom	<9.0	9.0
FB-1	21023	Field Blank	<9.0 µg	9.0 µg
FB-2	21023	Field Blank	<9.0 µg	9.0 µg

NOTE 1:

THE REPORTING LIMIT (RL) IS 18.0 µg

NOTE 2:

HUD Guidelines for final clearance dust wipe samples: Floor 40 µg/ft², Window sills 250 µg/ft².Window walls 400 µg/ft², Exterior surfaces 500 µg/ft².

NOTE 3:

Blank units are in µg

CERTIFICATION AND SIGNATURESANALYSIS PERFORMED BY: JKREPORT PREPARED BY: AK

ATC certifies that this report is an accurate and authentic report of results obtained from the laboratory analysis.

QUALITY ASSURANCE COORDINATOR: AKLABORATORY DIRECTOR: AK

ATC is accredited by the New York State Department of Health Environmental Laboratory Approval Program (ELAP) and by the American Industrial Hygiene Association (AIHA) to perform analysis of lead in paint, dust wipes, air and soil samples. (ELAP #10579), (AIHA #100229).

TAYLOR ENVIRONMENTAL GROUP, INC.
 130 JERICHO TPKE., FLORAL PARK, NY 11001

 516-358-2955
 Fax 516-358-1780

LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT

030210902

CLIENT NAME/ADDRESS NYC SCA			CONTACT: HANID SANDI		SAMPLER(S) SIGNATURE <i>[Signature]</i>	DATE 8/9/02	TIME	SAMPLE(S) SEALED YES / NO
PROJECT LOCATION: Stuyvesant H.S. 345 Chambers ST NY			PROJECT # 11477-15217-29881		SAMPLER NAME (PRINT) Kirk McKenzie		CORRECT CONTAINER(S) YES / NO	
SAMPLE INFORMATION:					MATRIX (CIRCLE ONE): <u>PAINT</u> PAINT SOIL OTHER			
LABORATORY #	SAMPLE #	LOCATION	AREA (FT ²)	SURFACE MATERIAL				LAB RESULT
				WOOD	METAL	BRICK	OTHER	
	LW-21	ROOM 732 - FLOOR Center of Room	1				X	<10.0
	LW-22	Room 734 - FLOOR Center of Room	1				X	<10.0
	LW-23	Room 736 - FLOOR 2' EAST of EAST window	1				X	<10.0
	LW-24	Room 736 - Table Top Teacher Table	1				X	<10.0
	LW-25	Room 738 - FLOOR 3' E of EAST ENTRANCE	1				X	<10.0 11.0
	LW-26	Room 738 - Desk Top SW Desk	1				X	11.0
	LW-27	Room 740 - FLOOR South of Teacher Table	1				X	<10.0
	LW-28	Room 740 - Table Top Teacher Table	1				X	10.0
FAX TO 212-406-2535 & 516-358-1780					TURNAROUND REQUIRED: NORMAL ☐ STAT ☐ BY 1/1		COMMENTS / INSTRUCTIONS 6 HR. TAT	
RELINQUISHED BY (SIGNATURE) <i>[Signature]</i>		DATE 8/9/02	PRINTED NAME Kirk McKenzie		RECEIVED BY (SIGNATURE)		DATE	PRINTED NAME
CUSHED BY (SIGNATURE) <i>[Signature]</i>		DATE 8/9/02	PRINTED NAME TORRES MICHAEL		RECEIVED BY LAB (SIGNATURE)		DATE	PRINTED NAME

WHITE - OFFICE / YELLOW - LAB / PINK - CLIENT

08/09/2002 11:25 212-298-2538

EML ANALYTICAL INC

PAGE 04/07

07220

CITY_21MC100_008878394

TAYLOR ENVIRONMENTAL GROUP, INC.
130 JERICHO TPKE., FLORAL PARK, NY 11001

516-358-2455
Fax 516-358-1780

030210902

LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT

CLIENT NAME/ADDRESS NYC SCA		CONTACT HAMID SANJ		SAMPLER SIGNATURE <i>[Signature]</i>	DATE 8/8/02	TIME	SAMPLE(S) SEALED YES / NO	
PROJECT LOCATION: Stuyvesant H.S. 345 Chambers St NY		PROJECT # M477-15217-29881		SAMPLER NAME (PRINT) Kirk McKenzie	CORRECT CONTAINER(S) YES / NO			
SAMPLE INFORMATION:				MATRIX (CIRCLE ONE): WIFE PAINT SOIL OTHER				
LABORATORY #	SAMPLE #	LOCATION	AREA (FT ²)	SURFACE MATERIAL WOOD METAL BRICK OTHER				LAB RESULT
	LW-29	ROOM 739 - FLOOR 2' of west unit vent	1				X	<10.0
	LW-30	ROOM 739 - Deck Top Rear Deck - w/til end.	1				X	<10.0
	LW-31	ROOM 737 - FLOOR 6' of EAST ENTRANCE	1				X	<10.0
	LW-32	ROOM 732 - Table Top Cauld of Tachyon table.	1				X	10.0
	LW-33	ROOM 735 - FLOOR WALL of EAST unit vent	1				X	12.0
	LW-34	ROOM 735 - Desk Top Hall Front Desk - south end	1				X	<10.0
	LW-35	ROOM 731 - FLOOR 2' of west unit vent	1				X	<10.0
	LW-36	ROOM 731 - Table Top Cauld of Lab Table (west side)	1				X	<10.0
TURNAROUND REQUIRED: NORMAL ☐ STAT ☐ BY 1/1				COMMENTS / INSTRUCTIONS 6 HR TAT				
RELINQUISHED BY (SIGNATURE) <i>[Signature]</i>	DATE 8/9/02 TIME 0500	PRINTED NAME Kirk McKenzie	RECEIVED BY (SIGNATURE) <i>[Signature]</i>	DATE	PRINTED NAME			
RELINQUISHED BY (SIGNATURE) <i>[Signature]</i>	DATE 8/9/02 TIME 8:45	PRINTED NAME TERESA MICHAELSON	RECEIVED BY LAB (SIGNATURE)	DATE	PRINTED NAME			

WHITE - OFFICE / YELLOW - LAB / PINK - CLIENT

08/09/2002 11:25

2-2-298-2538


ENSL ANALYTICAL INC

PAGE 05/07

ENSL MANHATTAN
RECEIVED
02 AUG - 9 AM 5:34
Kirk McKenzie

07221

CITY_21MC100_008878395

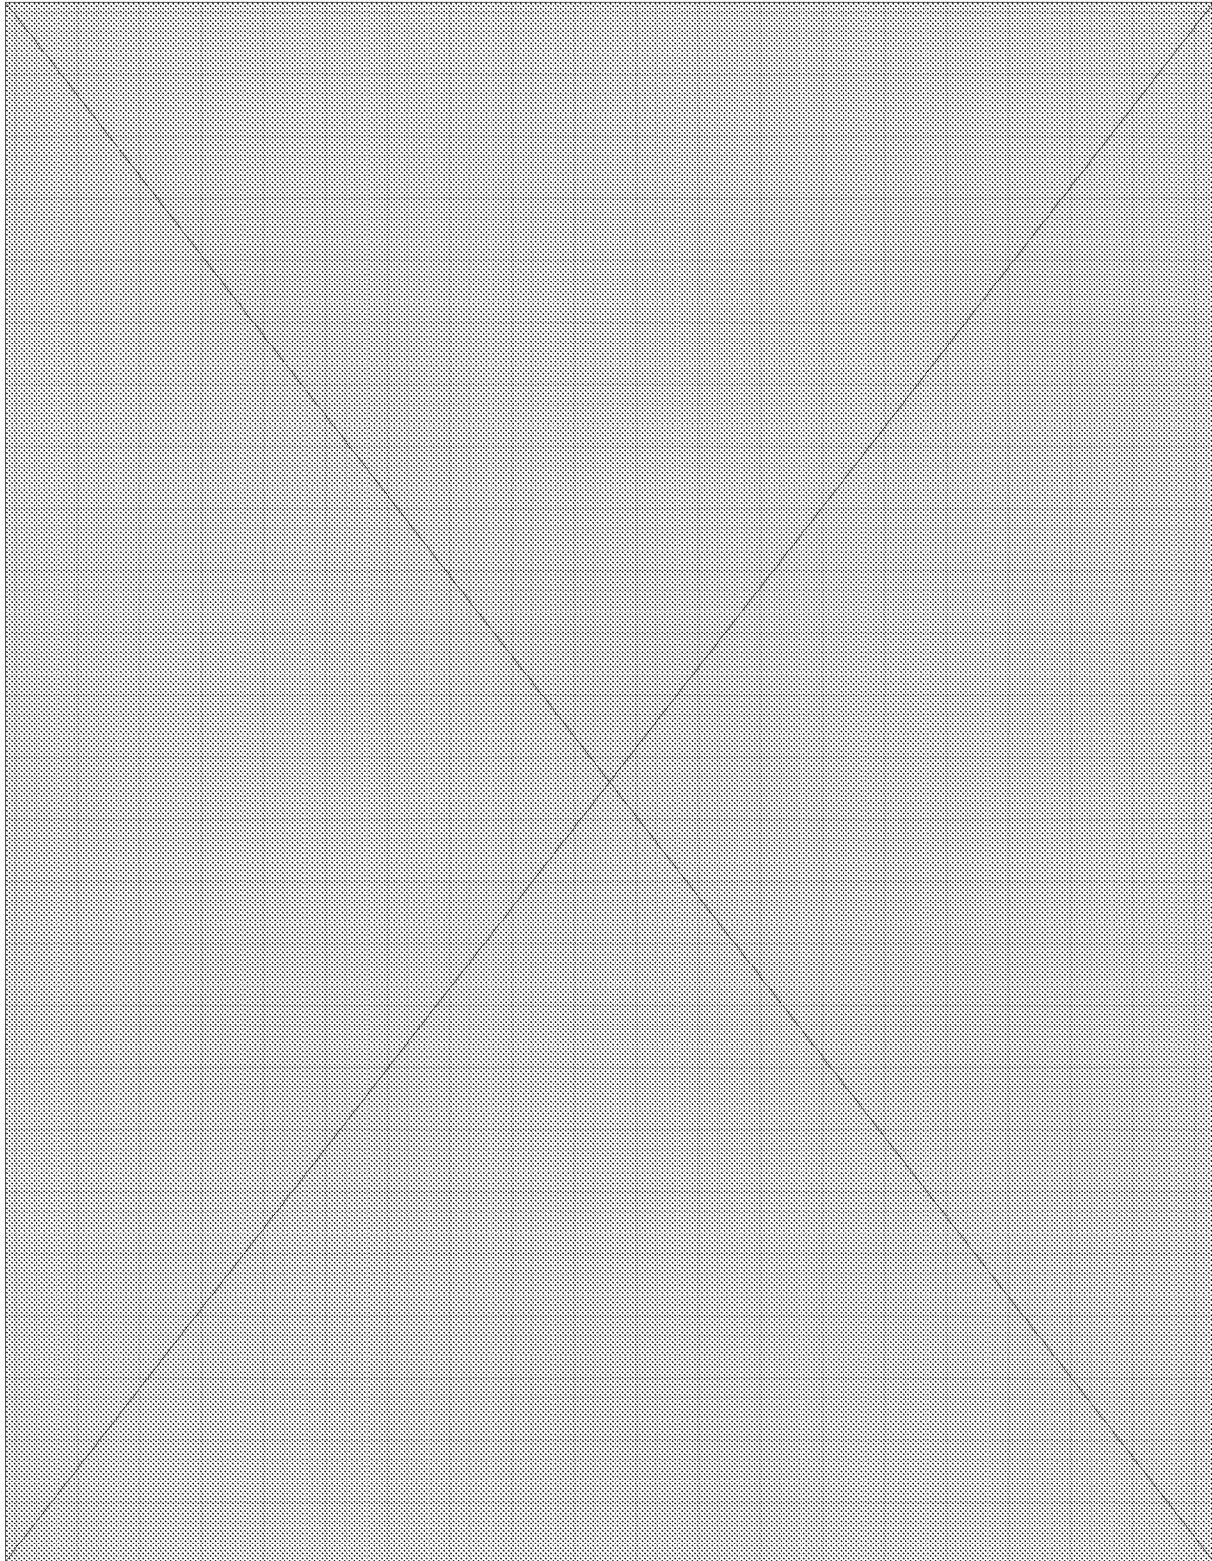

0602100:02 444

BB/09/2002 11:25

212-290-2536

EMSL ANALYTICAL INC.

PAGE 07/07

[illegible]

07223

WHITE - OFFICE / YELLOW - LAB / PINK - CLIENT

RECEIVED
JUL 10 1964
AM 5:34

NYC-WTC_000231147

09/09/2002 11:25 212-290-2538

EMSL ANALYTICAL INC

PAGE 31/37

EMSL Analytical, Inc.

107 West 38th Street, New York, NY 10018

Phone: 212-290-0051 Fax: 212-290-0058 Email: manhattanlab@emsl.com

EMSLAttn: Taylor Environmental Group, Inc.
Floral Park Corporate Center
120 Jericho Turnpike
Floral Park, NY 11001

Fax: (516) 358-1780 Phone: 516-358-2955

Project: M477-15217-29891 / NYC SQA / STUYVESANT H.S. / 345
CHAMBERS ST. NY.

Customer ID: TAYL50

Customer PO:


Received: 09/09/02 5:34 AM

EMSL Order: 030210902

EMSL Project ID:

Lead in Wipes by Flame AAS (SW 846, 7420)

Client Sample Description	Lab ID	Analyzed	Area Sampled	Lead Concentration	Notes
LW-21 ROOM 6732 / FLOOR / CENTER ROOM	0001		144 in ²	<10.0 µg/ft ²	
LW-22 ROOM 734 / FLOOR / CENTER ROOM	0002		144 in ²	<10.0 µg/ft ²	
LW-23 ROOM 736 / FLOOR / 2 IN. EAST OF EAST UNIT VENT	0003		144 in ²	<10.0 µg/ft ²	
LW-24 ROOM 736 / TABLE TOP / TEACHER TABLE	0004		144 in ²	<10.0 µg/ft ²	
LW-25 ROOM 736 / FLOOR / 3 INCHES OF EAST ENTRANCE	0005		144 in ²	<10.0 µg/ft ²	
LW-26 ROOM 738 / DESK TOP / SW DESK	0006		144 in ²	11.0 µg/ft ²	
LW-27 ROOM 740 / FLOOR / SOUTH OF TEACHER TABLE	0007		144 in ²	<10.0 µg/ft ²	
LW-28 ROOM 740 / TABLE TOP / TEACHER TABLE	0008		144 in ²	10.0 µg/ft ²	
LW-29 ROOM 739 / FLOOR / 2 INCH. OF WEST UNIT VENT	0009		144 in ²	<10.0 µg/ft ²	
LW-30 ROOM 739 / DESK TOP / REAR DESK / N. END	0010		144 in ²	<10.0 µg/ft ²	
LW-31 ROOM 737 / FLOOR / 6 INCH. OF E. ENTRANCE	0011		144 in ²	<10.0 µg/ft ²	
LW-32 ROOM 732 / TABLE TOP / CENTER OF TEACH. TABL	0012		144 in ²	10.0 µg/ft ²	
LW-33 ROOM 735 / NORTH OF EAST UNIT VENT	0013		144 in ²	12.0 µg/ft ²	
LW-34 ROOM 735 / DESK TOP / N. FRONT DESK / S. END	0014		144 in ²	<10.0 µg/ft ²	
LW-35 ROOM 731 / FLOOR / 2 INCH. OF WEST UNIT	0015		144 in ²	<10.0 µg/ft ²	


Laboratory Manager
or other approved signatory.

Reporting limit is 10 µg/wipe

ACCREDITATIONS: ANA Environmental Lead Laboratory Approval Program #002581

Page 1 of 2

07001

08/09/2002 11:25 212-298-2536

EMSL ANALYTICAL INC

PAGE 02/67

EMSL Analytical, Inc.

307 West 32nd Street, New York, NY 10018

Phone: 212-290-0051 Fax: 212-290-0058 Email: manhattanlab@emsl.com



Attn: Taylor Environmental Group, Inc.
Floral Park Corporate Center
130 Jericho Turnpike
Floral Park, NY 11001

Fax: (516) 358-1780

Phone: 516-358-2955

Project: M477-15217-29881 / NYC SCA / STUYVESANT H.S. / 345
CHAMBERS ST. NY.

Customer ID: TAYL50

Customer PO:

Received: 08/09/02 5:34 AM

EMSL Order: 030210902

EMSL Project ID:

Lead in Wipes by Flame AAS (SW 846, 7420)

Client Sample Description	Lab ID	Analyzed	Area Sampled	Lead Concentration	Notes
VENT					
LW-36 ROOM 731 / TABLE TOP / CENTER OF LAB TABLE	0016		144 in ²	<10.0 µg/m ²	
LW-37 ROOM 725 / FLOOR / CENTER OF ROOM	0017		144 in ²	<10.0 µg/m ²	
LW-38 ROOM 729 / LAB TABLE / TOP BY SINK	0018		144 in ²	<10.0 µg/m ²	
LW-39 LOCKER #7-83 / FLOOR OF LOCKER	0019		144 in ²	<10.0 µg/m ²	
LW-40 CORRIDOR / O/S RM 740 E. ENTRANCE / FLOOR	0020		144 in ²	<10.0 µg/m ²	

Eric B. B.
Laboratory Manager
or other approved signatory

Reporting limits 10 µg/m²

ACCREDITATIONS: NHA Environmental Lead Laboratory Approval Program #102581

Page 2 of 2

08/09/2002 11:25 212-290-2539

EMSL ANALYTICAL INC

PAGE 23/07

EMSL Analytical, Inc.

307 West 58th Street, New York, NY 10018

Phone: 212-290-0851 Fax: 212-290-0850 Email: manhattanlab@emsl.com



Attn: Taylor Environmental Group, Inc.
Floral Park Corporate Center
130 Jericho Turnpike
Floral Park, NY 11001

Fax: (516) 358-1780

Phone: 516-358-2955

Project: M477-15217-29881 / NYC SCA / STUYVESANT H.S. / 345
CHAMBERS ST. NY.

Customer ID: TAYL50

Customer PO:

Received: 08/09/02 5:34 AM

EMSL Order: 033210902

EMSL Project ID:

Lead in Wipes by Flame AAS (SW 846, 7420)

Client Sample Description	Lab ID	Analyzed	Area Sampled	Lead Concentration	Notes
LW-41 CORRIDOR / FLOOR 14 INCH. EAST OF RM 719	0021		144 in²	<10.0 µg/ft²	
LW-42 CORRIDOR / FLOOR / O/S ROOM 707	0022		144 in²	<10.0 µg/ft²	
FBL-3 Field blank	0023		n/a	<10.0 µg/wipe	
FBL-4 Field blank	0024		n/a	<10.0 µg/wipe	
FBL-3 Field blank	0025		n/a	<10.0 µg/wipe	


Laboratory Manager
or other approved signatory

Reporting limit is 10 µg/wipe

ACCREDITATIONS: AUSA Environmental Lead Laboratory Approval Program #122581

Page 1 of 1

CITY_21MC100_008878400

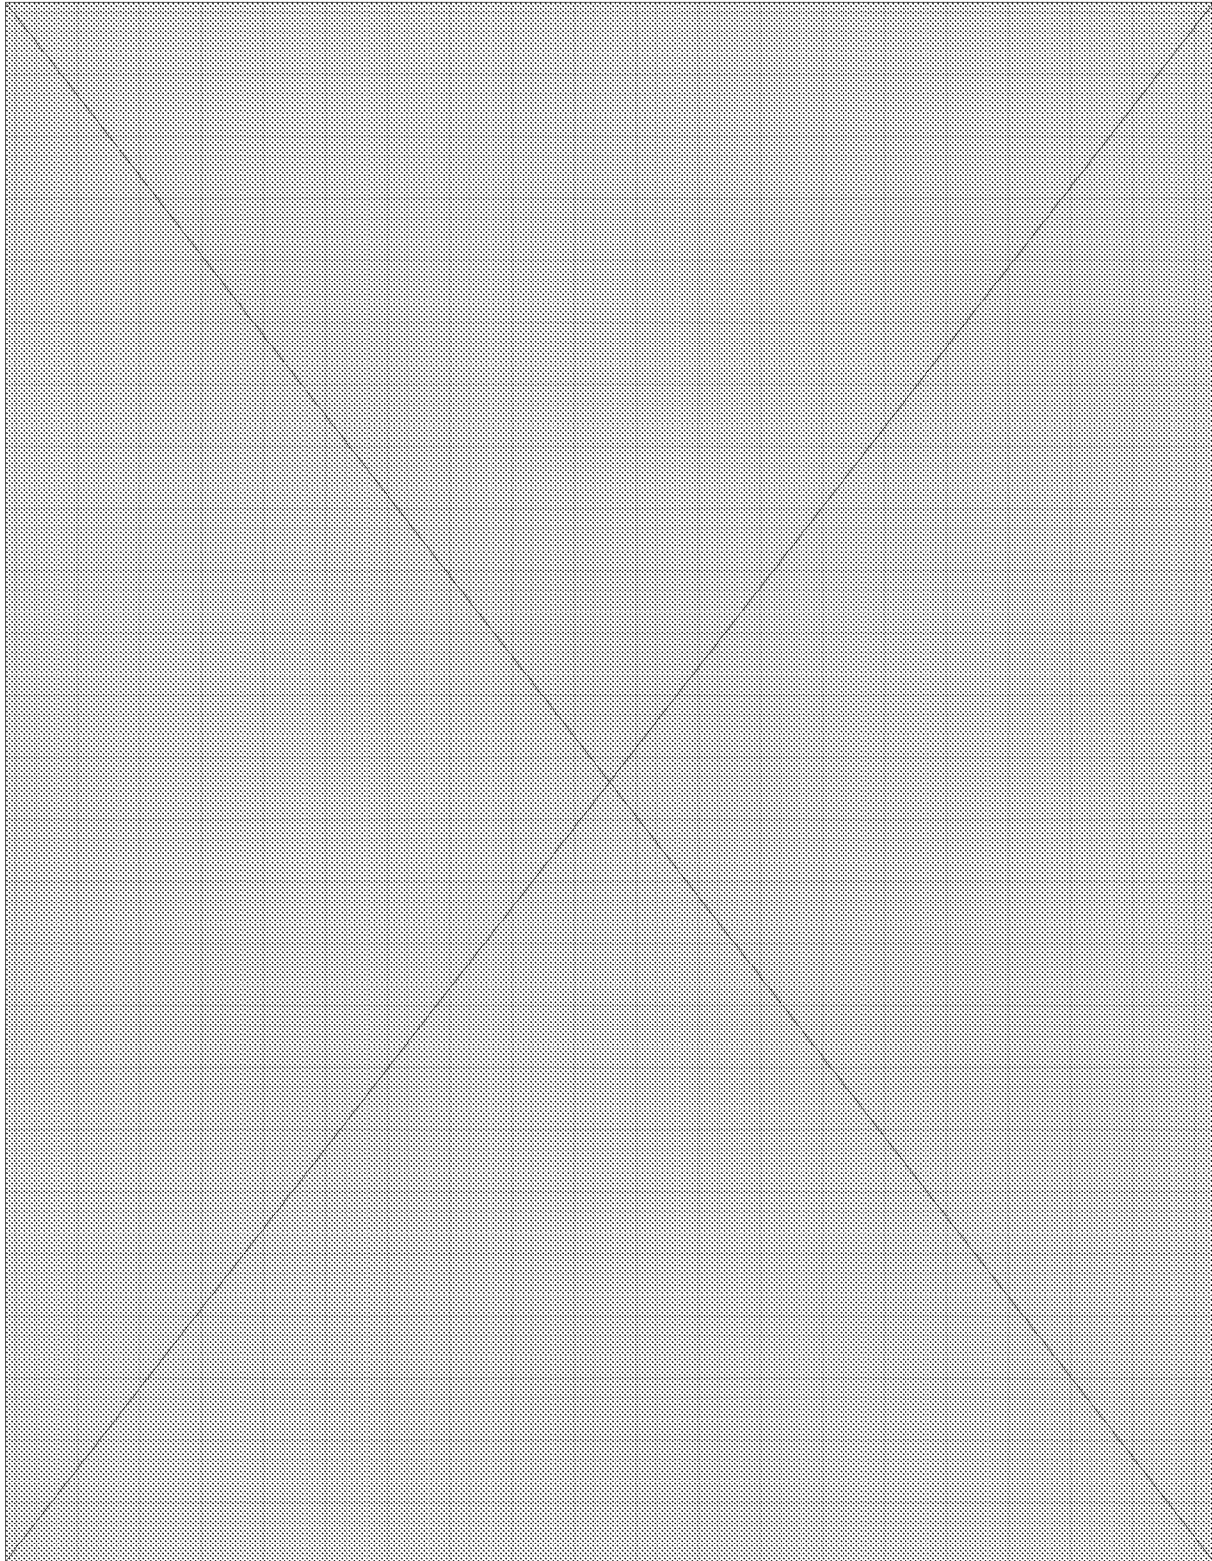

TAYLOR ENVIRONMENTAL GROUP, INC.
130 JERICHO TPKE., FLORAL PARK, NY 11001

516-358-2955
Fax 516-358-1700

LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT

CLIENT NAME/ADDRESS NYC SCA		CONTACT: Hamid SINDI		SAMPLER SIGNATURE <i>[Signature]</i>	DATE 8/11/02	TIME	SAMPLE(S) SEALED (YES) NO	
PROJECT LOCATION: 345 Chambers St NY		PROJECT # M477-15217-29881		SAMPLER NAME (PRINT) Kirk McKenzie		CORRECT CONTAINER(S) (YES) NO		
SAMPLE INFORMATION:				MATRIX (CIRCLE ONE): (PAVE) PAINT SOIL OTHER				
LABORATORY #	SAMPLE #	LOCATION	AREA (FT ²)	SURFACE MATERIAL				LAB RESULT
				WOOD	METAL	BRICK	OTHER	
	LW-09	6th Floor Corridor o/s Room 615 main ent. Floor	1				Y	69.0
	LW-10	6th Floor Corridor o/s Room 601 - Floor	1				X	69.0
	LW-11	Locker # 6-52 Floor of Locker	1		X			69.0
	LW-12	Room C632 (Stops) Floor	1				X	69.0
								69.0
	FBL1	Field Blank						69.0
	FBL2	Field Blank						69.0
				TURNAROUND REQUIRED: NORMAL ☐ SAT ☐ BY 1/1				COMMENTS / INSTRUCTIONS 6 HR TAT
RELINQUISHED BY (SIGNATURE) <i>[Signature]</i>	DATE 8/13/02	PRINTED NAME Kirk McKenzie	RECEIVED BY (SIGNATURE) <i>[Signature]</i>		DATE 8/11/02	PRINTED NAME D. Kocav		
RELINQUISHED BY (SIGNATURE) <i>[Signature]</i>	DATE	PRINTED NAME	RECEIVED BY LAB (SIGNATURE)		DATE	PRINTED NAME		

WHITE - OFFICE / YELLOW - LAB / PINK - CLIENT

07228

CITY_21MC100_008878402

ANALYTICAL SERVICES, INC.
 104 E 25th Street, 10th Floor
 New York, NY 10010
 Tel. 212-353-8280
 Fax 212-353-8306

REPORT DATE: 08-12-02
 CLIENT: Taylor Environmental Group, Inc.
 PROJECT NAME: SCA/Stuyvesant HS
 345 Chambers Street, NY
 PROJECT NUMBER: M477-15217-29881
 SAMPLED BY: Client
 SAMPLE DATE: 08-11-02
 DATE RECEIVED: 08-11-02
 DATE ANALYZED: 08-11-02
 SAMPLE MEDIA: Dust Wipe Sample
 ANALYSIS REQUIRED: Method EPA 3050/7420

ANALYSIS RESULTS

SAMPLE ID	BATCH NO.	SAMPLE DESCRIPTION	LEAD CONCENTRATION ($\mu\text{g}/\text{ft}^2$)	DETECTION LIMIT ($\mu\text{g}/\text{ft}^2$)
LW-01	21059	Rm 601 Floor Centre of Room	<9.0	9.0
LW-02	21059	Rm 601 Table Top South Side Table	<9.0	9.0
LW-03	21059	Rm 601A Floor 3' of Entrance	<9.0	9.0
LW-04	21059	Rm 601A Top of File Cabinet	<9.0	9.0
LW-05	21059	Rm 601B Floor 10' of Entrance	<9.0	9.0
LW-06	21059	Rm 601B Top of File Table	<9.0	9.0
LW-07	21059	Rm C621 Floor Right of Entrance	<9.0	9.0
LW-08	21059	Rm C623 Floor Center of Room	<9.0	9.0
LW-09	21059	6th Floor Corridor O/S Rm 615 Main Ent. Floor	<9.0	9.0
LW-10	21059	6th Floor Corridor O/S Rm 601 Floor	<9.0	9.0
LW-11	21059	Locker #6-53 Floor of Locker	<9.0	9.0
LW-12	21059	Rm C632 (Slop Sink) Floor	<9.0	9.0
FBL-1	21059	Field Blank	<9.0 μg	9.0 μg
FBL-2	21059	Field Blank	<9.0 μg	9.0 μg

07229

CITY_21MC100_008878403

ATC ASSOCIATES, INC.
104 E 25th Street, 10th Floor
New York, NY 10010
Tel. 212-353-8280
Fax 212-353-8306

NOTE 1:

THE REPORTING LIMIT (RL) IS 18.0 µg

NOTE 2:

HUD Guidelines for final clearance dust wipe samples: Floor 40 µg/ft², Window sills 250 µg/ft²,
Window wells 400 µg/ft², Exterior surfaces 800 µg/ft².

NOTE 3:

Blank units are in µg

CERTIFICATION AND SIGNATURES

ANALYSIS PERFORMED BY: BP

REPORT PREPARED BY: [Signature]

ATC certifies that this report is an accurate and authentic report of results obtained from the laboratory analysis.

QUALITY ASSURANCE COORDINATOR: [Signature]

LABORATORY DIRECTOR: [Signature]

ATC is accredited by the New York State Department of Health Environmental Laboratory Approval Program (ELAP) and by the American Industrial Hygiene Association (AIHA) to perform analysis of lead in paint, dust wipes, air and soil samples. (ELAP #13879), (AIHA #100229).

07230

CITY_21MC100_008878404

PAGE 09/14

EVS. ANALYTICAL INC.

8535-250-2535

212-250-2535 09/14/2002 07:23


TAYLOR ENVIRONMENTAL GROUP, INC.
130 JERICHO TPKE., FLORAL PARK, NY 11001

516-358-2755
FAX 516-358-1780

LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT

CLIENT NAME/ADDRESS NYC SCH		CONTACT HAMID SAWOJ		SAMPLER SIGNATURE <i>[Signature]</i>		DATE 08-09-02		TIME		SAMPLE(S) SEALED ☒ YES ☐ NO	
PROJECT LOCATION: STUYVESANT HS 345 CHAMBERS ST NY, NY		PROJECT # M477-15217-29881		SAMPLER NAME (PRINT) KIRK MC KEONIE						CORRECT CONTAINER(S) ☒ YES ☐ NO	
MATRIX (CIRCLE ONE): ☒ DUST ☐ PAINT ☐ SOIL ☐ OTHER											
SAMPLE INFORMATION:			AREA (F ²)	SURFACE MATERIAL				LAB RESULT	LAB RESULT <i>10.0</i>		
LABORATORY #	SAMPLE #	LOCATION		WOOD	METAL	PAINT	OTHER				
	LW-01	ROOM 627 - Floor 2' OF EAST window	1				X		<10.0		
	LW-02	ROOM 627 - Top of File cabinet	1		X				<10.0		
	LW-03	ROOM 627A - Floor Center of room	1				X		11.0		
	LW-04	ROOM 627A - Desk Top	1				X		14.0		
	LW-05	ROOM 625 - Floor By entrance	1				X		<10.0		
	LW-06	ROOM 629 - Floor 2' OF EAST ENTRANCE	1				X		<10.0		
	LW-07	ROOM 629 - Desk Top NE Desk	1				X		<10.0		
	LW-08	ROOM 635 - Floor 3' OF WEST window	1				X		<10.0		
TURNAROUND REQUIRED: NORMAL ☐ STAT ☐ BY 1/1				COMMENTS / INSTRUCTIONS 6 HRS TAT							
RELINQUISHED BY (SIGNATURE) <i>[Signature]</i>		DATE 8/10/02 TIME 01:15		PRINTED NAME Kirk McKeonie		RECEIVED BY (SIGNATURE) <i>[Signature]</i>		DATE		PRINTED NAME	
RELINQUISHED BY (SIGNATURE) <i>[Signature]</i>		DATE 09.10 TIME 5.00		PRINTED NAME FREDERICK MICHAEL		RECEIVED BY LAB (SIGNATURE)		DATE		PRINTED NAME	

FAX 212 406-2535 X 516 358-1780 WHITE - OFFICE / YELLOW - LAB / PINK - CLIENT

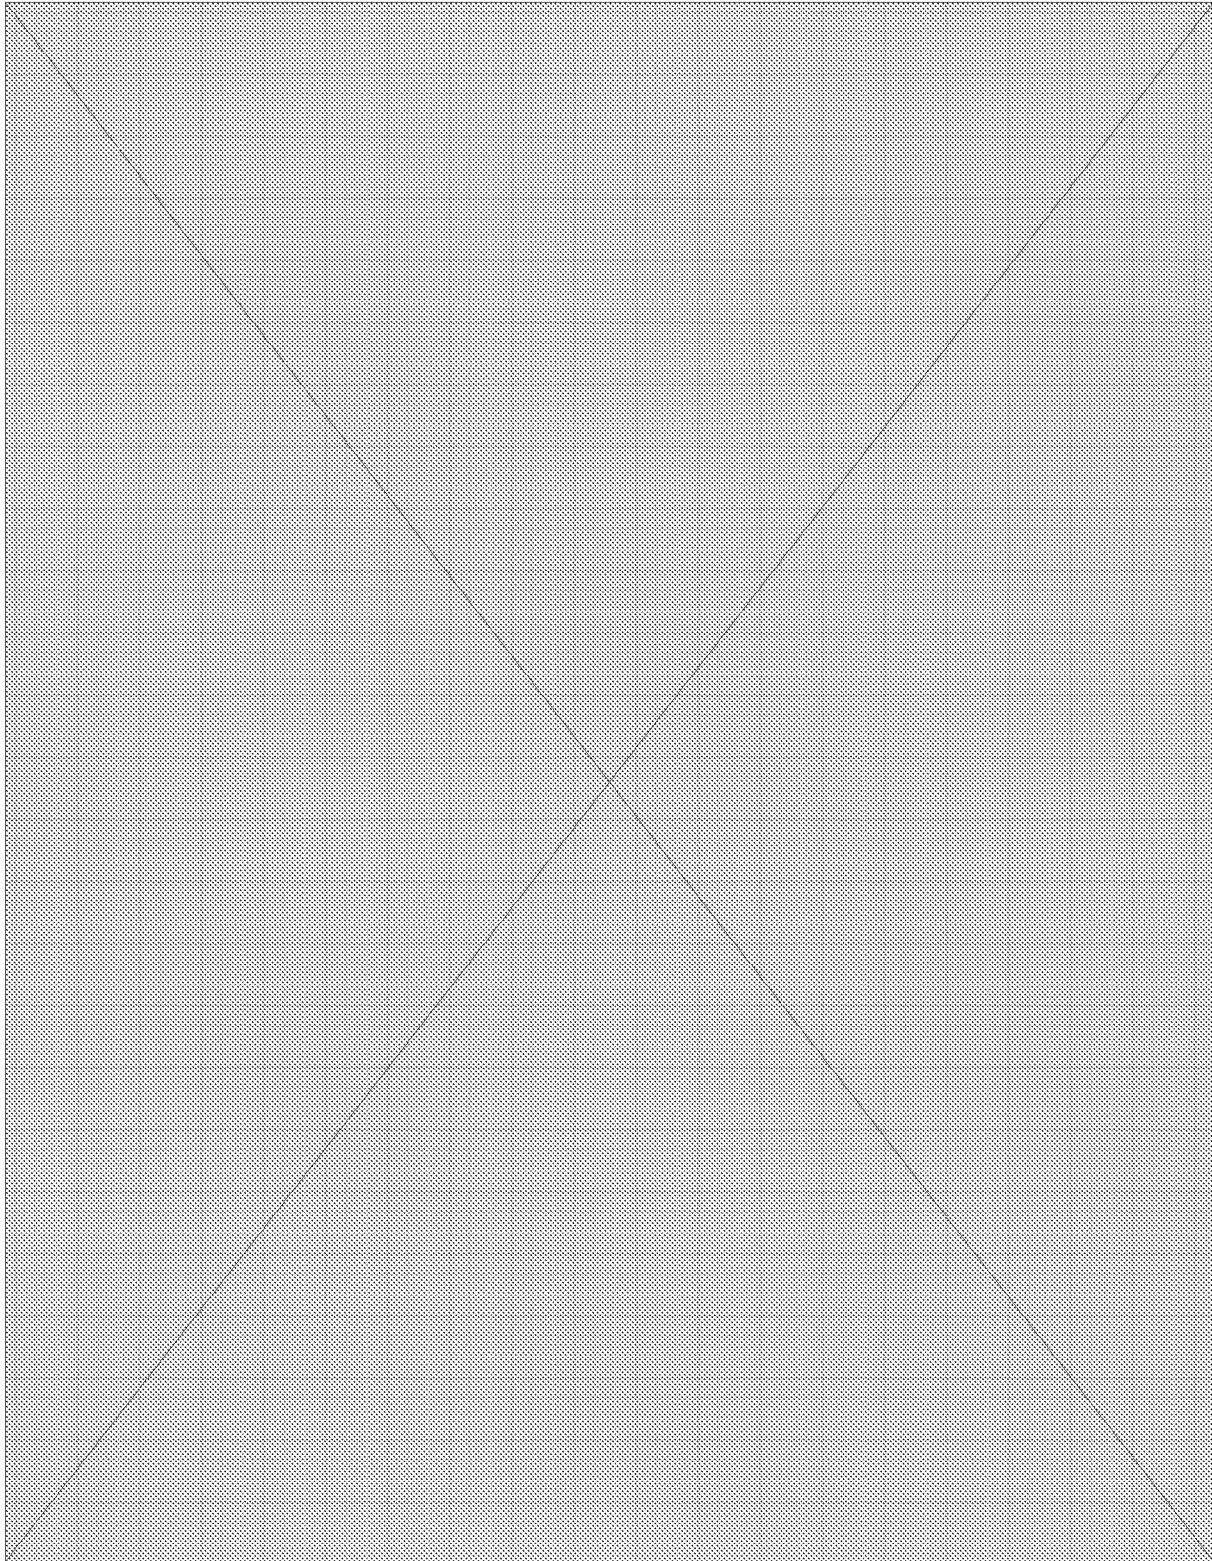

PAGE 11/14

ENVI ANALYTICAL INC

855-296-212

84-58

2002/01/07 233

TAYLOR ENVIRONMENTAL GROUP, INC.
130 JERICHO TPKE., FLORAL PARK, NY 11001

516-358-2955
Fax 516-358-1780

LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT

CLIENT NAME/ADDRESS NYC SCA		CONTACT HAROLD SAWOJ		SAMPLER (SIGNATURE) <i>[Signature]</i>	DATE 08/08/02	TIME	SAMPLE(S) SEALED ☒ YES / ☐ NO	
PROJECT LOCATION: STUDYVEST NT HS 345 HAMBERS ST. NY, NY		PROJECT # M477-19217-29881		SAMPLER NAME (PRINT) KIRK MC KENZIE		CORRECT CONTAINER(S) ☒ YES / ☐ NO		
SAMPLE INFORMATION:				MATRIX (CIRCLE ONE): ☒ WPE ☐ PAINT ☐ SOIL ☐ OTHER				
LABORATORY #	SAMPLE #	LOCATION	AREA (FT ²)	SURFACE MATERIAL				LAB RESULT
				WOOD	METAL	BRICK	OTHER	
	LW-17	ROOM 638 - FLOOR at north center cabana	1				X	<10.0
	LW-18	ROOM 638 - Table Top Teacher's table	1				X	<10.0
	LW-19	ROOM 636 - FLOOR 3' of wood entrance	1				X	12.0
	LW-20	ROOM 636 - Deck Top NE DRK	1				X	<10.0
	LW-21	ROOM 634 - FLOOR 3' of entrance	1				X	<10.0
	LW-22	ROOM 630 - FLOOR center of room	1				X	<10.0
	LW-23	ROOM C628 - FLOOR 2' of Service Elevator	1				X	<10.0
	LW-24	Locker # 6-127 Locker Floor	1		X			10.0
TURNAROUND REQUIRED:				COMMENTS / INSTRUCTIONS				
NORMAL ☐ STAT ☐ BY 1/1				6 hrs TAT				
RELINQUISHED BY (SIGNATURE) <i>[Signature]</i>		DATE 8/10/02 TIME 0115	PRINTED NAME Kirk McKenzie		RECEIVED BY (SIGNATURE) <i>[Signature]</i>		DATE TIME	PRINTED NAME
RELINQUISHED BY (SIGNATURE) <i>[Signature]</i>		DATE 08/10/02 TIME 5:00	PRINTED NAME TERESA MICHAEL		RECEIVED BY LAB (SIGNATURE)		DATE TIME	PRINTED NAME

FAX TO 212 406-2935

WHITE - OFFICE / YELLOW - LAB / PINK - CLIENT

07/23/2022 09:48

Fax 516 358-1780

WHITE - OFFICE / YELLOW - LAB / PINK - CLIENT

08/18/2002 09:46 111-152-0500

EMSL Analytical, Inc.

EMSL Analytical, Inc.

507 West 38th Street, New York, NY 10018

Phone: 212-290-0051 Fax: 212-290-0055 Email: manhattanlab@emsl.com



Attn: Taylor Environmental Group, Inc.
Floral Park Corporate Center
130 Jencho Tpke.
Floral Park, NY 11001

Fax: (516) 356-1780

Phone: 516-358-2955

Project: NYC SCA/Stuyvesant H.S. 345 Chambers St., New York,
N.Y. JM477-15217-29821.

Customer ID: TAYL50

Customer PO:

Received: 08/10/02 8:45 AM

EMSL Order: 030210972

EMSL Project ID:

Lead in Wipes by Flame AAS (SW 846, 7420)

Client Sample Description	Lab ID	Analyzed	Area Sampled	Lead Concentration	Notes
LW-01 Room 627-Floor 2' of East Unit Vent	0001		144 in ²	<10.0 µg/m ²	
LW-02 Room 627-Top of File Cabinet	0002		144 in ²	<10.0 µg/m ²	
LW-03 Room 627A-Floor Center of Room	0003		144 in ²	11.0 µg/m ²	
LW-04 Room 627A-Desk Top	0004		144 in ²	14.0 µg/m ²	
LW-05 Room 625-Floor by Entrance	0005		144 in ²	<10.0 µg/m ²	
LW-06 Room 625-Floor 3' of East Entrance	0006		144 in ²	<10.0 µg/m ²	
LW-07 Room 629-Desk Top NE Desk	0007		144 in ²	<10.0 µg/m ²	
LW-08 Room 635-Floor 3' of West Unit Vent	0008		144 in ²	<10.0 µg/m ²	
LW-09 Room 635-Table Top Teachers Table	0009		144 in ²	10.0 µg/m ²	
LW-10 Room 633-Floor Center of Room	0010		144 in ²	<10.0 µg/m ²	
LW-11 Room 635-Floor Center of Room	0011		144 in ²	<10.0 µg/m ²	
LW-12 Room 639-Top of Filing Cabinet	0012		144 in ²	<10.0 µg/m ²	
LW-13 Room 637-Floor Center of Room	0013		144 in ²	<10.0 µg/m ²	
LW-14 Room 631-Floor Center of Room	0014		144 in ²	<10.0 µg/m ²	
LW-15 Room 640-Floor 2' of SE Cabinet	0015		144 in ²	11.0 µg/m ²	
LW-16 Room 640-Desk Top SE Desk	0016		144 in ²	<10.0 µg/m ²	
LW-17 Room 638-Floor at North Center Column	0017		144 in ²	<10.0 µg/m ²	
LW-18 Room 638-Table Top	0018		144 in ²	<10.0 µg/m ²	

Eric B. ZB
Laboratory Manager
or other approved signatory

Reporting Limit: 10 µg/m²
ACCREDITATIONS: NHA Environmental Lead Laboratory Approval Program #102581

Page 1 of 2

07235

06/10/2002 09:48 212-290-0538


EMSL Analytical, Inc.

Page 2 of 2

EMSL Analytical, Inc.

307 West 38th Street, New York, NY 10018

Phone: 212-290-0051 Fax: 212-290-0538 Email: manhattanlab@emsl.com

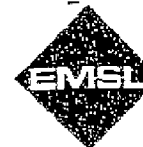

Attn: Taylor Environmental Group, Inc.
Floral Park Corporate Center
130 Jericho Tpke.
Floral Park, NY 11001

Customer ID: TAYLE0
Customer PO:
Received: 08/10/02 8:45 AM

Fax: (516) 358-1780 Phone: 516-358-2955

EMSL Order: 030210972

Project: NYC SCA/Stuyvesant H.S. 345 Chambers St., New York,
N.Y. J477-15217-29661.

EMSL Project ID:

Lead in Wipes by Flame AAS (SW 846, 7420)

Client Sample Description	Lab ID	Analyzed	Area Sampled	Lead Concentration	Notes
Teachers Table					
LW-19 Room 638-Floor 3' of West Entrance	0019		144 in ²	12.0 µg/ft ²	
LW-20 Room 638-Desk Top NE Desk	0020		144 in ²	<10.0 µg/ft ²	
LW-21 Room 634-Floor 3' of Entrance	0021		144 in ²	<10.0 µg/ft ²	
LW-22 Room 630-Floor Center of Room	0022		144 in ²	<10.0 µg/ft ²	
LW-23 Room 628-Floor 3' of Service Elevator	0023		144 in ²	<10.0 µg/ft ²	
LW-24 Locker #6-127 Locker Floor	0024		144 in ²	10.0 µg/ft ²	
LW-25 6th Floor Corridor Between Rms 636&625	0025		144 in ²	<10.0 µg/ft ²	
LW-26 Field Blank	0026		n/a	<10.0 µg/wipe	
LW-27 Field Blank	0027		n/a	<10.0 µg/wipe	
LW-28 Field blank	0028		n/a	<10.0 µg/wipe	

Eric B. Z. B.
Laboratory Manager
or other approved signatory


Reporting limit is 10 µg/wipe

ACCREDITATIONS: AIHA Environmental Lead Laboratory Approval Program #102381



Page 2 of 2

07236

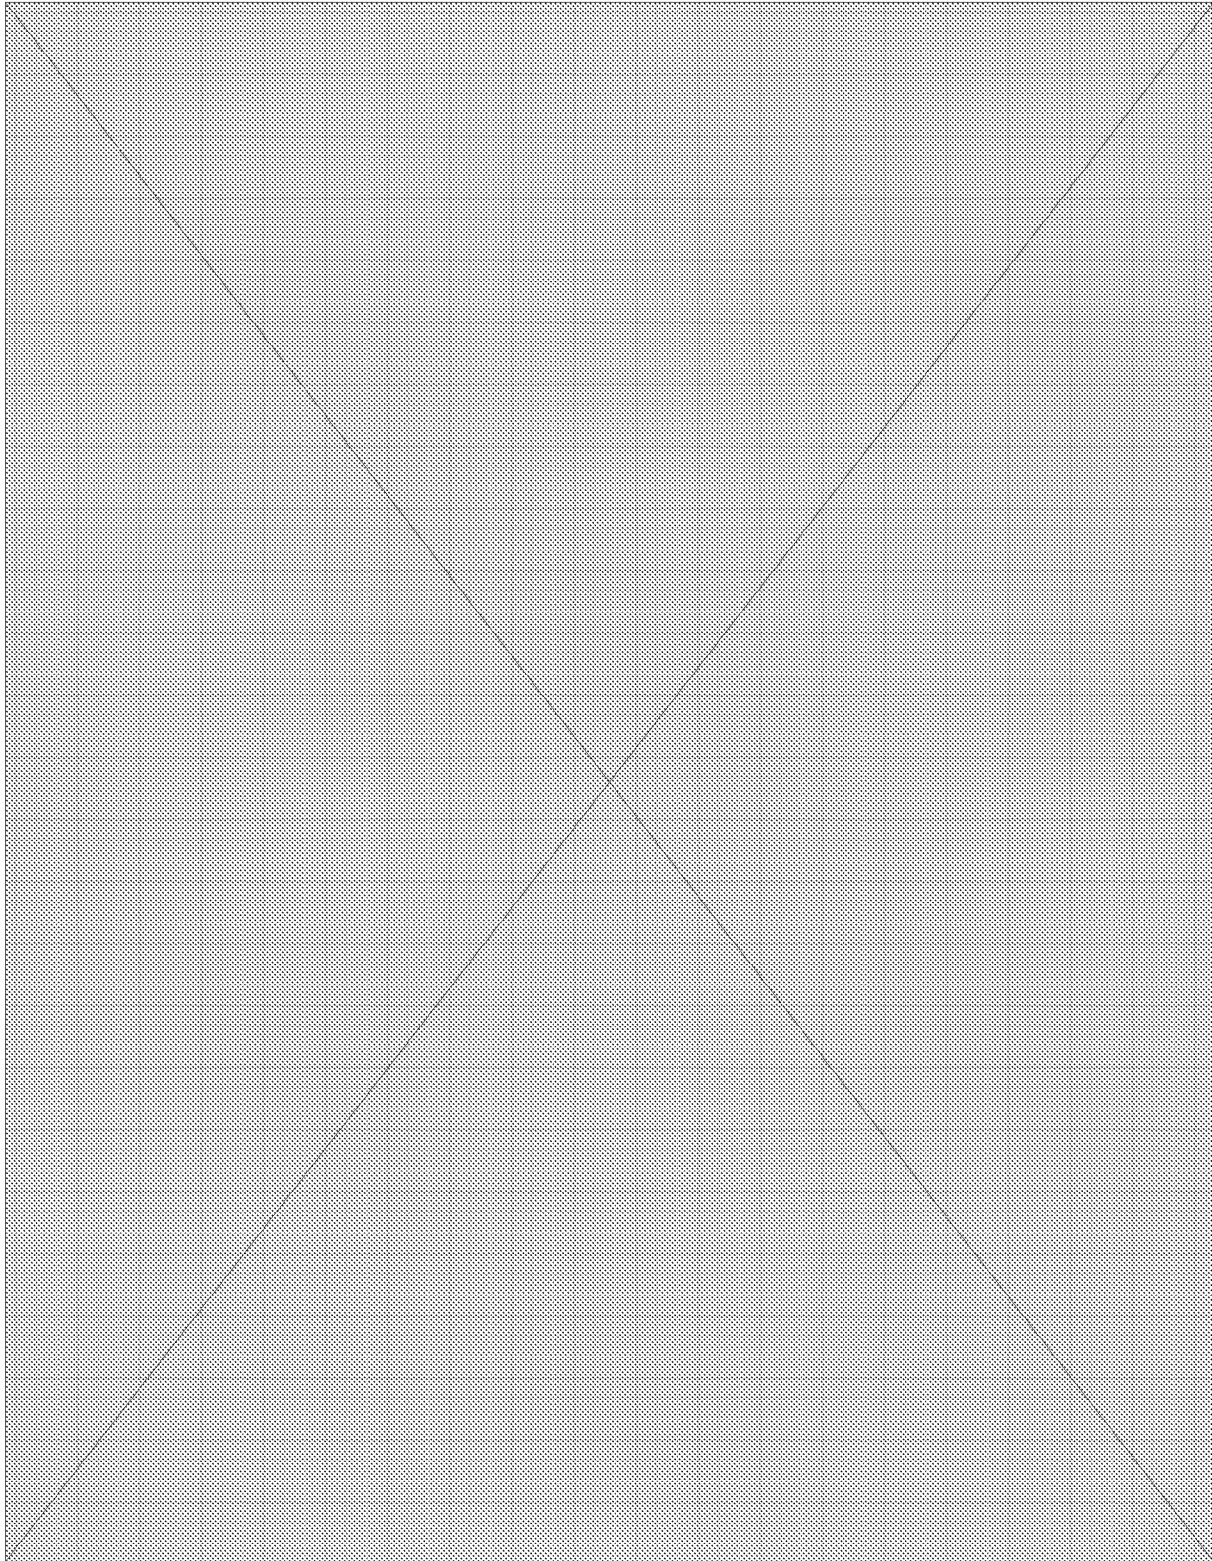

NYC-WTC_000231162

08/11/2002 15:29 012-290-1535

012-290-1535

EMSL Analytical, Inc.

307 West 26th Street, New York, NY 10013

Phone: 212-290-0251 Fax: 212-290-0658 Email: manhattanlab@emsl.com



Attn: Taylor Environmental Group, Inc.
 Floral Park Corporate Center
 130 Jensch 10ks
 Floral Park, NY 11001

Fax: (516) 358-1780

Phone: 516-358-2955

Project: M-77-15217-29881 / Stuyvesant H.S. 345 Chambers St
 NY, / NYC SCA

Customer ID: TAYL50

Customer PO:

Received: 08/11/02 5:53 AM

EMSL Order: 030211037

EMSL Project ID:

Lead in Wipes by Flame AAS (SW 846, 7420)

Client Sample Description	Lab ID	Analyzed	Area Sampled	Lead Concentration	Notes
LW-13 GYM (G580) FLOOR S OF ENTRANCE	0001	8/11/02	144 in ²	<10.0 µg/ft ²	
LW-14 GYM (G580) EAST SIDE LEDGE	0002	8/11/02	144 in ²	<10.0 µg/ft ²	
LW-15 G580 A FLOOR CENTER OF ROOM	0003	8/11/02	144 in ²	<10.0 µg/ft ²	
LW-16 G580 A SHELF TOP SE SIDE	0004	8/11/02	144 in ²	<10.0 µg/ft ²	
LW-17 G580 B FLOOR CENTER OF ROOM	0005	8/11/02	144 in ²	<10.0 µg/ft ²	
LW-18 G580 B TOP CABINET EAST SIDE	0006	8/11/02	144 in ²	<10.0 µg/ft ²	
LW-19 G580 C FLOOR BY ENTRANCE	0007	8/11/02	144 in ²	<10.0 µg/ft ²	
LW-20 G580 D FLOOR BY ENTRANCE	0008	8/11/02	144 in ²	<10.0 µg/ft ²	
LW-21 G580 E FLOOR CENTER	0009	8/11/02	144 in ²	<10.0 µg/ft ²	
FBL1 Field blank	0010	8/11/02	n/a	<10.0 µg/wipe	
FBL2 Field blank	0011	8/11/02	n/a	<10.0 µg/wipe	
LW-22 G580 D SHELF TOP	0012	8/11/02	144 in ²	<10.0 µg/ft ²	

M. Appleton

Laboratory Manager
or other approved signatory

ANALYST

Reporting limit is 10 µg/wipe

ACCREDITATIONS: NIA Environmental Lead Laboratory approval Program #102581

Page 1 of 1

07220

Fax 516-350-1780

Fax 516-358-1781

LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT

CLIENT NAME/ADDRESS NYCSCA Stuyvesant H.S.		CONTACT HARRY SAVOY		SAMPLER SIGNATURE Carlos A. Joffe		DATE 8/9/02		TIME 11:40		SAMPLE(S) SEALED YES / NO YES / NO	
PROJECT LOCATION HAMBOSS ST, NY, NY		PROJECT # M477-15217/29881		SAMPLER NAME (PRINT) Carlos Joffe		CORRECT CONTAINER(S) YES / NO YES / NO					
SAMPLE INFORMATION:				MATRIX (CIRCLE ONE): <u>WIPE</u> PAINT SOIL OTHER							
LABORATORY #	SAMPLE #	LOCATION	AREA (FT ²)	SURFACE MATERIAL				LAB RESULT			
				WOOD	METAL	BRICK	OTHER				
	LW-01	6TH FL DANCE STUDIO FLOOR AND LEFT WINDOW	1.0	X				49.0			
	LW-02	6TH FL DANCE STUDIO TABLE TOP - R.H.S.	1.0	X				49.0			
	FB-1	F/BLANK	—					49.0			
	FB-2	F/BLANK	—					49.0			
			TURNAROUND REQUIRED: NORMAL ☐ STAT ☐ BY 1/1				COMMENTS / INSTRUCTIONS 6TH FL				
RELINQUISHED BY (SIGNATURE) Carlos A. Joffe		DATE 8-9-02	PRINTED NAME		RECEIVED BY (SIGNATURE)		DATE	PRINTED NAME			
		TIME					TIME				
RELINQUISHED BY (SIGNATURE) J. L. Joffe		DATE	PRINTED NAME		RECEIVED BY LAB (SIGNATURE) ATC Lab / Joffe		DATE 08/09/02	PRINTED NAME			
		TIME 5:30					TIME 17:30	D. KOGAN			

WHITE - OFFICE / YELLOW - LAB / PINK - CLIENT

07240

ATC ASSOCIATES, INC.
104 E 25th Street, 10th Floor
New York, NY 10010
Tel. 212-353-8280
Fax 212-353-8306

REPORT DATE: 08-12-02
CLIENT: Taylor Environmental Group, Inc.
PROJECT NAME: SCA/Stuyvesant HS
345 Chambers Street, NY
PROJECT NUMBER: M477-15217-29881
SAMPLED BY: Client
SAMPLE DATE: 08-09-02
DATE RECEIVED: 08-09-02
DATE ANALYZED: 08-09-02
SAMPLE MEDIA: Dust Wipe Sample
ANALYSIS REQUIRED: Method EPA 3050/7420

ANALYSIS RESULTS

SAMPLE ID	BATCH NO.	SAMPLE DESCRIPTION	LEAD CONCENTRATION (µg/ft²)	DETECTION LIMIT (µg/ft²)
LW-01	21042	6th Floor Dance Studio Floor Adj. Left Window	<9.0	9.0
LW-02	21042	6th Floor Dance Studio Table Top R.H.S.	<9.0	9.0
FB-1	21042	Field Blank	<9.0 µg	9.0 µg
FB-2	21042	Field Blank	<9.0 µg	9.0 µg

NOTE 1:
THE REPORTING LIMIT (RL) IS 18.0 µg
NOTE 2:
HUD Guidelines for final clearance dust wipe samples: Floor 40 µg/ft², Window sills 250 µg/ft²,
Window wells 400 µg/ft², Exterior surfaces 800 µg/ft².
NOTE 3:
Blank units are in µg

CERTIFICATION AND SIGNATURES

ANALYSIS PERFORMED BY: [Signature]

REPORT PREPARED BY: [Signature]


ATC certifies that this report is an accurate and authentic report of results obtained from the laboratory analysis.

QUALITY ASSURANCE COORDINATOR: [Signature]

LABORATORY DIRECTOR: [Signature]

ATC is accredited by the New York State Department of Health Environmental Laboratory Approval Program (ELAP) and by the American Industrial Hygiene Association (AIHA) to perform analysis of lead in paint, dust wipes, air and soil samples. (ELAP #10879), (AIHA #160229).

07241

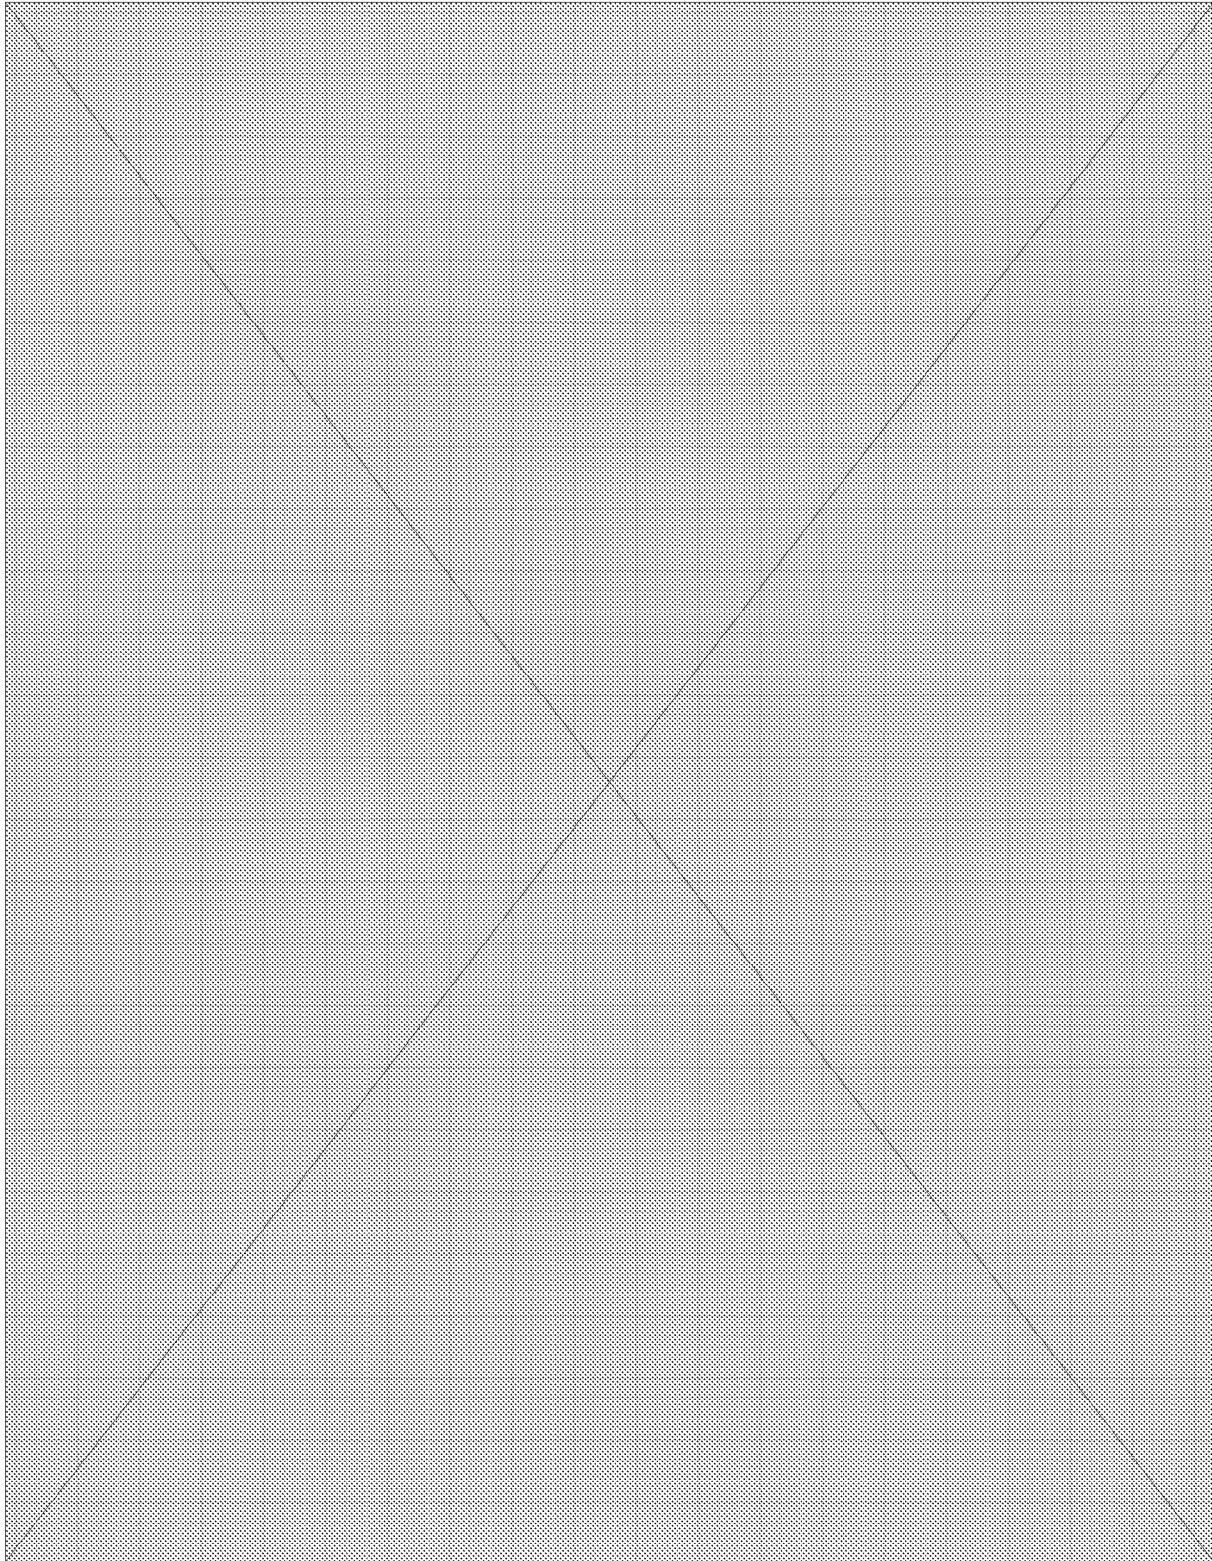

08/10/2002 09:48 212-250-2539

EMSL Analytical, Inc.



EMSL Analytical, Inc.

307 West 35th Street, New York, NY 10018

Phone: 212-250-0051 Fax: 212-250-0058 Email: manhattanlab@emsl.com

Attn: Taylor Environmental Group, Inc.
Floral Park Corporate Center
130 Jericho Tpke.
Floral Park, NY 11001

Fax: (516) 358-1780 Phone: 516-358-2955

Project: NYC SCA/Stuyvesant H.S. 345 Chambers St., New York.
N.Y./M477-15217-29881.

Customer ID: TAYL50

Customer PO:

Received: 08/10/02 8:13 AM

EMSL Order: 030210969

EMSL Project ID:

Lead in Wipes by Flame AAS (SW 846, 7420)

Client Sample Description	Lab ID	Analyzed	Area Sampled	Lead Concentration	Notes
LW-01 Room 650	0001		144 in²	<10.0 µg/m²	
FBL-1 Field blank	0002		n/a	<10.0 µg/wipe	
FBL-2 Field blank	0003		n/a	<10.0 µg/wipe	

E. B. B.
Laboratory Manager
or other approved signatory

Reporting limit is 10 µg/wipe
ACCREDITATIONS: AHA Environmental Lead Laboratory Approval Program #102581

Page 1 of 1

07243

TAYLOR ENVIRONMENTAL GROUP, INC.
130 JERICHO TPKE., FLORAL PARK, NY 11001

030211095

516-350-2955
Fax 516-350-1700

05/12/2002 21:14

212-290-2538

ENSL ANALYTICAL, INC.

PAGE 03/60

LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT

CLIENT NAME/ADDRESS SCA		CONTACT: Hamid Savaf		SAMPLER SIGNATURE: <i>[Signature]</i>	DATE 8/12/02	TIME	SAMPLE(S) SEALED (YES) NO	
PROJECT LOCATION: Sturgesand H.S.		PROJECT # NY 477-15217 / 24881		SAMPLER NAME (PRINT) A.L. Karamov		CORRECT CONTAINER(S) (YES) NO		
SAMPLE INFORMATION:				MATRIX (CIRCLE ONE): WIFE PAINT SOIL OTHER				
LABORATORY #	SAMPLE #	LOCATION	AREA (FT ²)	SURFACE MATERIAL				LAB RESULT
				WOOD	METAL	BRICK	OTHER	
	LW-01	Rm 507 TEACHER'S DESK	1				X	<10.0
	LW-02	Rm 507 FLOOR SW NEAR WINDOW	1				X	<10.0
	LW-03	Rm 505 TEACHER'S DESK	1				X	<10.0
	LW-04	Rm 505 FLOOR NEAR EAST DOOR	1				X	<10.0
	LW-05	Rm 503 TEACHER'S DESK	1				X	<10.0
	LW-06	Rm 503 FLOOR SE NEAR WINDOW	1				X	<10.0
	LW-07	Rm 501B REFRIGERATION TOP	1		X		X	<10.0
	LW-08	Rm 501B FLOOR SE NEAR WINDOW	1				X	<10.0
Fax results to Taylor on site (212) 406-2535				TURNAROUND REQUIRED: NORMAL ☐ STAT ☐ BY 1/1		COMMENTS / INSTRUCTIONS 6 hrs. FAST		
RELINQUISHED BY (SIGNATURE) <i>[Signature]</i>		DATE 8-12-02	PRINTED NAME [Name]	RECEIVED BY (SIGNATURE) <i>[Signature]</i>		DATE 8/12/02	PRINTED NAME	
RELINQUISHED BY (SIGNATURE) <i>[Signature]</i>		DATE 8/12/02	PRINTED NAME	RECEIVED BY LAB (SIGNATURE)		DATE	PRINTED NAME	
		TIME 1650				TIME		

WHITE - OFFICE / YELLOW - LAB / PINK - CLIENT

07244

CITY_21MC100_008878418

TAYLOR ENVIRONMENTAL GROUP, INC.
130 JERICHO TPKE., FLORAL PARK, NY 11001

030211095

516-358-2955
Fax 516-358-1780

08/12/2002 21:14

212-298-2538

ENSL ANALYTICAL INC.

PAGE 04/05

LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT

CLIENT NAME/ADDRESS NYC SCA		CONTACT HARID SAUDJ		SAMPLER (SIGNATURE) <i>[Signature]</i>		DATE 8-12-02		TIME		SAMPLE(S) SEALED ☒ YES ☐ NO	
PROJECT LOCATION STUYVESANT H.S.		PROJECT # M477-15217/29881		SAMPLER NAME (PRINT) CARLOS JOINT						CORRECT CONTAINER(S) ☒ YES ☐ NO	
SAMPLE INFORMATION:				MATRIX (CIRCLE ONE): ☒ WIPES ☐ PAINT ☐ SOIL ☐ OTHER							
LABORATORY #	SAMPLE #	LOCATION	AREA (FT ²)	SURFACE MATERIAL WOOD METAL BRICK OTHER				LAB RESULT			
	LW-09	RM 501 F FLOOR UNDER SINK	1				X	<10.0			
	LW-10	RM 501 C TOP OF LOBBY # 9A	1		X			<10.0			
	LW-11	RM 501 C FLOOR NEAR LOBBY # 9A	1				X	<10.0			
	LW-12	RM 501 E FLOOR SHOWER AREA	1				X	<10.0			
	LW-13	RM 501 A BOOK CABINET	1	X				<10.0			
	LW-14	RM 501 A FLOOR NEAR MIDDLE WINDOW	1				X	<10.0			
	LW-15	RM 502 B SHELF AT ENTRANCE	1		X			<10.0			
	LW-16	RM 502 B FLOOR BELOW CABINETS	1					<10.0			
Fax Results to (212) 406-2535				TURNAROUND REQUIRED: NORMAL ☐ STAT ☐ BY 1/1				COMMENTS / INSTRUCTIONS CARLOS TAT			
RELINQUISHED BY (SIGNATURE) <i>[Signature]</i>		DATE 8-12-02 TIME 1600		PRINTED NAME C. SAUDJ		RECEIVED BY (SIGNATURE) <i>[Signature]</i>		DATE 8/10/2		PRINTED NAME	
RELINQUISHED BY (SIGNATURE) <i>[Signature]</i>		DATE 8/12/02 TIME 1650		PRINTED NAME		RECEIVED BY LAB (SIGNATURE)		DATE		PRINTED NAME	

WHITE - OFFICE / YELLOW - LAB / PINK - CLIENT

07245

CITY_21MC100_008878419

TAYLOR ENVIRONMENTAL GROUP, INC.
130 JERICHO TPKE., FLORAL PARK, NY 11001

03021095

516-358-2955
Fax 516-358-1780

08/12/2002 21:14

212-280-2538

ENSL ANALYTICAL INC.

PAGE 02/00


LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT

CLIENT NAME/ADDRESS NYC SCH.		CONTACT: HAKID SAUDJ.		SAMPLER SIGNATURE: CARLOS BOFAT		DATE 8-12-02		TIME		SAMPLE(S) SEALED ☒ YES / ☐ NO			
PROJECT LOCATION: STUYVESANT H.S.		PROJECT # #1447-45217/24881		SAMPLER NAME (PRINT) CARLOS BOFAT						CORRECT CONTAINER(S) ☒ YES / ☐ NO			
SAMPLE INFORMATION:				MATRIX (CIRCLE ONE): ☒ WIFE ☐ PAINT ☐ SOIL ☐ OTHER									
LABORATORY #		SAMPLE #		LOCATION		AREA (FT ²)		SURFACE MATERIAL				LAB RESULT	
								WOOD METAL BRICK OTHER					
		LW-17		RM 502 A TOP OF FILING CABINET		1		X				<10.0	
		LW-18		RM 502 A FLOOR BENEATH COMPUTER DESK		1		X				<10.0	
		LW-19		RM 502 TOP OF CABINET		1		X				<10.0	
		LW-20		RM 502 FLOOR NEAR ENTRANCE		1		X				<10.0	
		LW-21		RM 504 COMPUTER DESK		1		X				<10.0	
		LW-22		RM 504 FLOOR SE CORNER		1		X				<10.0	
		LW-23		RM 6582 BENCH TOP		1		X				<10.0	
		LW-24		RM 6582 FLOOR BENEATH SINK		1		X				<10.0	
FAX RESULTS TO (212) 406-2535						TURNAROUND REQUIRED: NORMAL ☐ STAT ☐ BY 1/1			COMMENTS / INSTRUCTIONS GARS TAT				
RELINQUISHED BY (SIGNATURE) Carlos Bofat		DATE 8-12-02 TIME 1600		PRINTED NAME C. J. BOFAT		RECEIVED BY (SIGNATURE) J. J. Quispe		DATE 8/12/02		PRINTED NAME			
RELINQUISHED BY (SIGNATURE) Tanner M.		DATE TIME 1650		PRINTED NAME		RECEIVED BY LAB (SIGNATURE)		DATE TIME		PRINTED NAME			

WHITE - OFFICE / YELLOW - LAB ONLY

07246

CITY_21MC100_008878420

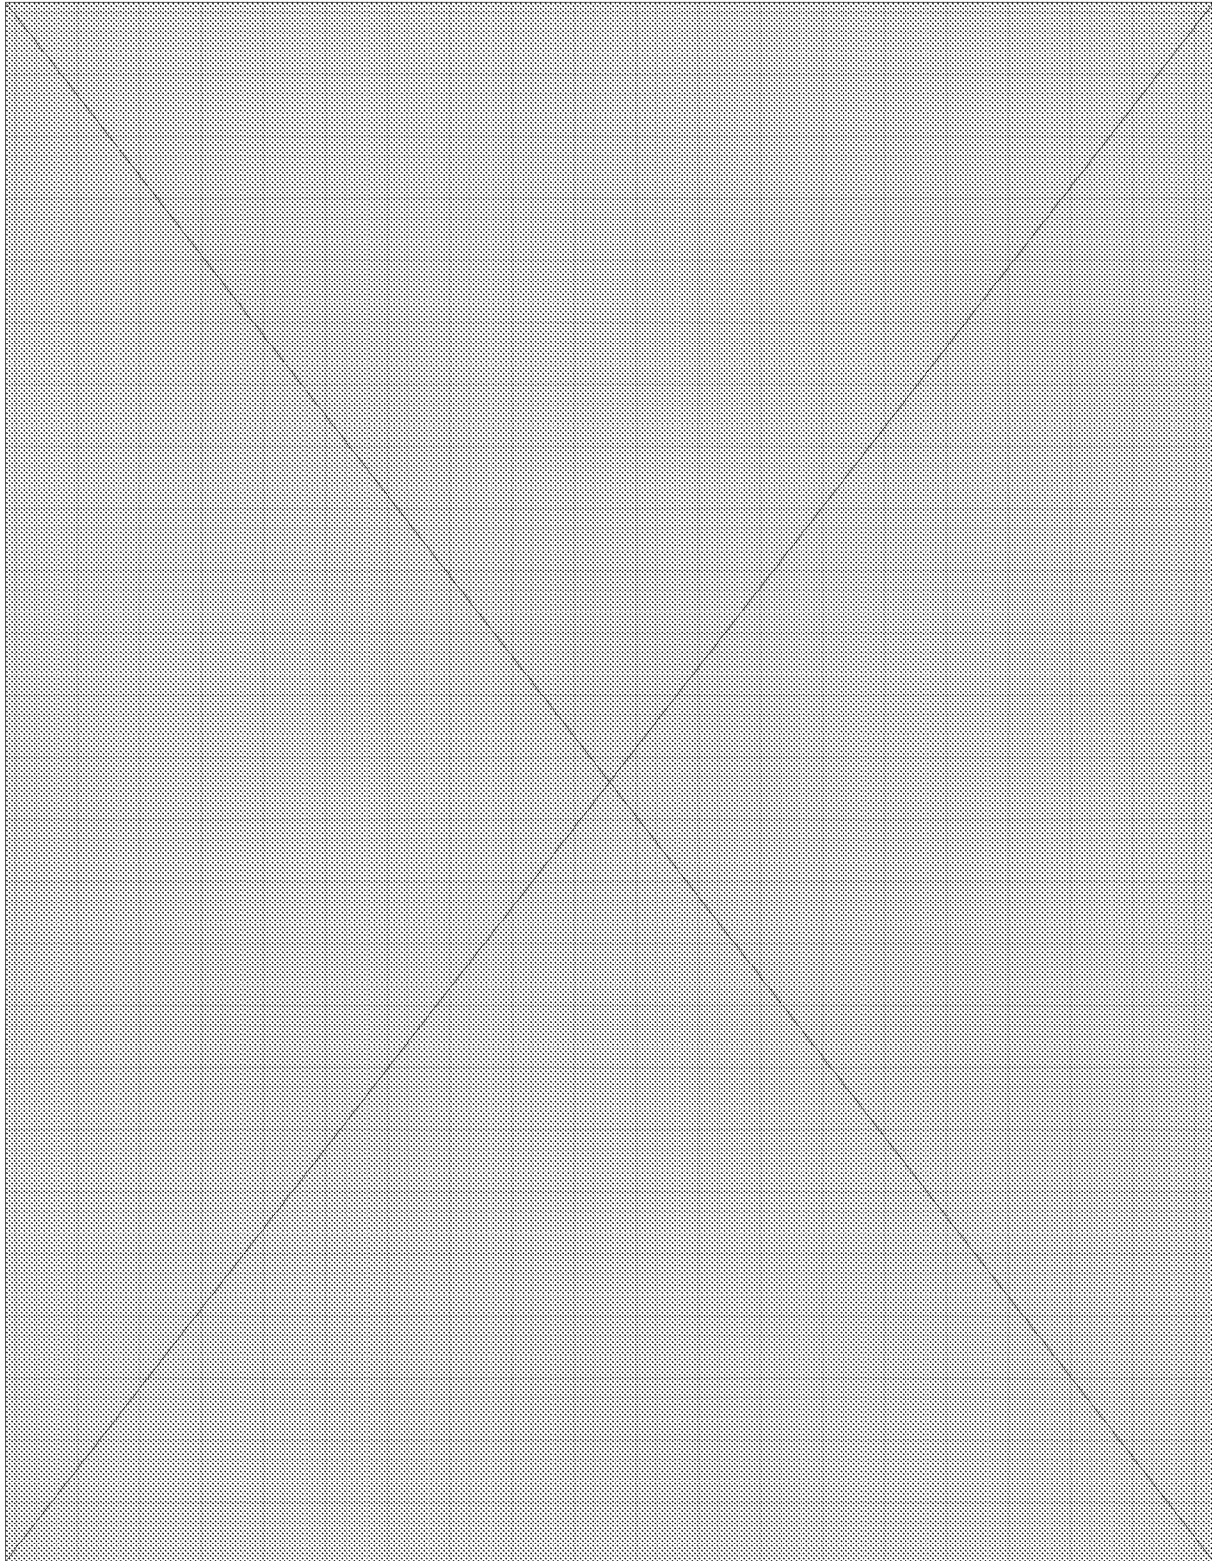

08/12/2002 21:14 212-290-2536

EMSL ANALYTICAL INC.

PAGE 01/02

EMSL Analytical, Inc.

307 West 38th Street, New York, NY 10012

Phone: 212-290-0951 Fax: 212-250-0058 Email: manhattanlab@emsl.com



Attn: Taylor Environmental Group, Inc.
Floral Park Corporate Center
130 Jericho Tpke.
Floral Park, NY 11001

Fax: (516) 358-1780

Phone: 516-358-2955

Project: M477-15217/29881 / NYC SCA / Stuyvesant HS

Customer ID: TAYL50

Customer PO:

Received: 08/12/02 4:50 PM

EMSL Order: 030211096

EMSL Project ID:

Lead in Wipes by Flame AAS (SW 846, 7420)

Client Sample Description	Lab ID	Analyzed	Area Sampled	Lead Concentration	Notes
LW-01 Rm 507 teachers desk	0001	8/12/02	144 in ²	<10.0 µg/ft ²	
LW-02 Rm 507 floor SW near window	0002	8/12/02	144 in ²	<10.0 µg/ft ²	
LW-03 Rm 505 teachers desk	0003	8/12/02	144 in ²	<10.0 µg/ft ²	
LW-04 Rm 505 floor near east door	0004	8/12/02	144 in ²	<10.0 µg/ft ²	
LW-05 Rm 503 teachers desk	0005	8/12/02	144 in ²	<10.0 µg/ft ²	
LW-06 Rm 503 SE floor near window	0006	8/12/02	144 in ²	<10.0 µg/ft ²	
LW-07 Rm 501B Refrigerator	0007	8/12/02	144 in ²	<10.0 µg/ft ²	
LW-08 Rm 501S SE floor near window	0008	8/12/02	144 in ²	<10.0 µg/ft ²	
LW-09 Rm 501F floor under sink	0009	8/12/02	144 in ²	<10.0 µg/ft ²	
LW-10 Rm 501C floor near locker #94	0010	8/12/02	144 in ²	<10.0 µg/ft ²	
LW-11 Rm 501C floor near locker #91	0011	8/12/02	144 in ²	<10.0 µg/ft ²	
LW-12 Rm 501E floor shower area	0012	8/12/02	144 in ²	<10.0 µg/ft ²	
LW-13 Rm 501A book cabinet	0013	8/12/02	144 in ²	<10.0 µg/ft ²	
LW-14 Rm 501A near floor middle window	0014	8/12/02	144 in ²	<10.0 µg/ft ²	
LW-15 Rm 502B shelf at entrance	0015	8/12/02	144 in ²	<10.0 µg/ft ²	
LW-16 Rm 502B floor below cabinet	0016	8/12/02	144 in ²	<10.0 µg/ft ²	
LW-17 Rm 502A top of filing cabinet	0017	8/12/02	144 in ²	<10.0 µg/ft ²	
LW-18 Rm 502A floor beneath computer desk	0018	8/12/02	144 in ²	<10.0 µg/ft ²	
LW-19 Rm 502 top of cabinet	0019	8/12/02	144 in ²	<10.0 µg/ft ²	
LW-20 Rm 502 floor near entrance	0020	8/12/02	144 in ²	<10.0 µg/ft ²	

M. Applender
Laboratory Manager
or other approved signatory

ANALYST

Reporting limit is 10 µg/ft²

ACCREDITATION: NATA Environmental Lead Laboratory Approval Program #102391



Page 1 of 2

07248

08/12/2002 21:14 212-290-2536

EMSL ANALYTICAL INC

PAGE 02/06

EMSL Analytical, Inc.

307 West 38th Street, New York, NY 10018

Phone: 212-290-0951 Fax: 212-290-0955 Email: manhattanlab@emsl.com



Attn: Taylor Environmental Group, Inc.
 Floral Park Corporate Center
 130 Jericho Tpke
 Floral Park, NY 11001

Fax: (516) 358-1780 Phone: 516-358-2956

Project: M477-15217/29881 / NYC SCA / Stuyvesant HS

Customer ID: TAYL50

Customer PO:

Received: 08/12/02 4:50 PM

EMSL Order: 030211095

EMSL Project ID:

Lead in Wipes by Flame AAS (SW 846, 7420)

Client Sample Description	Lab ID	Analyzed	Area Sampled	Lead Concentration	Notes
LW-21 Rm 504 computer desk	0021	8/12/02	144 in ²	<10.0 µg/ft ²	
LW-22 RM 504 floor SE corner	0022	8/12/02	144 in ²	<10.0 µg/ft ²	
LW-23 RM G582 bench top	0023	8/12/02	144 in ²	<10.0 µg/ft ²	
LW-24 Rm G582 floor beneath sink	0024	8/12/02	144 in ²	<10.0 µg/ft ²	
LW-25 RM G581 top of locker #V53	0025	8/12/02	144 in ²	<10.0 µg/ft ²	
LW-26 RM G581 floor beneath mirror (near bench)	0026	8/12/02	144 in ²	<10.0 µg/ft ²	
LW-27 Rm G580 top of weight bench near entrance	0027	8/12/02	144 in ²	32.0 µg/ft ²	
LW-28 Rm G580 floor near SE window	0028	8/12/02	144 in ²	<10.0 µg/ft ²	
LW-29 RM G580 top of locker	0029	8/12/02	144 in ²	<10.0 µg/ft ²	
LW-30 Rm 580 by floor entrance	0030	8/12/02	144 in ²	<10.0 µg/ft ²	
LW-31 Field blank	0031	8/12/02	n/a	<10.0 µg/wipe	
LW-32 Field blank	0032	8/12/02	n/a	<10.0 µg/wipe	

M. Arkidorker
 Laboratory Manager
 or other approved signatory / ANALYST

Reporting unit is 10 µg/wipe
 ACCREDITATIONS: AIAA Environmental Lead Laboratory Approval Program #102591



Page 1 of 1

07249

PAGE 53/56

ENEL ANALYTICAL INC

8552-662-212

08:11Z 2002/2/07250

ENVIRONMENTAL GROUP, INC.
130 JERICHO PARK, FLORAL PARK, NY 11001

516-358-2955
Fax 516-358-1780

LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT

CLIENT NAME/ADDRESS SCA	CONTACT HAROLD SALVO	SAMPLER (SIGNATURE) <i>[Signature]</i>	DATE 8-12-02	TIME	SAMPLE(S) SEALED YES NO
PROJECT LOCATION STANLEY ESSENTIAL HS.	PROJECT # 11477-N-217/29881	SAMPLER NAME (PRINT) DAVID L. SALVO	MATRIX (CIRCLE ONE) WIPE PAINT SOIL OTHER		CORRECT CONTAINER(S) YES NO

SAMPLE INFORMATION:		LOCATION	AREA (F ²)	SURFACE MATERIAL				LAB RESULT
LABORATORY #	SAMPLE #			WOOD	METAL	BRICK	OTHER	
	LW-33	RM 6583 TOP OF BOUCH (near corner #100)	1	X				<10.0
	LW-34	RM 6583 FLOOR near corner #104	1				X	<10.0
	LW-35	RM 6583 Storage Area FLOOR - CENTER AREA	1				X	<10.0
	LW-36	RM 6583 FLOOR MIDDLE STATION GRILL	1				X	<10.0
	LW-37	RM 6584 TOP OF BOUCH near corner #2590	1	X				<10.0
	LW-38	RM 6584 FLOOR near corner #2091	1				X	<10.0
	LW-39	RM 6584 BACK STATION STALL FLOOR (SW AREA)	1				X	<10.0
	LW-40	RM 509 FLOOR BOUCH MIDDLE GRILL	1				X	<10.0

FOR RESULTS TO (212) 406-2535

TURNAROUND REQUIRED:
NORMAL ☐ STAT ☐ BY 1/1

COMMENTS / INSTRUCTIONS
6 HRS TAT

RELINQUISHED BY (SIGNATURE) <i>[Signature]</i>	DATE 8-12-02	PRINTED NAME DAVID L. SALVO	RECEIVED BY (SIGNATURE) <i>[Signature]</i>	DATE 8-12-02	PRINTED NAME DAVID L. SALVO
RELINQUISHED BY (SIGNATURE)	DATE	PRINTED NAME	RECEIVED BY (SIGNATURE)	DATE	PRINTED NAME
	TIME			TIME	

WHITE - OFFICE / YELLOW - LAB / PINK - CLIENT

CITY_21MC100_008878424

PAGE 04/08

ENEL ANALYTICAL INC

8552-062-212

8P:12 0807/2:07251


ENVIRONMENTAL GROUP, INC.
130 JERICHO TPKE., FLORAL PARK, NY 11001

516-358-2955
Fax 516-358-1780

LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT

CLIENT NAME/ADDRESS		CONTACT:		SAMPLER (SIGNATURE)	DATE	TIME	SAMPLE(S) SEALED	YES ☒ NO ☐
NYC SCA		HAMILD SAUDJ.		<i>Carla E. Jofa</i>	8-12-02			
PROJECT LOCATION:		PROJECT #		SAMPLER NAME (PRINT)			CORRECT CONTAINER(S)	YES ☒ NO ☐
STUYVESANT H.S.		H477-15217/24881		CARLOS JOFAT				
SAMPLE INFORMATION:				MATRIX (CIRCLE ONE):		SCIL OTHER		
				LAPE PAINT				
LABORATORY #	SAMPLE #	LOCATION	AREA (FT ²)	SURFACE MATERIAL		LAB RESULT		
				WOOD	METAL BRICK OTHER			
	LW-41	Rm 511 TOP OF Trenchon's Desk	1			X	<10.0	
	LW-42	Rm 511 Floor near SW window	1			X	<10.0	
	LW-43	Rm 513 TOP of Trenchon's Desk	1			X	<10.0	
	LW-44	Rm 513 Floor between exit doors	1			X	<10.0	
X	LW-45	Rm 517 Floor between visible sinks	1			X	<10.0	
X	LW-46	Rm C521 Floor common area	1			X	<10.0	
	LW-47	Rm C523 Floor common area	1			X	<10.0	
	LW-48	Rm 525 TOP of Trenchon's Desk	1			X	<10.0	
Fax results to (212) 406-2535				TURNAROUND REQUIRED:		COMMENTS / INSTRUCTIONS		
				NORMAL ☐ STAT ☐ BY / /		6 HRS TAT		
RELINQUISHED BY (SIGNATURE)		DATE	PRINTED NAME	RECEIVED BY (SIGNATURE)		DATE	PRINTED NAME	
<i>Carla E. Jofa</i>		8-12-02	C. Jofa	<i>Chavez</i>				
RELINQUISHED BY (SIGNATURE)		DATE	PRINTED NAME	RECEIVED BY LAB (SIGNATURE)		DATE	PRINTED NAME	

WHITE - OFFICE / YELLOW - LAB / PINK - CLIENT

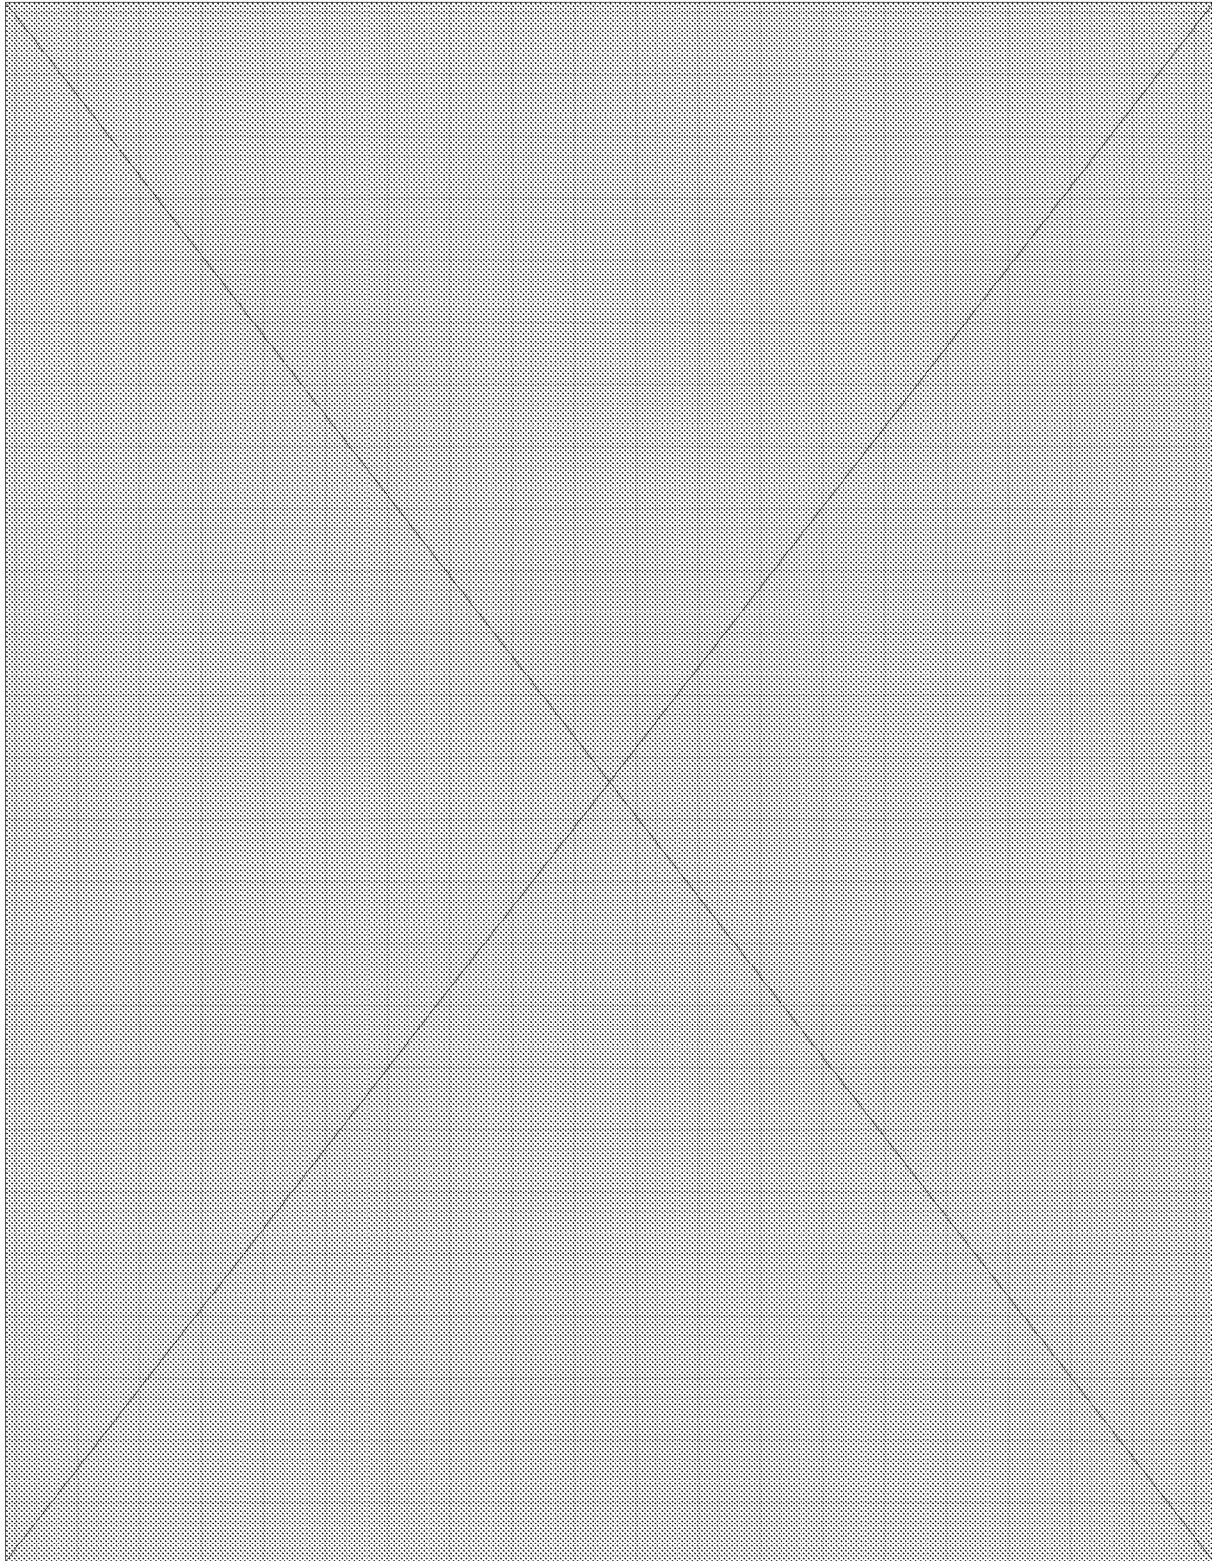

09/12/2002 21:40 212-290-2538

EMSL ANALYTICAL INC

PAGE 01/05

EMSL Analytical, inc.

307 West 38th Street, New York, NY 10018

Phone: 212-290-0051 Fax: 212-290-0053 Email: manhattanlab@emsl.com



Attn: Taylor Environmental Group, Inc.
 Floral Park Corporate Center
 130 Jericho Tpke
 Floral Park, NY 11001

Fax: (516) 359-1730 Phone: 516-359-2955

Project: M477-15217 / Z9801 / SCA / Stuyvesant H.S.

Customer ID: TAYL50

Customer PO:

Received: 08/12/02 6:29 AM

EMSL Order: 030211038

EMSL Project ID:

Lead in Wipes by Flame AAS (SW 846, 7420)

Client Sample Description	Lab ID	Analyzed	Area Sampled	Lead Concentration	Notes
LW-33 Rm 6583 Top of Bench (near locker #1200)	0001	8/12/02	144 in ²	<10.0 µg/ft ²	
LW-34 Rm 6583 Floor near Locker #104	0002	8/12/02	144 in ²	<10.0 µg/ft ²	
LW-35 Rm 6583 Storage Area Floor Center Area	0003	8/12/02	144 in ²	<10.0 µg/ft ²	
LW-36 Rm 6583 Floor Middle Shower Stall	0004	8/12/02	144 in ²	<10.0 µg/ft ²	
LW-37 Rm 6584 Top of Bench near Locker #2590	0005	8/12/02	144 in ²	<10.0 µg/ft ²	
LW-38 Rm 6584 Floor near Locker #2091	0006	8/12/02	144 in ²	<10.0 µg/ft ²	
LW-39 Rm 6584 Rear Shower Stall Floor (SW Area)	0007	8/12/02	144 in ²	<10.0 µg/ft ²	
LW-40 Rm 509 Floor Beneath Middle Sink	0008	8/12/02	144 in ²	<10.0 µg/ft ²	
LW-41 Rm 511 Top of Teachers Desk	0009	8/12/02	144 in ²	<10.0 µg/ft ²	
LW-42 Rm 511 Floor near SW Window	0010	8/12/02	144 in ²	<10.0 µg/ft ²	
LW-43 Rm 513 Top of Teachers desk	0011	8/12/02	144 in ²	<10.0 µg/ft ²	
LW-44 Rm 513 Floor between ent. Doors	0012	8/12/02	144 in ²	<10.0 µg/ft ²	
LW-45 Rm 517 Floor Beneath Middle Sink	0013	8/12/02	144 in ²	<10.0 µg/ft ²	
LW-46 Rm C521 Floor Center Area	0014	8/12/02	144 in ²	<10.0 µg/ft ²	
LW-47 Rm C523 Floor Center Area	0015	8/12/02	144 in ²	<10.0 µg/ft ²	
LW-48 Rm 525 Top of Teachers desk	0016	8/12/02	144 in ²	<10.0 µg/ft ²	
LW-49 Rm 525 Floor Beneath Clock	0017	8/12/02	144 in ²	<10.0 µg/ft ²	

Laboratory Manager
 or other approved signatory

Reporting limit is 10 µg/wipe

ACCREDITATIONS: AHA Environmental Lead Laboratory Approval Program #102501



Page 1 of 2

07253

08/12/2002 21:40 212-290-2538

EMSL ANALYTICAL INC

PAGE 02/00

EMSL Analytical, Inc.

307 West 38th Street, New York, NY 10018

Phone: 212-290-0081 Fax: 212-290-0058 Email: manhattanlab@emsl.com



Attn: Taylor Environmental Group, Inc.
Floral Park Corporate Center
130 Jericho Tpke.
Floral Park, NY 11001

Customer ID: TAYL50
Customer PO:
Received: 08/12/02 6:29 AM

Fax: (516) 358-1780 Phone: 516-358-2955

EMSL Order: 030211099

Project: M477-15217 / 29881 / SCA / Stuyvesant H.S.

EMSL Project ID:

Lead in Wipes by Flame AAS (SW 846, 7420)

Client Sample Description		Lab ID	Analyzed	Area Sampled	Lead Concentration	Notes
LW-50	Field blank	0018	8/12/02	n/a	<10.0 ug/wipe	
LW-51	Field blank	0019	8/12/02	n/a	<10.0 ug/wipe	

Laboratory Manager
or other approved signatory

Reporting unit is 10 ug/wipe
ACCREDITATIONS: AIMA Environmental Lead Laboratory Approval Program #102551



Page 2 of 4

07254

TAYLOR ENVIRONMENTAL GROUP, INC.
130 JERICHO TPKE., FLORAL PARK, NY 11001

#21096

P7 1084
516-358-2955
Fax 516-358-1780

LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT

CLIENT NAME/ADDRESS NYC R&A		CONTACT HAMID SAUDI		SAMPLER (SIGNATURE) <i>[Signature]</i>	DATE 8/13/02	TIME	SAMPLE(S) SEALED ☒ YES / NO	
PROJECT LOCATION: <i>Gravesant H.S.</i>		PROJECT # 11477-15217-29881		SAMPLER NAME (PRINT) Kirk McKenzie		CORRECT CONTAINER(S) ☒ YES / NO		
MATRIX (CIRCLE ONE): ☒ WIFE ☐ PAINT ☐ SOIL ☐ OTHER								
SAMPLE INFORMATION:			AREA (FT ²)	SURFACE MATERIAL				LAB RESULT <i>ug/ft²</i>
LABORATORY #	SAMPLE #	LOCATION		WOOD	METAL	BRICK	OTHER	
	LW-19	ROOM K550A - Floor 3' of entrance	1				X	69.0
	LW-20	ROOM K550A - Locker #6	1		X			69.0
	LW-21	ROOM C550B - Floor	1				X	69.0
	LW-22	ROOM K550C - Floor 3' of entrance	1				X	69.0
	LW-23	ROOM K550C - Locker #23	1		X			69.0
	LW-24	ROOM K550D - Floor GAS BOMB BOX	1				X	10.2
	LW-25	ROOM K550D - top of GAS BOMB BOX (left side)	1		X			12.4
	LW-26	ROOM K550E - Floor Center of room	1				X	10.9
FAX 212-406-2535 & 516-358-1780			TURNAROUND REQUIRED: NORMAL ☐ STAT ☐ BY 1/1			COMMENTS / INSTRUCTIONS 6 Hr. TAT		
RELINQUISHED BY (SIGNATURE) <i>[Signature]</i>		DATE 8/13/02 TIME 0415	PRINTED NAME Kirk McKenzie		RECEIVED BY (SIGNATURE) <i>[Signature]</i>		DATE TIME	PRINTED NAME
RELINQUISHED BY (SIGNATURE) <i>[Signature]</i>		DATE 8/13 TIME 0432	PRINTED NAME G. McKen		RECEIVED BY LAB (SIGNATURE) R. Droulina		DATE 8/13 TIME 4:35	PRINTED NAME R. Droulina

WHITE - OFFICE / YELLOW - LAB / GREEN - FIELD

TAYLOR ENVIRONMENTAL GROUP, INC.
130 JERICHO TPKE., FLORAL PARK, NY 11001

#21096

516-358-2955
Fax 516-358-1780


LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT

CLIENT NAME/ADDRESS H/C SCA		CONTACT: HAROLD SANDOZ		SAMPLER (SIC/MAILING) [Signature]	DATE 8/13/02	TIME	SAMPLE(S) SEALED (YES) NO	
PROJECT LOCATION: Stuyvesant H.S.		PROJECT # 477-15217-2988		SAMPLER NAME (PRINT) Kirk McKenzie		CORRECT CONTAINER(S) (YES) NO		
SAMPLE INFORMATION:				MATRIX (CIRCLE ONE): (WIPE) PAINT SOIL OTHER				
LABORATORY #	SAMPLE #	LOCATION	AREA (FT ²)	SURFACE MATERIAL				LAB RESULT
				WOOD	METAL	BRICK	OTHER	
	LW-27	ROOM K550E - TOP of CARDBOARD BOX	1				X	13.7
	LW-28	ROOM K550 L - FLOOR at ENTRANCE	1 Composite				X	12.1
	LW-29	ROOM K550 K - FLOOR Center of ROOM	1 Composite				X	19.0
	LW-30	ROOM K550 K - TOP of File Cabinet	1		X			13.9
	LW-31	ROOM K550 L - FLOOR at center	1 Composite				X	12.8
	LW-32	ROOM K550 L - TOP of Refrigerator	1		X			24.2
	LW-33	Kitchen - FLOOR by south center column	1 Composite				X	19.0
	LW-34	Kitchen - TOP of South center sink table	1		X			19.0
TURNAROUND REQUIRED: NORMAL ☐ STAT ☐ BY 11				COMMENTS / INSTRUCTIONS 6 HR TAT				
RELINQUISHED BY (SIGNATURE) [Signature]		DATE 8/13/02 TIME 0415	PRINTED NAME Kirk McKenzie		RECEIVED BY (SIGNATURE) [Signature]		DATE 8.13 TIME 4.35	PRINTED NAME R. Druddina
RELINQUISHED BY (SIGNATURE) [Signature]		DATE 8/13 TIME 0432	PRINTED NAME G. McKen		RECEIVED BY LAB (SIGNATURE) R. Druddina		PRINTED NAME R. Druddina	

WHITE - OFFICE / YELLOW - LAB / PINK - CLIENT

07256

CITY_21MC100_008878430

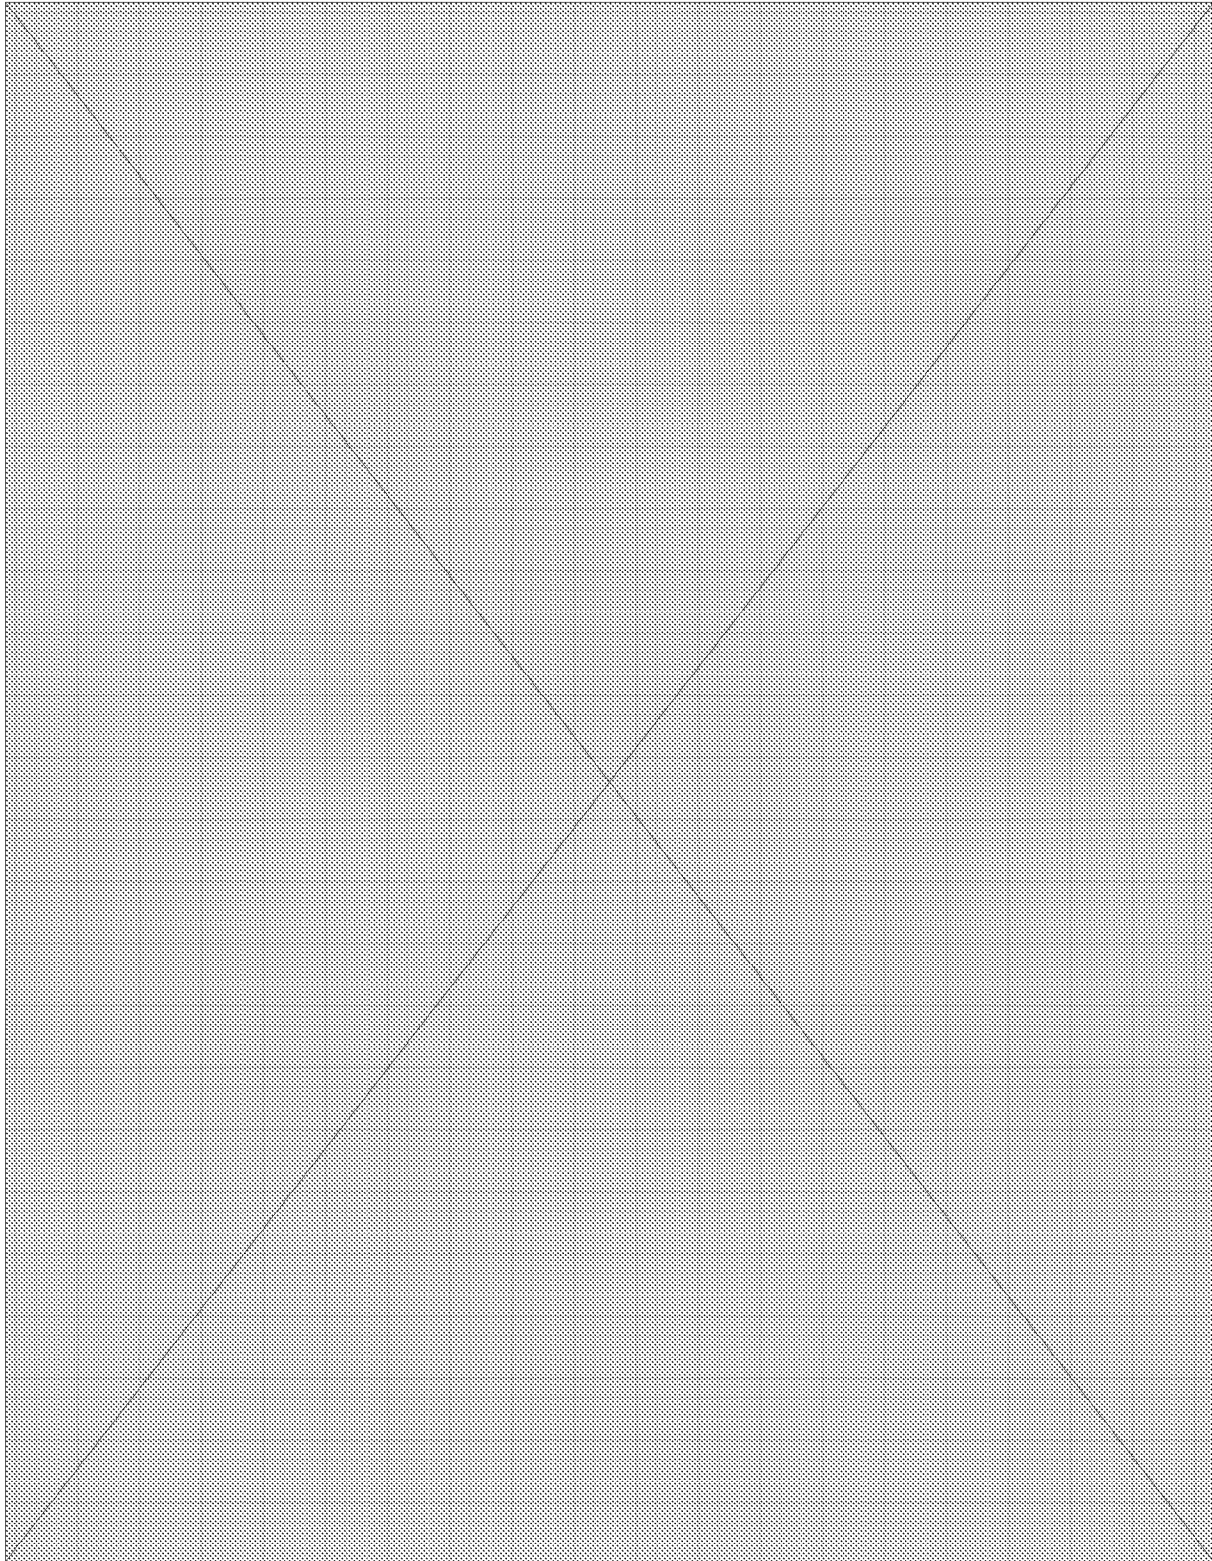

0 1516-358-2955
Fax 516-358-1780

LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT

CLIENT NAME/ADDRESS NYC RCA		CONTACT: Hania Sanoj		SAMPLER SIGNATURE <i>[Signature]</i>	DATE 8/13/02	TIME	SAMPLE(S) SEALED ☒ YES ☐ NO	
PROJECT LOCATION: Stuyvesant H.S.		PROJECT # M477-15217-29881		SAMPLER NAME (PRINT) Kirk McKenzie		CORRECT CONTAINER(S) ☒ YES ☐ NO		
SAMPLE INFORMATION:				MATRIX (CIRCLE ONE): ☒ WIFE ☐ PAINT ☐ SOIL ☐ OTHER				
LABORATORY #	SAMPLE #	LOCATION	AREA (FT²)	SURFACE MATERIAL				LAB RESULT
				WOOD	METAL	BRICK	OTHER	
	LW-43	ROOM C540 D - FLOOR 3' x ENTRANCE	1				X	Cg.o
	LW-44	ROOM C540 E - FLOOR 3' x ENTRANCE	1				X	Cg.o
	LW-45	ROOM C528 (Service Sted. Lk.) FLOOR	1				X	Cg.o
	FBL-1 ¹⁶	Field Blank						Cg.o
	FBL-2 ⁴³	Field Blank						Cg.o
	FBL-3 ¹⁸	Field Blank						Cg.o
				TURNAROUND REQUIRED. NORMAL ☐ STAT ☐ BY 1 / 1		COMMENTS / INSTRUCTIONS 6 HR TAT		
RELINQUISHED BY (SIGNATURE) <i>[Signature]</i>		DATE 8/13/02 TIME 0415	PRINTED NAME Kirk McKenzie		RECEIVED BY (SIGNATURE) <i>[Signature]</i>		DATE TIME	PRINTED NAME
RELINQUISHED BY (SIGNATURE) <i>[Signature]</i>		DATE 8/13 TIME 0432	PRINTED NAME G. McKenzie		RECEIVED BY LAB (SIGNATURE) R. Dondolina		DATE 8/13 TIME 4:35	PRINTED NAME R. Dondolina

UNITG. OCCURS / YELLOW. LAB / PINK. CLIENT

AIC ASSOCIATES, INC
 104 E 25th Street, 10th Floor
 New York, NY 10010
 Tel. 212-353-8280
 Fax 212-353-8306

REPORT DATE: 08-13-02
CLIENT: Taylor Environmental Group, Inc.
PROJECT NAME: SCA/Stuyvesant HS
 345 Chambers Street, NY
PROJECT NUMBER: M477-15217-29881
SAMPLED BY: Client
SAMPLE DATE: 08-13-02
DATE RECEIVED: 08-13-02
DATE ANALYZED: 08-13-02
SAMPLE MEDIA: Dust Wipe Sample
ANALYSIS REQUIRED: Method EPA 3050/7420

ANALYSIS RESULTS

SAMPLE ID	BATCH NO.	SAMPLE DESCRIPTION	LEAD CONCENTRATION ($\mu\text{g}/\text{ft}^2$)	DETECTION LIMIT ($\mu\text{g}/\text{ft}^2$)
LW-19	21096	Rm K550A Floor 3' of Entrance	<9.0	9.0
LW-20	21096	Rm K550A Locker #6	<9.0	9.0
LW-21	21096	Rm C550B Floor	<9.0	9.0
LW-22	21096	Rm K550C Floor 3' of Entrance	<9.0	9.0
LW-23	21096	Rm K550C Locker #23	<9.0	9.0
LW-24	21096	Rm K550D Floor	10.2	9.0
LW-25	21096	Rm K550D Top of Metal Table (Left Side)	12.4	9.0
LW-26	21096	Rm K550E Floor Center of Rm	10.9	9.0
LW-27	21096	Rm K550E Top of Cardboard Box	13.7	9.0
LW-28	21096	Rm K550J Floor at Entrance	12.1	9.0
LW-29	21096	Rm K550K Floor Center of Rm	<9.0	9.0
LW-30	21096	Rm K550K Top of File Cabinet	13.9	9.0
LW-31	21096	Rm K550L Floor of Center	12.9	9.0
LW-32	21096	Rm K550L Top of Refrigeration	24.2	9.0
LW-33	21096	Kitchen Floor by South Center Column	<9.0	9.0

07259

CITY_21MC100_008878433

ATC ASSOCIATES, INC

104 E 25th Street, 10th Floor

New York, NY 10010

Tel. 212-353-8280

Fax 212-353-8306

LW-34	21096	Kitchen Top of South Center Sink Table	<9.0	9.0
LW-35	21096	Rm K540B Floor Center	<9.0	9.0
LW-36	21096	Rm K540B Table Top North Side	<9.0	9.0
LW-37	21096	Rm K540C Floor Center	<9.0	9.0
LW-38	21096	Rm K540C Table Top	<9.0	9.0
LW-39	21096	Rm K540A Floor Center	<9.0	9.0
LW-40	21096	Rm K540A Top of Middle Service Counter	<9.0	9.0
LW-41	21096	Cafeteria Floor Center	<9.0	9.0
LW-42	21096	Cafeteria Table Top NB Side	<9.0	9.0
LW-43	21096	Rm C540D Floor 3' of Entrance	<9.0	9.0
LW-44	21096	Rm C540E Floor 3' of Entrance	<9.0	9.0
LW-45	21096	Rm C528 Service Elev. Lobby Floor	<9.0	9.0
FBL-1	21096	Field Blank	<9.0 µg	9.0 µg
FBL-2	21096	Field Blank	<9.0 µg	9.0 µg
FBL-3	21096	Field Blank	<9.0 µg	9.0 µg

NOTE 1:

THE REPORTING LIMIT (RL) IS 18.0 µg

NOTE 2:

HUD Guidelines for final clearance dust wipe samples: Floor 46 µg/ft², Window sills 250 µg/ft², Window wells 400 µg/ft², Exterior surfaces 800 µg/ft².

NOTE 3:

Blank units are in µg

CERTIFICATION AND SIGNATURES

ANALYSIS PERFORMED BY: _____

REPORT PREPARED BY: _____

ATC certifies that this report is an accurate and authentic report of results obtained from the laboratory analysis.

QUALITY ASSURANCE COORDINATOR: _____

LABORATORY DIRECTOR: _____

ATC is accredited by the New York State Department of Health Environmental Laboratory Approval Program (ELAP) and by the American Industrial Hygiene Association (AIHA) to perform analysis of lead in paint, dust wipes, air and soil samples. (ELAP #10879), (AIHA #100229).

07000

TAYLOR ENVIRONMENTAL GROUP, INC.
130 JERICHO PIKE., FLORAL PARK, NY 11001

516-358-2955
Fax 516-358-1700

LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT

CLIENT NAME/ADDRESS NYC SW		CONTACT HAROLD SAND		SAMPLER SIGNATURE <i>[Signature]</i>		DATE 08.13.02		TIME 02		SAMPLE(S) SEALED (YES) NO	
PROJECT LOCATION STUYVESENT HS		PROJECT # M477-15217/18881		SAMPLER NAME (PRINT) KIRK MC KENZIE						CORRECT CONTAINER(S) (YES) NO	
SAMPLE INFORMATION:				MATRIX (CIRCLE ONE): (TWIST)		PAINT		SOIL		OTHER	
LABORATORY #		SAMPLE #		LOCATION		AREA (FT ²)		SURFACE MATERIAL		LAB RESULT	
								WOOD METAL BRICK OTHER			
	LW-01			5th floor corridor 0/8		1				X	12.0
	LW-02			Room 584 - Floor		1				X	14.0
	LW-03			5th floor corridor 0/8		1				X	<10.0
	LW-04			Staircase "E" - Floor		1				X	10.0
	LW-05			5th floor corridor 0/8 at Escalator (West side) floor		1				X	<10.0
	LW-06			Room 501 - Floor		1				X	<10.0
	LW-07			5' of Entrance		1				X	<10.0
	LW-08			Room 501 - Table Top		1				X	<10.0
				Right side of office		1				X	<10.0
				Room 501D - Floor		1				X	<10.0
				3' of Entrance		1				X	12.0
				Room 501D - Top of Shelf (East side)		1			X		<10.0
				Room 510 - Floor		1				X	12.0
				Center		1				X	12.0
FAX RESULTS TO 212 406-2585 516 358-1780				TURN-AROUND REQUIRED: NORMAL ☐ STAT ☐ BY 1/1				COMMENTS / INSTRUCTIONS 6 HRS TAT			
RELINQUISHED BY (SIGNATURE) <i>[Signature]</i>		DATE 8/13/02		PRINTED NAME Kirk McKenzie		RECEIVED BY (SIGNATURE) <i>[Signature]</i>		DATE 08.13.02		PRINTED NAME JOSE ARRIGHI	
RELINQUISHED BY (SIGNATURE) <i>[Signature]</i>		DATE 08.13.02		PRINTED NAME TERESA MICHAEL		RECEIVED BY LAB (SIGNATURE)		DATE		PRINTED NAME	

WHITE - OFFICE / YELLOW - LAB / PINK - CLIENT

08/13/2002 09:36 212-260-2336

ENVIRONMENTAL

RECEIVED

07261

CITY_21MC100_008878435

TAYLOR ENVIRONMENTAL GROUP, INC.
130 JERICHO TPKE., FLORAL PARK, NY 11001

516-358-2955
Fax 516-358-1700

LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT

CLIENT NAME/ADDRESS NYC SCB		CONTACT: RAMMO SPWBY		SAMPLER SIGNATURE: <i>[Signature]</i>	DATE 08.13.02	TITLE	SAMPLE(S) SEALED (YES) / NO	
PROJECT LOCATION: STUYVESANT H.S.		PROJECT # 1447-15217 / 29881		SAMPLER NAME (PRINT) KIRK MC LENZIE			CORRECT CONTAINER(S) (YES) / NO	
SAMPLE INFORMATION:		MATRIX (CIRCLE ONE): WIFE PAINT SOIL OTHER		LAB RESULT mg/Pt?				
LABORATORY #	SAMPLE #	LOCATION	AREA (FT ²)	SURFACE MATERIAL				
				WOOD	METAL	BRICK	OTHER	
	LW-09	Room 527 Locker # 5-221 0/3 RM 525	1		X			< 10.0
	LW-10	ROOM 527 - Floor center	1				X	< 10.0
	LW-11	ROOM 529 - Floor center	1				X	10.0
	LW-12	ROOM K531 - Floor 3' x 8' east window	1				X	11.0
	LW-13	ROOM K531 - Table Top	1				X	< 10.0
	LW-14	Serving Area to K531 Floor - 4' x 8' window	1				X	< 10.0
	LW-15	Serving Area to K531 Sink Counter Top	1		X			12.0
	LW-16	Hallway Floor o/s Room K550C	1				X	< 10.0
FAX RESULTS TO 212 106-2535 516 358-1780				TURNAROUND REQUIRED: NORMAL ☐ STAT ☐ BY 1/1		COMMENTS / INSTRUCTIONS 6 HRS LAT		
RELINQUISHED BY (SIGNATURE) <i>[Signature]</i>		DATE 8/13/02 TIME 4:15		PRINTED NAME KIRK MC LENZIE		RECEIVED BY (SIGNATURE) <i>[Signature]</i>		
DATE 8/13/02 TIME 4:30		PRINTED NAME RECEIVED		RECEIVED BY LAB (SIGNATURE) <i>[Signature]</i>		DATE 08/13/02		
TIME 4:30		PRINTED NAME JOSE ANASTAS		DATE 08/13/02		TIME 4:30		

WHITE - OFFICE / YELLOW - LAB / PINK - CLIENT

RECEIVED
EPC HANNAH TAYLOR

07262

CITY_21MC100_008878436

TAYLOR ENVIRONMENTAL GROUP, INC.
130 JERICHO TPKE., FLORAL PARK, NY 11001

030211110

516-358-2955
Fax 516-358-1780

08/13/2002 03:36 212-250-2538

EMEL ANALYTICAL INC

PAGE 05/05

LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT

CLIENT NAME/ADDRESS NYC SLA		CONTACT HAMID SAHOY		SAMPLER SIGNATURE <i>[Signature]</i>	DATE 08.13.02	TIME	SAMPLE(S) SEALED (YES) / NO
PROJECT LOCATION STUYVESANT HS.		PROJECT # M477-15317/29881		SAMPLER NAME (PRINT) Kirk McKenzie	MATRIX (CIRCLE ONE): <u>WIFE</u> PAINT SOIL OTHER		CORRECT CONTAINER(S) (YES) / NO
SAMPLE INFORMATION:			AREA (FT ²)	SURFACE MATERIAL		LAB RESULT	
LABORATORY #	SAMPLE #	LOCATION		WOOD	METAL	BRICK	OTHER
	LW-17	Locker # 5-26 O/S Girls Locker Rm	1		X		K10.0
	LW-18	Locker # 5-204 By Room 512	1		X		13.0
	FBL-1	Field BS/alk					
	FBL-2	Field BS/alk					
FAX RESULTS TO 212 406-2535 516 358-1780			TURNAROUND REQUIRED: NORMAL ☐ STAT ☐ BY 1/1		COMMENTS / INSTRUCTIONS 6 hrs TAT		
RELINQUISHED BY (SIGNATURE) <i>[Signature]</i>		DATE 8/13/02	PRINTED NAME Kirk McKenzie		RECEIVED BY (SIGNATURE) <i>[Signature]</i>	DATE TIME	PRINTED NAME
RELINQUISHED BY (SIGNATURE) <i>[Signature]</i>		DATE 8/13/02	PRINTED NAME TERRY MICHANOW		RECEIVED BY LAB (SIGNATURE) <i>[Signature]</i>	DATE TIME	PRINTED NAME JOSE ARRAS

07263

CITY_21MC100_008878437

09/13/2002 09:36 212-298-2536

EMSL ANALYTICAL, INC.

PAGE 01/02

EMSL Analytical, Inc.

307 West 38th Street, New York, NY 10018

Phone: 212-290-0051 Fax: 212-290-0052 Email: manhattan@emsl.com

EMSL

Attn: Taylor Environmental Group, Inc.
 Floral Park Corporate Center
 130 Jericho Tpke.
 Floral Park, NY 11001
 Fax: (516) 358-1760 Phone: 516-358-2955
 Project: NYC SCA/Stuyvesant H.S./M477-15217/29881.

Customer ID: TAYLSD
 Customer PO:
 Received: 09/13/02 7:44 AM
 EMSL Order: 030211111
 EMSL Project ID:

Lead in Wipes by Flame AAS (SW 846, 7420)

Client Sample Description	Lab ID	Analyzed	Area Sampled	Lead Concentration	Notes
LW-01 5th Floor Corridor O/S Room 548-Floor	0001		144 in ²	12.0 µg/ft ²	
LW-02 5th Floor Corridor O/S Staircase "E"-Floor	0002		144 in ²	14.0 µg/ft ²	
LW-03 5th Floor Corridor at Escalator (West Side) Floor	0003		144 in ²	<10.0 µg/ft ²	
LW-04 Room 501-Floor 5' of Entrance	0004		144 in ²	10.0 µg/ft ²	
LW-05 Room 501 Table Top Right Side of Office	0005		144 in ²	<10.0 µg/ft ²	
LW-06 Room 501C-Floor 3' of Entrance	0006		144 in ²	<10.0 µg/ft ²	
LW-07 Room 501C-Top of Shelf (East Side)	0007		144 in ²	<10.0 µg/ft ²	
LW-08 Room 510-Floor Center	0008		144 in ²	12.0 µg/ft ²	
LW-09 Locker #5-221 O/S Room 523	0009		144 in ²	<10.0 µg/ft ²	
LW-10 Room 527-Floor Center	0010		144 in ²	<10.0 µg/ft ²	
LW-11 Room 529-Floor Center	0011		144 in ²	10.0 µg/ft ²	
LW-12 Room K531-Floor 3' of East Unit Vent	0012		144 in ²	11.0 µg/ft ²	
LW-13 Room K531-Table Top	0013		144 in ²	<10.0 µg/ft ²	
LW-14 Serving Area to K531 4' of Window	0014		144 in ²	<10.0 µg/ft ²	
LW-15 Serving Area to K531 Sink Counter Top	0015		144 in ²	12.0 µg/ft ²	
LW-16 Hallway Floor O/S Room K530C	0016		144 in ²	<10.0 µg/ft ²	
LW-17 Locker #5-26 O/S Girls Locker Room	0017		144 in ²	<10.0 µg/ft ²	
LW-18 Locker #5-204 by Room 517	0018		144 in ²	13.0 µg/ft ²	
LW-19 Field Blank	0019		n/a	<10.0 µg/wipe	

Eric B. Gzil
 Laboratory Manager
 or other approved signatory

Reporting limit is 10 µg/wipe
 ACCREDITATIONS: NYA Environmental Lead Laboratory Approval Program #102581

08/13/2002 09:36 212-290-2538

EMSL ANALYTICAL INC

PAGE 02/03

EMSL Analytical, Inc.

307 West 38th Street, New York, NY 10018

Phone: 212-290-0051 Fax: 212-290-0055 Email: manhattanlab@emsl.com



Attn: Taylor Environmental Group, Inc.
Floral Park Corporate Center
130 Jericho Turnpike
Floral Park, NY 11001

Fax: (516) 358-1780 Phone: 516-358-2955

Project: NYC SCA/Stuyvesant H.S./M477-15217/29881.

Customer ID: TAYL50

Customer PO:

Received: 08/13/02 7:44 AM

EMSL Order: 030211111


EMSL Project ID:

Lead in Wipes by Flame AAS (SW 846, 7420)

Client Sample Description	Lab ID	Analyzed	Area Sampled	Lead Concentration	Notes
LW-20 Field blank	0020		n/a	<10.0 µg/wipe	

Eric B. Galt
Laboratory Manager
or other approved signatory

Reporting limit is 10 µg/wipe
ACCREDITATIONS: AHA Environmental Lead Laboratory Approval Program #102581

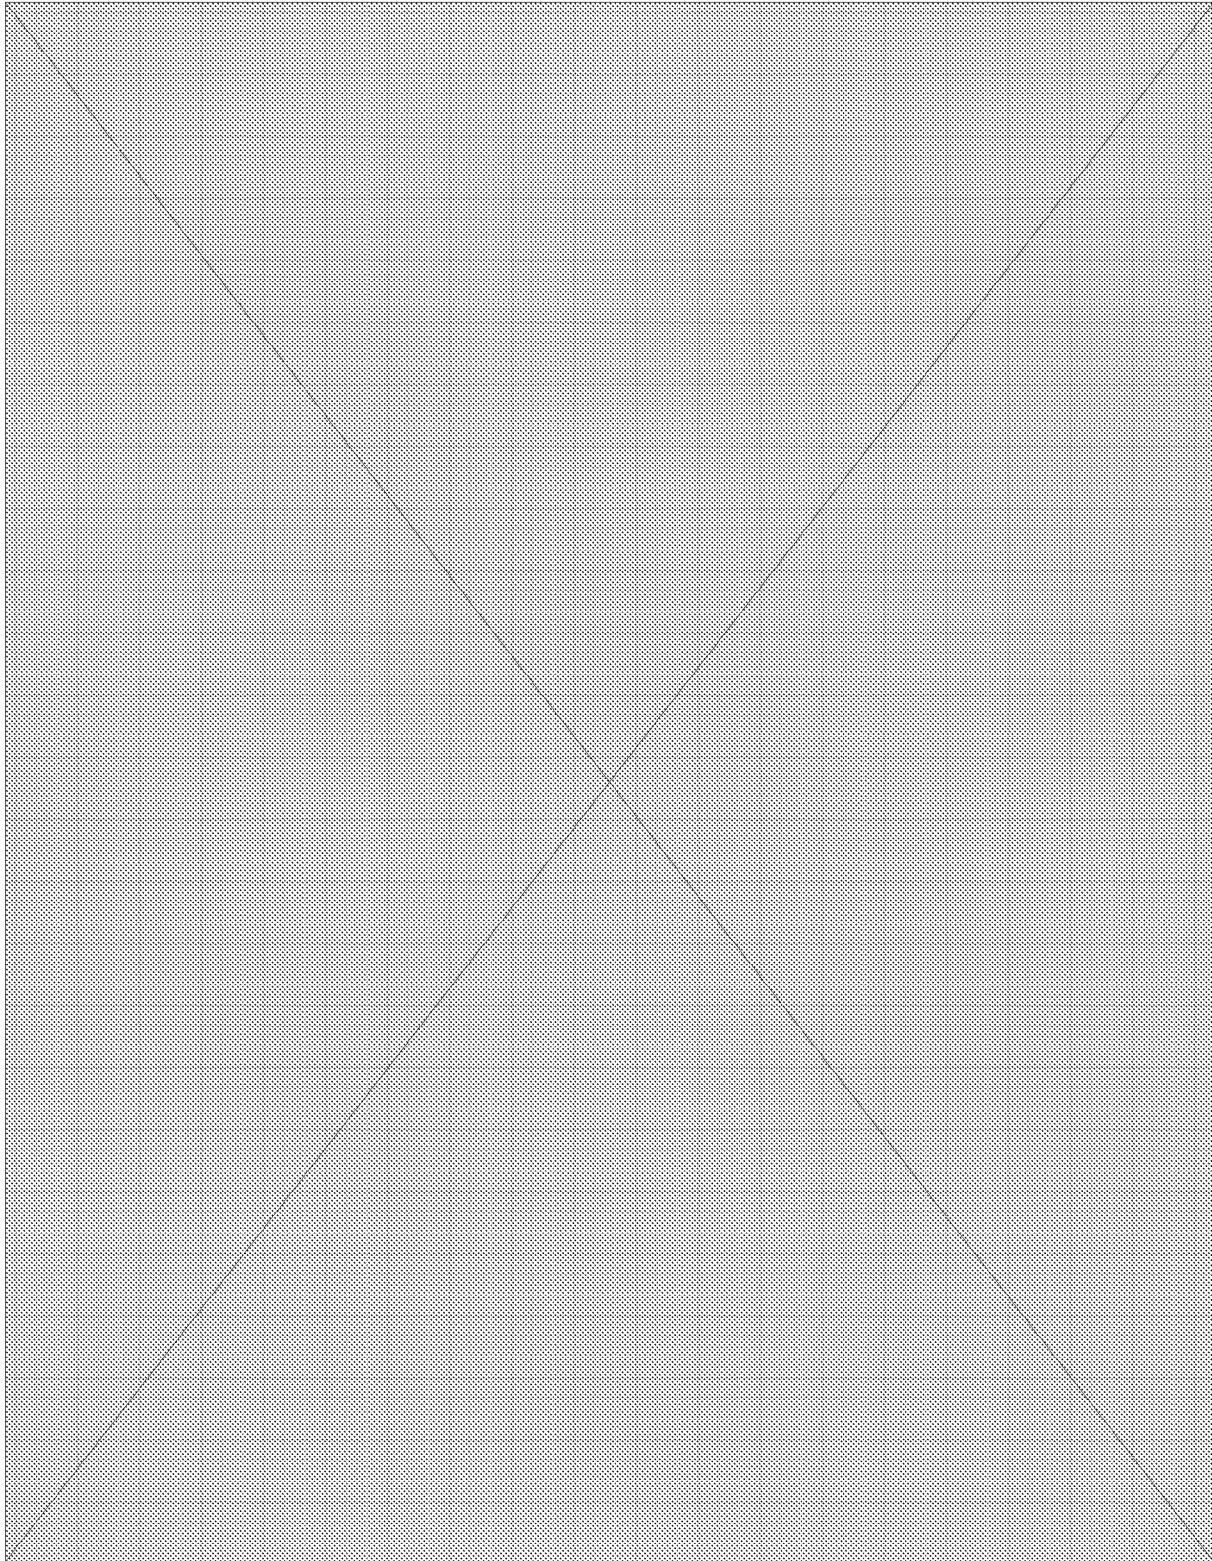

TAYLOR ENVIRONMENTAL GROUP, INC.
130 JERICHO TPKE., FLORAL PARK, NY 11001

516-358-2955

Fax 516-358-1780

LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT

CLIENT NAME/ADDRESS SCA		CONTACT: Haniol Savat		SAMPLER SIGNATURE <i>[Signature]</i>		DATE 8/6/02		TIME		SAMPLE(S) SEALED ☒ YES ☐ NO	
PROJECT LOCATION: Stuyvesant H.S.		PROJECT # #1477-15217/29881		SAMPLER NAME (PRINT) Ali K. Zaman						CORRECT CONTAINER(S) ☒ YES ☐ NO	
MATRIX (CIRCLE ONE): ☒ WIPE ☐ PAINT ☐ SOIL ☐ OTHER											
SAMPLE INFORMATION:				AREA (F ²)		SURFACE MATERIAL				LAB RESULT	
LABORATORY #	SAMPLE #	LOCATION			WOOD	METAL	BRICK	OTHER			
	LW-09	Room # 405 Teacher desk		1				X	<9.0		
	LW-10	Room # 405 floor by S-W window		1				X	<9.0		
	LW-11	Room # 403 File cabinet center		1		X			<9.0		
	LW-12	Room # 405 floor by TV set		1				X	<9.0		
	LW-13	Room # 404 Student desk by entrance		1				X	<9.0		
	LW-14	Room # 404 floor by North side blackboard		1				X	<9.0		
	LW-15	Room # 406 book shelf by entrance		1		X			<9.0		
	LW-16	Room # 406 floor by the entrance		1				X	<9.0		
				TURNAROUND REQUIRED: NORMAL ☐ STAT ☐ BY 1 / 1				COMMENTS / INSTRUCTIONS 6 HRS TAT			
REMOVED BY (SIGNATURE) <i>[Signature]</i>		DATE 8-11-02		PRINTED NAME C. Sant		RECEIVED BY (SIGNATURE) <i>[Signature]</i>		DATE 08/14		PRINTED NAME	
RELINQUISHED BY (SIGNATURE)		DATE		PRINTED NAME		RECEIVED BY LAB (SIGNATURE)		DATE		PRINTED NAME	
		TIME						TIME			

WHITE - OFFICE / YELLOW - LAB / PINK - CLIENT

TAYLOR ENVIRONMENTAL GROUP, INC.
130 JERICHO TPKE., FLORAL PARK, NY 11001

21148

516-358-2955
Fax 516-358-1780

LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT

CLIENT NAME/ADDRESS SEA		CONTACT: Haniol Savoy		SAMPLER (SIGNATURE) <i>[Signature]</i>		DATE 8/14/02		TIME		SAMPLE(S) SEALED ☒ YES ☐ NO	
PROJECT LOCATION: Stuyvesant H.S.		PROJECT # M477-15217/29881		SAMPLER NAME (PRINT) PL. Kacerev						CORRECT CONTAINER(S) ☒ YES ☐ NO	
SAMPLE INFORMATION:				MATRIX (CIRCLE ONE): ☒ WIPES ☐ PAINT ☐ SOIL ☐ OTHER							
LABORATORY #	SAMPLE #	LOCATION	AREA (FT ²)	SURFACE MATERIAL				LAB RESULT			
				WOOD	METAL	BRCK	OTHER				
	LW-17	Room #408 Computer desk	1				X	<9.0			
	LW-18	Room #408 Floor Center of the room	1				X	<9.0			
	LW-19	Room #409 back wall	1		X			<9.0			
	LW-20	Room #409 Floor Center of the room	1				X	<9.0			
	LW-21	Room #411 Computer desk 1st on end wall	1				X	<9.0			
	LW-22	Room #411 Floor By the entrance	1				X	<9.0			
	LW-23	F/8						<9.0			
	LW-24	F/13						<9.0			
Fax results to Taylor at (212) 406-2555				TURNAROUND REQUIRED: NORMAL ☐ STAT ☐ BY 1/1				COMMENTS / INSTRUCTIONS Ok VAV.			
RELINQUISHED BY (SIGNATURE) <i>[Signature]</i>		DATE 8-14-02		PRINTED NAME C. J. [Signature]		RECEIVED BY (SIGNATURE) <i>[Signature]</i>		DATE 08/14		PRINTED NAME	
RELINQUISHED BY (SIGNATURE)		DATE		PRINTED NAME		RECEIVED BY LAB (SIGNATURE)		DATE		PRINTED NAME	

WHITE - OFFICE / YELLOW - LAB / PINK - CLIENT

CITY_21MC100_008878442

07208

ATC ASSOCIATES, INC
104 E 25th Street, 10th Floor
New York, NY 10010
Tel. 212-353-8280
Fax 212-353-8306

REPORT DATE: 08-15-02
CLIENT: Taylor Environmental Group, Inc.
PROJECT NAME: SCA/Stuyvesant HS
345 Chambers Street, NY
PROJECT NUMBER: M477-15217-29881
SAMPLED BY: Client
SAMPLE DATE: 08-14-02
DATE RECEIVED: 08-14-02
DATE ANALYZED: 08-14-02
SAMPLE MEDIA: Dust Wipe Sample
ANALYSIS REQUIRED: Method EPA 3050/7420

ANALYSIS RESULTS

SAMPLE ID	BATCH NO.	SAMPLE DESCRIPTION	LEAD CONCENTRATION ($\mu\text{g}/\text{ft}^2$)	DETECTION LIMIT ($\mu\text{g}/\text{ft}^2$)
LW-01	21148	Rm 401 Teacher Desk	<9.0	9.0
LW-02	21148	Rm 401 Floor by NE Side Window	<9.0	9.0
LW-03	21148	Rm 402 Computer Desk	<9.0	9.0
LW-04	21148	Rm 402 Floor by Refrigerator	<9.0	9.0
LW-05	21148	Rm 402A Desk	<9.0	9.0
LW-06	21148	Rm 402A Floor by the Window	<9.0	9.0
LW-07	21148	Rm 407 Teacher Desk	<9.0	9.0
LW-08	21148	Rm 407 Floor by SW Side Window	<9.0	9.0
LW-09	21148	Rm 405 Teacher Desk	<9.0	9.0
LW-10	21148	Rm 403 Floor by SW Window	<9.0	9.0
LW-11	21148	Rm 403 File Cabinet Center	<9.0	9.0
LW-12	21148	Rm 403 Floor by TV Set	<9.0	9.0
LW-13	21148	Rm 404 Student Desk by Entrance	<9.0	9.0
LW-14	21148	Rm 404 Floor by North Side Blackboard	<9.0	9.0

07269

CITY_21MC100_008878443

ATC ASSOCIATES, INC
 104 E 25th Street, 10th Floor
 New York, NY 10010
 Tel. 212-353-8280
 Fax 212-353-8306

LW-15	21148	Rm 406 Book Shelf by Entrance	<9.0	9.0
LW-16	21148	Rm 406 Floor by the Entrance	<9.0	9.0
LW-17	21148	Rm 408 Computer Desk	<9.0	9.0
LW-18	21148	Rm 408 Floor Center of the Room	<9.0	9.0
LW-19	21148	Rm 409 Book Shelf	<9.0	9.0
LW-20	21148	Rm 409 Floor Center of the Room	<9.0	9.0
LW-21	21148	Rm 411 Computer Desk 1st on 2nd	<9.0	9.0
LW-22	21148	Rm 411 Floor by the Entrance	<9.0	9.0
LW-23	21148	Field Blank	<9.0 µg	9.0 µg
LW-24	21148	Field Blank	<9.0 µg	9.0 µg

NOTE 1:

THE REPORTING LIMIT (RL) IS 18.0 µg

NOTE 2:

HUD Guidelines for final clearance dust wipe samples: Floor 40 µg/ft², Window sills 250 µg/ft², Window wells 400 µg/ft², Exterior surfaces 800 µg/ft².

NOTE 3:

Blank units are in µg

CERTIFICATION AND SIGNATURES

ANALYSIS PERFORMED BY: for

REPORT PREPARED BY: [Signature]

ATC certifies that this report is an accurate and authentic report of results obtained from the laboratory analysis.

QUALITY ASSURANCE COORDINATOR: [Signature]

LABORATORY DIRECTOR: [Signature]

ATC is accredited by the New York State Department of Health's Environmental Laboratory Approval Program (ELAP) and by the American Industrial Hygiene Association (AIHA) to perform analysis of lead in paint, dust wipes, air and soil samples. (ELAP #10879), (AIHA #100279).

516-358-2955
FAX 516-358-4780

21147

LEAD CUSTODY DOCUMENT

DATE: 8/14/02
TIME: 2:14 PM

LEAD: []
CONTAINER: []

ONE: []
TWO: []
THREE: []
FOUR: []
FIVE: []
SIX: []
SEVEN: []
EIGHT: []
NINE: []
TEN: []
ELEVEN: []
TWELVE: []

PAINT: []
SOIL: []
OTHER: []

SURFACE MATERIAL		LAB RESULT
WOOD	METAL	
X		<9.0
	X	<9.0
X		<9.0
	X	<9.0
		<9.0
		<9.0

COMMENTS / INSTRUCTIONS: 6th F.A.P.

BY (SIGNATURE): [Signature]
DATE: 8/14/02

BY LAB (SIGNATURE): [Signature]
DATE: 8/14/02

PRINTED NAME: [Name]
PRINTED NAME: [Name]

PINK CLIENT

PROJECT NAME: SCA/Stuyvesant HS
345 Chambers Street, NY

PROJECT NUMBER: M477-15217-29881

SAMPLED BY: Client

SAMPLE DATE: 08-14-02
DATE RECEIVED: 08-14-02
DATE ANALYZED: 08-14-02

SAMPLE MEDIA: Dust Wipe Sample
ANALYSIS REQUIRED: Method EPA 3050/7420

ANALYSIS RESULTS

LOCATION	DETECTION LIMIT (µg/ft²)
0	9.0
0	9.0
0	9.0
0	9.0
µg	9.0 µg
µg	9.0 µg

SAMPLE ID	BATCH NO.	SAMPLE DESCRIPTION	LEAD CONCENT (µg/ft²)
LW-01	21147	Rm 615F Book Shelf	<9.0
LW-02	21147	Rm 615F Floor by the Entrance	<9.0
LW-03	21147	Rm 655A Book Shelf	<9.0
LW-04	21147	Rm 655A Floor Center of the Room	<9.0
LW-05	21147	Field Blank	<9.0
LW-06	21147	Field Blank	<9.0

ATC ASSOCIATES, INC
104 E 25th Street, 10th Floor
New York, NY 10010
Tel. 212-353-8280
Fax 212-353-8306

REPORT DATE: 08-15-02
CLIENT: Taylor Environmental Group, Inc.
PROJECT NAME: SCA/Stuyvesant HS
345 Chambers Street, NY
PROJECT NUMBER: M477-15217-29881
SAMPLED BY: Client
SAMPLE DATE: 08-14-02
DATE RECEIVED: 08-14-02
DATE ANALYZED: 08-14-02
SAMPLE MEDIA: Dust Wipe Sample
ANALYSIS REQUIRED: Method EPA 3050/7420

ANALYSIS RESULTS

SAMPLE ID	BATCH NO.	SAMPLE DESCRIPTION	LEAD CONCENTRATION ($\mu\text{g}/\text{ft}^2$)	DETECTION LIMIT ($\mu\text{g}/\text{ft}^2$)
LW-01	21147	Rm 615F Book Shelf	<9.0	9.0
LW-02	21147	Rm 615F Floor by the Entrance	<9.0	9.0
LW-03	21147	Rm 655A Book Shelf	<9.0	9.0
LW-04	21147	Rm 655A Floor Center of the Room	<9.0	9.0
LW-05	21147	Field Blank	<9.0 μg	9.0 μg
LW-06	21147	Field Blank	<9.0 μg	9.0 μg

NOTE 1:

THE REPORTING LIMIT (RL) IS 18.0 μg

NOTE 2:

HUD Guidelines for final clearance dust wipe samples: Floor 40 $\mu\text{g}/\text{ft}^2$, Window sills 250 $\mu\text{g}/\text{ft}^2$, Window wells 400 $\mu\text{g}/\text{ft}^2$, Exterior surfaces 800 $\mu\text{g}/\text{ft}^2$.

NOTE 3:

Blank units are in μg

ATC ASSOCIATES, INC
104 E 25th Street, 10th Floor
New York, NY 10010
Tel. 212-353-8280
Fax 212-353-8306

CERTIFICATION AND SIGNATURES

ANALYSIS PERFORMED BY: WCV

REPORT PREPARED BY: [Signature]

ATC certifies that this report is an accurate and authentic report of results obtained from the laboratory analysis.

QUALITY ASSURANCE COORDINATOR: [Signature]

LABORATORY DIRECTOR: [Signature]

ATC is accredited by the New York State Department of Health Environmental Laboratory Approval Program (ELAP) and by the American Industrial Hygiene Association (AIHA) to perform analysis of lead in paint, dust wipes, air and soil samples. (ELAP #10579), (AIHA #100229).

TAYLOR ENVIRONMENTAL GROUP, INC.
130 JERICHO TPKE., FLORAL PARK, NY 11001

#21155

P7 184

516-358-2955
Fax 516-358-1780

LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT

CLIENT NAME/ADDRESS NYC SCA		CONTACT Harold Sanoj		SAMPLER (SIGNATURE) [Signature]		DATE 8/14/02		TIME		SAMPLE(S) SEALED (YES) NO	
PROJECT LOCATION: Stuyvesant HS 345 Chambers St NY		PROJECT # M477-15217-29881		SAMPLER NAME (PRINT) Kirk McKenzie		CORRECT CONTAINER(S) (YES) NO					
SAMPLE INFORMATION:				MATRIX (CIRCLE ONE): (WIFE) PAINT SOIL OTHER							
LABORATORY #	SAMPLE #	LOCATION	AREA (FT ²)	SURFACE MATERIAL				LAB RESULT			
				WOOD	METAL	BRICK	OTHER				
	LW-26	ROOM 428 - FLOOR Center of Room	1				X	C9.0			
	LW-27	ROOM 428 - Shelf EAST side of Room	1		X			C9.0			
	LW-28	ROOM 438A - FLOOR Center of Room	1				X	C9.0			
	LW-29	ROOM 438A - Table Top EAST side of Room	1				X	C9.0			
	LW-30	ROOM 436 - FLOOR 3' of West Entrance	1				X	C9.0			
	LW-31	ROOM 436 - Table Top Printer Table - West side	1				X	C9.0			
	LW-32	ROOM 424 - FLOOR EAST Entrance	1				X	C9.0			
	LW-33	ROOM 432 - FLOOR Center of Room	1				X	C9.0			
Fax to 212-406-2535 & 516-358-1780				TURNAROUND REQUIRED: NORMAL ☐ STAT ☐ BY 1/1				COMMENTS / INSTRUCTIONS 6 HR - AT			
RELINQUISHED BY (SIGNATURE) [Signature]		DATE 8/14/02 TIME 2:30		PRINTED NAME Kirk McKenzie		RECEIVED BY (SIGNATURE) [Signature]		DATE TIME		PRINTED NAME	
RELINQUISHED BY (SIGNATURE) Gr. Putanov		DATE 8/15/02 TIME 4:50		PRINTED NAME Gr. Putanov		RECEIVED BY LAB (SIGNATURE) R. Droudina		DATE 8/15 TIME 4:50		PRINTED NAME R. Droudina	

07274

CITY_21MC100_008878448

TAYLOR ENVIRONMENTAL GROUP, INC.
130 JERICHO TPKE., FLORAL PARK, NY 11001

#21155 P9.284

516-358-2955
Fax 516-358-1280

LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT

CLIENT NAME/ADDRESS M/L SCA		CONTACT: HAMID SAUDJ		SAMPLER SIGNATURE <i>[Signature]</i>		DATE 8/14/02	TIME	SAMPLE(S) SEALED (YES) NO
PROJECT LOCATION: Stuyvesant H.S.		PROJECT # M477-15747-2988/		SAMPLER NAME (PRINT) LILL McLeuzie				CORRECT CONTAINER(S) (YES) NO
345 Chambers St. N.Y.				MATRIX (CIRCLE ONE): (WIPE) PAINT SOIL OTHER				
SAMPLE INFORMATION:			AREA (FT ²)	SURFACE MATERIAL				LAB RESULT
LABORATORY #	SAMPLE #	LOCATION		WOOD	METAL	BRICK	OTHER	
	LW-34	ROOM 430 - FLOOR	1				X	19/ft ² C9.0
	LW-35	ROOM 442B - FLOOR	1				X	C9.0
	LW-36	Corridor o/s RM 438 - FLOOR	1				X	C9.0
	LW-37	ROOM 446 - FLOOR	1				X	C9.0
	LW-38	ROOM 448 - FLOOR	1				X	C9.0
	LW-39	Locker 44-225 o/s RM 438A	1		X			C9.0
	LW-40	ROOM 453 - FLOOR	1				X	C9.0
	LW-41	ROOM 453 - Top of SE work table	1				X	C9.0
			TURNAROUND REQUIRED: NORMAL ☐ STAT ☐ BY 1/1				COMMENTS / INSTRUCTIONS CHA TAT	
RELINQUISHED BY (SIGNATURE) <i>[Signature]</i>		DATE 8/14/02	PRINTED NAME LILL McLeuzie		RECEIVED BY (SIGNATURE) <i>[Signature]</i>		DATE TIME	PRINTED NAME
RELINQUISHED BY (SIGNATURE) Gr. Mutator		DATE 8/15/02	PRINTED NAME GARY DULATA		RECEIVED BY LAB (SIGNATURE) R. Drouding		DATE 8.15	PRINTED NAME R. Drouding
		TIME 4:50					TIME 4.50	

07275

CITY_21MC100_008878449

TAYLOR ENVIRONMENTAL GROUP, INC.
130 JERICHO TPKE., FLORAL PARK, NY 11001

#21155

3.84

516-358-2955
Fax 516-358-1780

LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT

CLIENT NAME/ADDRESS NYC SCA		CONTACT: HANID SANOI		SAMPLER (SIGNATURE) <i>[Signature]</i>	DATE 8/14/02	TIME	SAMPLE(S) SEALED (YES) NO	
PROJECT LOCATION: Stuyvesant H.S. 345 Chambers St NY		PROJECT # M477-15217-29881		SAMPLER NAME (PRINT) Kirk McKenzie		CORRECT CONTAINER(S) (YES) NO		
SAMPLE INFORMATION:				MATRIX (CIRCLE ONE): (TAPE) PAINT SCIL OTHER				
LABORATORY #	SAMPLE #	LOCATION	AREA (FT ²)	SURFACE MATERIAL				LAB RESULT
				WOOD	METAL	BRICK	OTHER	
	LW-42	ROOM 452 - Floor center of room	1				X	CG.0
	LW-43	ROOM 452 - Shelf Top right side of room	1		X			CG.0
	LW-44	ROOM 451 - Floor 7' of entrance	1				X	CG.0
	LW-45	ROOM 451 - Top of EAST FRONTER Table	1				X	CG.0
	LW-46	ROOM 450 - Floor 3' of EAST window	1				X	CG.0
	LW-47	ROOM 450 - Table Top Computer Table at center window	1				X	CG.0
	LW-48	ROOM 450 - 10' of West side CORRIDOR - Floor	1				X	CG.0
	LW-49	LOCER AREA 414 at corridor w/o escalator	1		X			CG.0
				TURNAROUND REQUIRED: NORMAL ☐ STAT ☐ BY 1/1			COMMENTS / INSTRUCTIONS 6 HR TAT	
RELINQUISHED BY (SIGNATURE) <i>[Signature]</i>		DATE 8/14/02	PRINTED NAME Kirk McKenzie	RECEIVED BY (SIGNATURE) <i>[Signature]</i>		DATE 8/15	PRINTED NAME R. D. Roudina	
RELINQUISHED BY (SIGNATURE) G. Bluck		DATE 8/14/02	PRINTED NAME Gregory Pulato	RECEIVED BY LAB (SIGNATURE) R. D. Roudina		DATE 8/15	PRINTED NAME R. D. Roudina	

07276

WHITE - OFFICE / YELLOW - LAB / PINK - CLIENT

CITY_21MC100_008878450

ATC ASSOCIATES, INC
 104 E 25th Street, 10th Floor
 New York, NY 10010
 Tel. 212-353-8280
 Fax 212-353-8306

REPORT DATE: 08-15-02
CLIENT: Taylor Environmental Group, Inc.
PROJECT NAME: SCA/Stuyvesant HS
 345 Chambers Street, NY
PROJECT NUMBER: M477-15217-29881
SAMPLED BY: Client
SAMPLE DATE: 08-14-02
DATE RECEIVED: 08-15-02
DATE ANALYZED: 08-15-02
SAMPLE MEDIA: Dust Wipe Sample
ANALYSIS REQUIRED: Method EPA 3050/7420

ANALYSIS RESULTS

SAMPLE ID	BATCH NO.	SAMPLE DESCRIPTION	LEAD CONCENTRATION ($\mu\text{g}/\text{ft}^2$)	DETECTION LIMIT ($\mu\text{g}/\text{ft}^2$)
LW-26	21155	Rm 438 Floor Center of Room	<9.0	9.0
LW-27	21155	Rm 438 Shelf East Side of Room	<9.0	9.0
LW-28	21155	Rm 438A Floor Center of Room	<9.0	9.0
LW-29	21155	Rm 438A Table Top Side of Room	<9.0	9.0
LW-30	21155	Room 436 Floor 3' of West Entrance	<9.0	9.0
LW-31	21155	Room 436 Table Top Printer Table West Side	<9.0	9.0
LW-32	21155	Room 434 Floor 3' of Entrance	<9.0	9.0
LW-33	21155	Room C432 Floor Center of Room	<9.0	9.0
LW-34	21155	Room 430 Floor 3' of Entrance	<9.0	9.0
LW-35	21155	Room C428 Floor Center	<9.0	9.0
LW-36	21155	Corridor O/S Rm 438 Floor	<9.0	9.0
LW-37	21155	Room 446 Floor 4' of Entrance	<9.0	9.0
LW-38	21155	Room 448 Floor 4' of Entrance	<9.0	9.0
LW-39	21155	Locker #4 - 235 O/S Rm 438A	<9.0	9.0

07278

CITY_21MC100_008878452

ATC ASSOCIATES, INC
 104 E 25th Street, 10th Floor
 New York, NY 10010
 Tel 212-353-8280
 Fax 212-353-8306

LW-40	21155	Room 453 Floor 2' of Unitvent	<9.0	9.0
LW-41	21155	Room 453 Top of SE Work Table	<9.0	9.0
LW-42	21155	Room 452 Floor Center of Room	<9.0	9.0
LW-43	21155	Room 452 Shelf Top Right Side of Room	<9.0	9.0
LW-44	21155	Room 451 Floor 7' of Entrance	<9.0	9.0
LW-45	21155	Room 451 Top of East Printer Table	<9.0	9.0
LW-46	21155	Room 450 Floor 3' of East Unitvent	<9.0	9.0
LW-47	21155	Room 450 Table Top Computer Table at Center Wall	<9.0	9.0
LW-48	21155	Corridor 10' of West Side Escalator Floor	<9.0	9.0
LW-49	21155	Locker #4-414 at Corridor N/O Escalator	<9.0	9.0
LW-50	21155	Corridor O/S Rm 403 Floor	<9.0	9.0
FBL-1	21155	Field Blank	<9.0 µg	9.0 µg
FBL-2	21155	Field Blank	<9.0 µg	9.0 µg
FBL-3	21155	Field Blank	<9.0 µg	9.0 µg

NOTE 1:

THE REPORTING LIMIT (RL) IS 18.0 µg


NOTE 2:


HUD Guidelines for final clearance dust wipe samples: Floor 40 µg/R², Window sills 250 µg/R², Window wells 400 µg/R², Exterior surfaces 800 µg/R².

NOTE 3:


Blank units are in µg


CERTIFICATION AND SIGNATURES

ANALYSIS PERFORMED BY: 

REPORT PREPARED BY: 

ATC certifies that this report is an accurate and authentic report of results obtained from the laboratory analysis.

QUALITY ASSURANCE COORDINATOR: 

LABORATORY DIRECTOR: 

ATC is accredited by the New York State Department of Health Environmental Laboratory Approval Program (ELAP) and by the American Industrial Hygiene Association (AIHA) to perform analysis of lead in paint, dust wipes, air and soil samples. (ELAP #10879), (AIHA #100229).

07279

CITY_21MC100_008878453

TAYLOR ENVIRONMENTAL GROUP, INC.
130 JERICHO TRKE, FLORAL PARK, NY 11001

030211207

PT 10/4

516-358-2955
Fax 516-358-1780

LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT

CLIENT NAME/ADDRESS M7CSCA		CONTACT: HAHID SANDJ		SAMPLER SIGNATURE <i>[Signature]</i>		DATE 8/14/02		TIME		SAMPLE(S) SEALED (YES) NO	
PROJECT LOCATION: Stuyvesant HS 345 Chambers St NY		PROJECT # M477-15217-29881		SAMPLER NAME (PRINT) Kirk McKenzie						CORRECT CONTAINER(S) (YES) NO	
SAMPLE INFORMATION:				MATRIX (CIRCLE ONE): WIPR PAINT SOIL OTHER							
LABORATORY #	SAMPLE #	LOCATION	AREA (FT ²)	SURFACE MATERIAL				US/FT ²	LAB RESULT		
				WOOD	METAL	BRICK	OTHER				
	LW-01	ROOM 413 - FLOOR 4' 5" ENTRANCE	1				X	< 10.0			
	LW-02	ROOM 413 - Table Top NE Computer Desk	1				X	10.0			
	LW-03	ROOM C421 - FLOOR BY ENTRANCE	1				X	< 10.0			
	LW-04	ROOM C423 - FLOOR CENTER OF ROOM	1				X	< 10.0			
	LW-05	ROOM C425 - FLOOR 3' 5" ENTRANCE	1				X	< 10.0			
	LW-06	ROOM C425 - Shelf Left side of room	1		X			12.0			
	LW-07	ROOM Locker #471 o/s RM 427	1		X		X	12.0			
	LW-08	ROOM 427 - FLOOR 3' of West Wall	1				X	< 10.0			
Fax to 212-406-2535 & 516-358-1780				TURNAROUND REQUIRED: NORMAL ☐ STAT ☐ BY 1/1				COMMENTS / INSTRUCTIONS 6 HR. TAT			
RELINQUISHED BY (SIGNATURE) <i>[Signature]</i>		DATE 8/14/02		PRINTED NAME Kirk McKenzie		RECEIVED BY (SIGNATURE)		DATE		PRINTED NAME	
RELINQUISHED BY (SIGNATURE)		DATE		PRINTED NAME		RECEIVED BY LAB (SIGNATURE)		DATE		PRINTED NAME	

WHITE - OFFICE / YELLOW - LAB / PINK - CLIENT

CITY_21MC100_008878454

TAYLOR ENVIRONMENTAL GROUP, INC.
130 JERICHO TURNPIKE, FLORAL PARK, NY 11001

050211051

287

516-358-2955

Fax 516-358-1780

LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT

CLIENT NAME/ADDRESS NYC SCA			CONTACT HAROLD SAVOY		SAMPLER SIGNATURE <i>[Signature]</i>		DATE / TIME 8/14/02		SAMPLE(S) SEALED? (YES) NO		
PROJECT LOCATION: STUYVESANT H.S. 345 Chambers St NY			PROJECT # 11477-15217-29881		SAMPLER NAME (PRINT) KIRK MCKENZIE				CORRECT CONTAINER(S) (YES) NO		
SAMPLE INFORMATION:					MATRIX (CIRCLE ONE): (WIFE) PAINT SOIL OTHER						
LABORATORY #	SAMPLE #	LOCATION	AREA (FT ²)	SURFACE MATERIAL				lb/ft ²	LAB RESULT		
				WOOD	METAL	BRICK	OTHER				
	LW-09	ROOM 427 - Top of Teachers Desk	1				X	< 10.0			
	LW-10	ROOM 429 - Floor Room 3' of East side of Room	1				X	< 10.0			
	LW-11	ROOM 429 - Desk Top NE STUDENT DESK	1				X	< 10.0			
	LW-12	ROOM 431 - Floor 3' of EAST ENTRANCE	1				X	< 10.0			
	LW-13	ROOM 431 - Top of Teachers Desk	1				X	< 10.0			
	LW-14	ROOM 433 - Floor 2' of EAST ENTRANCE	1				X	< 10.0			
	LW-15	ROOM 433 - Top of CABINET	1				X	10.0			
	LW-16	ROOM 435 - Floor Center of ROOM	1				X	< 10.0			
					TURNAROUND REQUIRED: NORMAL ☐ STAT ☐ BY 1/1			COMMENTS / INSTRUCTIONS 6 HR TAT			
RELINQUISHED BY (SIGNATURE) <i>[Signature]</i>		DATE 8/15/02 TIME 0435	PRINTED NAME KIRK MCKENZIE		RECEIVED BY (SIGNATURE)		DATE	PRINTED NAME			
RELINQUISHED BY (SIGNATURE)		DATE	PRINTED NAME		RECEIVED BY LAB (SIGNATURE)		DATE	PRINTED NAME			
		TIME					TIME				

WHITE - OFFICE / YELLOW - LAB / PINK - CLIENT

CITY_21MC100_008878455

07284

TAYLOR ENVIRONMENTAL GROUP, INC.
130 JERICHO TPKE., FLORAL PARK, NY 11001

050 211234

516 358-2955
FAX 516-358-1700

LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT

CLIENT NAME/ADDRESS NYC SCA		CONTACT HAMID SAVOI		SAMPLER SIGNATURE <i>[Signature]</i>		DATE 8/14/02		TIME		SAMPLE(S) SEALED (YES) NO	
PROJECT LOCATION: Stuyvesant H.S.		PROJECT # 1477-15217-29881		SAMPLER NAME (PRINT) Kirk McKenzie		CORRECT CONTAINER(S) YES NO					
SAMPLE INFORMATION:		MATRIX (CIRCLE ONE): (WIFE)		PAINT		SOIL		OTHER			
LABORATORY #	SAMPLE #	LOCATION	AREA (FT ²)	SURFACE MATERIAL				UG/FT ²	LAB RESULT		
				WOOD	METAL	BRICK	OTHER				
	LW-17	ROOM 435 - Desk Top SE Desk	1				X	< 10.0			
	LW-18	ROOM 437 - FLOOR 3' of EAST ENTRANCE	1				X	< 10.0			
	LW-19	ROOM 437 - Desk Top Teacher's Desk	1				X	< 10.0			
	LW-20	ROOM 439 - FLOOR West of Teacher's Desk	1				X	< 10.0			
	LW-21	ROOM 439 - Top of Cabinet	1		X			< 10.0			
	LW-22	ROOM 442 - FLOOR 4' of ENTRANCE	1				X	< 10.0			
	LW-23	ROOM 442 - Cabinet Top	1		X			< 10.0			
	LW-24	ROOM 440 - FLOOR SW side of ROOM	1				X	< 10.0			
TURNAROUND REQUIRED:				NORMAL ☐ STAT ☐ BY 1/1				COMMENTS / INSTRUCTIONS 6 HR TAT			
RELINQUISHED BY (SIGNATURE) <i>[Signature]</i>		DATE 8/14/02		PRINTED NAME Kirk McKenzie		RECEIVED BY (SIGNATURE)		DATE		PRINTED NAME	
RELINQUISHED BY (SIGNATURE)		DATE		PRINTED NAME		RECEIVED BY LAB (SIGNATURE)		DATE		PRINTED NAME	
		TIME						TIME			

WHITE - OFFICE / YELLOW - LAB / PINK - CLIENT

NYC SCA


ENVIRONMENTAL GROUP, INC.

6532-865-212

4P:58

2882/517/02

CITY_21MC100_008878456

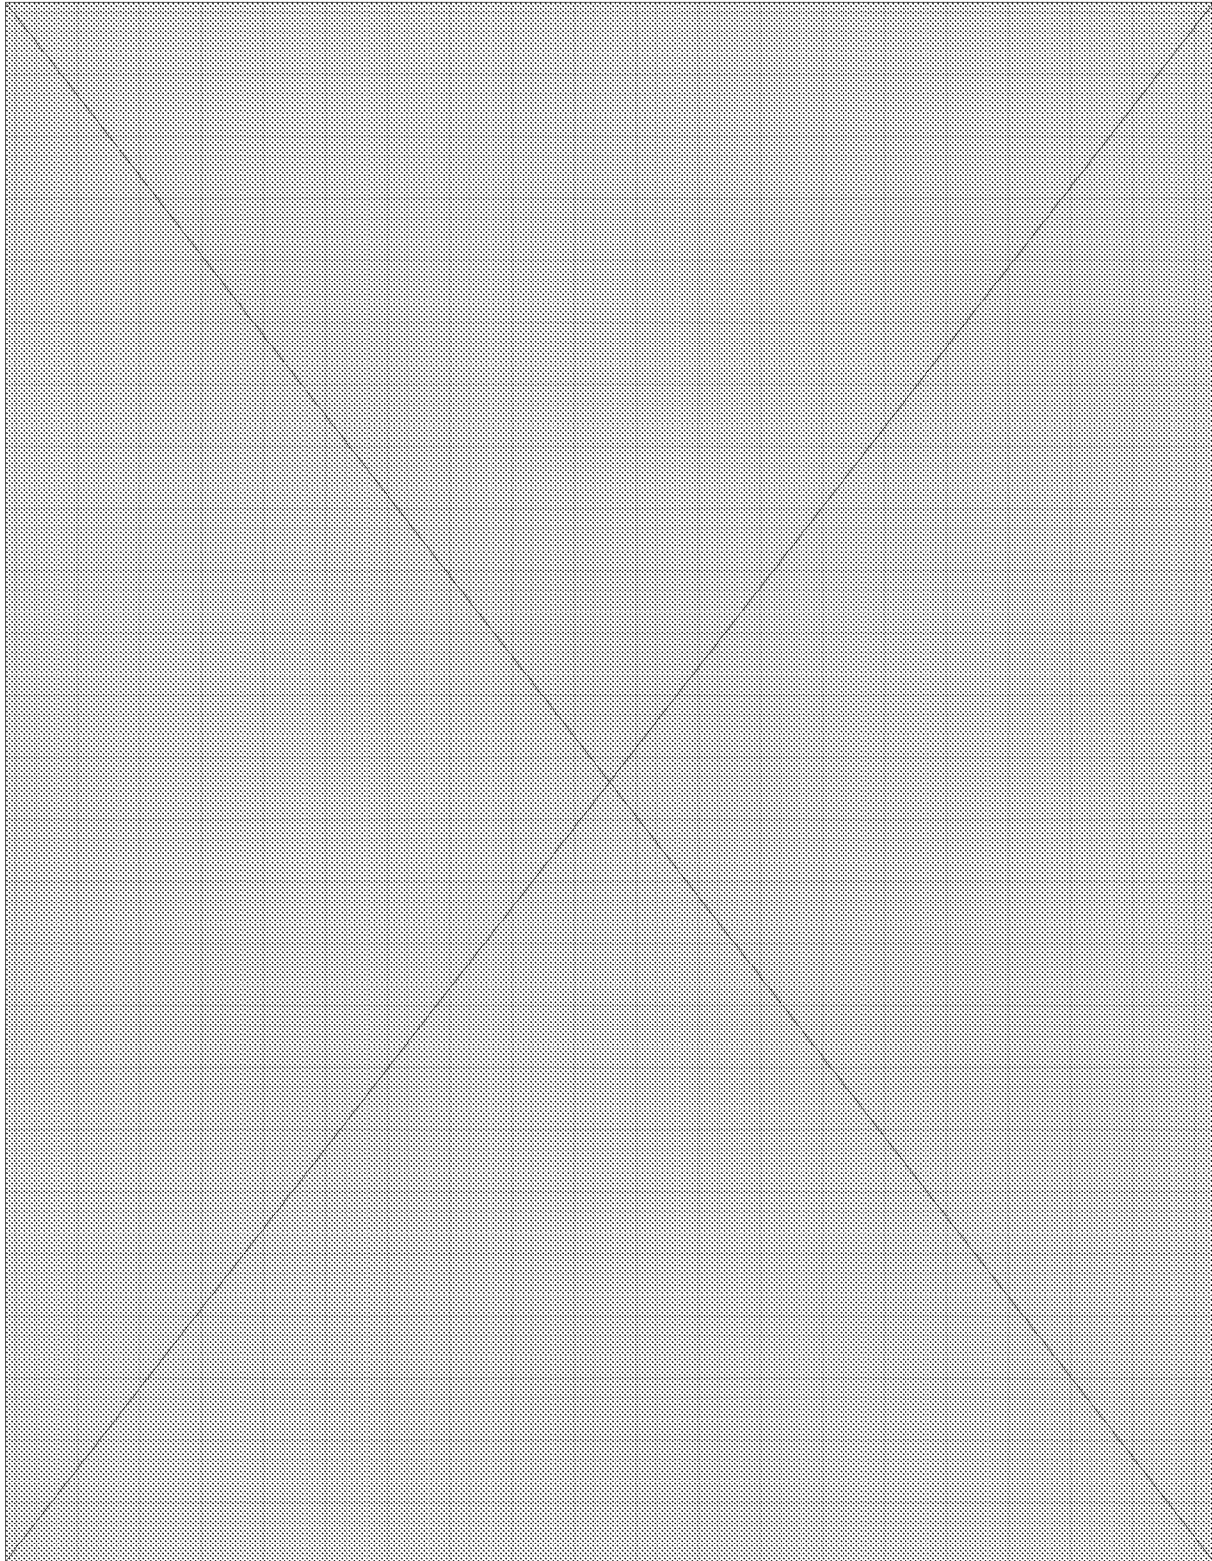

09/15/2002 09:47 212-290-2536

EMSL ANALYTICAL INC

PAGE 21/96

EMSL Analytical, Inc.

307 West 38th Street, New York, NY 10018

Phone: 212-290-0051 Fax: 212-290-0058 Email: manhattanlab@emsl.com



Attn: Taylor Environmental Group, Inc.
 Floral Park Corporate Center
 130 Jericho Tpke.
 Floral Park, NY 11001

Fax: (516) 358-1780 Phone: 516-358-2955
 Project: NYC SCA/Stuyvesant H.S. 345 Chambers St., N.Y.
 NY10477-15217-25881

Customer ID: TAYL50
 Customer PO:
 Received: 09/15/02 7:44 AM
 EMSL Order: 000211234
 EMSL Project ID:

Lead in Wipes by Flame AAS (SW 846, 7420)

Client Sample Description	Lab ID	Analyzed	Area Sampled	Lead Concentration	Notes
LW-01 Room 413-Floor 4' of Entrance	0001		144 in ²	<10.0 µg/R ²	
LW-02 Room 413-Table Top NE Computer Desk	0002		144 in ²	10.0 µg/R ²	
LW-03 Room C421-Floor by Entrance	0003		144 in ²	<10.0 µg/R ²	
LW-04 Room C423-Floor Center of Room	0004		144 in ²	<10.0 µg/R ²	
LW-05 Room C425-Floor 3' of Entrance	0005		144 in ²	<10.0 µg/R ²	
LW-06 Room C425-Shelf Left Side of Room	0006		144 in ²	12.0 µg/R ²	
LW-07 Locker #471 Q/S Rm 427	0007		144 in ²	12.0 µg/R ²	
LW-08 Room 427-Floor 3' of West Unit Vent	0008		144 in ²	<10.0 µg/R ²	
LW-09 Room 427-Top of Teachers Desk	0009		144 in ²	<10.0 µg/R ²	
LW-10 Room 428-Floor East Side of Room	0010		144 in ²	<10.0 µg/R ²	
LW-11 Room 428-Desk Top NE Student Desk	0011		144 in ²	<10.0 µg/R ²	
LW-12 Room 431-Floor 3' of East Entrance	0012		144 in ²	<10.0 µg/R ²	
LW-13 Room 431-Top of Teachers Desk	0013		144 in ²	<10.0 µg/R ²	
LW-14 Room 433-Floor 2' of East Unit Vent	0014		144 in ²	<10.0 µg/R ²	
LW-15 Room 433-Top of Cabinet	0015		144 in ²	10.0 µg/R ²	
LW-16 Room 435-Floor Center of Room	0016		144 in ²	<10.0 µg/R ²	
LW-17 Room 435-Desk Top SE Desk	0017		144 in ²	<10.0 µg/R ²	
LW-18 Room 437-Floor 3' of East Entrance	0018		144 in ²	<10.0 µg/R ²	


 Laboratory Manager
 or other approved signatory

Reporting time is 10 uprise
 ACCREDITATIONS: NJHA Environmental Lead Laboratory Approval Program #102861

Page 1 of 2

07284

08/15/2002 09:47 212-290-2558

EMSL ANALYTICAL INC

PAGE 02/06

EMSL Analytical, Inc.

307 West 22nd Street, New York, NY 10011

Phone: 212-290-0051 Fax: 212-290-0058 Email: manhattanlab@emsl.com



Attn: Taylor Environmental Group, Inc.
Floral Park Corporate Center
130 Jericho Turnpike
Floral Park, NY 11001

Fax: (516) 358-1730

Phone: 516-358-2955

Project: NYC SCA/Stuyvesant H.S. 345 Chambers St., N.Y.,
NY/M477-15217-29881

Customer ID: TAYL50

Customer PO:

Received: 08/15/02 7:44 AM

EMSL Order: 030211234

EMSL Project ID:

Lead in Wipes by Flame AAS (SW 846, 7420)

Client Sample Description	Lab ID	Analyzed	Area Sampled	Lead Concentration	Notes
LW-19 Room 437-Desk Top Teachers Desk	0019		144 in ²	<10.0 µg/ft ²	
LW-20 Room 439-Floor West of Teachers Desk	0020		144 in ²	<10.0 µg/ft ²	
LW-21 Room 439-Top of Cabinet	0021		144 in ²	<10.0 µg/ft ²	
LW-22 Room 442-Floor 4' of Entrance	0022		144 in ²	<10.0 µg/ft ²	
LW-23 Room 442-Cabinet Top	0023		144 in ²	<10.0 µg/ft ²	
LW-24 Room 440-Floor SW side of Room	0024		144 in ²	<10.0 µg/ft ²	
LW-25 Room 440-Desk Top Front 5 Desks from South	0025		144 in ²	<10.0 µg/ft ²	
FBL-1 Field Blank	0026		n/a	<10.0 µg/wipe	
FBL-2 Field Blank	0027		n/a	<10.0 µg/wipe	
FBL-3 Field blank	0028		n/a	<10.0 µg/wipe	


Laboratory Manager
or other approved signatory

Reporting limit is 10 µg/wipe

ACCREDITATIONS: AHA Environmental Lead Laboratory Approval Program #102581

Page 2 of 2

07285

CITY_21MC100_008878459

TAYLOR ENVIRONMENTAL GROUP, INC.
130 JERICHO TPKE., FLORAL PARK, NY 11001

2/248

1 of 3

516-358-2955
Fax 516-358-1700

LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT

CLIENT NAME/ADDRESS Stuyvesant H.S.		CONTACT Harold S. - 101		SAMPLER (SIGNATURE) <i>[Signature]</i>		DATE 8/16/02	TIME 5:30	SAMPLE(S) SEALED ☒ YES / NO
PROJECT LOCATION: 345 Chambers		PROJECT # M477-15217-29881		SAMPLER NAME (PRINT) H. S. - 101		CORRECT CONTAINER(S) ☒ YES / NO		
SAMPLE INFORMATION:				MATRIX (CIRCLE ONE): ☒ WIFE PAINT SOIL OTHER				
LABORATORY #	SAMPLE #	LOCATION	AREA (FT ²)	SURFACE MATERIAL				LAB RESULT
				WOOD	METAL	BRICK	OTHER	
	8	rm 450A Floor at entrance	1				RET	<9.0
	9	rm 450A metal shelf near entry	1				RET	<9.0
Fax 212-406-2535				TURNAROUND REQUIRED: NORMAL ☐ STAT ☐ BY 10/1		COMMENTS / INSTRUCTIONS		
RELINQUISHED BY (SIGNATURE) <i>[Signature]</i>		DATE 8/16/02	PRINTED NAME H. S. - 101		RECEIVED BY (SIGNATURE) <i>[Signature]</i>		DATE 8/16/02	PRINTED NAME
RELINQUISHED BY (SIGNATURE)		DATE	PRINTED NAME		RECEIVED BY LAB (SIGNATURE)		DATE	PRINTED NAME

07286

WHITE - OFFICE / YELLOW - LAB / PINK - CLIENT

ATC ASSOCIATES, INC
104 E 25th Street, 10th Floor
New York, NY 10010
Tel. 212-353-8280
Fax 212-353-8306

REPORT DATE: 08-19-02

CLIENT: Taylor Environmental Group, Inc.

PROJECT NAME: SCA/Snyvcsant HS
345 Chambers Street, NY

PROJECT NUMBER: M477-15217-29881

SAMPLED BY: Client

SAMPLE DATE: 08-16-02
DATE RECEIVED: 08-16-02
DATE ANALYZED: 08-16-02

SAMPLE MEDIA: Dust Wipe Sample
ANALYSIS REQUIRED: Method EPA 3050/7420

ANALYSIS RESULTS

SAMPLE ID	BATCH NO.	SAMPLE DESCRIPTION	LEAD CONCENTRATION (µg/ft²)	DETECTION LIMIT (µg/ft²)
8	21248	Rm 450A Floor at Entrance	<9.0	9.0
9	21248	Rm 450A Metal Shelf Near Entr.	<9.0	9.0
10	21248	Rm 307 Floor at Rear Entrance	<9.0	9.0
11	21248	Rm 307 Floor Table Top Near Entrance	<9.0	9.0
12	21248	Cellar Corr. O/S C029 Supply	<9.0	9.0
13	21248	Cellar Corr. O/S C029 Supply	15.1	9.0
14	21248	Cellar Corr. O/S C029 Supply	<9.0	9.0
16	21248	Rm 517 Floor Left Side	53.0	9.0
17	21248	Rm 517 Shelf at Entr.	49.0	9.0
18	21248	3rd Floor GYM Floor Storage Rm 380B SW	53.6	9.0
19	21248	3rd Floor GYM Shelf Storage Rm 380B	18.6	9.0
FB7	21248	Field Blank	<9.0 µg	9.0 µg
FB8	21248	Field Blank	<9.0 µg	9.0 µg

NOTE 1:

THE REPORTING LIMIT (RL) IS 18.0 µg

NOTE 2:

HUD Guidelines for final clearance dust wipe samples: Floor 40 µg/ft², Window sills 250 µg/ft², Window wells 400 µg/ft², Exterior surfaces 800 µg/ft².

NOTE 3:

Blank units are in µg

07287

CITY_21MC100_008878461

ATC ASSOCIATES, INC

104 E 25th Street, 10th Floor

New York, NY 10010

Tel. 212-353-8280

Fax 212-353-8306

CERTIFICATION AND SIGNATURES

ANALYSIS PERFORMED BY: ALH

REPORT PREPARED BY: J. [Signature]

ATC certifies that this report is an accurate and authentic report of results obtained from the laboratory analysis.

QUALITY ASSURANCE COORDINATOR: MS

LABORATORY DIRECTOR: GM

ATC is accredited by the New York State Department of Health Environmental Laboratory Approval Program (ELAP) and by the American Industrial Hygiene Association (AIHA) to perform analysis of lead in paint, dust wipes, air and soil samples. (ELAP #10879), (AIHA #100229).

TAYLOR ENVIRONMENTAL GROUP, INC.
130 JERICHO TPKE., FLORAL PARK, NY 11001

516-358-2955
Fax 516-358-1780

21224

LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT

CLIENT NAME/ADDRESS SCA		CONTACT: Harriet Santos		SAMPLER SIGNATURE <i>[Signature]</i>		DATE 8/15/02		TIME		SAMPLE(S) SEALED (YES) NO	
PROJECT LOCATION: Stuyvesant H.S.		PROJECT # M477-15217/29821		SAMPLE NAME (PRINT) M. Kozawa						CORRECT CONTAINER(S) (YES) NO	
SAMPLE INFORMATION:				MATRIX (CIRCLE ONE): WIRE PAINT SOIL OTHER							
LABORATORY #	SAMPLE #	LOCATION	AREA (FT ²)	SURFACE MATERIAL				LAB RESULT			
				WOOD	METAL	BRICK	OTHER				
	LW01	Rm 302 TOP of COMPUTER DESK	1.0				X	< 9.0			
	LW02	Rm 302 FLOOR CENTER of room	1.0				X	11.1			
	LW03	Rm 302A TOP of DESK	1.0				X	< 9.0			
	LW04	Rm 302A FLOOR NEAR ENTRANCE	1.0				X	< 9.0			
	LW05	Rm 302B TOP of FILE CABINET	1.0		X			< 9.0			
	LW06	Rm 302B FLOOR BETWEEN BOOKSHELVES	1.0				X	< 9.0			
	LW07	Rm 301 FLOOR CENTER AREA	1.0				X	< 9.0			
	LW08	Rm 301B TOP of DESK	1.0				X	< 9.0			
			TURNAROUND REQUIRED: NORMAL ☐ STAT ☐ BY 1/1				COMMENTS / INSTRUCTIONS 6hr FAT				
RELINQUISHED BY (SIGNATURE) <i>[Signature]</i>		DATE 8/16/02	PRINTED NAME M. Kozawa		RECEIVED BY (SIGNATURE) <i>[Signature]</i>		DATE 8/16/02	PRINTED NAME ME/LW01			
RELINQUISHED BY (SIGNATURE)		DATE	PRINTED NAME		RECEIVED BY LAB (SIGNATURE)		DATE	PRINTED NAME			
		TIME					TIME				

07289

WHITE - OFFICE / YELLOW - LAB / PINK - CLIENT

CITY_21MC100_008878463

TAYLOR ENVIRONMENTAL GROUP, INC.
130 JERICHO TPKE., FLORAL PARK, NY 11001

516-358-2955
Fax 516-358-1780

LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT

CLIENT NAME/ADDRESS SCA		CONTACT: Harriet Savat		SAMPLER (SIGNATURE) <i>[Signature]</i> - 8/16/02		DATE 8/16/02		TIME		SAMPLE(S) SEALED (YES) NO	
PROJECT LOCATION: Stuyvesant H.S.		PROJECT # M47T-15217/29281		SAMPLER NAME (PRINT) AL. KARAKOV						CORRECT CONTAINER(S) (YES) NO	
SAMPLE INFORMATION:				MATRIX (CIRCLE ONE): (VAPE) PAINT SOIL OTHER							
LABORATORY #	SAMPLE #	LOCATION	AREA (FT ²)	SURFACE MATERIAL				LAB RESULT			
				WOOD	METAL	BRICK	OTHER				
	LW 09	Room 301B FLOOR EAST OF DESK	1.0				X	< 9.0			
	LW 10	Room 301A TOP OF COMPUTER DESK / BENCHTOP CLOCK	1.0				X	< 9.0			
	LW 11	Room 301A FLOOR CENTER AREA	1.0				X	< 9.0			
	LW 12	Room 301C TOP OF DESK / NEAR COMPUTER	1.0				X	< 9.0			
	LW 13	Room 301C FLOOR NEAR WINDOW	1.0				X	< 9.0			
	LW 14	Room 303 TOP OF TEACHER'S DESK	1.0				X	< 9.0			
	LW 15	Room 303 FLOOR NEAR CABINETS	1.0				X	< 9.0			
	LW 16	Room 305 TOP OF TEACHER'S DESK	1.0				X	< 9.0			
Fax results to Taylor (212) 408-2535				TURNAROUND REQUIRED: NORMAL ☐ STAT ☐ BY 1 / 1				COMMENTS / INSTRUCTIONS OK TAY			
RELINQUISHED BY (SIGNATURE) <i>[Signature]</i>		DATE 8/16/02 TIME 1300		PRINTED NAME AL. KARAKOV		RECEIVED BY (SIGNATURE) <i>[Signature]</i>		DATE 8/16/02 TIME 1400		PRINTED NAME WEL WERN	
RELINQUISHED BY (SIGNATURE)		DATE TIME		PRINTED NAME		RECEIVED BY LAB (SIGNATURE)		DATE TIME		PRINTED NAME	

WHITE - OFFICE / YELLOW - LAB / PINK - CLIENT

CITY_21MC100_008878464

TAYLOR ENVIRONMENTAL GROUP, INC.
130 JERICHO TPKE., FLORAL PARK, NY 11001

21220

516-358-2955
Fax 516-358-1780

LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT

CLIENT NAME/ADDRESS <i>SCA</i> Al. Kaczkowski		CONTACT: <i>Hamid Sami</i>		SAMPLER SIGNATURE <i>[Signature]</i>		DATE <i>8/16/02</i>		TIME		SAMPLE(S) SEALED ☒ YES ☐ NO	
PROJECT LOCATION: <i>Stuyvesant H.S.</i>		PROJECT # <i>MA77-15217/24881</i>		SAMPLER NAME (PRINT) <i>Al. Kaczkowski</i>						CORRECT CONTAINER(S) ☒ YES ☐ NO	
SAMPLE INFORMATION:				MATRIX (CIRCLE ONE): ☒ WIFE ☐ PAINT ☐ SOIL ☐ OTHER							
LABORATORY #	SAMPLE #	LOCATION		AREA (FT ²)	SURFACE MATERIAL WOOD METAL BRICK OTHER				LAB RESULT <i>ug/L²</i>		
	LW 17	Room 305 Floor NEAR WEST WINDOW		1.0				X	< 9.0		
	LW 18	Room 309 Middle of NORTH REARABLE		1.0		X			< 9.0		
	LW 19	Room 309 Floor NORTH ENTRANCE		1.0				X	< 9.0		
	LW 20	Room 313 Top of TEACHERS DESK		1.0				X	< 9.0		
	LW 21	Room 313 Floor NORTH TEACHERS DESK		1.0				X	< 9.0		
	LW 22	FIELD BLANKS							—		
	LW 23	FIELD BLANKS							—		
Fax results to Taylor (212) 406-2535				TURNAROUND REQUIRED: NORMAL ☐ STAT ☐ BY <i>1/1</i>				COMMENTS / INSTRUCTIONS <i>OK TAT</i>			
RELINQUISHED BY (SIGNATURE) <i>[Signature]</i>		DATE <i>8/16/02</i> TIME <i>1300</i>		PRINTED NAME <i>Al. Kaczkowski</i>		RECEIVED BY (SIGNATURE) <i>[Signature]</i>		DATE <i>8/16/02</i> TIME <i>1410</i>		PRINTED NAME <i>[Signature]</i>	
RELINQUISHED BY (SIGNATURE) <i>[Signature]</i>		DATE TIME		PRINTED NAME		RECEIVED BY LAB (SIGNATURE)		DATE TIME		PRINTED NAME	

WHITE - OFFICE / YELLOW - LAB / PINK - CLIENT

07291

CITY_21MC100_008878465

ATC ASSOCIATES, INC

104 E 25th Street, 10th Floor

New York, NY 10010

Tel. 212-353-8280

Fax 212-353-8306

REPORT DATE: 08-16-02
CLIENT: Taylor Environmental Group, Inc.
PROJECT NAME: SCA/Stuyvesant HS
345 Chambers Street, NY
PROJECT NUMBER: M477-15217-29881
SAMPLED BY: Client
SAMPLE DATE: 08-16-02
DATE RECEIVED: 08-16-02
DATE ANALYZED: 08-16-02
SAMPLE MEDIA: Dust Wipe Sample
ANALYSIS REQUIRED: Method EPA 2050/7420

ANALYSIS RESULTS

SAMPLE ID	BATCH NO.	SAMPLE DESCRIPTION	LEAD CONCENTRATION ($\mu\text{g}/\text{ft}^2$)	DETECTION LIMIT ($\mu\text{g}/\text{ft}^2$)
LW-01	21224	Rm 302 Top of Computer Desk	<9.0	9.0
LW-02	21224	Rm 302 Floor Center of Room	11.1	9.0
LW-03	21224	Rm 302A Top of Desk	<9.0	9.0
LW-04	21224	Rm 302A Floor Near Entrance	<9.0	9.0
LW-05	21224	Rm 302B Top of File Cabinet	<9.0	9.0
LW-06	21224	Rm 302B Floor between Bookshelves	<9.0	9.0
LW-07	21224	Rm 301 Floor Center Area	<9.0	9.0
LW-08	21224	Rm 301B Top of Desk	<9.0	9.0
LW-09	21224	Rm 301B Floor East of Door	<9.0	9.0
LW-10	21224	Rm 301A Top of Computer Desk beneath Clock	<9.0	9.0
LW-11	21224	Rm 301A Floor Center Area	<9.0	9.0
LW-12	21224	Rm 301C Top of Desk/Near Computer	<9.0	9.0
LW-13	21224	Rm 301C Floor Near Window	<9.0	9.0
LW-14	21224	Rm 303 Top of Teacher's Desk	<9.0	9.0

07000

ATC ASSOCIATES, INC

104 E 25th Street, 10th Floor

New York, NY 10010

Tel. 212-353-8280

Fax 212-353-8306

LW-15	21224	Rm 303 Floor Near Cabinets	<9.0	9.0
LW-16	21224	Rm 305 Top of Teacher's Desk	<9.0	9.0
LW-17	21224	Rm 305 Floor Near West Window	<9.0	9.0
LW-18	21224	Rm 309 Middle of North Bookshelf	<9.0	9.0
LW-19	21224	Rm 309 Floor Near Entrance	<9.0	9.0
LW-20	21224	Rm 313 Top of Teacher's Desk	<9.0	9.0
LW-21	21224	Rm 313 Floor Near Teacher's Desk	<9.0	9.0
LW-22	21224	Field Blank	<9.0 μg	9.0 μg
LW-23	21224	Field Blank	<9.0 μg	9.0 μg

NOTE 1:

THE REPORTING LIMIT (RL) IS 18.0 μg

NOTE 2:

HUD Guidelines for final clearance dust wipe samples: Floor 40 $\mu\text{g}/\text{ft}^2$, Window sills 250 $\mu\text{g}/\text{ft}^2$, Window walls 400 $\mu\text{g}/\text{ft}^2$, Exterior surfaces 800 $\mu\text{g}/\text{ft}^2$.

NOTE 3:

Blank units are in μg CERTIFICATION AND SIGNATURESANALYSIS PERFORMED BY: WIKREPORT PREPARED BY: WIK




ATC certifies that this report is an accurate and authentic report of results obtained from the laboratory analysis.

QUALITY ASSURANCE COORDINATOR: WIKLABORATORY DIRECTOR: WIK

ATC is accredited by the New York State Department of Health Environmental Laboratory Approval Program (ELAP) and by the American Industrial Hygiene Association (AIHA) to perform analysis of lead in paint, dust wipes, air and soil samples. (ELAP #10879), (AIHA #100229).

07293

CITY_21MC100_008878467

030211363 LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT		Fax	
CLIENT NAME/ADDRESS SCA		CONTACT: Harriet Sawyer	SAMPLER SIGNATURE  DATE 8/16/02
PROJECT LOCATION: Stuyvesant H.S.		PROJECT # W477-15217/29881	SAMPLE(S) SEALED ☒ YES ☐ NO CORRECT CONTAINER(S) ☒ YES ☐ NO
SAMPLE INFORMATION:		SAMPLER NAME (PRINT) AL Kazakov MATRIX (CIRCLE ONE): ☒ WIPES ☐ PAINT ☐ SOIL ☐ OTHER	
LABORATORY #	SAMPLE #	LOCATION	AREA (FT ²) SURFACE MATERIAL WOOD METAL BRICK OTHER
	LW 24	Room 311 TOP OF COMPUTER DESK	1.0 X <10.0
	LW 25	Room 311 FLOOR CENTER AREA	1.0 X <10.0
	LW 26	Room 315 TOP OF TOMBONE'S DESK	1.0 X <10.0
	LW 27	Room 315 FLOOR NOOK EAST WINDOW	1.0 X <10.0
	LW 28	Room C321 FLOOR NORTH ENTRANCE	1.0 X <10.0
	LW 29	Room C325 FLOOR CENTER OF ROOM	1.0 X <10.0
	LW 30	Room 315 TOP OF TOMBONE'S DESK	1.0 X <10.0
	LW 31	Room 325 FLOOR CENTRAL TELEPHONE	1.0 X <10.0
Fax results to Faylon (212) 406-2535		TURNAROUND REQUIRED: NORMAL ☐ STAT ☐ BY 1/1	
RELINQUISHED BY (SIGNATURE) 		COMMENTS / INSTRUCTIONS OK T.A.P.	
DATE 8/16/02 TIME 1:30		RECEIVED BY (SIGNATURE) 	
PRINTED NAME AL. KAZAKOV		DATE 8/16/02 TIME 1:50	
RELINQUISHED BY (SIGNATURE) DATE TIME		RECEIVED BY LAB (SIGNATURE) DATE TIME	
		PRINTED NAME	
WHITE - OFFICE / YELLOW - LAB / PINK - CLIENT			

08/16/2002 13:45 212-298-2530

EMIL ANNUAL/TICAL INC

PAGE 03/25

07294

CITY_21MC100_008878468

030211363

516-358-2955
Fax 516-358-1700

08/15/2002 15:45 212-299-2535

EMEL ANALYTICAL INC

PAGE 04/05

07295

LEAD ENVIRONMENTAL GROUP, INC.
130 JERICHO TPKE., FLORAL PARK, NY 11001

LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT

CLIENT NAME/ADDRESS SCA		CONTACT Haniel Savoy		SAMPLER (SIGNATURE) <i>[Signature]</i>	DATE 8/16/02	TIME	SAMPLE(S) SEALED YES/NO
PROJECT LOCATION Stuyvesant H.S.		PROJECT # M477-15217/29881		SAMPLER NAME (PRINT) AL. Kaganow	CORRECT CONTAINER(S) YES/NO		
SAMPLE INFORMATION:		MATRIX (CIRCLE ONE):					
		WIFE PAINT SOIL OTHER					
LABORATORY #	SAMPLE #	LOCATION	AREA (FT ²)	SURFACE MATERIAL WOOD METAL BRICK OTHER		LAB RESULT	
	LW 32	Room 327 Top of Teachers Desk	1.0		x	<10.0	
	LW 33	Room 327 Floor NEAR EAST WINDOW	1.0		x	<10.0	
	LW 34	Room 329 Top of Teachers Desk	1.0		x	<10.0	
	LW 35	Room 329 Floor NEAR CABINETS	1.0		x	<10.0	
	LW 36	Room 333 Top of FILING CABINET NEAR E. EXT.	1.0	x		<10.0	
	LW 37	Room 333 Floor CENTER of Room	1.0		x	<10.0	
	LW 38	Room 335 Top of Teachers Desk	1.0		x	<10.0	
	LW 39	Room 335 Floor CENTER of Room	1.0		x	<10.0	
Fax mesoCts to Taylor (212) 406-2535			TURNAROUND REQUIRED: NORMAL ☐ STAT ☐ BY 1/1		COMMENTS / INSTRUCTIONS 642 PM		
RELINQUISHED BY (SIGNATURE) <i>[Signature]</i>	DATE 8/16/02 TIME 13:00	PRINTED NAME AL. Kaganow	RECEIVED BY (SIGNATURE) <i>[Signature]</i>	DATE 8/16/02 TIME 1:54pm	PRINTED NAME S. Peacock		
RELINQUISHED BY (SIGNATURE)	DATE TIME	PRINTED NAME	RECEIVED BY LMI (SIGNATURE)	DATE TIME	PRINTED NAME		

WHITE - OFFICE / YELLOW - LAB / PINK - CLIENT

EMEL RECEIVED

030211363

130 JERICHO TPKE., FLORAL PARK, NY 11001 516-358-2955
Fax 516-360-1780

LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT

CLIENT NAME/ADDRESS SCA		CONTACT: Hampel Sewer		SAMPLER SIGNATURE: <i>[Signature]</i>	DATE 8/16/02	TIME	SAMPLE(S) SEALED YES / NO
PROJECT LOCATION: Stuyvesant H.S.		PROJECT # W477-15217/29881		SAMPLER NAME (PRINT): AL. KARAKAN			CORRECT CONTAINER(S) YES / NO
SAMPLE INFORMATION:				MATRIX (CIRCLE ONE): ☒ WIFE ☐ PAINT ☐ SOIL ☐ OTHER			
LABORATORY #	SAMPLE #	LOCATION	AREA (FT ²)	SURFACE MATERIAL WOOD METAL BRICK OTHER		LAB RESULT	
	LW 40	Room 337 TOP OF FLOOR entr. 337	1.0	☒ WOOD ☒ METAL ☐ BRICK ☐ OTHER		< 10.0	
	LW 41	Room 337 FLOOR Bathroom Cloak	.0	☐ WOOD ☐ METAL ☐ BRICK ☐ OTHER		< 10.0	
	LW 42	Room 339 TOP OF TOMATOES DESK	1.0	☐ WOOD ☐ METAL ☐ BRICK ☐ OTHER		< 10.0	
	LW 43	Room 339 FLOOR SOUTH SIDE / Bathroom Windows	1.0	☐ WOOD ☐ METAL ☐ BRICK ☐ OTHER		< 10.0	
	LW 44	FIELD BLANK					
	LW 45	FIELD BLANK					
				TURNAROUND REQUIRED: NORMAL ☐ STAT ☐ BY 11		COMMENTS / INSTRUCTIONS 6hr PAT	
RELINQUISHED BY (SIGNATURE) <i>[Signature]</i>		DATE 8/16/02	PRINTED NAME AL. KARAKAN	RECEIVED BY (SIGNATURE) <i>[Signature]</i>		DATE 8/16/02	PRINTED NAME S. Petrosky
RELINQUISHED BY (SIGNATURE)		DATE	PRINTED NAME	RECEIVED BY LAB (SIGNATURE)		DATE	PRINTED NAME
		TIME				TIME	

WHITE - OFFICE / YELLOW - LAB / PINK - CLIENT

08/16/2002 19:49

212-298-2536

ENV. ANALYTICAL INC

PAGE 05/05

RECEIVED
LABORATORY

02 AUG 16 PM 11:54

07296

CITY_21MC100_008878470

08/16/2002 19:49 212-290-2538

EMSL ANALYTICAL INC

PAGE 01/05

EMSL Analytical, Inc.

307 West 38th Street, New York, NY 10018

Phone: 212-290-0051 Fax: 212-290-0050 Email: manhattanlab@emsl.com

Attn: Taylor Environmental Group, Inc.
Floral Park Corporate Center
130 Jericho Turnpike
Floral Park, NY 11001

Fax: (516) 358-1780

Phone: 516-358-2955

Project: M477-15217 / 29881 / SCA / Stuyvesant HS

Customer ID: TAYL50

Customer PO:

Received: 08/16/02 1:54 PM

EMSL Order: 030211363

EMSL Project ID:

Lead in Wipes by Flame AAS (SW 846, 7420)

Client Sample Description	Lab ID	Analyzed	Area Sampled	Lead Concentration	Notes
LW24 Room 311 Top of Computer Desk	0001	8/16/02	144 in ²	<10.0 µg/ft ²	
LW25 Room 311 Floor Center Area	0002	8/16/02	144 in ²	<10.0 µg/ft ²	
LW26 Room 315 Top of Teachers Desk	0003	8/16/02	144 in ²	<10.0 µg/ft ²	
LW27 Room 315 Floor Near East Window	0004	8/16/02	144 in ²	<10.0 µg/ft ²	
LW28 Room C321 Floor Near Entrance	0005	8/16/02	144 in ²	<10.0 µg/ft ²	
LW29 Room C323 Floor Center of Room	0006	8/16/02	144 in ²	<10.0 µg/ft ²	
LW30 Room 325 Top of Teachers Desk	0007	8/16/02	144 in ²	<10.0 µg/ft ²	

M. Appldorker
Laboratory Manager
or other approved signatory / ANALYST

Reporting limit is 10 µg/wipe

ACCREDITATIONS: AHA Environmental Lead Laboratory Approval Program #102581



Page 4 of 4

07297

8/16/2002 19:43 212-290-2538

EMSL ANALYTICAL INC

PAGE 02/05

EMSL Analytical, Inc.

307 West 38th Street, New York, NY 10018

Phone: 212-290-0051 Fax: 212-290-0058 Email: manhattanlab@emsl.com



Attn: Taylor Environmental Group, Inc.
Floral Park Corporate Center
130 Jericho Tpke.
Floral Park, NY 11001

Fax: (516) 358-1780 Phone: 516-358-2955
Project: M477-15217 / 29881 / SCA / Stuyvesant HS

Customer ID: TAYLS0
Customer PO:
Received: 08/16/02 1:54 PM
EMSL Order: 030211363
EMSL Project ID:

Lead in Wipes by Flame AAS (SW 846, 7420)

Client Sample Description	Lab ID	Analyzed	Area Sampled	Lead Concentration	Notes
LW31 Room 325 Floor Beneath Thermostat	0008	8/16/02	144 in ²	<10.0 µg/ft ²	
LW32 Room 327 Top of Teachers Desk	0009	8/16/02	144 in ²	<10.0 µg/ft ²	
LW33 Room 327 Floor Near East Window	0010	8/16/02	144 in ²	<10.0 µg/ft ²	
LW34 Room 329 Top of Teachers Desk	0011	8/16/02	144 in ²	<10.0 µg/ft ²	
LW35 Room 329 Floor Near Cabinets	0012	8/16/02	144 in ²	<10.0 µg/ft ²	
LW36 Room 333 Top of Filing Cabinet / Near E. Ent	0013	8/16/02	144 in ²	<10.0 µg/ft ²	
LW37 Room 333 Floor Center of Room	0014	8/16/02	144 in ²	<10.0 µg/ft ²	
LW38 Room 335 Top of Teachers Desk	0015	8/16/02	144 in ²	<10.0 µg/ft ²	
LW39 Room 335 Floor Center of Room	0016	8/16/02	144 in ²	<10.0 µg/ft ²	
LW40 Room 337 Top of Filing Cabinet	0017	8/16/02	144 in ²	<10.0 µg/ft ²	
LW41 Room 337 Floor Beneath Clock	0018	8/16/02	144 in ²	<10.0 µg/ft ²	
LW42 Room 339 Top of Teachers Desk	0019	8/16/02	144 in ²	<10.0 µg/ft ²	
LW43 Room 339 Floor South Side / Between Windows	0020	8/16/02	144 in ²	<10.0 µg/ft ²	
LW44 Field blank	0021	8/16/02	n/a	<10.0 µg/wipe	
LW45 Field blank	0022	8/16/02	n/a	<10.0 µg/wipe	

M. Apfelrofer
Laboratory Manager
or other approved signatory / ANALYST

Reporting limit is 10 µg/wipe
ACCREDITATIONS: NYHA Environmental Lead Laboratory Approval Program # 02581



Page 1 of 1

07298

CITY_21MC100_008878472

TAYLOR ENVIRONMENTAL GROUP, INC.
130 JERICHO TPKE., FLORAL PARK, NY 11001

21248

203

516-358-2955
Fax 516-358-1780

LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT

CLIENT NAME/ADDRESS <i>Stuyvesant</i>		CONTACT: <i>Hamid Saoudi</i>		SAMPLER SIGNATURE <i>[Signature]</i>	DATE <i>8/16/04</i>	TIME <i>3</i>	SAMPLE(S) SEALED <i>YES</i> / NO	
PROJECT LOCATION: <i>345 Chambers</i>		PROJECT # <i>M427-15217/29881</i>		SAMPLER NAME (PRINT) <i>Retractable</i>		CORRECT CONTAINER(S) <i>YES</i> / NO		
SAMPLE INFORMATION:				MATRIX (CIRCLE ONE): <i>WIFE</i> PAINT SOIL OTHER				
LABORATORY #	SAMPLE #	LOCATION	AREA (FT ²)	SURFACE MATERIAL				LAB RESULT
	10	on 307 Floor at rear entrance	1	WOOD	METAL	BRICK	OTHER <i>WTF</i>	29.0
	11	on 307 Floor table top near entrance	1				OTHER <i>WTF</i>	29.0
	16	on 317 Floor (2nd 317) left side	1				OTHER <i>concrete</i>	53.0
	17	on 317 Shelf (2nd 317) at entrance	1		X			49.0
	18	3rd floor 3rd room w/ storage 380-A. SW corner	1				OTHER <i>concrete</i>	53.6
	19	3rd floor 3rd room Shelf Storage on 380-A	1		X			18.6
212-406-2535 516-358-1780				TURNAROUND REQUIRED: NORMAL ☐ STAT ☐ BY <i>10/11</i>		COMMENTS / INSTRUCTIONS		
RELINQUISHED BY (SIGNATURE) <i>[Signature]</i>		DATE <i>8/16/04</i>	PRINTED NAME <i>E. Corrado</i>		RECEIVED BY (SIGNATURE)		DATE	PRINTED NAME
RELINQUISHED BY (SIGNATURE)		DATE	PRINTED NAME		RECEIVED BY LAB (SIGNATURE)		DATE	PRINTED NAME

07299

WHITE - OFFICE / YELLOW - LAB / OTHER - FIELD

CITY_21MC100_008878473

ATC ASSOCIATES, INC
104 E 25th Street, 10th Floor
New York, NY 10010
Tel. 212-353-8280
Fax 212-353-8306

REPORT DATE: 08-19-02
CLIENT: Taylor Environmental Group, Inc.
PROJECT NAME: SCA/Stuyvesant HS
 345 Chambers Street, NY
PROJECT NUMBER: M477-15217-29881
SAMPLED BY: Client
SAMPLE DATE: 08-16-02
DATE RECEIVED: 08-16-02
DATE ANALYZED: 08-16-02
SAMPLE MEDIA: Dust Wipe Sample
ANALYSIS REQUIRED: Method EPA 3050/7420

ANALYSIS RESULTS

SAMPLE ID	BATCH NO.	SAMPLE DESCRIPTION	LEAD CONCENTRATION (ug/ft ²)	DETECTION LIMIT (ug/ft ²)
8	21248	Rm 450A Floor at Entrance	<9.0	9.0
9	21248	Rm 450A Metal Shelf Near Entr.	<9.0	9.0
10	21248	Rm 307 Floor at Rear Entrance	<9.0	9.0
11	21248	Rm 307 Floor Table Top Near Entrance	<9.0	9.0
12	21248	Cellar Corr. O/S C029 Supply	<9.0	9.0
13	21248	Cellar Corr. O/S C029 Supply	15.1	9.0
14	21248	Cellar Corr. O/S C029 Supply	<9.0	9.0
16	21248	Rm 517 Floor Left Side	53.0	9.0
17	21248	Rm 317 Shelf at Entr.	49.0	9.0
18	21248	2nd Floor C029 Floor Storage Rm 300B C029	52.6	9.0

212-353-8306

Fax:

CERTIFICATION AND SIGNATURES

ANALYSIS PERFORMED BY: ALH

REPORT PREPARED BY: Jure

ATC ASSOCIATES, INC
104 E 25th Street, 10th Floor
New York, NY 10010
Tel. 212-353-8280
Fax 212-353-8306

CERTIFICATION AND SIGNATURES

ANALYSIS PERFORMED BY: HLH

REPORT PREPARED BY: J. [Signature]

ATC certifies that this report is an accurate and authentic report of results obtained from the laboratory analysis.

QUALITY ASSURANCE COORDINATOR: MS

LABORATORY DIRECTOR: GM L.

ATC is accredited by the New York State Department of Health Environmental Laboratory Approval Program (ELAP) and by the American Industrial Hygiene Association (AIHA) to perform analysis of lead in paint, dust wipes, air and soil samples. (ELAP #10879), (AIHA #100229).

07301

CITY_21MC100_008878475

TAYLOR ENVIRONMENTAL GROUP, INC.
130 JERICHO TPKE., FLORAL PARK, NY 11001

030211390

185

516-358-2955
Fax 516-358-1780

08/17/2002 12:40

212-230-2538

EML ANALYTICAL, INC.

PAGE 01/05

LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT

CLIENT NAME/ADDRESS NYC SCA		CONTACT: HAMID SAHOJ		SAMPLER SIGNATURE(S) <i>[Signature]</i>		DATE 8/14/02		TIME		SAMPLE(S) SEALED (YES) NO	
PROJECT LOCATION: STUYVESANT HS.		PROJECT # M477-15217/2984		SAMPLER NAME (PRINT) KIRK MC KENZIE						CORRECT CONTAINER(S) (YES) NO	
SAMPLE INFORMATION:				MATRIX (CIRCLE ONE): (WIFE) PAINT SOIL OTHER							
LABORATORY #	SAMPLE #	LOCATION	AREA (FT ²)	SURFACE MATERIAL				LAB RESULT			
				WOOD	METAL	BRICK	OTHER				
	LW-01	ROOM 338 - FLOOR Center Elevation Lobby	1.0				X	L/0 4g/42			
	LW-02	ROOM 330 - FLOOR 3' of ENTRANCE	1.0				X	L/0 "			
	LW-03	ROOM 334 - FLOOR 3' of ENTRANCE	1.0				X	L/0			
	LW-04	ROOM 336 - FLOOR Center of ROOM	1.0				X	L/0			
	LW-04 A	ROOM 336 Table Top Left side work table	1.0				X	L/0			
	LW-05	ROOM 336 A - FLOOR Center of ROOM	1.0				X	L/0			
	LW-06	ROOM 336 A - Table Top - North side cabinet	1.0				X	L/0			
	LW-07	ROOM 336 C - FLOOR Center of ROOM	1.0				X	L/0 S.M. 08/17/02			
FAX RESULTS TO: 212 406-2535 516 358-1780				TURNAROUND REQUIRED: NORMAL ☐ STAT ☐ BY 1/1				COMMENTS / INSTRUCTIONS 6 hr TAT			
RELINQUISHED BY (SIGNATURE) <i>[Signature]</i>		DATE 8/17/02		PRINTED NAME KIRK McKenzie		RECEIVED BY (SIGNATURE) <i>[Signature]</i>		DATE 8/17/02		PRINTED NAME	
RELINQUISHED BY (SIGNATURE) <i>[Signature]</i>		DATE 8/17/02		PRINTED NAME TERESA MICHAK		RECEIVED BY LAB (SIGNATURE) <i>[Signature]</i>		DATE 8/17/02		PRINTED NAME	

07302

CITY_21MC100_008878476

TAYLOR ENVIRONMENTAL GROUP, INC.
130 JERICHO TPKE., FLORAL PARK, NY 11001

0302 11390

285

516-358-2955
Fax 516-358-1790

08/17/2002 12:40
212-298-2538

EMEL ANALYTICAL INC


PAGE 02/35

LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT

CLIENT NAME/ADDRESS NYC SCA		CONTACT HAMIL SHWJ		SAMPLER SIGNATURE <i>[Signature]</i>		DATE 8/16/02		TIME		SAMPLE(S) SEALED ☒ YES / ☐ NO	
PROJECT LOCATION: STUYVESANT HS		PROJECT # M477-15217/29887		SAMPLER NAME (PRINT) KIRK MC KENZIE						CORRECT CONTAINER(S) ☒ YES / ☐ NO	
				MATRIX (CIRCLE ONE): ☒ WIFE		PAINT		SOIL		OTHER	
SAMPLE INFORMATION:				AREA (FT ²)		SURFACE MATERIAL				LAB RESULT	
LABORATORY #	SAMPLE #	LOCATION			WOOD	METAL	BRICK	OTHER			
	LW-08	ROOM 336 C - Shelf		1.0		X			210 ug/ft ²		
	LW-09	ROOM 336 R - Floor		1.0				X	210 "		
	LW-10	ROOM 336 R - Table		1.0				X	210		
	LW-11	ROOM 338 - Floor		1.0				X	210		
	LW-12	ROOM 338 - #3 Booth		1.0				X	14.41 ug/ft ²		
	LW-13	Locker # 3-193		1.0		X			210		
	LW-14	CORRIDOR o/s ROOM		1.0					210		
	LW-15	ROOM 351 - Floor		1.0				X	210 SM. 08/17/02		
FAX RESULTS TO: 212 406-2535 516 358-1780				TURNAROUND REQUIRED: NORMAL ☐ STAT ☐ BY 1/1				COMMENTS / INSTRUCTIONS 6 W. TAT			
RELINQUISHED BY (SIGNATURE) <i>[Signature]</i>		DATE 8/17/02 TIME 04:15		PRINTED NAME KIRK Mc Kenzie		RECEIVED BY (SIGNATURE)		DATE		PRINTED NAME	
RELINQUISHED BY (SIGNATURE) <i>[Signature]</i>		DATE 8.17.02 TIME 4:30		PRINTED NAME TERESA MICHAEL		RECEIVED BY LAB (SIGNATURE)		DATE		PRINTED NAME	

07302

CITY_21MC100_008878477

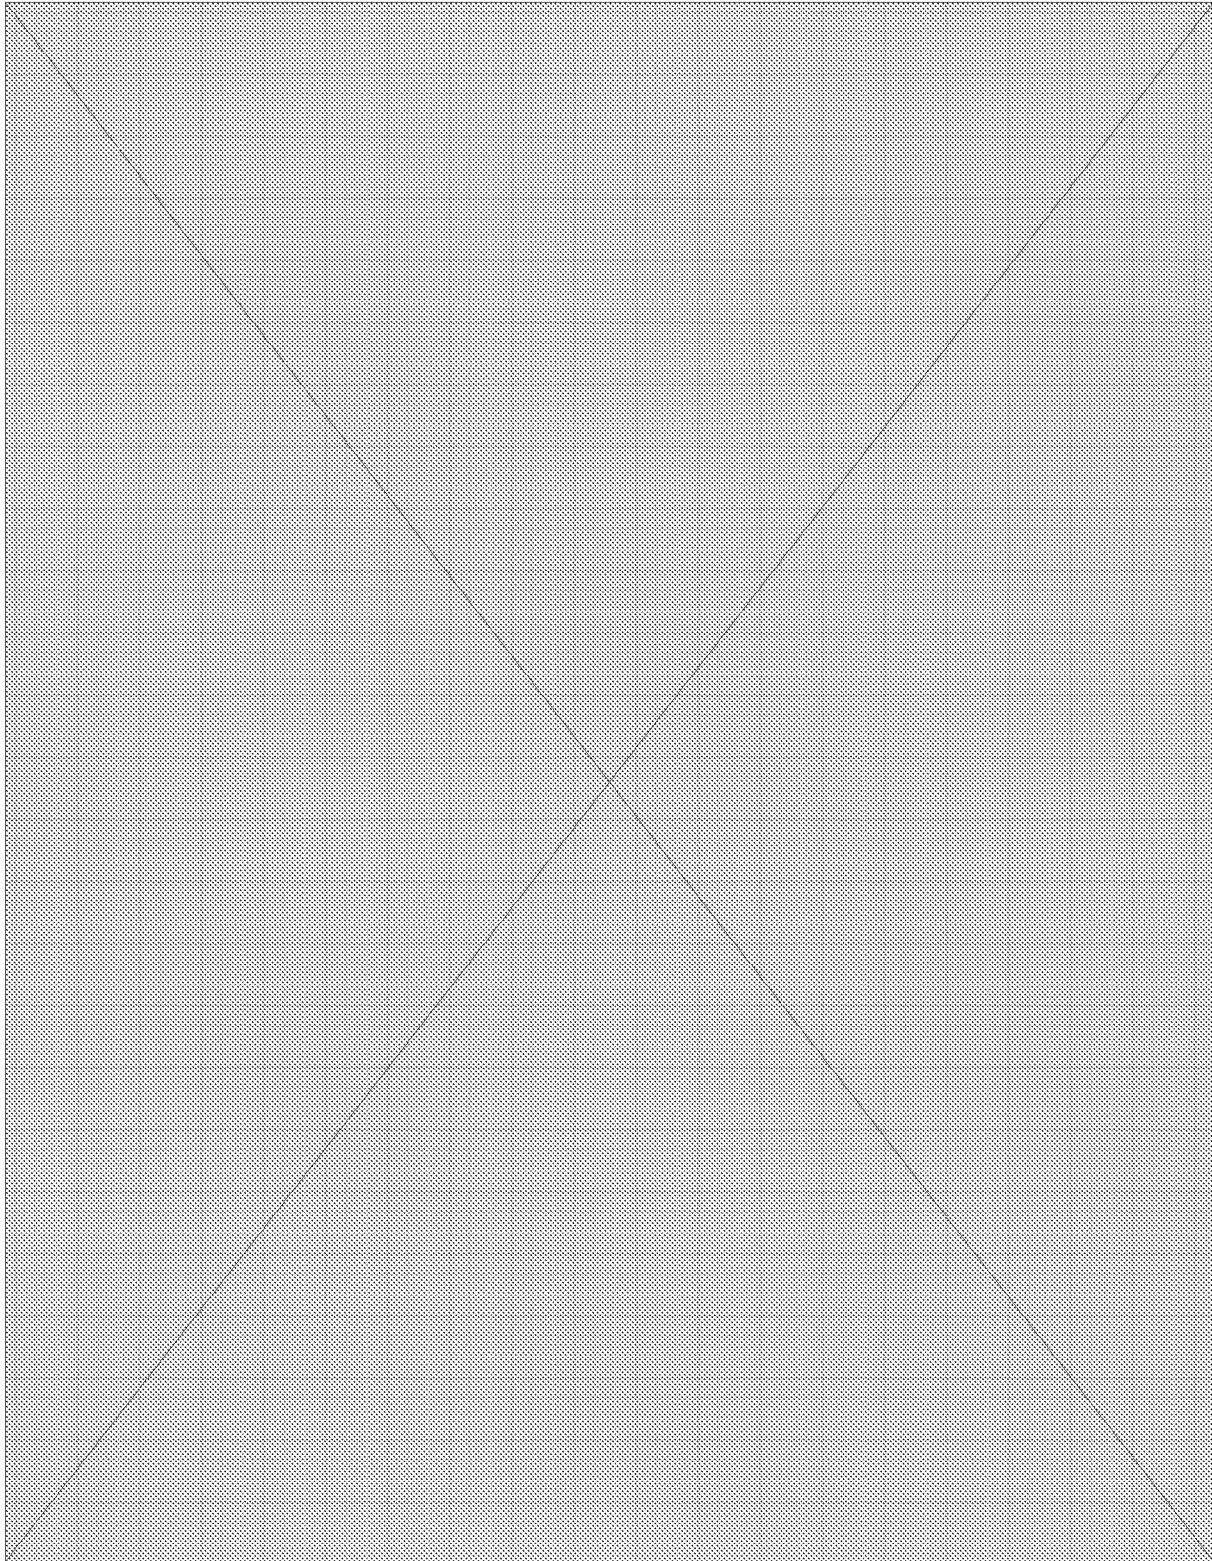

TAYLOR ENVIRONMENTAL GROUP, INC.
130 JERICHO TPKE., FLORAL PARK, NY 11001

030211390

485

516-358-2955
Fax 516-358-1780

09/17/2002 12:40

212-298-2538

ENSL ANALYTICAL INC

PAGE 04/05

LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT

CLIENT NAME/ADDRESS NYC BCA		CONTACT: HANID SAVOJ		SAMPLER SIGNATURE: <i>[Signature]</i>	DATE 8/16/02	TIME	SAMPLE(S) SEALED (YES) NO	
PROJECT LOCATION: Stuyvesant H.S. 345 Chambers St NY		PROJECT # M477-15217-2988		SAMPLER NAME (PRINT) Kirk McKenzie		CORRECT CONTAINER(S) (YES) NO		
SAMPLE INFORMATION:				MATRIX (CIRCLE ONE): (WIFE) PAINT SOIL OTHER				
LABORATORY #	SAMPLE #	LOCATION	AREA (F ²)	SURFACE MATERIAL				LAB RESULT
				WOOD	METAL	BRICK	OTHER	
	LW-24	ROOM 360 - FLOOR 3' of ENTRANCE	1.0				X	<10 $\mu\text{g}/\text{ft}^2$
	LW-25	ROOM 362 - FLOOR 3' of ENTRANCE	1.0				X	<10
	LW-26	ROOM 350A - FLOOR Center of ROOM	1.0				X	<10
	LW-27	ROOM 350A - TABLE Top - Center Table	1.0				X	<10
	LW-28	ROOM 350B - FLOOR 3' of ENTRANCE	1.0				X	<10
	LW-29	ROOM 350B - TOP of CABINET - Left Side	1.0		X			<10
	LW-30	ROOM 332 - FLOOR	1.0					<10
	FBL-1 LW-31	Field Blank	0					<10 $\mu\text{g}/\text{wipe}$ <i>Shirley</i>
TURNAROUND REQUIRED:				COMMENTS / INSTRUCTIONS				
NORMAL ☐ STAT ☐ BY 1/1				6 HR TAT				
RELINQUISHED BY (SIGNATURE) <i>[Signature]</i>		DATE 8/17/02	PRINTED NAME Kirk McKenzie	RECEIVED BY (SIGNATURE) <i>[Signature]</i>		DATE 8/17/02	PRINTED NAME	
RELINQUISHED BY (SIGNATURE) <i>[Signature]</i>		DATE 8/17/02	PRINTED NAME TERESA MICHAEL	RECEIVED BY LAB (SIGNATURE)		DATE	PRINTED NAME	

02 AUG 17 AM 4:34
RECEIVED
Shirley

07305

CITY_21MC100_008878479

030211390

585
516-358-2955
Fax 516-358-1780

05/17/2002 12:40

212-298-2538

EMSL ANALYTICA INC.

PAGE 05/25

07306

05/17/2002 15:14 212-298-2538

EMSL ANALYTICAL INC

PAGE 01/04

EMSL Analytical, Inc.

307 West 38th Street, New York, NY 10018

Phone: 212-298-0051 Fax: 212-298-0058 Email: manhattanlab@emsl.com

Attn: Taylor Environmental Group, Inc.
Floral Park Corporate Center
130 Jericho Tpke.
Floral Park, NY 11001

Fax: (516) 358-1790

Phone: 516-358-2955

Project: M477-15217 / 29881 /NYCSCA/ STUYVESANT H.S.

Customer ID: TAYL50

Customer PO:


Received: 05/17/02 4:30 AM

EMSL Order: 030211380

EMSL Project ID:

Lead in Wipes by Flame AAS (SW 846, 7420)

Client Sample Description	Lab ID	Analyzed	Area Sampled	Lead Concentration	Notes
LW-01 ROOM C328 FLR CENTER ELEV LOBBY	0001	5/17/02	144 in ²	<10.0 µg/ft ²	
LW-02 ROOM 330 / FLOOR / S IN. OF ENTRANCE	0002	5/17/02	144 in ²	<10.0 µg/ft ²	
LW-03 ROOM 334 / FLOOR / S IN. OF ENTRANCE	0003	5/17/02	144 in ²	<10.0 µg/ft ²	
LW-04 ROOM 335 / FLOOR / CENTER OF ROOM	0004	5/17/02	144 in ²	<10.0 µg/ft ²	
LW-04A ROOM 335 / TABLE TOP / LEFT SIDE WORK TABLE	0005	5/17/02	144 in ²	<10.0 µg/ft ²	
LW-05 ROOM 336A / FLOOR / CENTER OF ROOM	0006	5/17/02	144 in ²	<10.0 µg/ft ²	
LW-06 ROOM 336A / TABLE TOP / NORTH SIDE CABINET	0007	5/17/02	144 in ²	<10.0 µg/ft ²	
LW-07 ROOM 336C / FLOOR / CENTER OF ROOM	0008	5/17/02	144 in ²	<10.0 µg/ft ²	
LW-08 ROOM 336C / SHELF / EAST SIDE	0009	5/17/02	144 in ²	<10.0 µg/ft ²	
LW-09 ROOM 336B / FLOOR / CENTER OF ROOM	0010	5/17/02	144 in ²	<10.0 µg/ft ²	
LW-10 ROOM 336B / TABLE TOP / SOUTH TABLE	0011	5/17/02	144 in ²	<10.0 µg/ft ²	
LW-11 ROOM 338 / FLOOR / S IN. OF ENTRANCE	0012	5/17/02	144 in ²	<10.0 µg/ft ²	
LW-12 ROOM 336 / #3 BOOTH TABLE TOP / LEFT OF ENT.	0013	5/17/02	144 in ²	14.0 µg/ft ²	
LW-13 LOCKER #3-193 O/S RM 333	0014	5/17/02	144 in ²	<10.0 µg/ft ²	
LW-14 CORRIDOR O/S ROOM 338 / FLOOR	0015	5/17/02	144 in ²	<10.0 µg/ft ²	
LW-15 ROOM 35* / FLOOR / NW SIDE BY RADIATOR	0016	5/17/02	144 in ²	<10.0 µg/ft ²	


Laboratory Manager
or other approved signatory

Reporting limit is 10 µg/wipe

ACCREDITATIONS: AIMA Environmental Lead Laboratory Approval Program 9102581

Page 1 of 2

07307

CITY_21MC100_008878481

08/17/2002 15:14 212-298-2538

EMSL ANALYTICAL INC

PAGE 02/04

EMSL Analytical, Inc.

307 West 38th Street, New York, NY 10018

Phone: 212-290-0051 Fax: 212-290-0058 Email: manhattanlab@emsl.com



Attn: Taylor Environmental Group, Inc.
Floral Park Corporate Center
130 Jericho Tpke.
Floral Park, NY 11001

Fax: (516) 358-1780 Phone: 516-358-2955

Project: M477-15217 / 29881 / NYCSCA / STUYVESANT H.S.

Customer ID: TAYL50

Customer PO:

Received: 08/17/02 4:20 AM

EMSL Order: 030211390

EMSL Project ID:

Lead in Wipes by Flame AAS (SW 846, 7420)


Client Sample Description	Lot ID	Analyzed	Area Sampled	Lead Concentration	Notes
LW-16 ROOM 351 / TABLE TOP / SW WORK TABLE	0017	8/17/02	144 in ²	<10.0 µg/ft ²	
LW-17 ROOM 351A / FLOOR / 3 IN. OF ENTRANCE	0018	8/17/02	144 in ²	<10.0 µg/ft ²	
LW-18 ROOM 351A / SHELF TOP / SOUTH SHELF	0019	8/17/02	144 in ²	<10.0 µg/ft ²	
LW-19 ROOM 351B / FLOOR / CENTER OF ROOM	0020	8/17/02	144 in ²	<10.0 µg/ft ²	

[Signature]
Laboratory Manager
or other approved signatory

Reporting limits: 10 µg/ft²
ACCREDITATIONS: AIAA Environmental Lead Laboratory Approval Program #102581

Page 2 of 2

07308

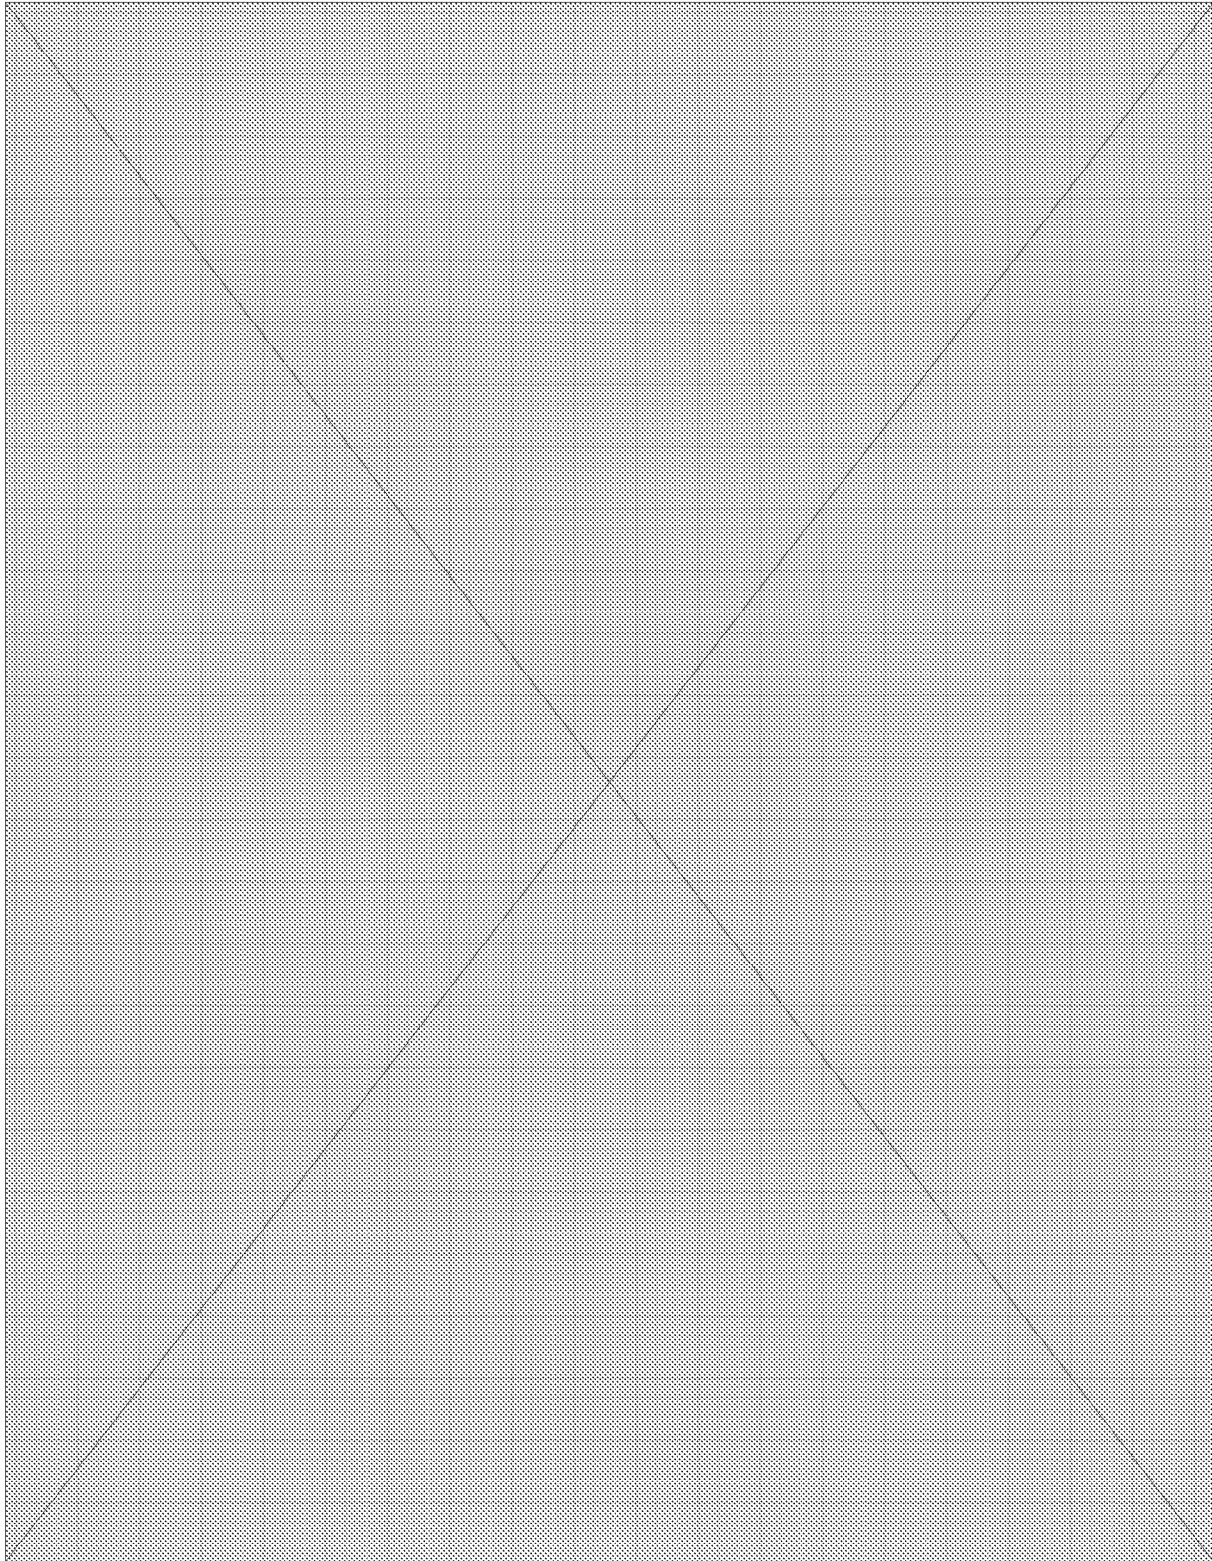

516-358-2955
Fax 516-358-1780

LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT

CLIENT NAME/ADDRESS: NYC SCA
PROJECT LOCATION: STUYVESANT H.S.
PROJECT # 11477-15217/29881

CONTACT: HARID SAUQI
PROJECT # 11477-15217/29881

SAMPLER SIGNATURE: Carlos Tofat
DATE: 8-17-02
TIME: 11:07
SAMPLER NAME (PRINT): CARLOS TOFAT
CORRECT CONTAINER(S): YES NO
MATRIX (CIRCLE ONE): WPP PAINT SOIL OTHER

SAMPLE INFORMATION:

LABORATORY #	SAMPLE #	LOCATION	AREA (FT ²)	SURFACE MATERIAL				LAB RESULT
				WOOD	METAL	BRICK	OTHER	
FB-01	LW-01	TOP OF SHELL AT CEPTER. ROOM # G 380A.	1 FT ²		✓			<10.0
FB-02	LW-02	Floor by Entrance. ROOM # G 380A	1 FT ²				✓	<10.0
	LW-03	TOP OF CABINET ROOM # 336D	1 FT ²		✓			110.0
	LW-04	Floor by Entrance ROOM # 336D.	1 FT ²				✓	11.0
	FB-01	FIELD BLANK						==
	FB-02	FIELD BLANK						==

TURNAROUND REQUIRED:
NORMAL ☐ STAT ☐ BY 1/1

COMMENTS / INSTRUCTIONS: GHS TAT

RELINQUISHED BY (SIGNATURE): Gary McKenzie
DATE: 8/17/02
TIME: 13:10
PRINTED NAME: GARY MCKENZIE

RECEIVED BY (SIGNATURE): Carlos Tofat
DATE: 8/17/02
TIME: 11:07
PRINTED NAME: CARLOS TOFAT

RELINQUISHED BY (SIGNATURE):
DATE:
TIME:

RECEIVED BY (SIGNATURE):
DATE:
TIME:

WHITE - OFFICE / YELLOW - LAB / PINK - CLIENT

PAGE 32/04

ENGL ANALYTICAL INC

212-290-2535

12:08

2002/07/31 07:310

CITY_21MC100_008878484

08/17/2002 15:14 212-290-2536

EMSL ANALYTICAL INC

PAGE 04/04

EMSL Analytical, Inc.

307 West 28th Street, New York, NY 10018

Phone: 212-290-0051 Fax: 212-290-0058 Email: manhattanlab@emsl.com



Attn: Taylor Environmental Group, Inc.
Floral Park Corporate Center
130 Jericho Tpke.
Floral Park, NY 11001

Fax: (516) 358-1780

Phone: 516-358-2955

Project: M477-15217/29881 / NYC-SCA / STUYVESANT H.S.

Customer ID: TAYL50

Customer PO:

Received: 08/17/02 1:07 PM

EMSL Order: 030211410

EMSL Project ID:

Lead in Wipes by Flame AAS (SW 846, 7420)

Client Sample Description	Lab ID	Analysed	Area Sampled	Lead Concentration	Notes
LW-01 TOP OF SHELL AT CENTER / ROOM #G380A	0001	8/17/02	144 in ²	<10.0 µg/ft ²	
LW-02 FLOOR BY ENTRANCE / ROOM #E380A	0002	8/17/02	144 in ²	<10.0 µg/ft ²	
LW-03 TOP OF CABINET / ROOM #336D	0003	8/17/02	144 in ²	110.0 µg/ft ²	
LW-04 FLOOR BY ENTRANCE / ROOM #336D	0004	8/17/02	144 in ²	11.0 µg/ft ²	
FB-01 Field blank	0005	8/17/02	n/a	<10.0 µg/wipe	
FB-02 Field blank	0006	8/17/02	n/a	<10.0 µg/wipe	

Samuel M. [Signature]
Laboratory Manager
or other approved signatory

Reporting limit is 10 µg/wipe

ACCREDITATIONS: AIAA Environmental Lead Laboratory Approval Program 5102521

Page 1 of 1

07311

NYC-WTC_000231236

08/17/2002 19:20 212-290-2508

EMSL ANALYTICAL INC

PAGE 01/02

EMSL Analytical, Inc.

307 West 38th Street, New York, NY 10018

Phone: 212-290-0051 Fax: 212-290-0058 Email: manhattanlab@emsl.com



Attn: Taylor Environmental Group, Inc.
Floral Park Corporate Center
130 Jericho Tpke.
Floral Park, NY 11001

Fax: (516) 358-1780 Phone: 516-358-2855

Project: M477-15217/28881 / NYC-SCA / STUYVESANT H.S

Customer ID: TAYL50

Customer PO:

Received: 08/17/02 4:28 PM

EMSL Order: 030211415

EMSL Project ID:

Lead in Wipes by Flame AAS (SW 846, 7420)

Client Sample Description	Lab ID	Analyzed	Area Sampled	Lead Concentration	Notes
LW-01 ROOM #336-D / TOP OF CABINET	0001	8/17/2002	144 in ²	<10.0 µg/ft ²	
LW-02 ROOM #336-D / FLOOR BY ENTRANCE	0002	8/17/2002	144 in ²	<10.0 µg/ft ²	
FB 1 Field blank	0003	8/17/2002	n/a	<10.0 µg/wipe	
FB 2 Field blank	0004	8/17/2002	n/a	<10.0 µg/wipe	



Laboratory Manager
or other approved signatory

Reporting limit is 10 µg/wipe
ACCREDITATIONS: AIA (Environmental Lead Laboratory Approval Program #102581)

Page 1 of 1

07313

CITY_21MC100_008878487

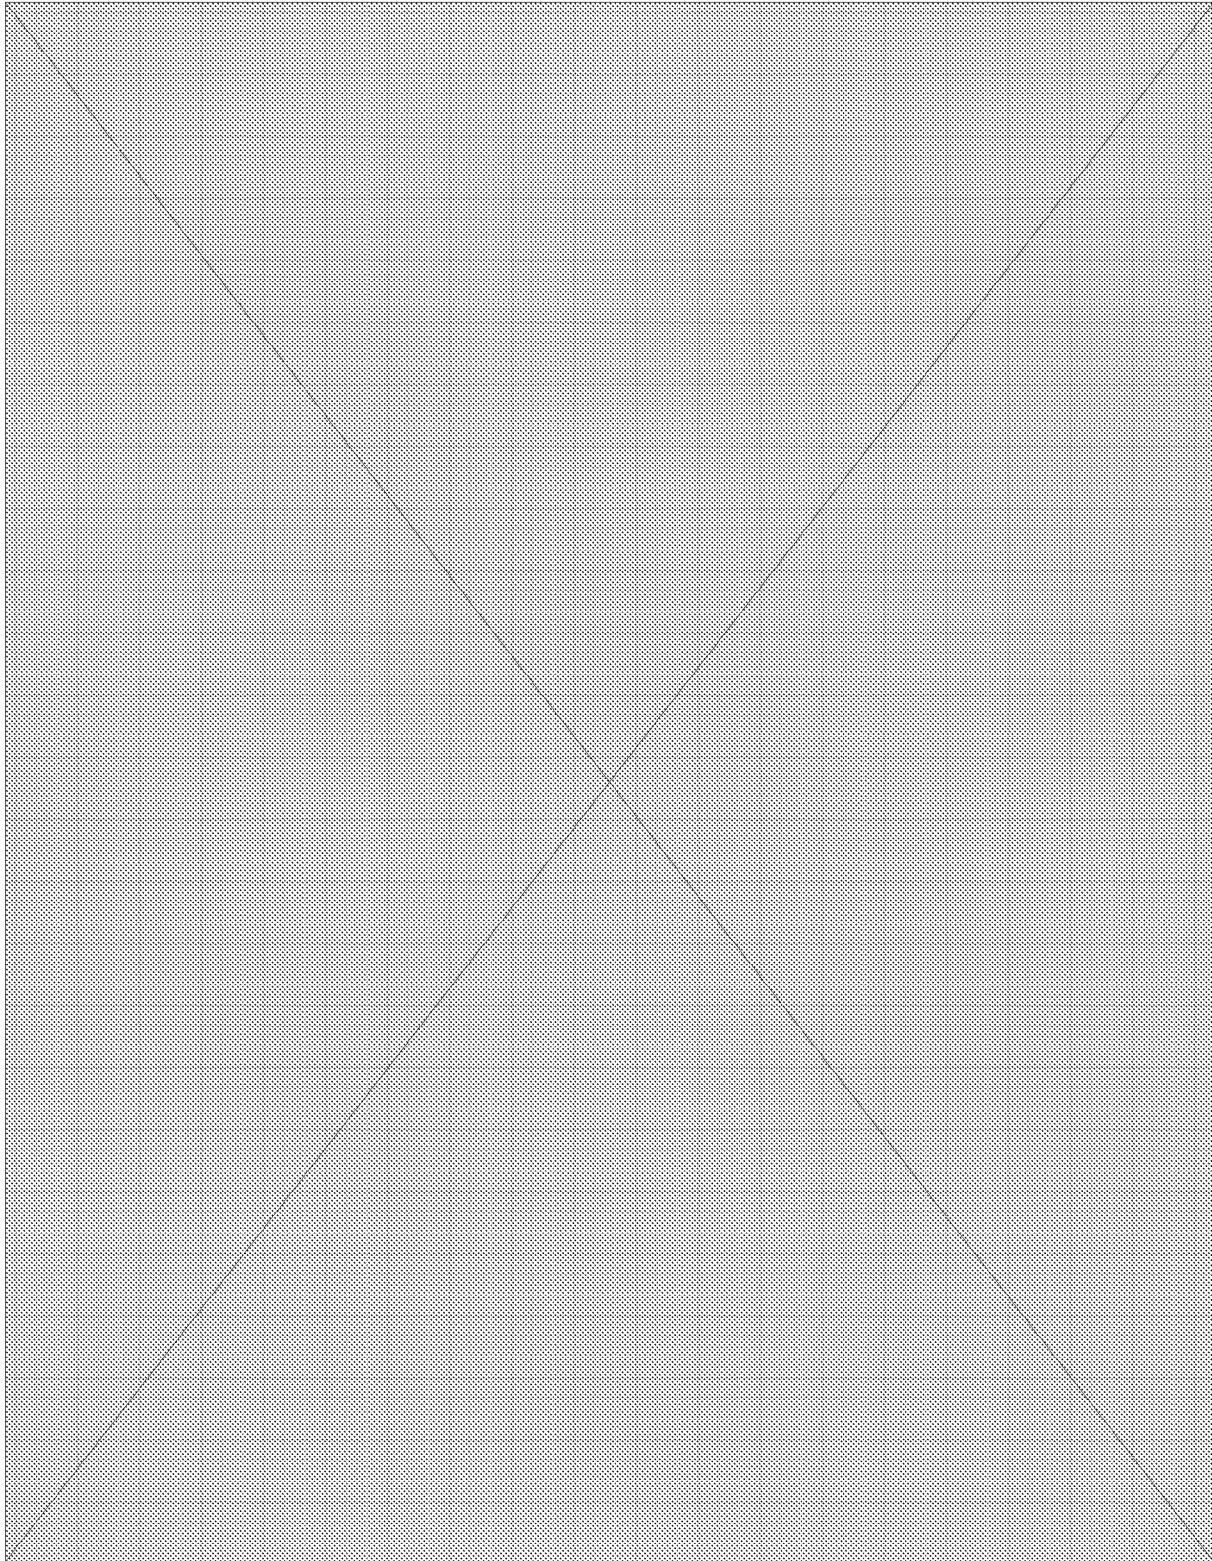

TAYLOR ENVIRONMENTAL GROUP, INC.
130 JERICHO TPKE., FLORAL PARK, NY 11001

21251

2845

516-358-2955

Fax 516-358-1780

LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT

CLIENT NAME/ADDRESS NYC SCA		CONTACT: HAMID SANDOZ		SAMPLER SIGNATURE <i>[Signature]</i>		DATE 8/17/02		TIME 05:20		SAMPLE(S) SEALED ☒ YES / ☐ NO	
PROJECT LOCATION: STUYVESANT HS		PROJECT # M477-15217/29881		SAMPLER NAME (PRINT) MARK MC KENZIE		CORRECT CONTAINER(S) ☒ YES / ☐ NO					
SAMPLE INFORMATION:				MATRIX (CIRCLE ONE): ☒ WIRE ☐ PAINT ☐ SOIL ☐ OTHER							
LABORATORY #	SAMPLE #	LOCATION	AREA (FT ²)	SURFACE MATERIAL WOOD METAL BRICK OTHER				LAB RESULT			
	LW-39	ROOM 371 B - FLOOR 2nd 3rd of ROOM ENT.	1					Y			< 9.0
	LW-40	ROOM 371 B - TOP OF 1st desk	1					X			< 9.0
	LW-41	ROOM 371 C - FLOOR center of room	1					X			13.8
	LW-42	ROOM 371 C - TOP of Bed Platform	1					X			18.7
	LW-43	ROOM 371 D - FLOOR by entrance	1					X			< 9.0
	LW-44	ROOM 371 D - TOP of Bed Platform	1				X				< 9.0
	LW-45	ROOM 371 E - FLOOR NW side	1					X			26.8
	LW-46	ROOM 371 E - TOP of Refrigerator - south	1					X			< 9.0
FAX RESULTS TO: 212 406-2936 516 358-1780				TURNAROUND REQUIRED: NORMAL ☐ STAT ☐ BY 1/1				COMMENTS / INSTRUCTIONS 6 HR STAT			
RELINQUISHED BY (SIGNATURE) <i>[Signature]</i>		DATE 8/17/02		PRINTED NAME Mark McKenzie		RECEIVED BY (SIGNATURE) <i>[Signature]</i>		DATE 8/17/02		PRINTED NAME	
RELINQUISHED BY (SIGNATURE)		DATE		PRINTED NAME		RECEIVED BY LAB (SIGNATURE) R. Drudejia		DATE 8/17/02		PRINTED NAME R. Drudejia	

WHITE - OFFICE / YELLOW - LAB / PINK - CLIENT

07315

CITY_21MC100_008878489

TAYLOR ENVIRONMENTAL GROUP, INC.
130 JERICHO TPKE., FLORAL PARK, NY 11001

516-358-2955
Fax 516-358-1780

LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT

CLIENT NAME/ADDRESS NYC SCH		CONTACT: HAMID SAWOZ		SAMPLER SIGNATURE <i>[Signature]</i>	DATE 8/17/02	TIME	SAMPLE(S) SEALED ☒ YES ☐ NO
PROJECT LOCATION: STUYVESANT HS		PROJECT # M477-19217 / 29881		SAMPLER NAME (PRINT) KIRK MC KENZIE			CORRECT CONTAINER(S) ☒ YES ☐ NO
SAMPLE INFORMATION:				MATRIX (CIRCLE ONE): ☒ WIFE ☐ PAINT ☐ SOIL ☐ OTHER			
LABORATORY #	SAMPLE #	LOCATION	AREA (FT ²)	SURFACE MATERIAL WOOD METAL BRICK OTHER			LAB RESULT
	LW-47	ROOM 371 F - FLOOR of 2 ENTRANCE	1			X	< 9.0
	LW-48	ROOM 371 G - FLOOR of 2 ENTRANCE	1			X	< 9.0
	LW-49	NE CORRIDOR of GYM FLOOR by north ENTRANCE				X	< 9.0
	LW-50	Room GYM (G380) - FLOOR Center of Gym		X		1	< 9.0
	LW-51	Gym (G380) Left TOP of bleachers south END		X			13.2
	LW-52	G380 B - FLOOR Center of room				X	11.4
	LW-53	G380 B - Shelf TOP Left side			X		< 9.0
	LW-54	G380 C - FLOOR West side				X	15.5
FAX RESULTS TO: 212 406-2536 516 358-1740				TURNAROUND REQUIRED: NORMAL ☐ STAT ☐ BY 1/1 6 HR TAT			
RELINQUISHED BY (SIGNATURE) <i>[Signature]</i>		DATE 8/17/02	PRINTED NAME Kirk McKenzie	RECEIVED BY (SIGNATURE) <i>[Signature]</i>		DATE 8/17/02	PRINTED NAME
RELINQUISHED BY (SIGNATURE)		DATE	PRINTED NAME	RECEIVED BY LAB (SIGNATURE) R. Droulita		DATE 8/20/02	PRINTED NAME R. Droulita

WHITE - OFFICE / YELLOW - LAB / PINK - CLIENT

07316

CITY_21MC100_008878490

TAYLOR ENVIRONMENTAL GROUP, INC.
130 JERICHO TPKE., FLORAL PARK, NY 11001

516-358-2955
Fax 516-358-1780


LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT

CLIENT NAME/ADDRESS NYC SCIA		CONTACT: HAMID SAWOD		SAMPLER SIGNATURE: <i>[Signature]</i>	DATE 8/17/02	TIME	SAMPLE(S) SEALED ☒ YES ☐ NO	
PROJECT LOCATION: STUYVESANT HS		PROJECT # M477-15217/29881		SAMPLER NAME (PRINT) KIRK MC KENZIE		CORRECT CONTAINER(S) ☒ YES ☐ NO		
SAMPLE INFORMATION:				MATRIX (CIRCLE ONE): ☒ WIFE ☐ PAINT ☐ SOIL ☐ OTHER				
LABORATORY #	SAMPLE #	LOCATION	AREA (FT ²)	SURFACE MATERIAL				LAB RESULT
				WOOD	METAL	BRICK	OTHER	
	LW-55	G-380 C - Shelf Center	1		X			< 9.0
	LW-56	G-382 (AUF GYM) - FLOOR By G-382 B	1				X	< 9.0
	LW-57	G-382 - TOP B Tumbling PADS	1				X	23.4
	LW-58	G-382/A - FLOOR by entrance	1				X	26.0
	LW-59	G-382 B - FLOOR center of ROOM	1				X	27.9
	LW-60	G-382 B - Shelf Left side	1		X			30.8
Post-Test	LW-61	ROOM 317 - FLOOR 3' of entrance	1				X	18.2
Post-Test	LW-62	ROOM 317 - Shelf Right side	1		X			< 9.0
FAX RESULTS TO: 212 306-2536 516 358-1780				TURNAROUND REQUIRED: NORMAL ☐ STAT ☐ BY 1/1		COMMENTS / INSTRUCTIONS 6 HR TAT		
RELINQUISHED BY (SIGNATURE) <i>[Signature]</i>	DATE 8/17/02	TIME 0520	PRINTED NAME Kirk McKenzie	RECEIVED BY (SIGNATURE) <i>[Signature]</i>		DATE 8/17/02	PRINTED NAME R. Drouina	
RELINQUISHED BY (SIGNATURE) <i>[Signature]</i>	DATE 8/17/02	TIME 0520	PRINTED NAME R. Drouina	RECEIVED BY LAB (SIGNATURE) <i>[Signature]</i>		DATE 8/17/02	PRINTED NAME R. Drouina	

WHITE - OFFICE / YELLOW - LAB / PINK - CLIENT

07317

CITY_21MC100_008878491

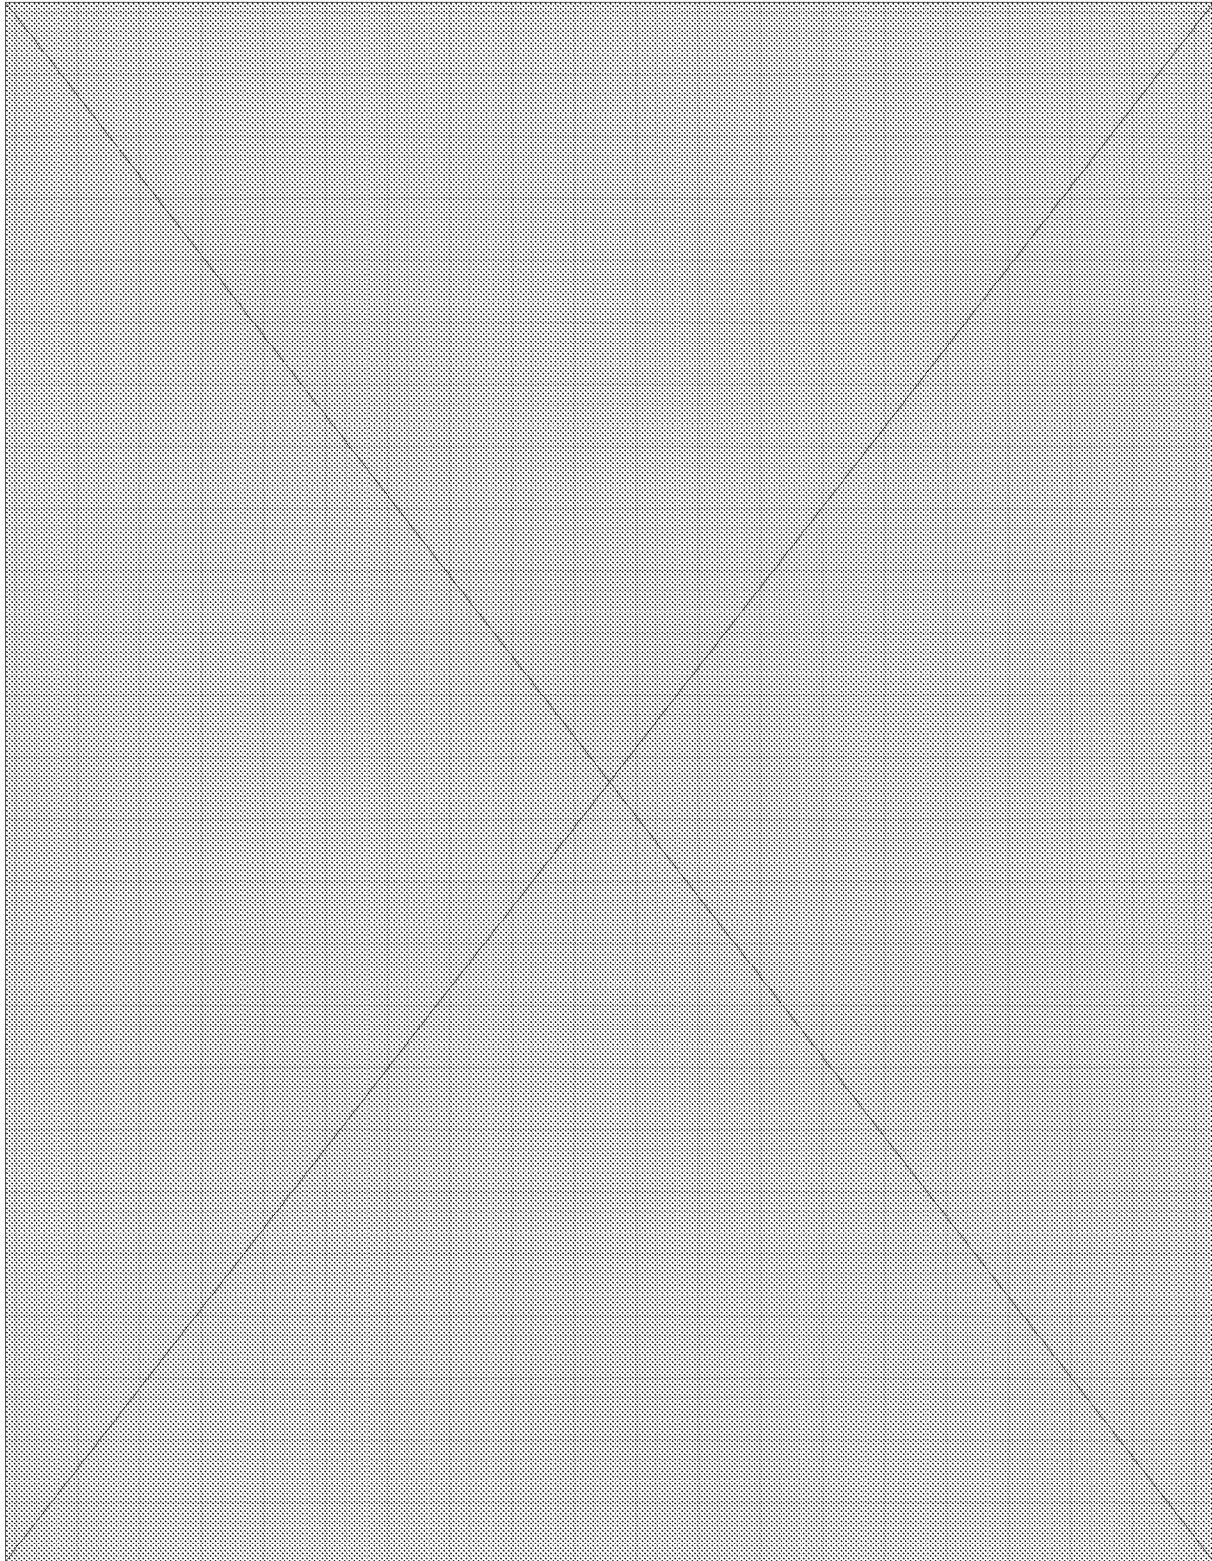

ATC ASSOCIATES, INC
104 E 25th Street, 10th Floor
New York, NY 10010
Tel. 212-353-8280
Fax 212-353-8306

REPORT DATE: 08-19-02

CLIENT: Tayler Environmental Group, Inc.

PROJECT NAME: SCA/Stuyvesant HS
345 Chambers Street, NY

PROJECT NUMBER: M477-15217-29881

SAMPLED BY: Client

SAMPLE DATE: 08-17-02
DATE RECEIVED: 08-17-02
DATE ANALYZED: 08-17-02

SAMPLE MEDIA: Dust Wipe Sample
ANALYSIS REQUIRED: Method EPA 3050/7420

ANALYSIS RESULTS

SAMPLE ID	BATCH NO.	SAMPLE DESCRIPTION	LEAD CONCENTRATION (µg/ft²)	DETECTION LIMIT (µg/ft²)
LW-31	21251	Rm 373 Floor North Side by Radiator	<9.0	9.0
LW-32	21251	Rm 373 Tabel Top North Side	<9.0	9.0
LW-33	21251	Rm 372 Floor Center of Room	<9.0	9.0
LW-34	21251	Rm 372 Desk Top South Desk	<9.0	9.0
LW-35	21251	Rm 371 Floor North Side by Blackboard	<9.0	9.0
LW-36	21251	Rm 371 Table Top North East Side	<9.0	9.0
LW-37	21251	Rm 371A Floor 3' of Entrance	<9.0	9.0
LW-38	21251	Rm 371A Desk Top 1st Desk	<9.0	9.0
LW-39	21251	Rm 371B Floor of Room Ent.	<9.0	9.0
LW-40	21251	Rm 371B Top of 1st Desk	<9.0	9.0
LW-41	21251	Rm 371C Floor Center of Room	13.8	9.0
LW-42	21251	Rm 371C Top of Bed	18.7	9.0
LW-43	21251	Bedroom 371D Floor by Entrance	<9.0	9.0

ATC ASSOCIATES, INC
104 E 25th Street, 10th Floor
New York, NY 10010
Tel. 212-353-8280
Fax 212-353-8306

LW-44	21251	Rm 371D Top of Bedroom Platform	<9.0	9.0
LW-45	21251	Rm 371E Floor NW Side	26.8	9.0
LW-46	21251	Rm 371E Top of Refrigerator South	<9.0	9.0
LW-47	21251	Rm 371F Floor 3' of Entrance	<9.0	9.0
LW-48	21251	Rm 371G Floor 3' of Entrance	<9.0	9.0
LW-49	21251	NE Corridor O/S GYM Floor by North Entrance	<9.0	9.0
LW-50	21251	GYM (G380) Floor Center of GYM	<9.0	9.0
LW-51	21251	GYM (G380) Top of Bleachers South End	13.2	9.0
LW-52	21251	G380B Floor Center of Room	11.4	9.0
LW-53	21251	G380 Shelf Top Left Side	<9.0	9.0
LW-54	21251	G380C Floor West Side	15.5	9.0
LW-55	21251	G380C Shelf Center	<9.0	9.0
LW-56	21251	G382 (Aux. GYM) Floor by G382B	<9.0	9.0
LW-57	21251	G382 Top of Tumbling Pads	23.4	9.0
LW-58	21251	G382A Floor by Entrance	26.0	9.0
LW-59	21251	G382B Floor Center of Room	27.9	9.0
LW-60	21251	G382B Shelf Left Side	30.8	9.0
LW-61	21251	Rm 317 Floor 3' of Entrance	19.2	9.0
LW-62	21251	Rm 317 Shelf Right Side	<9.0	9.0
LW-63	21251	Corridor East Side by Elevator Floor	<9.0	9.0
LW-64	21251	Locker #3-9S O/S GYM	<9.0	9.0
FBL-1	21251	Field Blank	<9.0 µg	9.0 µg
FBL-2	21251	Field Blank	<9.0 µg	9.0 µg
FBL-3	21251	Field Blank	<9.0 µg	9.0 µg
FBL-4	21251	Field Blank	<9.0 µg	9.0 µg

NOTE 1:

THE REPORTING LIMIT (RL) IS 18.0 µg

NOTE 2:

HUD Guidelines for final clearance dust wipe samples: Floor 40 µg/ft², Window sills 250 µg/ft², Window wells 400 µg/ft², Exterior surfaces 800 µg/ft².

NOTE 3:

Blank units are in µg

07320

CITY_21MC100_008878494

ATC ASSOCIATES, INC

104 E 25th Street, 10th Floor

New York, NY 10010

Tel. 212-353-8280

Fax 212-353-8306

CERTIFICATION AND SIGNATURES

ANALYSIS PERFORMED BY: HCN

REPORT PREPARED BY: [Signature]

ATC certifies that this report is an accurate and authentic report of results obtained from the laboratory analysis.

QUALITY ASSURANCE COORDINATOR: [Signature]

LABORATORY DIRECTOR: [Signature]

ATC is accredited by the New York State Department of Health Environmental Laboratory Approval Program (ELAP) and by the American Industrial Hygiene Association (AIHA) to perform analysis of lead in paint, dust wipes, air and soil samples. (ELAP #10879), (AIHA #100229).

07321

CITY_21MC100_008878495

TAYLOR ENVIRONMENTAL GROUP, INC.
130 JERICHO TPKE., FLORAL PARK, NY 11001

516-358-2955
Fax 516-358-1780

LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT

CLIENT NAME/ADDRESS		CONTACT		SAMPLER (SIGNATURE)		DATE		TIME		SAMPLE(S) SEALED		YES		NO	
PROJECT LOCATION		PROJECT #		SAMPLER (PRINT)		DATE		TIME		CORRECT CONTAINERS		YES		NO	
SAMPLE INFORMATION		LABORATORY #		SAMPLE #		LOCATION		AREA (FT ²)		SURFACE MATERIAL				LAB RESULT	
P/101 LW-01		Km 371-E		FLOOR		1.0						X		10.0	
P/101 LW-02		Km 371-E		DOCK - TOP		1.0						X		10.0	
P/101 LW-03		Aux Gym G-382-A		FLOOR		1.0						X		10.0	
P/101 LW-04		Km G-382-B		FLOOR		1.0						X		12.0	
P/101 LW-05		Km G-382-B		SHELF, L.H.S.		1.0		X						10.0	
P/101 LW-06		Km G-382 - Aux Gym		FLOOR @ Cantor Window		1.0		X						10.0	
P/101 LW-07		Km G-382 - Aux Gym		TUNNELING - MAT.		1.0						X		10.0	
FB-1		F/BALUC-1													
FB-2		F/BALUC-2													
RECEIVED BY (SIGNATURE)		DATE		PRINTED NAME		TURNAROUND REQUIRED:		NORMAL		STAT		BY		COMMENTS / INSTRUCTIONS	
[Signature]		8/19/02		GARY McKEON		[X]		[]		1		1		ASAP (See [Signature])	
RECEIVED BY (SIGNATURE)		DATE		PRINTED NAME		RECEIVED BY (SIGNATURE)		DATE		PRINTED NAME		DATE		PRINTED NAME	
[Signature]		[]		[]		[Signature]		[]		[]		[]		[]	

WHITE - OFFICE / YELLOW - LAB / PINK - CLIENT

09/19/2002 14:04 212-296-2538

EMSL ANALYTICAL INC

PAGE 01/02

EMSL Analytical, Inc.

307 West 32nd Street, New York, NY 10018

Phone: 212-296-0051 Fax: 212-296-0058 E-mail: manhattanlab@emsl.comAttn: Taylor Environmental Group, Inc.
Floral Park Corporate Center
130 Jericho Tpke.
Floral Park, NY 11001

Fax: (516) 358-1780 Phone: 516-358-2955

Project: M477-15217-29831/ NYC SCA STUYVESANT H.S./
CHAMBERS ST. NY, NY

Customer ID: TAYL50

Customer PO:


Received: 09/19/02 11:59 AM

EMSL Order: 030211452

EMSL Project ID:

Lead in Wipes by Flame AAS (SW 846, 7420)

Client Sample Description	Lab ID	Analyzed	Area Sampled	Lead Concentration	Notes
LW-01 RM. 371-E FLOOR ADJ. TO DESK	0001	8/19/2002	144 in ²	<10.0 µg/ft ²	
LW-02 RM. 371-E DESK-TOP	0002	8/19/2002	144 in ²	<10.0 µg/ft ²	
LW-03 AUX GYM G-382-A FLOOR	0003	8/19/2002	144 in ²	<10.0 µg/ft ²	
LW-04 RM. G-382-B FLOOR	0004	8/19/2002	144 in ²	12.0 µg/ft ²	
LW-05 RM. G-382-B SHELF L.H.S.	0005	8/19/2002	144 in ²	<10.0 µg/ft ²	
LW-06 RM. G-382 FLOOR @ CONTOR WINDOW	0006	8/19/2002	144 in ²	<10.0 µg/ft ²	
LW-07 RM. G-382 TUMBLING MAT.	0007	8/19/2002	144 in ²	<10.0 µg/ft ²	
FB-1 F/BLANK-1	0008	8/19/2002	n/a	<10.0 µg/wipe	
FB-2 F/BLANK-2	0009	8/19/2002	n/a	<10.0 µg/wipe	


Laboratory Manager
or other approved signatory

Reporting limit is 10 µg/wipe
ACCREDITATIONS: ALHA Environmental Lead Laboratory Approval Program #102581

Page 1 of 1

07372

TAYLOR ENVIRONMENTAL GROUP, INC.

**UNIT VENTILATOR
LEAD WIPE SAMPLE
RESULTS
3RD THROUGH 10TH
FLOORS**

**PROJECT #: M477-15217
LLW#: 29881**

130A JERICHO TPKE., FLORAL PARK, NY 11001 • PHONE (516) 358-2955 • FAX (516) 358-1780

07324

CITY_21MC100_008878498

TAYLOR ENVIRONMENTAL GROUP, INC.
130 JERICHO TPKE., FLORAL PARK, NY 11001

20362

516-358-2955
Fax 516-358-1780

LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT

CLIENT NAME/ADDRESS SCA		CONTACT Hamid Savou	SAMPLER (SIGNATURE) <i>[Signature]</i>		DATE 7/14/02	TIME	SAMPLE(S) SEALED (YES) / NO	
PROJECT LOCATION: Stuyvesand HS		PROJECT # M477-15217/29871	SAMPLER NAME (PRINT) AL. KAZANOV		CORRECT CONTAINER(S) (YES) / NO			
SAMPLE INFORMATION:			MATRIX (CIRCLE ONE): (WIFE) PAINT SOIL OTHER					
LABORATORY #	SAMPLE #	LOCATION	AREA (FT ²)	SURFACE MATERIAL				LAB RESULT
				WOOD	METAL	BRICK	OTHER	
	W-01	Room # 1001, East side Univert (back wall)	1		X			49.0
	W-02	Room # 1001, South side Left Univert (back wall)	1		X			49.0
	W-03	Room # 1001, South side Right Univert (back wall)	1		X			49.0
	W-04	Room # 1007, South side Left Univert (back wall)	1		X			49.0
	W-05	Room # 1007, South side Middle Univert (back wall)	1		X			49.0
	W-06	Room # 1007, South side Right Univert (back wall)	1		X			49.0
	W-07	F/B " "						49.0
	W-08	F/B " "						49.0
TURNAROUND REQUIRED:			NORMAL ☐ STAT ☒ BY 1 / 1		COMMENTS / INSTRUCTIONS 6 hr TAT.			
RELINQUISHED BY (SIGNATURE) <i>[Signature]</i>	DATE 7/14/02	PRINTED NAME AL. KAZANOV	RECEIVED BY (SIGNATURE)		DATE	PRINTED NAME		
RELINQUISHED BY (SIGNATURE) <i>[Signature]</i>	DATE 7/14/02	PRINTED NAME	RECEIVED BY LAU (SIGNATURE)		DATE	PRINTED NAME		
	TIME 2:00				TIME			
	TIME 2:00				TIME			

07325

CITY_21MC100_008878499

ATC ASSOCIATES, INC
104 E 25th Street, 10th Floor
New York, NY 10010
Tel. 212-353-8280
Fax 212-353-8306

REPORT DATE: 07-15-02
CLIENT: Taylor Environmental Group, Inc.
PROJECT NAME: SCA/Stuyvesant HS
SAMPLED BY: Client
SAMPLE DATE: 07-14-02
DATE RECEIVED: 07-14-02
DATE ANALYZED: 07-14-02
SAMPLE MEDIA: Dust Wipe Sample
ANALYSIS REQUIRED: Method EPA 3050/7420

ANALYSIS RESULTS

SAMPLE ID	BATCH NO.	SAMPLE DESCRIPTION	LEAD CONCENTRATION ($\mu\text{g}/\text{ft}^2$)	DETECTION LIMIT ($\mu\text{g}/\text{ft}^2$)
W-01	20362	Room 1001 East Side Univent Back Wall	<9.0	9.0
W-02	20362	Room 1001 South Side Left Univent Back Wall	<9.0	9.0
W-03	20362	Room 1001 South Side Right Univent Back Wall	<9.0	9.0
W-04	20362	Room 1007 South Side Left Univent Back Wall	<9.0	9.0
W-05	20362	Room 1007 South Side Middle Univent Back Wall	<9.0	9.0
W-06	20362	Room 1007 South Side Right Univent Back Wall	<9.0	9.0
W-07	20362	Field Blank	<9.0	9.0
W-08	20362	Field Blank	<9.0	9.0

NOTE 1

THE REPORTING LIMIT (RL) IS 18.0 μg

NOTE 2:


HUD Guidelines for final clearance dust wipe samples: Floor 40 $\mu\text{g}/\text{ft}^2$, Window sills 250 $\mu\text{g}/\text{ft}^2$, Window wells 400 $\mu\text{g}/\text{ft}^2$, Exterior surfaces 800 $\mu\text{g}/\text{ft}^2$.

NOTE 3:

Blank units are in μg

07326

CITY_21MC100_008878500

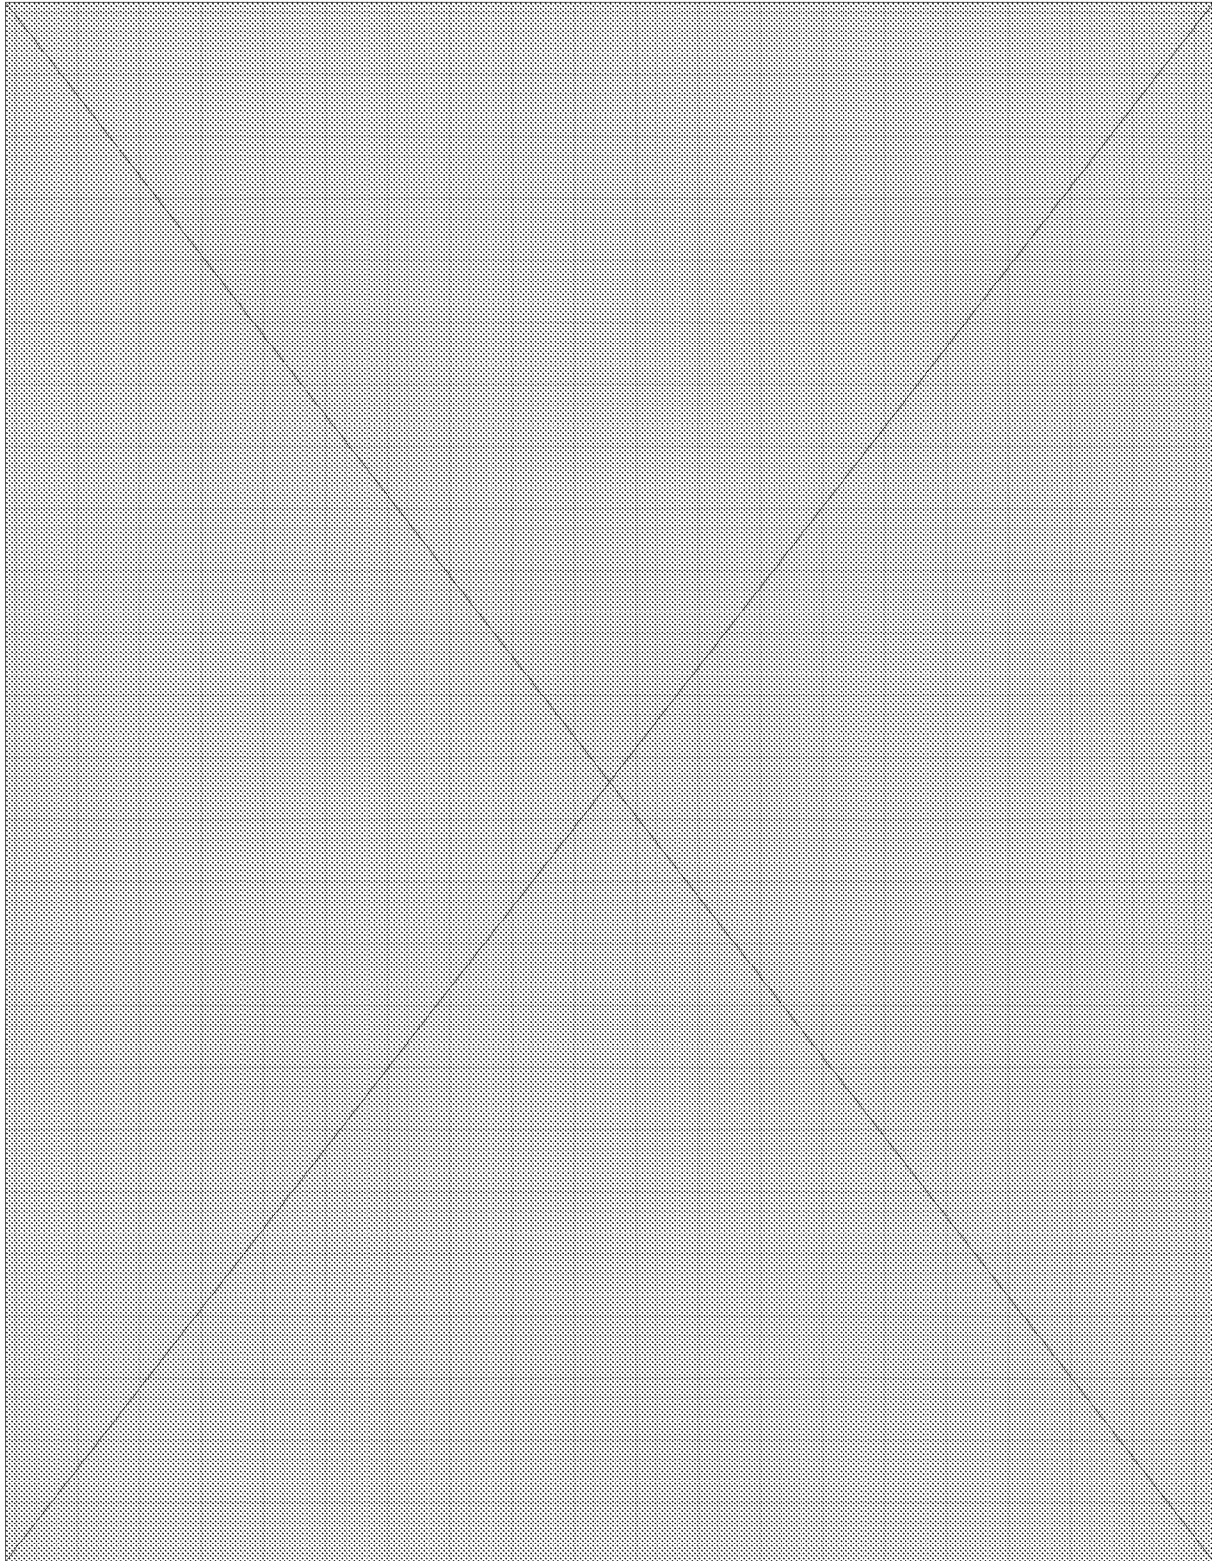

130 JERICHO TPKE., FLORAL PARK, NY 11001

20380

516-358-2955
Fax 516-358-1780

LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT										
CLIENT NAME/ADDRESS NYC SCA			CONTACT: Harid Savoy		SAMPLER SIGNATURE: <i>[Signature]</i>		DATE 7/5/02		TIME	
PROJECT LOCATION: Stuyvesant HS 345 Chambers St NY			PROJECT # M477-15217/29881		SAMPLER NAME (PRINT) Kirk McKenzie		SAMPLE(S) SEALED (YES) / NO		CORRECT CONTAINER(S) (YES) / NO	
SAMPLE INFORMATION:					MATRIX (CIRCLE ONE): <u>WIPE</u> PAINT SOIL OTHER					
LABORATORY #	SAMPLE #	LOCATION	AREA (FT ²)	SURFACE MATERIAL				LAB RESULT		
				WOOD	METAL	BRICK	OTHER			
	LW-01	ROOM 1009, South side Left unit vent - REAR	1		✓			✓ < 9.0 $\mu\text{g}/\text{ft}^2$		
	LW-02	ROOM 1009, South side Right unit vent - REAR	1		✓			✓ < 9.0		
	LW-03	ROOM 1017, South side Left unit vent - REAR	1		✓			✓ < 9.0		
	LW-04	ROOM 1017, South side Right unit vent - REAR	1		✓			✓ < 9.0		
	LW-05	ROOM 1025, South side Left unit vent - REAR	1		✓			✓ < 9.0		
	LW-06	ROOM 1025, South side Middle unit vent - REAR	1		✓			✓ < 9.0		
	LW-07	ROOM 1025, South side Right side - REAR	1		✓			✓ < 9.0		
	LW-08	ROOM 1024, North side Left unit vent - REAR	1		✓			✓ < 9.0		
<i>[Signature]</i> 6:58 PM RELINQUISHED BY (SIGNATURE) DATE 7/5/02 TIME 1:00 PM PRINTED NAME Kirk McKenzie					TURNAROUND REQUIRED: NORMAL ☐ STAT ☐ BY 1/1 COMMENTS / INSTRUCTIONS 6 HR TAT					
RECEIVED BY (SIGNATURE) <i>[Signature]</i>			DATE 7/5/02		RECEIVED BY (SIGNATURE) <i>[Signature]</i>		DATE 7/5/02		PRINTED NAME	
RECEIVED BY (SIGNATURE) <i>[Signature]</i>			DATE 7/5/02		RECEIVED BY (SIGNATURE) <i>[Signature]</i>		DATE 7/5/02		PRINTED NAME	

WHITE - OFFICE / YELLOW - LAB / PINK - CLIENT

07328

CITY_21MC100_008878502

130 JERICHO TPKE., FLORAL PARK, NY 11001

20386

516-358-2955
Fax 516-358-1780

LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT											
CLIENT NAME/ADDRESS NYC SCA			CONTACT: Hanna BAVOJ		SAMPLED (SIGNATURE) [Signature]		DATE 7/5/02		TIME		
PROJECT LOCATION: Stuyvesant H.S. 345 Chambers St. NY			PROJECT # M477-15217/29881		SAMPLE NAME (PRINT)		SAMPLE(S) SEALED (YES) / NO		CORRECT CONTAINER(S) (YES) / NO		
SAMPLE INFORMATION:					MATRIX (CIRCLE ONE): ☒ WIFE ☐ PAINT ☐ SOIL ☐ OTHER						
LABORATORY #	SAMPLE #	LOCATION	AREA (F ²)	SURFACE MATERIAL				LAB RESULT			
				WOOD	METAL	BRICK	OTHER				
	LW-09	Room 1024, North side Right unit vent - Rear	1		✓			< 9.0			
	LW-10	Room 1032, South side Left unit vent - Rear	1		✓			< 9.0			
	LW-11	Room 1032, South side Right unit vent - Rear	1		✓			< 9.0			
	LW-12	Room 1039, South side - Rear	1		✓			< 9.0			
	LW-13	Room 1039, North side Left unit vent - Rear	1		✓			11.3			
	LW-14	Room 1039, North side Middle unit vent - Rear	1		✓			< 9.0			
	LW-15	Room 1039, North side Right unit vent - Rear	1		✓			< 9.0			
	FBL-1	Field Blank						< 9.0			
	FBL-2	Field Blank						< 9.0			
TURNAROUND REQUIRED:					NORMAL ☐ STAT ☐ BY 1/1		COMMENTS / INSTRUCTIONS 6 HR TAT				
RELINQUISHED BY (SIGNATURE) [Signature]			DATE 7/5/02 TIME 1700		PRINTED NAME Kirk McKenzie		RECEIVED BY (SIGNATURE) [Signature]		DATE TIME		
RELINQUISHED BY (SIGNATURE)			DATE TIME		PRINTED NAME		RECEIVED BY LAB (SIGNATURE)		DATE TIME		

WHITE - OFFICE / YELLOW - LAB / PINK - CLIENT

07329

CITY_21MC100_008878503

TAYLOR ENVIRONMENTAL GROUP, INC.
130 JERICHO TPKE., FLORAL PARK, NY 11001

20391

516-358-2955
Fax 516-358-1780

LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT

CLIENT NAME/ADDRESS SCA		CONTACT: Hamid Suway		SAMPLER (SIGNATURE) <i>[Signature]</i>		DATE 7/15/02		TIME		SAMPLE(S) SEALED YES NO	
PROJECT LOCATION: Stuyvesant H.S.		PROJECT # M447-15217/29881		SAMPLER NAME (PRINT) AL. KARAKOV						CORRECT CONTAINER(S) YES NO	
SAMPLE INFORMATION:				MATRIX (CIRCLE ONE): WIPE PAINT SOIL OTHER							
LABORATORY #	SAMPLE #	LOCATION	AREA (FT ²)	SURFACE MATERIAL				LAB RESULT			
				WOOD	METAL	BRICK	OTHER				
	W-01	Room # 1004 North side Left Univent (Back wall)	1		X						
	W-02	Room # 1004 North side Right Univent (Back wall)	1		X						
	W-03	Room # 1006 North side Left Univent (Back wall)	1		X						
	W-04	Room # 1006 North side Right Univent (Back wall)	1		X						
	W-05	Room # 1006 North side Middle Univent (Back wall)	1		X						
	W-06	F/B " "									
	W-07	F/B " "									
	W-08										
				TURNAROUND REQUIRED: NORMAL ☐ STAT ☐ BY 1/1				COMMENTS / INSTRUCTIONS 06 hr			
RELINQUISHED BY (SIGNATURE) <i>[Signature]</i>		DATE 7/15/02 TIME		PRINTED NAME AL. KARAKOV		RECEIVED BY (SIGNATURE) <i>[Signature]</i>		DATE 7/16/02 TIME 4:00		PRINTED NAME	
RELINQUISHED BY (SIGNATURE)		DATE TIME		PRINTED NAME		RECEIVED BY LAB (SIGNATURE)		DATE TIME		PRINTED NAME	

07330

CITY_21MC100_008878504

ASSOCIATES, INC
 104 E 25th Street, 10th Floor
 New York, NY 10010
 Tel. 212-353-8280
 Fax 212-353-8306

REPORT DATE: 07-16-02
 CLIENT: Taylor Environmental Group, Inc.
 PROJECT NAME: SCA/Stuyvesant HS
 345 Chambers St., NY
 SAMPLED BY: Client
 SAMPLE DATE: 07-16-02
 DATE RECEIVED: 07-16-02
 DATE ANALYZED: 07-16-02
 SAMPLE MEDIA: Dust Wipe Sample
 ANALYSIS REQUIRED: Method EPA 3050/7420

ANALYSIS RESULTS

SAMPLE ID	BATCH NO.	SAMPLE DESCRIPTION	LEAD CONCENTRATION ($\mu\text{g}/\text{ft}^2$)	DETECTION LIMIT ($\mu\text{g}/\text{ft}^2$)
W-01	20391	Rm 1004 North Side Left Univent Back Wall	<9.0	9.0
W-02	20391	Rm 1004 North Side Right Univent Back Wall	<9.0	9.0
W-03	20391	Rm 1006 North Side Left Univent Back Wall	<9.0	9.0
W-04	20391	Rm 1006 North Side Right Univent Back Wall	<9.0	9.0
W-05	20391	Rm 1006 North Side Middle Univent Back Wall	<9.0	9.0
W-06	20391	Field Blank	<9.0 μg	9.0 μg
W-07	20391	Field Blank	<9.0 μg	9.0 μg

NOTE 1:

THE REPORTING LIMIT (RL) IS 18.0 μg

NOTE 2:

HUD Guidelines for final clearance dust wipe samples: Floor 40 $\mu\text{g}/\text{ft}^2$, Window sills 250 $\mu\text{g}/\text{ft}^2$, Window wells 400 $\mu\text{g}/\text{ft}^2$, Exterior surfaces 800 $\mu\text{g}/\text{ft}^2$.

NOTE 3:

Blank units are in μg

07331

CITY_21MC100_008878505

TAYLOR ENVIRONMENTAL GROUP, INC.
130 JERICHO TPKE., FLORAL PARK, NY 11001

20410

516-358-2955
Fax 516-358-1780

LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT

CLIENT NAME/ADDRESS NYC SCA			CONTACT: Harold Savoi		SAMPLE(S) SIGNATURE [Signature]		DATE 7/16/02	TIME	SAMPLE(S) SEALED ☒ YES / ☐ NO		
PROJECT LOCATION: Stuyvesant H.S. 545 Chambers St. NY NY			PROJECT #		SAMPLER NAME (PRINT) Rick McKenzie				CORRECT CONTAINER(S) ☒ YES / ☐ NO		
SAMPLE INFORMATION:					MATRIX (CIRCLE ONE): ☒ WIFE ☐ PAINT ☐ SOIL ☐ OTHER						
LABORATORY #	SAMPLE #	LOCATION	AREA (FT ²)	SURFACE MATERIAL				LAB RESULT			
				WOOD	METAL	BRICK	OTHER				
	LW-01	Room 1010, North side Left unit vent - Rear	1		☒			23.2			
	LW-02	Room 1010, North side Middle unit vent - Rear	1		☒			22.3			
	LW-03	Room 1010, North side Right unit vent - Rear	1		☒			26.2			
	FRL-1	Field Blank						49.0			
	FRL-2	Field Blank						49.0			
					TURNAROUND REQUIRED: NORMAL ☐ STAT ☐ BY 11		COMMENTS / INSTRUCTIONS 6 HR TAT				
RELINQUISHED BY (SIGNATURE) [Signature]		DATE 7/16/02 TIME 1100	PRINTED NAME		RECEIVED BY (SIGNATURE) [Signature]		DATE 7/16/02	TIME	PRINTED NAME		
RELINQUISHED BY (SIGNATURE) [Signature]		DATE 7/16/02 TIME 1130am	PRINTED NAME		RECEIVED BY LAB (SIGNATURE)		DATE	TIME	PRINTED NAME		

07332

CITY_21MC100_008878506

TAYLOR ENVIRONMENTAL GROUP, INC.
130 JERICHO TPKE., FLORAL PARK, NY 11001

20409

516-358-2955
Fax 516-358-1780

LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT										
CLIENT NAME/ADDRESS NYC SCA			CONTACT: Harold Pavojs		SAMPLER (SIGNATURE) <i>[Signature]</i>		DATE 7/16/02		SAMPLE(S) SEALED ☒ YES / NO	
PROJECT LOCATION: Stuyvesant H.S. 345 Chambers St NY NY			PROJECT # M477-15217/28881		SAMPLER NAME (PRINT) Rick McKeown				CORRECT CONTAINER(S) ☒ YES / NO	
SAMPLE INFORMATION:					MATRIX (CIRCLE ONE): ☒ WIFE ☐ PAINT ☐ SOIL ☐ OTHER					
LABORATORY #	SAMPLE #	LOCATION	AREA (FT ²)	SURFACE MATERIAL				LAB RESULT		
				WOOD	METAL	BRICK	OTHER			
	LW-01	ROOM 901 - EAST SIDE Unit Vent - Rear	1		✓			14.3		
	LW-02	Room 903 - South side Left unit vent - Rear	1		✓			16.1		
	LW-03	Room 903 - South side Middle unit vent - Rear	1		✓			9.5		
	LW-04	Room 903 - South side Right unit vent - Rear	1		✓			12.0		
	LW-05	Room 907 - South side Unit vent - Rear	1		✓			12.7		
	LW-06	Room 911 - South side Left unit vent - Rear	1		✓			15.8		
	LW-07	Room 911 - South side Right unit vent - Rear	1		✓			30.3		
	FRL-1	Field Blank						29.0		
	FRL-2	Field Blank						29.0		
					TURNAROUND REQUIRED: NORMAL ☐ STAT ☐ BY 1/1			COMMENTS / INSTRUCTIONS 6 HR TAT		
RELINQUISHED BY (SIGNATURE) <i>[Signature]</i>			DATE 7/16/02 TIME 1:00		PRINTED NAME Rick McKeown		RECEIVED BY (SIGNATURE) <i>[Signature]</i>		DATE 7/16/02 TIME	
RELINQUISHED BY (SIGNATURE) <i>[Signature]</i>			DATE 7/16/02 TIME 1:00		PRINTED NAME		RECEIVED BY LAB (SIGNATURE) <i>[Signature]</i>		DATE 7/16/02 TIME	

WHITE - OFFICE / YELLOW - LAB / PINK - CLIENT

07333

CITY_21MC100_008878507

ATC ASSOCIATES, INC
 104 E 25th Street, 10th Floor
 New York, NY 10010
 Tel. 212-353-8280
 Fax 212-353-8306

REPORT DATE: 07-17-02
CLIENT: Taylor Environmental Group, Inc.
PROJECT NAME: SCA/Stuyvesant HS
 345 Chambers St., NY
SAMPLED BY: Client
SAMPLE DATE: 07-16-02
DATE RECEIVED: 07-16-02
DATE ANALYZED: 07-16-02
SAMPLE MEDIA: Dust Wipe Sample
ANALYSIS REQUIRED: Method EPA 8050/7420

ANALYSIS RESULTS

SAMPLE ID	BATCH NO.	SAMPLE DESCRIPTION	LEAD CONCENTRATION ($\mu\text{g}/\text{ft}^2$)	DETECTION LIMIT ($\mu\text{g}/\text{ft}^2$)
LW-01	20409	Rm 901 East Side Unitvent Rear	14.3	9.0
LW-02	20409	Rm 903 South Side Left Unitvent Rear	16.1	9.0
LW-03	20409	Rm 903 South Side Middle Unitvent Rear	9.5	9.0
LW-04	20409	Rm 903 South Side Right Unitvent Rear	12.0	9.0
LW-05	20409	Rm 907 South Side Unitvent Rear	12.7	9.0
LW-06	20409	Rm 911 South Side Left Unitvent Rear	15.8	9.0
LW-07	20409	Rm 911 South Side Right Unitvent Rear	30.3	9.0
FBL-1	20409	Field Blank	<9.0 μg	9.0 μg
FBL-2	20409	Field Blank	<9.0 μg	9.0 μg

NOTE 1:

THE REPORTING LIMIT (RL) IS 18.0 μg

NOTE 2:

HUD Guidelines for final clearance dust wipe samples: Floor 40 $\mu\text{g}/\text{ft}^2$, Window sills 250 $\mu\text{g}/\text{ft}^2$, Window wells 400 $\mu\text{g}/\text{ft}^2$, Exterior surfaces 800 $\mu\text{g}/\text{ft}^2$.

NOTE 3:

Blank units are in μg

07334

CITY_21MC100_008878508

TAYLOR ENVIRONMENTAL GROUP, INC.
130 JERICHO TPKE., FLORAL PARK, NY 11001

516-358-2955
Fax 516-358-1760

LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT


CLIENT NAME/ADDRESS SCA		CONTACT: Hamid Savoy		SAMPLER SIGNATURE: <i>[Signature]</i>		DATE 7/17/02		TIME		SAMPLE(S) SEALED (YES) / NO	
PROJECT LOCATION: Stuyvesant H.S.		PROJECT # M477-15217/24881		SAMPLER NAME (PRINT) AL. KAZAKOV						CORRECT CONTAINER(S) (YES) / NO	
SAMPLE INFORMATION:				MATRIX (CIRCLE ONE): (WIFE) PAINT SOIL OTHER							
LABORATORY #	SAMPLE #	LOCATION	AREA (FT ²)	SURFACE MATERIAL				LAB RESULT µg/ft²			
	W-01	Room # 925 South side Left Unitvent (back wall)	1	WOOD	METAL	BRICK	OTHER				49.0
	W-02	Room # 925 South side Right Unitvent (back wall)	1		X						49.0
	W-03	Room # 913 South side Right Unitvent (back wall)	1		X						10.1
	W-04	Room # 913 South side Middle Unitvent (back wall)	1		X						11.4
	W-05	Room # 913 South side Left Unitvent (back wall)	1		X						49.0
	W-06	F/B									49.0
	W-07	F/B									49.0
	W-08										
				TURNAROUND REQUIRED: NORMAL ☐ STAT ☐ BY 1 / 1				COMMENTS / INSTRUCTIONS Fax results to Taylor (212) 406-25 # (516) 358-1760			
RELINQUISHED BY (SIGNATURE) <i>[Signature]</i>		DATE 7/17/02		PRINTED NAME AL. KAZAKOV		RECEIVED BY (SIGNATURE) <i>[Signature]</i>		DATE 7.17.02		PRINTED NAME R. Droukina	
RELINQUISHED BY (SIGNATURE)		DATE		PRINTED NAME		RECEIVED BY LAB (SIGNATURE)		DATE		PRINTED NAME	
		TIME						TIME			

WHITE - OFFICE / YELLOW - LAB / PINK - CLIENT

6 hr T.A.T.

07335

CITY_21MC100_008878509

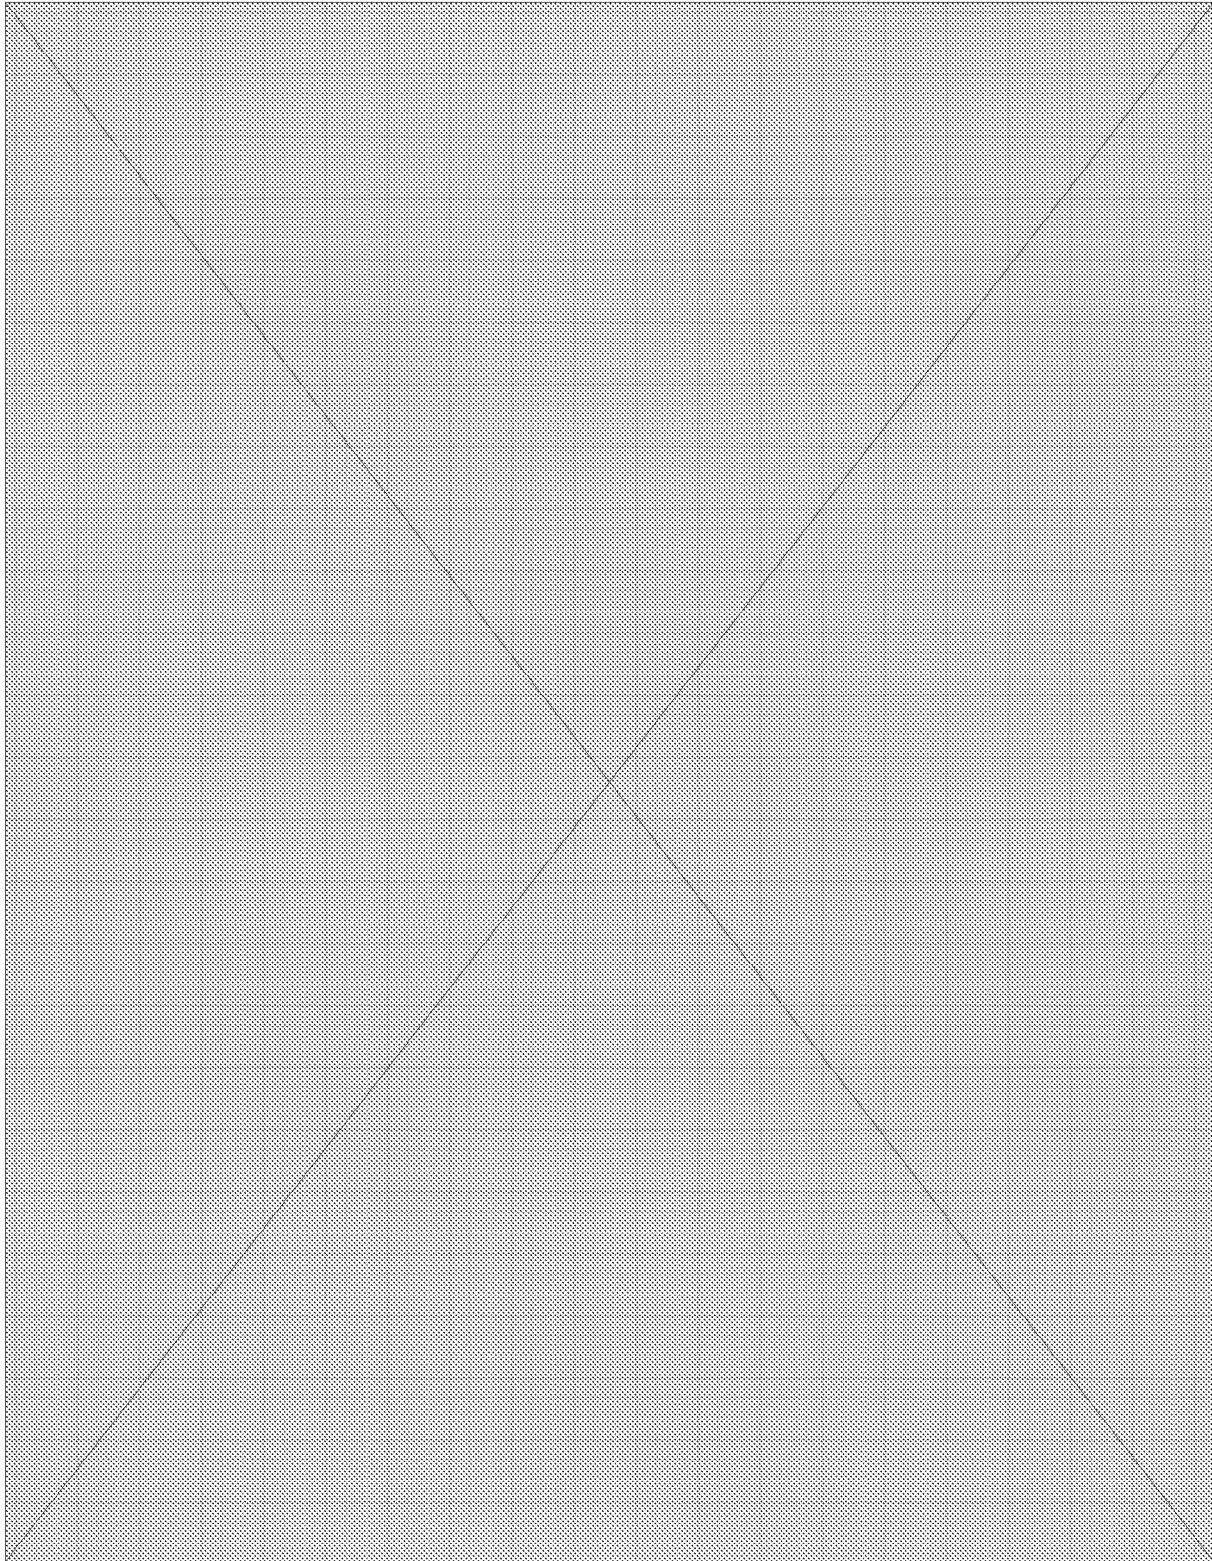

TAYLOR ENVIRONMENTAL GROUP, INC.
130 JERICHO TPKE., FLORAL PARK, NY 11001

6hr T.A.T.

20452

516-358-2955
FAX 516-358-1780

LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT

CLIENT NAME/ADDRESS SCA		CONTACT: Hamid Savos		SAMPLER SIGNATURE <i>[Signature]</i>	DATE 7/17/02	TIME	SAMPLE(S) SEALED ☒ YES / NO
PROJECT LOCATION: Stuyvesant H.S.		PROJECT # M477-15217/29881		SAMPLER NAME (PRINT) AL. KARANOV		CORRECT CONTAINER(S) ☒ YES / NO	
SAMPLE INFORMATION:		MATRIX (CIRCLE ONE): ☒ WIFE ☐ FAINT ☐ SOIL ☐ OTHER		LAB RESULT 18.0			
LABORATORY #	SAMPLE #	LOCATION	AREA (FT ²)	SURFACE MATERIAL			
				WOOD	METAL	BRICK	OTHER
	W-01	Room #911 South side Right Univalent (Back wall)	1		X		
	W-02	Room #927 South side Right Univalent (Back wall)	1		X		
	W-03	Room #927 South side Middle Univalent (Back wall)	1		X		
	W-04	Room #927 South side Left Univalent (Back wall)	1		X		
	W-05	Room #931 South side Left Univalent (Back wall)	1		X		
	W-06	Room #931 South side Right Univalent (Back wall)	1		X		
	W-07	Room #938 North side Univalent (Back wall)	1		X		
	W-08	Room #939 South side Left Univalent (Back wall)	1		X		
TURNAROUND REQUIRED: NORMAL ☐ STAT ☒ BY 11				COMMENTS / INSTRUCTIONS Fax results to Paycan (212) 406-2535			
RELINQUISHED BY (SIGNATURE) <i>[Signature]</i>		DATE 7/17/02	PRINTED NAME AL. KARANOV		RECEIVED BY (SIGNATURE) <i>[Signature]</i>		DATE 7/17/02
RELINQUISHED BY (SIGNATURE)		DATE	PRINTED NAME		RECEIVED BY LAB (SIGNATURE)		DATE
		TIME					TIME

WHITE - OFFICE / YELLOW - LAB / PINK - CLIENT

07337

CITY_21MC100_008878511

TAYLOR ENVIRONMENTAL GROUP, INC.
130 JERICHO TPKE., FLORAL PARK, NY 11001

6hr T.A.T.

2045

516-58-2955
Fax 516-58-1780

LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT

CLIENT NAME/ADDRESS SCA		CONTACT: Hamid. Savoj		SAMPLER (SIGNATURE) <i>[Signature]</i>		DATE 7/17/02		TIME		SAMPLE(S) SEALED YES / NO	
PROJECT LOCATION: Stuyvesant H.S.		PROJECT # M477-15217/29881		SAMPLER NAME (PRINT) AL. KAZANOV						CORRECT CONTAINER(S) YES / NO	
				MATRIX (CIRCLE ONE): WPC		PAINT		SOIL		OTHER	
SAMPLE INFORMATION:				AREA (FT ²)		SURFACE MATERIAL				LAB RESULT	
LABORATORY #		SAMPLE #		LOCATION		WOOD		METAL		BRICK	
				TURNAROUND REQUIRED: NORMAL ☐ STAT ☐ BY 1/1				COMMENTS / INSTRUCTIONS Fax results to Taylor at Stuyvesant (212) 406-2535			
RELINQUISHED BY (SIGNATURE) <i>[Signature]</i>		DATE 7/17/02		PRINTED NAME AL. KAZANOV		RECEIVED BY (SIGNATURE) <i>[Signature]</i>		DATE 7/17/02		PRINTED NAME	
RELINQUISHED BY (SIGNATURE) <i>[Signature]</i>		DATE		PRINTED NAME		RECEIVED BY LAB (SIGNATURE)		DATE		PRINTED NAME	
		TIME						TIME			

WHITE - OFFICE / YELLOW - LAB / PINK - CLIENT

07338

CITY_21MC100_008878512


Fax 516-358-1780

LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT			
CONTACT:	SAMPLER SIGNATURE:	DATE:	TIME:
[Signature]	[Signature]	7/17/02	10:00

[illegible]

07339

WHITE - OFFICE / YELLOW - LAB / PINK - CLIENT

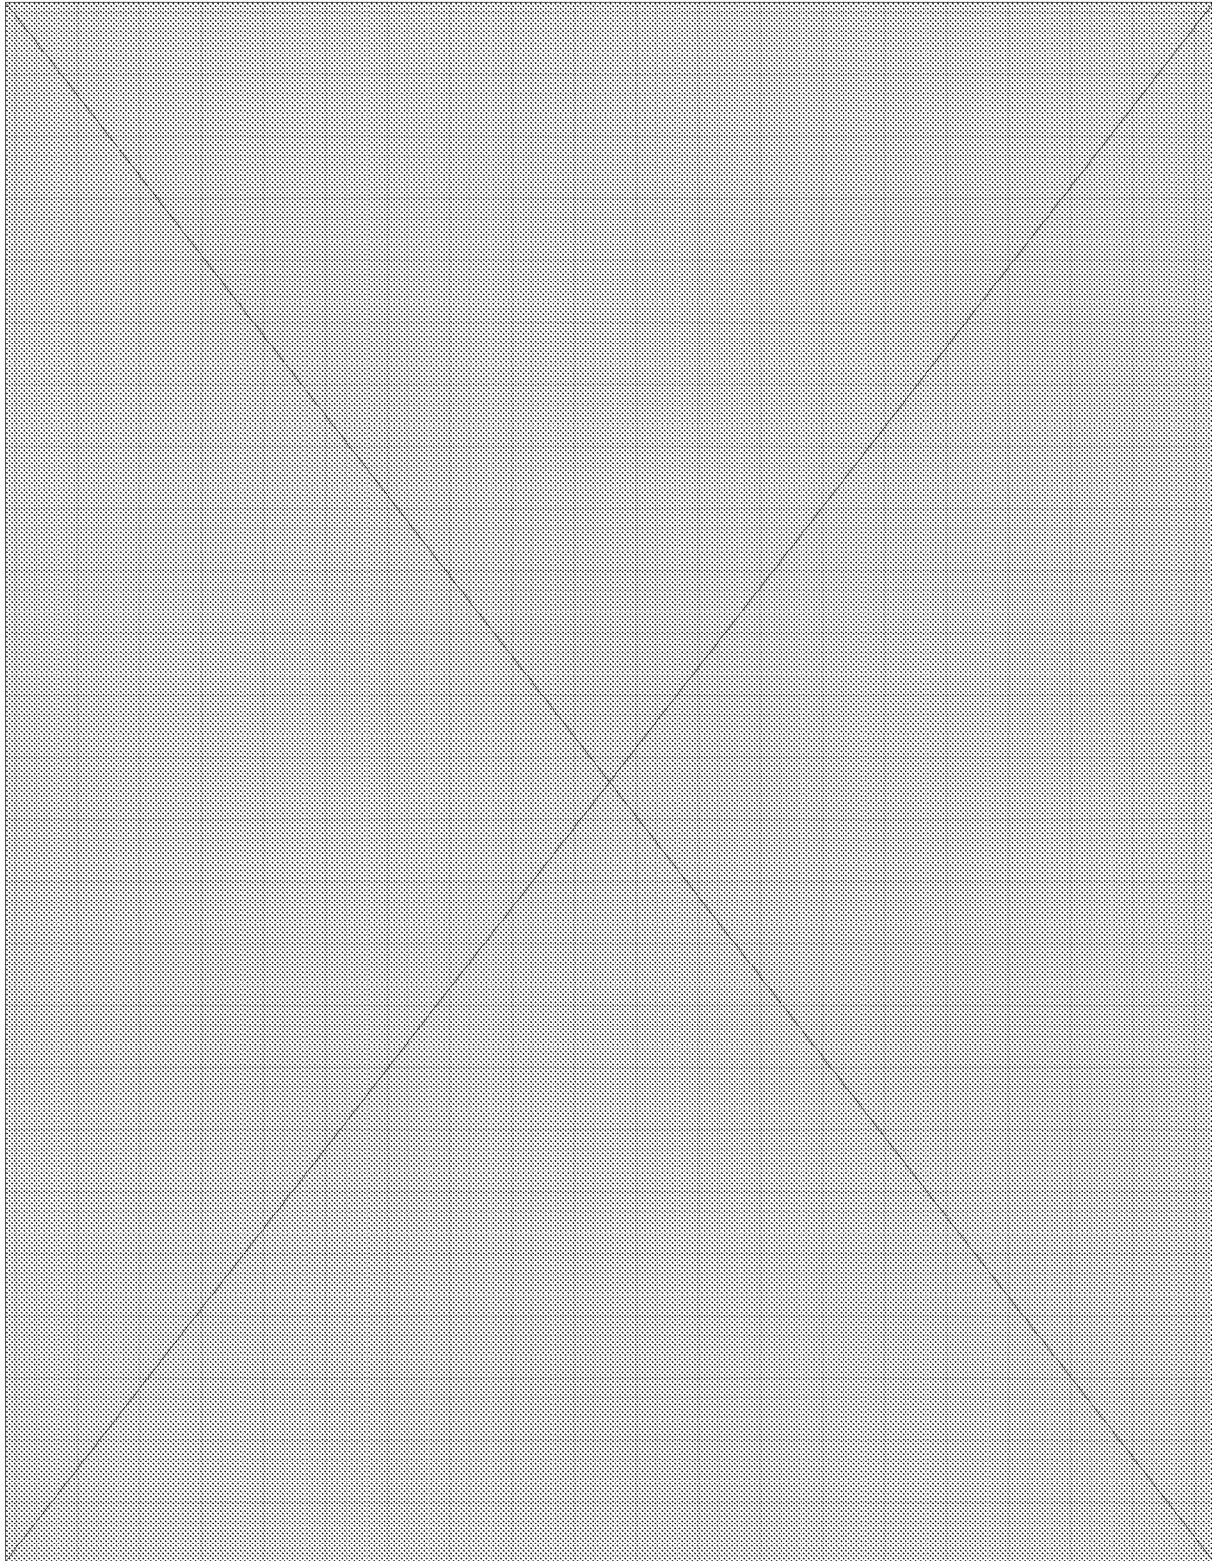

TAYLOR ENVIRONMENTAL GROUP, INC.
130 JERICHO TPKE., FLORAL PARK, NY 11001

GHRS TAT

20773

516-358-2955
Fax 516-358-1789

LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT

CLIENT NAME/ADDRESS 442 SEA			CONTACT: HAROLD SAVOJ		SAMPLER (SIGNATURE) <i>Carlos Jofat</i>		DATE 7-17-02		TIME		SAMPLE(S) SEALED		(YES) NO	
PROJECT LOCATION: STUYVESANT H.S.			PROJECT # 11477-15217/29881		SAMPLER NAME (PRINT) CARLOS JOFAT						CORRECT CONTAINER(S)		(YES) NO	
SAMPLE INFORMATION:					MATRIX (CIRCLE ONE):		PAINT		SOIL		OTHER			
LABORATORY #	SAMPLE #	LOCATION	AREA (FT ²)	SURFACE MATERIAL				LAB RESULT						
				WOOD	METAL	BRICK	OTHER							
	LW-01	Room # 1010 Left side. HURVANT back wall	1		/			11.1						
	LW-02	Room # 1010 center HURVANT back wall	1		/			19.1						
	LW-03	Room # 1010 Right side. HURVANT back wall	1		/			11.7						
	FB 1	FIELD BLANK	—	—	—	—	—	29.0						
	FB 2	FIELD BLANK	—	—	—	—	—	29.0						
					TURNAROUND REQUIRED:				COMMENTS / INSTRUCTIONS					
					NORMAL ☐ STAT ☐ BY 1/1				GHRS TAT Fax to TEG at (212) 406-2535					
RELINQUISHED BY (SIGNATURE) <i>Carlos Jofat</i>		DATE 7-17-02 TIME 1650	PRINTED NAME CARLOS JOFAT		RECEIVED BY (SIGNATURE) <i>ALCOFFITZ</i>		DATE 7-17-02	PRINTED NAME						
RELINQUISHED BY (SIGNATURE)		DATE	PRINTED NAME		RECEIVED BY LAB (SIGNATURE)		DATE	PRINTED NAME						
		TIME					TIME							

WHITE - OFFICE / YELLOW - LAB / PINK - CLIENT

07244

CITY_21MC100_008878515

TAYLOR ENVIRONMENTAL GROUP, INC.
130 JERICHO PIKE., FLORAL PARK, NY 11001

516-358-2955
Fax 516-358-1780

LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT

20467 182

CLIENT NAME/ADDRESS NYC SCA		CONTACT HANID SMOVJ		SAMPLER SIGNATURE <i>[Signature]</i>	DATE 7/18/02	TIME	SAMPLE(S) SEALED (YES) NO	
PROJECT LOCATION: Stuyvesant H.S.		PROJECT # 1477-15217-29881		SAMPLER NAME (PRINT) Kirk McKeown		CORRECT CONTAINER(S) (YES) NO		
345 Chambers St. NY, NY				MATRIX (CIRCLE ONE): (WIFE) PAINT SOIL OTHER				
SAMPLE INFORMATION:			AREA (FT ²)	SURFACE MATERIAL				LAB RESULT
LABORATORY #	SAMPLE #	LOCATION		WOOD	METAL	BRICK	OTHER	
LW-01		ROOM 940, North side Left unit vent - Rear	1		✓			<9.0 / ft ²
LW-02		ROOM 940, North side Right unit vent - Rear	1		✓			<9.0
LW-03		ROOM 839, South side Left unit vent - Rear	1		✓			<9.0
LW-04		ROOM 839, South side Right unit vent - Rear	1		✓			<9.0
LW-05		ROOM 837, South side Left unit vent - Rear	1		✓			<9.0
LW-06		ROOM 837, South side Right unit vent - Rear	1		✓			<9.0
LW-07		ROOM 835, South side Left unit vent - Rear	1		✓			<9.0
LW-08		ROOM 835, South side Right unit vent - Rear	1		✓			<9.0
TURNAROUND REQUIRED:				COMMENTS / INSTRUCTIONS				
NORMAL ☐ STAT ☐ BY 11				6 HR TAT				
RELINQUISHED BY (SIGNATURE) <i>[Signature]</i>		DATE 7/18/02	PRINTED NAME	RECEIVED BY (SIGNATURE) <i>[Signature]</i>		DATE	PRINTED NAME	
		TIME 16:24				TIME		
RELINQUISHED BY (SIGNATURE)		DATE	PRINTED NAME	RECEIVED BY LAB (SIGNATURE)		DATE	PRINTED NAME	
		TIME				TIME		

WHITE - OFFICE / YELLOW - LAB / PINK - CLIENT

1780

07342

CITY_21MC100_008878516

20467 282
516-358-2955
Fax 516-358-1780

LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT											
CLIENT NAME/ADDRESS <div style="font-size: 1.2em;">NYC DCA</div>			CONTACT: <div style="font-size: 1.2em;">Hania Davis</div>		SAMPLER SIGNATURE: <div style="font-size: 1.2em;">[Signature]</div>		DATE <div style="font-size: 1.2em;">7/18/02</div>		TIME		
PROJECT LOCATION: <div style="font-size: 1.2em;">Stuyvesant H.S.</div>			PROJECT # <div style="font-size: 1.2em;">M477-15217-29881</div>		SAMPLER NAME (PRINT) <div style="font-size: 1.2em;">Kirk McKelvie</div>				SAMPLE(S) SEALED <div style="font-size: 1.2em;">YES</div> NO		
345 Chambers St NY, NY									CORRECT CONTAINER(S) <div style="font-size: 1.2em;">YES</div> NO		
SAMPLE INFORMATION:					MATRIX (CIRCLE ONE): <div style="font-size: 1.2em;">PIPE</div> PAINT SOIL OTHER						
LABORATORY #	SAMPLE #	LOCATION	AREA (FT ²)	SURFACE MATERIAL				LAB RESULT			
				WOOD	METAL	BRICK	OTHER				
	LW-09	ROOM 833, South side Left unit vent - Rear	1		✓			<9.0			
	LW-10	ROOM 833, South side Right unit vent - Rear	1		✓			<9.0			
	LW-11	ROOM 829, South side Left unit vent - Rear	1		✓			<9.0			
	LW-12	ROOM 829, South side Right unit vent - Rear	1		✓			<9.0			
	FBL-1	Field Blank						<9.0			
	FBL-2	Field Blank						<9.0			
					TURNAROUND REQUIRED:		COMMENTS / INSTRUCTIONS <div style="font-size: 1.2em;">6 HR TAT</div>				
					NORMAL ☐ STAT ☐ BY <div style="font-size: 1.2em;">1/1</div>						
RELINQUISHED BY (SIGNATURE) <div style="font-size: 1.2em;">[Signature]</div>		DATE <div style="font-size: 1.2em;">7/18/02</div> TIME <div style="font-size: 1.2em;">10:24</div>		PRINTED NAME		RECEIVED BY (SIGNATURE) <div style="font-size: 1.2em;">[Signature]</div>		DATE TIME		PRINTED NAME	
RELINQUISHED BY (SIGNATURE)		DATE TIME		PRINTED NAME		RECEIVED BY LAB (SIGNATURE)		DATE TIME		PRINTED NAME	

07343

ATC ASSOCIATES, INC.
104 E 25th Street, 10th Floor
New York, NY 10010
Tel. 212-353-8280
Fax 212-353-8306

REPORT DATE: 07-19-02
CLIENT: Taylor Environmental Group, Inc.
PROJECT NAME: SCA/Stuyvesant HS
 345 Chambers St., NY
SAMPLED BY: Client
SAMPLE DATE: 07-18-02
DATE RECEIVED: 07-18-02
DATE ANALYZED: 07-18-02
SAMPLE MEDIA: Dust Wipe Sample
ANALYSIS REQUIRED: Method EPA 3050/7420

ANALYSIS RESULTS

SAMPLE ID	BATCH NO.	SAMPLE DESCRIPTION	LEAD CONCENTRATION ($\mu\text{g}/\text{ft}^2$)	DETECTION LIMIT ($\mu\text{g}/\text{ft}^2$)
LW-01	20467	Rm 940 North Side Left Unitvent Rear	<9.0	9.0
LW-02	20467	Rm 940 North Side Right Unitvent Rear	<9.0	9.0
LW-03	20467	Rm 839 South Side Left Unitvent Rear	<9.0	9.0
LW-04	20467	Rm 839 South Side Right Unitvent Rear	<9.0	9.0
LW-05	20467	Rm 837 South Side Left Unitvent Rear	<9.0	9.0
LW-06	20467	Rm 837 South Side Right Unitvent Rear	<9.0	9.0
LW-07	20467	Rm 835 South Side Left Unitvent Rear	<9.0	9.0
LW-08	20467	Rm 835 South Side Right Unitvent Rear	<9.0	9.0
LW-09	20467	Rm 833 South Side Left Unitvent Rear	<9.0	9.0
LW-10	20467	Rm 833 South Side Right Unitvent Rear	<9.0	9.0
LW-11	20467	Rm 829 South Side Left Unitvent Rear	<9.0	9.0
LW-12	20467	Rm 829 South Side Right Unitvent Rear	<9.0	9.0
FBL-13	20467	Field Blank	<9.0 μg	9.0 μg
FBL-14	20467	Field Blank	<9.0 μg	9.0 μg

NOTE 1:

THE REPORTING LIMIT (RL) IS 18.0 μg

NOTE 2:

HUD Guidelines for final clearance dust wipe samples: Floor 40 $\mu\text{g}/\text{ft}^2$, Window sills 250 $\mu\text{g}/\text{ft}^2$, Window wells 400 $\mu\text{g}/\text{ft}^2$, Exterior surfaces 800 $\mu\text{g}/\text{ft}^2$.

NOTE 3:

Blank units are in μg

07344

TAYLOR ENVIRONMENTAL GROUP, INC.
130 JERICHO TPKE., FLORAL PARK, NY 11001

20479

516-358-2955
Fax 516-358-1780

LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT

CLIENT NAME/ADDRESS SCA		CONTACT Harold Savoy		SAMPLER (SIGNATURE) <i>AL. Kacemou</i>		DATE 7/18/02		TIME		SAMPLE(S) SEALED (YES) / NO	
PROJECT LOCATION: Stuyvesant H.S.		PROJECT # M 477-15217/29881		SAMPLER NAME (PRINT) AL. Kacemou		CORRECT CONTAINER(S) (YES) / NO					
SAMPLE INFORMATION:		MATRIX (CIRCLE ONE): (WIPE) PAINT SOIL OTHER		AREA (FT ²)		SURFACE MATERIAL		LAB RESULT			
LABORATORY #	SAMPLE #	LOCATION		WOOD	METAL	BRICK	OTHER				
	W-01	Room # 836 North side Univent Right (back wall)			X			109/472 19.0			
	W-02	Room # 836 North side Left Univent (back wall)			X			19.0			
	W-03	Room # 838 North side Left Univent (back wall)			X			19.0			
	W-04	Room # 838 North side Right Univent (back wall)			X			10.5			
	W-05	Room # 840 North side Left Univent (back wall)			X			11.7			
	W-06	Room # 840 North side Right Univent (back wall)			X			19.0			
	W-07	FIB "						19.0			
	W-08	FIB "						19.0			
TURNAROUND REQUIRED:				NORMAL ☐ STAT ☐ BY 1/1				COMMENTS / INSTRUCTIONS 6 hr PAY			
RELINQUISHED BY (SIGNATURE) <i>[Signature]</i>		DATE 7/18/02		PRINTED NAME AL. Kacemou		RECEIVED BY (SIGNATURE) <i>[Signature]</i>		DATE 07/18/02		PRINTED NAME	
RELINQUISHED BY (SIGNATURE)		DATE		PRINTED NAME		RECEIVED BY (SIGNATURE)		DATE		PRINTED NAME	

07345

WHITE - OFFICE / YELLOW - LAB / PINK - CLIENT

CITY_21MC100_008878519

TAYLOR ENVIRONMENTAL, INC.
 104 E 25th Street, 10th Floor
 New York, NY 10010
 Tel. 212-353-8280
 Fax 212-353-8306

REPORT DATE: 07-19-02
 CLIENT: Taylor Environmental Group, Inc.
 PROJECT NAME: SCA/Stuyvesant HS
 345 Chambers St., NY
 SAMPLED BY: Client
 SAMPLE DATE: 07-18-02
 DATE RECEIVED: 07-18-02
 DATE ANALYZED: 07-18-02
 SAMPLE MEDIA: Dust Wipe Sample
 ANALYSIS REQUIRED: Method EPA 3050/7420

ANALYSIS RESULTS

SAMPLE ID	BATCH NO.	SAMPLE DESCRIPTION	LEAD CONCENTRATION ($\mu\text{g}/\text{ft}^2$)	DETECTION LIMIT ($\mu\text{g}/\text{ft}^2$)
W-01	20479	Rm 836 North Side Univent Right Back Wall	<9.0	9.0
W-02	20479	Rm 836 North Side Univent Left Back Wall	<9.0	9.0
W-03	20479	Rm 838 North Side Univent Left Back Wall	<9.0	9.0
W-04	20479	Rm 838 North Side Univent Right Back Wall	10.5	9.0
W-05	20479	Rm 840 North Side Left Univent Back Wall	11.7	9.0
W-06	20479	Rm 840 North Side Right Univent Back Wall	<9.0	9.0
W-07	20479	Field Blank	<9.0 μg	9.0 μg
W-08	20479	Field Blank	<9.0 μg	9.0 μg

NOTE 1:

THE REPORTING LIMIT (RL) IS 18.0 μg

NOTE 2:

HUD Guidelines for final clearance dust wipe samples: Floor 40 $\mu\text{g}/\text{ft}^2$, Window sills 250 $\mu\text{g}/\text{ft}^2$, Window wells 400 $\mu\text{g}/\text{ft}^2$, Exterior surfaces 800 $\mu\text{g}/\text{ft}^2$.

NOTE 3:

Blank units are in μg

07346

CITY_21MC100_008878520

TAYLOR ENVIRONMENTAL GROUP, INC.
130 JERICHO TURNPIKE, FLORAL PARK, NY 11001

20511

516-358-2955

Fax 516-358-1780

LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT

CLIENT NAME/ADDRESS SCA		CONTACT Harold Savoy		SAMPLER (SIGNATURE) <i>AL. KLEANOV</i>	DATE 7/19/01	TIME	SAMPLE(S) SEALED (YES) NO
PROJECT LOCATION: Stuyvesant H.S. N.Y.C.		PROJECT # M477-15217/29881		SAMPLER NAME (PRINT) AL. KLEANOV	CORRECT CONTAINER(S) (YES) NO		
MATRIX (CIRCLE ONE): (WIPE) PAINT SOIL OTHER							
SAMPLE INFORMATION:			AREA (FT ²)	SURFACE MATERIAL		LAB RESULT	
LABORATORY #	SAMPLE #	LOCATION		WOOD	METAL	BRICK	OTHER
	W-01	Room # 1017 A, Top Univalent Composid sample (Naופן)	1		X		
	W-02	Room # 1017 A, Bottom Univalent South side (Back wall)	1		X		
	W-03	Room # 801 South side Univalent, Back wall	1		X		
	W-04	Room # 807 South side Univalent (Back wall)	1		X		
	W-05	Room # 809 South side Univalent (Back wall)	1		X		
	W-06	Room # 811 South side Right Univalent (Back wall)	1		X		
	W-07	Room # 811 South side Middle Univalent (Back wall)	1		X		
	W-08	Room # 811 South side Left Univalent (Back wall)	1		X		
Pay results to Taylor (W) 406-2535				TURNAROUND REQUIRED: NORMAL ☐ STAT ☐ BY 1 / 1		COMMENTS / INSTRUCTIONS OK TAY	
RELINQUISHED BY (SIGNATURE) <i>[Signature]</i>		DATE 7/19/01	PRINTED NAME AL. KLEANOV	RECEIVED BY (SIGNATURE) <i>R. Brudman</i>		DATE 7.20.01	PRINTED NAME R. Brudman
RELINQUISHED BY (SIGNATURE)		DATE	PRINTED NAME	RECEIVED BY LAB (SIGNATURE)		DATE	PRINTED NAME
		TIME				TIME	

WHITE - OFFICE / YELLOW - LAB / PINK - CLIENT

07347

CITY_21MC100_008878521

TAYLOR ENVIRONMENTAL GROUP, INC.
130 JERICO TPKE., FLORAL PARK, NY 11001

20011

516-358-2955
Fax 516-358-1780

LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT

CLIENT NAME/ADDRESS SCA		CONTACT Hamid Saoud		SAMPLER IN CHARGE <i>[Signature]</i>		DATE 7/19/02		TIME		SAMPLE(S) SEALED ☒ YES ☐ NO	
PROJECT LOCATION: Stuyvesant H.S.		PROJECT # W477-15217/29881		SAMPLER NAME (PRINT) Al. Kacaron				CORRECT CONTAINER(S) ☒ YES ☐ NO			
SAMPLE INFORMATION:				MATRIX (CIRCLE ONE): ☒ WIFE ☐ PAINT		SOIL		OTHER			
LABORATORY #	SAMPLE #	LOCATION	AREA (FT ²)	SURFACE MATERIAL				LAB RESULT			
	W-09	Room # 826 North side Univert (back wall)	1	WOOD	METAL	BRICK	OTHER	9.8			
	W-10	Room # 803 South side Right side Univert (back wall)	1		X			12.2			
	W-11	Room # 803 South side Middle Univert (back wall)	1		X			49.0			
	W-12	Room # 803 South side Left Univert (back wall)	1		X			49.0			
	W-13	Room # 803 East side Univert (back wall)	1		X			49.0			
	W-14	F/B						49.0			
	W-15	F/B						49.0			
Fax results to Taylor: (212) 406-2535			TURNAROUND REQUIRED: NORMAL ☐ STAT ☐ BY 1/1				COMMENTS / INSTRUCTIONS 6 hr FAT.				
RELINQUISHED BY (SIGNATURE) <i>[Signature]</i>		DATE 7/19/02	PRINTED NAME Al. Kacaron		RECEIVED BY (SIGNATURE) R. Drouina		DATE 7.20.01	PRINTED NAME R. Drouina			
RELINQUISHED BY (SIGNATURE)		DATE	PRINTED NAME		RECEIVED BY LAB (SIGNATURE)		DATE	PRINTED NAME			
		TIME					TIME				

WHITE - OFFICE / YELLOW - LAB / PINK - CLIENT

07348

CITY_21MC100_008878522

ATC ASSOCIATES, INC
 104 E 25th Street, 10th Floor
 New York, NY 10910
 Tel. 212-353-8280
 Fax 212-353-8306

REPORT DATE: 07-22-02
CLIENT: Taylor Environmental Group, Inc.
PROJECT NAME: SCA/Stuyvesant HS
 345 Chambers Street, NY
 8th, 10th Floors
PROJECT NUMBER: M477-15217-29881
SAMPLED BY: Client
SAMPLE DATE: 07-19-02
DATE RECEIVED: 07-20-02
DATE ANALYZED: 07-20-02
SAMPLE MEDIA: Dust Wipe Sample
ANALYSIS REQUIRED: Method EPA 3050/7420

ANALYSIS RESULTS

SAMPLE ID	BATCH NO.	SAMPLE DESCRIPTION	LEAD CONCENTRATION (µg/ft ²)	DETECTION LIMIT (µg/ft ²)
W-01	20511	Rm #1017A Top Unit Vent (Composit Sample)	<9.0	9.0
W-02	20511	Rm #1017A Bottom Unit Vent South Side Back Wall	<9.0	9.0
W-03	20511	Rm #801 East Side Unit Vent Back Wall	<9.0	9.0
W-04	20511	Rm #807 South Side Unit Vent Back Wall	<9.0	9.0
W-05	20511	Rm #809 South Side Unit Vent Back Wall	<9.0	9.0
W-06	20511	Rm #811 South Side Right Unit Vent Back Wall	<9.0	9.0
W-07	20511	Rm #811 South Side Middle Unit Vent Back Wall	<9.0	9.0
W-08	20511	Rm #811 South Side Left Unit Vent Back Wall	<9.0	9.0
W-09	20511	Rm #826 North Side Unit Vent Back Wall	9.8	9.0
W-10	20511	Rm #803 South Side Right Unit Vent Back Wall	12.2	9.0
W-11	20511	Rm #803 South Side Middle Unit Vent Back Wall	<9.0	9.0
W-12	20511	Rm #803 South Side Left Unit Vent Back Wall	<9.0	9.0
W-13	20511	Rm #803 East Side Unit Vent Back Wall	<9.0	9.0
W-14	20511	Field Blank	<9.0 µg	9.0 µg

07349

TAYLOR ENVIRONMENTAL GROUP, INC.
130 JERICHO TPKE., FLORAL PARK, NY 11001

6 HRS TAT

20906

516-358-2955
Fax 516-358-1780

LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT

CLIENT NAME/ADDRESS NYC BGA		CONTACT: HAMID SAUOJ.		SAMPLER (SIGNATURE) <i>Carlos Jofat</i>		DATE 7-19-02		TIME		SAMPLE(S) SEALED ☒ YES ☐ NO	
PROJECT LOCATION: STUYVESANT H.S.		PROJECT # K477-15217 / 29881		SAMPLER NAME (PRINT) CARLOS JOFAT						CORRECT CONTAINER(S) ☒ YES ☐ NO	
SAMPLE INFORMATION:				MATRIX (CIRCLE ONE): ☒ WOOD ☐ PAINT ☐ SOIL ☐ OTHER							
LABORATORY #	SAMPLE #	LOCATION	AREA (FT ²)	SURFACE MATERIAL				LAB RESULT			
				WOOD	METAL	BRICK	OTHER				
	LW-01	ROOM # 902. LEFT UNIT VENT - REAR	1		✓			≤ 9.0 <i>10/12</i>			
	LW-02	ROOM # 902 RIGHT UNIT VENT → REAR	1		✓			≤ 9.0			
	LW-03	ROOM # 804 LEFT UNIT VENT → REAR	1		✓			≤ 9.0			
	LW-04	ROOM # 804 RIGHT UNIT VENT → REAR	1		✓			≤ 9.0			
	LW-05	ROOM # 815 LEFT UNIT VENT → REAR	1		✓			≤ 9.0			
	LW-06	ROOM # 815 RIGHT UNIT VENT → REAR	1		✓			≤ 9.0			
	LW-07	ROOM # 827 LEFT UNIT VENT → REAR	1		✓			≤ 9.0			
	LW-08	ROOM # 827 CENTER UNIT VENT → REAR	1		✓			≤ 9.0			
				TURNAROUND REQUIRED: NORMAL ☐ STAT ☐ BY 1/1				COMMENTS / INSTRUCTIONS NIOSH Method 7082.			
RELINQUISHED BY (SIGNATURE) <i>Carlos Jofat</i>		DATE 7-19-02 TIME 11:00		PRINTED NAME CARLOS JOFAT		RECEIVED BY (SIGNATURE) <i>Alfred</i>		DATE 7-19-02		PRINTED NAME	
RELINQUISHED BY (SIGNATURE) <i>[Signature]</i>		DATE 7-19-02 TIME 5:00 PM		PRINTED NAME		RECEIVED BY LAB (SIGNATURE)		DATE		PRINTED NAME	

07350

For results to (red) WHITE - OFFICE / YELLOW - LAB / PINK - CLIENT

CITY_21MC100_008878524

TAYLOR ENVIRONMENTAL GROUP, INC.
130 JERICHO TPKE., FLORAL PARK, NY 11001

6 HRS TAT

20506

516-358-2955
Fax 516-358-1780

LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT

CLIENT NAME/ADDRESS NYC SEA		CONTACT: HANIB SAUOJ		SAMPLER (SIGNATURE) <i>Carlos J. Jofat</i>		DATE 7/9/02		TIME		SAMPLE(S) SEALED YES / NO	
PROJECT LOCATION: Stuyvesant H.S.		PROJECT # H117-15217 / 29881		SAMPLER NAME (PRINT) Carlos Jofat						CORRECT CONTAINER(S) YES / NO	
SAMPLE INFORMATION:				MATRIX (CIRCLE ONE): Wipe PAINT SOIL OTHER							
LABORATORY #	SAMPLE #	LOCATION	AREA (FT ²)	SURFACE MATERIAL				LAB RESULT			
				WOOD	METAL	BRICK	OTHER				
	LW-09	ROOM # 827. Right Und Vent → BEAR	1		✓			11.3			
	FB-1	FIELD BLANK	—	—	—	—	—	<9.0			
	FB-2	FIELD BLANK	—	—	—	—	—	<9.0			
				TURNAROUND REQUIRED: NORMAL ☐ STAT ☐ BY 1/1				COMMENTS / INSTRUCTIONS NIOSH Method 7082			
RELINQUISHED BY (SIGNATURE) <i>Carlos J. Jofat</i>		DATE 7/9/02	PRINTED NAME Carlos Jofat		RECEIVED BY (SIGNATURE) <i>Alfred G...</i>		DATE 7/19/02	PRINTED NAME			
RELINQUISHED BY (SIGNATURE)		DATE	PRINTED NAME		RECEIVED BY LAB (SIGNATURE)		DATE	PRINTED NAME			
		TIME					TIME				

WHITE - OFFICE / YELLOW - LAB / PINK - CLIENT

07351

CITY_21MC100_008878525

ATC ASSOCIATES, INC

104 E 25th Street, 10th Floor

New York, NY 10010

Tel. 212-353-8280

Fax 212-353-8306

REPORT DATE: 07-22-02

CLIENT: Taylor Environmental Group, Inc.

PROJECT NAME: SCA/Stuyvesant HS
345 Chambers Street, NY
9th, 8th Floors

PROJECT NUMBER: M477-15217-29881

SAMPLED BY: Client

SAMPLE DATE: 07-19-02
DATE RECEIVED: 07-19-02
DATE ANALYZED: 07-19-02

SAMPLE MEDIA: Dust Wipe Sample
ANALYSIS REQUIRED: Method EPA 3050/7420

ANALYSIS RESULTS

SAMPLE ID	BATCH NO.	SAMPLE DESCRIPTION	LEAD CONCENTRATION ($\mu\text{g}/\text{ft}^2$)	DETECTION LIMIT ($\mu\text{g}/\text{ft}^2$)
LW-01	20506	Room #902, Left Unit Vent - Rear	<9.0	9.0
LW-02	20506	Room #902, Right Unit Vent - Rear	<9.0	9.0
LW-03	20506	Room #804, Left Unit Vent - Rear	<9.0	9.0
LW-04	20506	Room #804, Right Unit Vent - Rear	<9.0	9.0
LW-05	20506	Room #815, Left Unit Vent - Rear	<9.0	9.0
LW-06	20506	Room #815, Right Unit Vent - Rear	<9.0	9.0
LW-07	20506	Room #827, Left Unit Vent - Rear	<9.0	9.0
LW-08	20506	Room #827, Center Unit Vent - Rear	<9.0	9.0
LW-09	20506	Room #827, Right Unit Vent - Rear	11.3	9.0
FB-1	20506	Field Blank	<9.0 μg	9.0 μg
FB-2	20506	Field Blank	<9.0 μg	9.0 μg

NOTE 1:

THE REPORTING LIMIT (RL) IS 18.0 μg

NOTE 2:

HUD Guidelines for final clearance dust wipe samples: Floor 40 $\mu\text{g}/\text{ft}^2$, Window sills 250 $\mu\text{g}/\text{ft}^2$, Window wells 400 $\mu\text{g}/\text{ft}^2$, Exterior surfaces 800 $\mu\text{g}/\text{ft}^2$.

NOTE 3:

Blank units are in μg

07352

CITY_21MC100_008878526

FOR ENVIRONMENTAL GROUP, INC.
30 JERICHO TPKE., FLORAL PARK, NY 11001

20516

516-358-2955
Fax 516-358-1780

LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT

CLIENT NAME/ADDRESS NYC SCA		CONTACT: HAMID SAUDJ.		SAMPLER (SIGNATURE) <i>Carlos A. Jofre</i> DATE 7-20-02		SAMPLE(S) SEALED ☒ YES ☐ NO	
PROJECT LOCATION: STUYVESANT H.S.		PROJECT # 11477-15217/29881		SAMPLER NAME (PRINT) CARLOS JOFRE		CORRECT CONTAINER(S) ☒ YES ☐ NO	
				MATRIX (CIRCLE ONE): ☒ WIFE ☐ PAINT ☐ SOIL ☐ OTHER			
SAMPLE INFORMATION:				AREA (FT ²)		SURFACE MATERIAL	
LABORATORY #	SAMPLE #	LOCATION		WOOD	METAL	BRICK	OTHER
	LW-01	ROOM # 903 A South side LEFT UNIT VENT REAR		L	☒		
	LW-02	ROOM # 903 A South side RIGHT UNIT VENT REAR		L	☒		
	LW-03	ROOM # 817 South side UNIT VENT REAR		L	☒		
	FB 1	FIELD BLANK					
	FB 2	FIELD BLANK					
				TURNAROUND REQUIRED: NORMAL ☐ STAT ☐ BY 1/1		COMMENTS / INSTRUCTIONS 6 HR TAT	
RELINQUISHED BY (SIGNATURE) <i>Carlos A. Jofre</i>		DATE 7-20-02 TIME	PRINTED NAME	RECEIVED BY (SIGNATURE)		DATE	PRINTED NAME
RELINQUISHED BY (SIGNATURE) <i>[Signature]</i>		DATE 7-20-02 TIME 4:30 PM	PRINTED NAME	RECEIVED BY LAB (SIGNATURE) <i>R. Brudina</i>		DATE 7-20-02 TIME 16:30	PRINTED NAME <i>R. Brudina</i>

WHITE - OFFICE / YELLOW - LAB / PINK - CLIENT

07363

CITY_21MC100_008878527

ATC ASSOCIATES, INC

104 E 25th Street, 10th Floor

New York, NY 10010

Tel. 212-353-8280

Fax 212-353-8306

REPORT DATE: 07-22-02

CLIENT: Taylor Environmental Group, Inc.

PROJECT NAME: SCA/Stuyvesant HS
345 Chambers Street, NY
8th-9th Floors

PROJECT NUMBER: M477-15217/29881

SAMPLED BY: Client

SAMPLE DATE: 07-20-02
DATE RECEIVED: 07-20-02
DATE ANALYZED: 07-20-02

SAMPLE MEDIA: Dust Wipe Sample
ANALYSIS REQUIRED: Method EPA 3050/7420

ANALYSIS RESULTS

SAMPLE ID	BATCH NO.	SAMPLE DESCRIPTION	LEAD CONCENTRATION (µg/ft²)	DETECTION LIMIT (µg/ft²)
LW-01	20516	Room #903A South Side Left Unit Vent Rear	<9.0	9.0
LW-02	20516	Room #903A South Side Right Unit Vent Rear	<9.0	9.0
LW-03	20516	Room #817 South Side Unit Vent Rear	<9.0	9.0
FB-1	20516	Field Blank	<9.0 µg	9.0 µg
FB-2	20516	Field Blank	<9.0 µg	9.0 µg

NOTE 1:

THE REPORTING LIMIT (RL) IS 18.0 µg


NOTE 2:

HUD Guidelines for final clearance dust wipe samples: Floor 40 µg/ft², Window sills 250 µg/ft², Window walls 400 µg/ft², Exterior surfaces 800 µg/ft².

NOTE 3:


Blank units are in µg


CERTIFICATION AND SIGNATURES

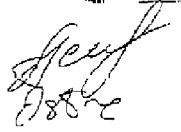ANALYSIS PERFORMED BY: 

REPORT PREPARED BY:

ATC certifies that this report is an accurate and authentic report of results obtained from the laboratory analysis.

QUALITY ASSURANCE COORDINATOR: 

LABORATORY DIRECTOR: 

ATC is accredited by the New York State Department of Health Environmental Laboratory Approval Program (ELAP) and by the American Industrial Hygiene Association (AIHA) to perform analysis of lead in paint, dust wipes, air and soil samples. (ELAP #10879), (AIHA #100229).

07354

TAYLOR ENVIRONMENTAL GROUP, INC.
130 JERICHO TPKE., FLORAL PARK, NY 11001

205/5

516-358-2955
Fax 516 358-1780

LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT

CLIENT NAME/ADDRESS NYC BCA		CONTACT HAROLD PEROZ		SAMPLER SIGNATURE <i>[Signature]</i>		DATE 7/20/02		TIME		SAMPLE(S) SEALED YES / NO	
PROJECT LOCATION: Stuyvesant H.S.		PROJECT # 1477-15217-2988		SAMPLER NAME (PRINT) Liz McKenzie						CORRECT CONTAINER(S) YES / NO	
SAMPLE INFORMATION:				MATRIX (CIRCLE ONE): PAINT SOIL OTHER							
LABORATORY #	SAMPLE #	LOCATION	AREA (FT ²)	SURFACE MATERIAL				LAB RESULT			
				WOOD	METAL	BRICK	OTHER				
	LW-01	Room 703, EAST side unit vent - Rear	1		✓			49.0			
	LW-02	Room 703 - South side Left unit vent - rear	1		✓			49.0			
	LW-03	Room 703 - South side Right unit vent - Rear	1		✓			49.0			
	FBL-1	Field Blank						49.0			
	FBL-2	Field Blank						49.0			
				TURNAROUND REQUIRED: NORMAL ☐ STAT ☐ BY 1/1				COMMENTS / INSTRUCTIONS 6 HR TAT			
RELINQUISHED BY (SIGNATURE) <i>[Signature]</i>		DATE 7/20/02		PRINTED NAME		RECEIVED BY (SIGNATURE)		DATE		PRINTED NAME	
		TIME 1:00						TIME			
RELINQUISHED BY (SIGNATURE)		DATE		PRINTED NAME		RECEIVED BY LAB (SIGNATURE) R. Drudina		DATE 7.20.02		PRINTED NAME	
		TIME						TIME 16.30		R. Drudina	

WHITE - OFFICE / YELLOW - LAB / PINK - CLIENT

07355

CITY_21MC100_008878529

ATC ASSOCIATES, INC
 104 E 25th Street, 10th Floor
 New York, NY 10010
 Tel. 212-353-8280
 Fax 212-353-8306

REPORT DATE: 07-22-02
CLIENT: Taylor Environmental Group, Inc.
PROJECT NAME: SCA/Stuyvesant HS
 345 Chambers Street, NY
 7th Floor
PROJECT NUMBER: M477-15217-29881
SAMPLED BY: Client
SAMPLE DATE: 07-20-02
DATE RECEIVED: 07-20-02
DATE ANALYZED: 07-20-02
SAMPLE MEDIA: Dust Wipe Sample
ANALYSIS REQUIRED: Method EPA 3050/7420


ANALYSIS RESULTS

SAMPLE ID	BATCH NO	SAMPLE DESCRIPTION	LEAD CONCENTRATION (µg/ft²)	DETECTION LIMIT (µg/ft²)
LW-01	20515	Room #703 East Side Unit Vent Rear	<9.0	9.0
LW-02	20515	Room #703 South Side Left Unit Vent Rear	<9.0	9.0
LW-03	20515	Room #703 South Side Right Unit Vent Rear	<9.0	9.0
FBL-1	20515	Field Blank	<9.0 µg	9.0 µg
FBL-2	20515	Field Blank	<9.0 µg	9.0 µg


NOTE 1:
 THE REPORTING LIMIT (RL) IS 18.0 µg
 NOTE 2:
 HUD Guidelines for final clearance dust wipe samples: Floor 40 µg/ft², Window sills 250 µg/ft²,
 Window wells 400 µg/ft², Exterior surfaces 500 µg/ft².
 NOTE 3:
 Blank units are in µg


CERTIFICATION AND SIGNATURES

ANALYSIS PERFORMED BY: 

REPORT PREPARED BY: 


ATC certifies that this report is an accurate and authentic report of results obtained from the laboratory analysis.

QUALITY ASSURANCE COORDINATOR: 

LABORATORY DIRECTOR: 

ATC is accredited by the New York State Department of Health Environmental Laboratory Approval Program (ELAP) and by the American Industrial Hygiene Association (AIHA) to perform analysis of lead in paint, dust wipes, air and soil samples. (ELAP #10879), (AIHA 4100229).



07356

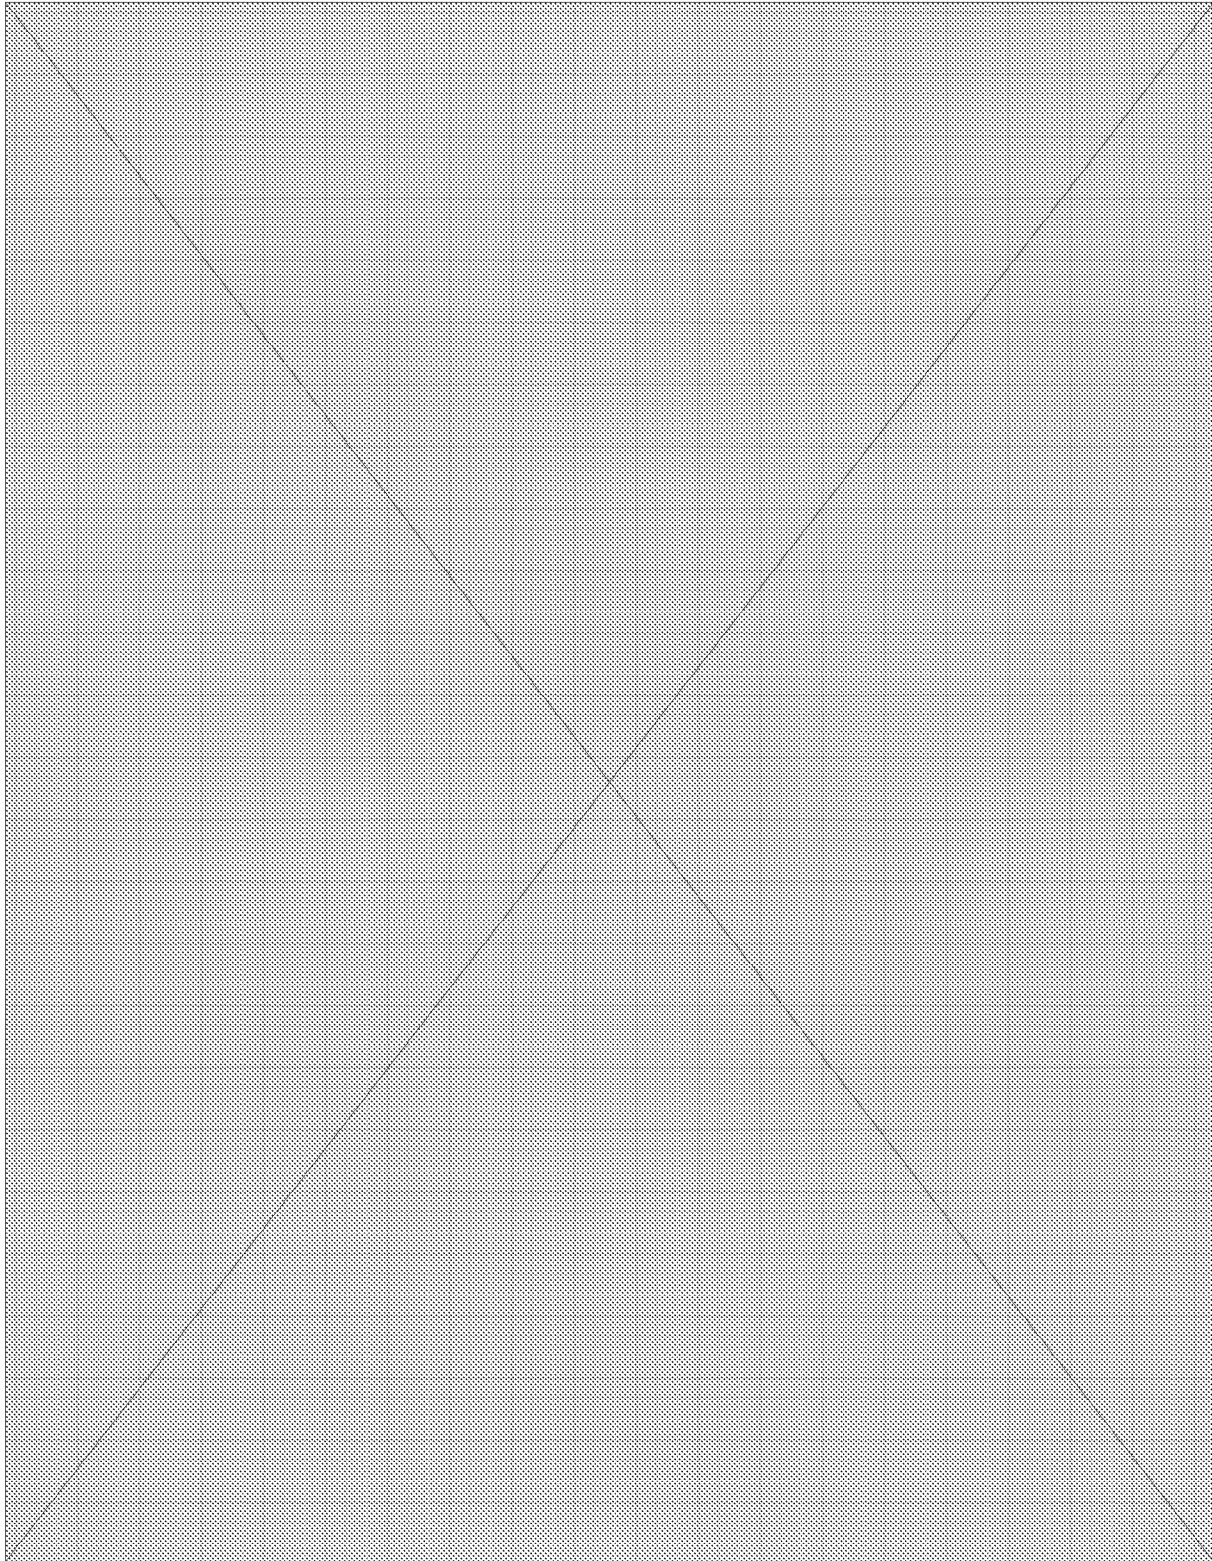

TAYLOR ENVIRONMENTAL GROUP, INC.
130 JERICHO TPKE., FLORAL PARK, NY 11001

516-358-2955
Fax 516-358-1780

LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT

CLIENT NAME/ADDRESS SCA		CONTACT: Hamid Saoud		SAMPLER (SIGNATURE) 		DATE 7/21/02		TIME		SAMPLE(S) SEALED ☒ YES ☐ NO	
PROJECT LOCATION: Stuyvesant H.S.		PROJECT # M477-15217/25881		SAMPLER NAME (PRINT) AL. Kazzan						CORRECT CONTAINER(S) ☒ YES ☐ NO	
SAMPLE INFORMATION:				MATRIX (CIRCLE ONE): ☒ WIFE ☐ PAINT ☐ SOIL ☐ OTHER							
LABORATORY #	SAMPLE #	LOCATION		AREA (FT ²)	SURFACE MATERIAL				LAB RESULT		
					WOOD	METAL	BRICK	OTHER			
	W-09	F/136							49.0		
				TURNAROUND REQUIRED: NORMAL ☐ STAT ☐ BY 1/1				COMMENTS / INSTRUCTIONS 6 hr P.A.D.			
RELINQUISHED BY (SIGNATURE) 		DATE 7/21/02 TIME 17:30		PRINTED NAME AL. Kazzan		RECEIVED BY (SIGNATURE)		DATE		PRINTED NAME	
RELINQUISHED BY (SIGNATURE)		DATE		PRINTED NAME		RECEIVED BY LAB (SIGNATURE)		DATE		PRINTED NAME	
		TIME						TIME			

WRITE - OFFICE / YELLOW - LAB / PINK - CLIENT

07368

CITY_21MC100_008878532

ATC ASSOCIATES, INC
 104 E 15th Street, 10th Floor
 New York, NY 10010
 Tel 212-353-8280
 Fax 212-353-8306

REPORT DATE: 07-22-02

CLIENT: Taylor Environmental Group, Inc.

PROJECT NAME: SCA/Stuyvesant HS
 345 Chambers Street, NY
 7th Floor

PROJECT NUMBER: M477-15217/29881

SAMPLED BY: Client

SAMPLE DATE: 07-21-02
DATE RECEIVED: 07-21-02
DATE ANALYZED: 07-21-02

SAMPLE MEDIA: Dust Wipe Sample
ANALYSIS REQUIRED: Method EPA 3050/7420

ANALYSIS RESULTS

SAMPLE ID	BATCH NO.	SAMPLE DESCRIPTION	LEAD CONCENTRATION (µg/ft²)	DETECTION LIMIT (µg/ft²)
W-01	20523	Room #701 East Side Univent Back Wall	<9.0	9.0
W-02	20523	Room #701A East Side Univent Back Wall	<9.0	9.0
W-03	20523	Room #705 South Side Right Univent Back Wall	<9.0	9.0
W-04	20523	Room #705 South Side Left Univent Back Wall	<9.0	9.0
W-05	20523	Room #707 South Side Univent Back Wall	<9.0	9.0
W-06	20523	Room #709 South Side Left Univent Back Wall	<9.0	9.0
W-07	20523	Room #709 South Side Right Univent Back Wall	<9.0	9.0
W-08	20523	Field Blank	<9.0 µg	9.0 µg
W-09	20523	Field Blank	<9.0 µg	9.0 µg

NOTE 1:

THE REPORTING LIMIT (RL) IS 18.0 µg

NOTE 2:

HUD Guidelines for final clearance dust wipe samples: Floor 40 µg/ft², Window sills 250 µg/ft², Window wells 400 µg/ft², Exterior surfaces 800 µg/ft².

NOTE 3:

Blank units are in µg

07359

CITY_21MC100_008878533

TAYLOR ENVIRONMENTAL GROUP, INC.
130 JERICHO TPKE., FLORAL PARK, NY 11001

#20526

516-358-2955
Fax 516-358-1780

LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT

CLIENT NAME/ADDRESS SCA	CONTACT: Hamid Savog	SAMPLER (SIGNATURE) <i>AL. KARAKON</i>	DATE 7/21/02	TIME	SAMPLE(S) SEALED (YES) NO
PROJECT LOCATION: Stuyvesant H.S.	PROJECT # 11488-15217/29881	SAMPLER NAME (PRINT) AL. KARAKON	MATRIX (CIRCLE ONE): WIP PAINT SOIL OTHER		CORRECT CONTAINER(S) (YES) NO

SAMPLE INFORMATION:			AREA (FT ²)	SURFACE MATERIAL				LAB RESULT
LABORATORY #	SAMPLE #	LOCATION		WOOD	METAL	BRICK	OTHER	
	2W-01	Room # 702 North side Univert (back wall)	1		X			29.0
	2W-02	Room # 704 North side Univert (back wall)	1		X			29.0
	2W-03	Room # 715 (South side) Right Univert (back wall)	1		X			29.0
	2W-04	Room # 715 South side Left Univert (back wall)	1		X			13.2
	2W-05	Room # 717 South side Left Univert (back wall)	1		X			29.0
	2W-06	Room # 717 South side Right Univert (back wall)	1		X			29.0
	2W-07	Room # 727 South side Right Univert (back wall)	1		X			29.0
	2W-08	Room # 727 South side Left Univert (back wall)	1		X			29.0

2nd set for today.

TURNAROUND REQUIRED:

COMMENTS / INSTRUCTIONS

NORMAL ☐ STAT ☐ BY 11

6hr TAT

RELINQUISHED BY (SIGNATURE) <i>[Signature]</i>	DATE 7/21/02	PRINTED NAME AL. KARAKON	RECEIVED BY (SIGNATURE) <i>[Signature]</i>	DATE 7/21/02	PRINTED NAME
RELINQUISHED BY (SIGNATURE)	DATE	PRINTED NAME	RECEIVED BY LAB (SIGNATURE)	DATE	PRINTED NAME

WHITE - OFFICE / YELLOW - LAB / PINK - CLIENT

07360

CITY_21MC100_008878534


516-358-2955
Fax 516-358-1700

LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT

[illegible]

07361

WHITE OFFICE LONDON EAD / BIRMINGHAM / GLASGOW

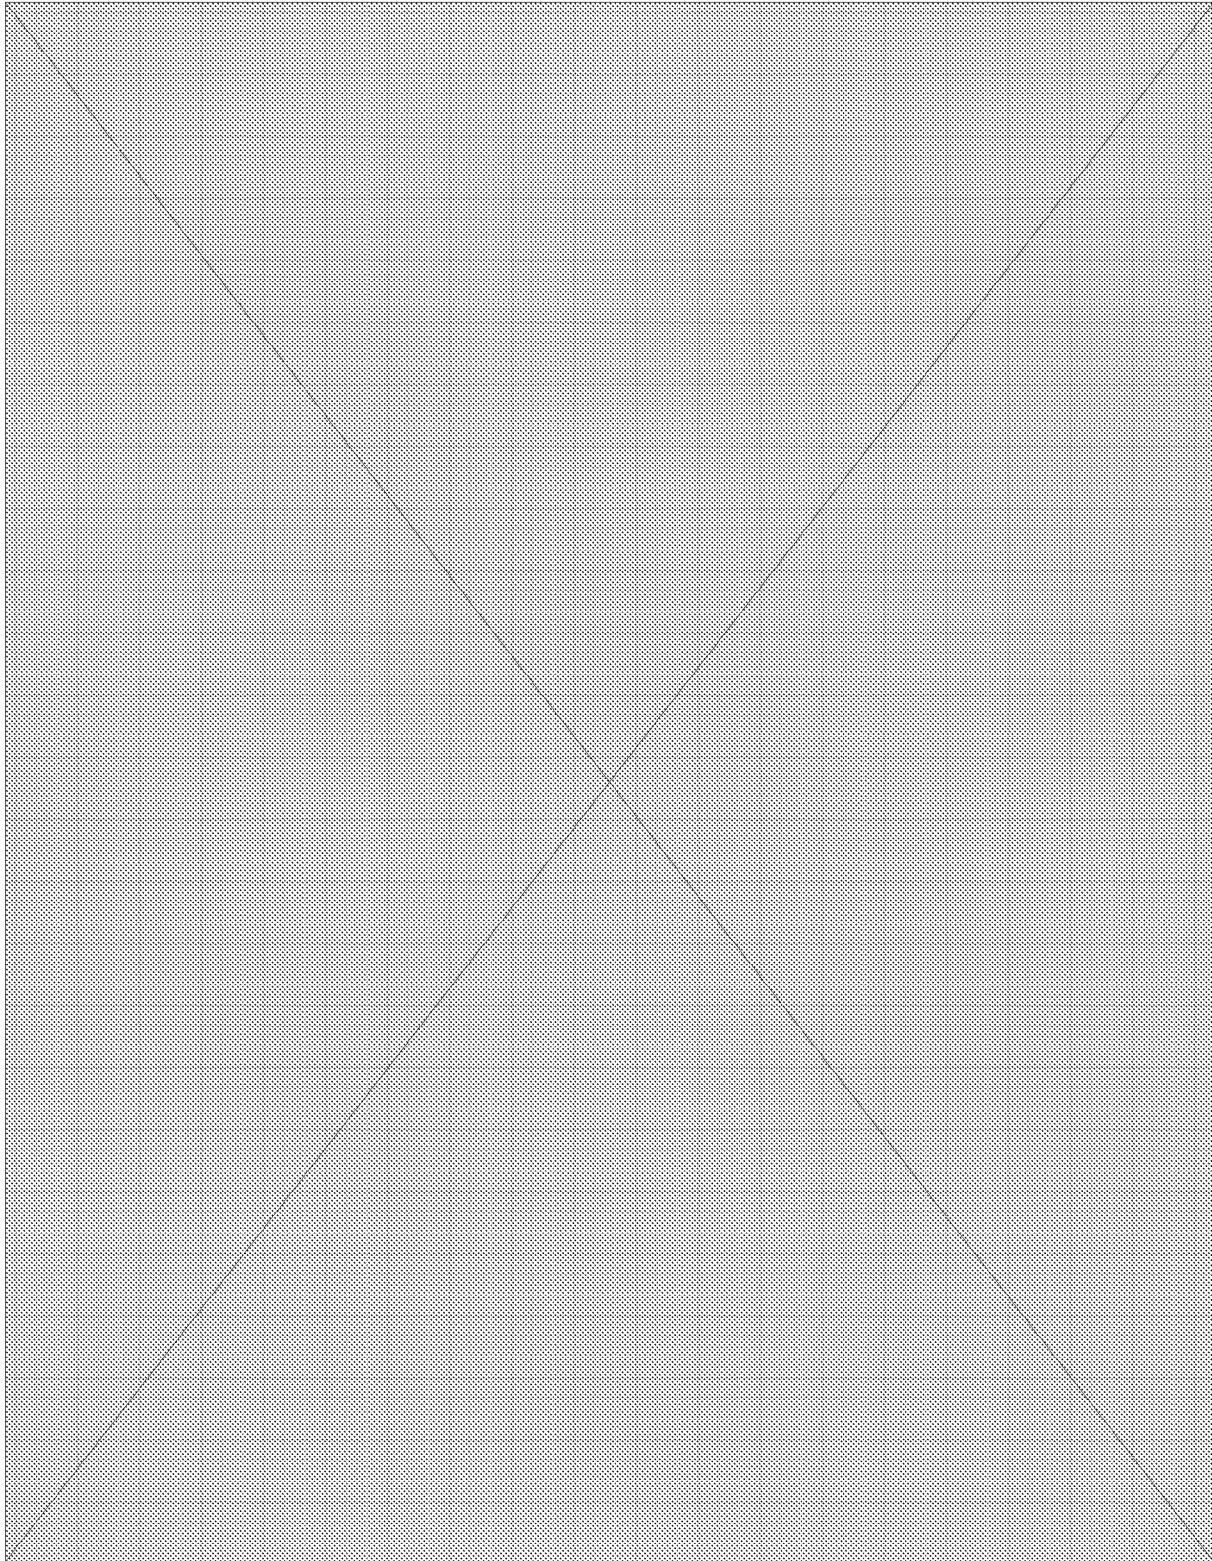

TAYLOR ENVIRONMENTAL GROUP, INC.
130 JERICHO TPKE., FLORAL PARK, NY 11001

20538

516-358-2955
Fax 516-358-1700

LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT

CLIENT NAME/ADDRESS Sch. Stuyvesant		CONTACT Hamed Sawoj		SAMPLER (SIGNATURE) <i>[Signature]</i>		DATE 7/22/02	TIME 12:00	SAMPLE(S) SEALED ☒ YES ☐ NO
PROJECT LOCATION: 345 Chambers St		PROJECT # M-472-1527		SAMPLER NAME (PRINT) Petraulek		CORRECT CONTAINER(S) ☒ YES ☐ NO		
SAMPLE INFORMATION:				MATRIX (CIRCLE ONE): ☒ WIFE ☐ PAINT ☐ SOIL ☐ OTHER				
LABORATORY #	SAMPLE #	LOCATION	AREA (FT ²)	SURFACE MATERIAL				LAB RESULT $\mu\text{g}/\text{ft}^2$
				WOOD	METAL	BRICK	OTHER	
	1	UN. VANTS rm 739 right	1		X			16.0
	2	↓ left	1		X			<9.0
	3	rm 737 right	1		X			<9.0
	4	↓ left	1		X			<9.0
	5	rm 735 right	1		X			<9.0
	6	↓ left	1		X			<9.0
	7	rm 731 right 4	1		X			<9.0
	8	↓ right 3	1		X			<9.0
TURNAROUND REQUIRED: ☒ NORMAL ☐ STAT BY <i>(9/16)</i>				COMMENTS / INSTRUCTIONS w/ petraulek from left to right				
RELINQUISHED BY (SIGNATURE) <i>[Signature]</i>		DATE 7/25/02 TIME 12:30	PRINTED NAME Petraulek		RECEIVED BY (SIGNATURE) <i>[Signature]</i>		DATE 7/22/02 TIME 12:00	PRINTED NAME
RELINQUISHED BY (SIGNATURE)		DATE TIME	PRINTED NAME		RECEIVED BY LAB (SIGNATURE) <i>[Signature]</i>		DATE 7/22/02 TIME 12:00	PRINTED NAME

07363

WHITE - OFFICE / YELLOW - LAB / PINK - CLIENT

TAYLOR ENVIRONMENTAL GROUP, INC.
130 JERICHO TPKE., FLORAL PARK, NY 11001

20538
516-358-2955
Fax 516-358-1780

LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT

CLIENT NAME/ADDRESS Sch Stuyvesant		CONTACT: Hand Sew		SAMPLER SIGNATURE Peterson		DATE 7/22/02		TIME 12		SAMPLE(S) SEALED YES NO	
PROJECT LOCATION: 825 Chamber m 472-15213		PROJECT # m 472-15213		SAMPLER NAME (PRINT) Peterson		CORRECT CONTAINER(S) YES NO					
SAMPLE INFORMATION:				MATRIX (CIRCLE ONE): Wipe Paint Soil Other							
LABORATORY #	SAMPLE #	LOCATION	AREA (FT ²)	SURFACE MATERIAL				LAB RESULT			
				WOOD	METAL	BRICK	OTHER				
	9	UNION m 731 right 2	1		X			29.0			
	10	left 1	1		X			29.0			
	11	m 722 1	1		X			12.2			
	12	m 726 1	1		X			<9.0			
	13	m 736 right	1		X			<9.0			
	14	m 736 Left	1		X			11.7			
	15	m 738 right	1		X			<9.0			
	16	m 738 Left	1		X			<9.0			
				TURNAROUND REQUIRED: NORMAL ☐ STAT ☐ BY 6/10				COMMENTS / INSTRUCTIONS			
RELINQUISHED BY (SIGNATURE) [Signature]		DATE 7/22/02		PRINTED NAME Peterson		RECEIVED BY (SIGNATURE) [Signature]		DATE 7/22/02		PRINTED NAME	
RELINQUISHED BY (SIGNATURE)		DATE		PRINTED NAME		RECEIVED BY LAB (SIGNATURE) [Signature]		DATE 7/22/02		PRINTED NAME	

WHITE - OFFICE / YELLOW - LAB / PINK - CLIENT

07364

CITY_21MC100_008878538

20538

07365

Fax 310-336-1700

LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT

CLIENT NAME/ADDRESS <i>Sara Sturges</i>		CONTACT: <i>Hand Saw;</i>		SAMPLER [SIGNATURE] <i>[Signature]</i>		DATE <i>7/2/02</i>	TIME <i>12⁰⁰</i>	SAMPLE(S) SEALED YES / NO <i>(YES)</i>
PROJECT LOCATION: <i>345 Chambers</i>		PROJECT # <i>gn 472 152B</i>		SAMPLER NAME [PRINT] <i>Retraxer</i>		CORRECT CONTAINER? YES / NO <i>(YES)</i>		
SAMPLE INFORMATION:				MATRIX [CIRCLE ONE]: <i>(WIFE)</i> PAINT SOIL OTHER _____				
LABORATORY #	SAMPLE #	LOCATION	AREA (FT²)	SURFACE MATERIAL				LAB RESULT
				WOOD	METAL	BRICK	OTHER	
	<i>17</i>	<i>university right</i>	<i>1</i>		<i>X</i>			<i><9.0</i>
	<i>18</i>	<i>left</i>	<i>1</i>		<i>X</i>			<i><9.0</i>
	<i>FB-1</i>	<i>Field Blak</i>						
	<i>FB-2</i>	<i>Field Blak</i>						
				TURNAROUND REQUIRED: NORMAL ☐ STAT ☐ BY <i>[Signature]</i>		COMMENTS / INSTRUCTIONS <i>Fax to [Signature] 212 405 23</i> <i>+ 516 358 4779</i>		
RELINQUISHED BY [SIGNATURE] <i>[Signature]</i>	DATE <i>7/2/02</i> TIME <i>3r</i>	PRINTED NAME <i>Retraxer</i>	RECEIVED BY [SIGNATURE] <i>[Signature]</i>		DATE <i>7/2/02</i> TIME <i>1400</i>	PRINTED NAME		
RELINQUISHED BY [SIGNATURE]	DATE <i>7/2/02</i> TIME	PRINTED NAME	RECEIVED BY LAB [SIGNATURE] <i>In [Signature]</i>		DATE <i>7/2/02</i> TIME <i>1400</i>	PRINTED NAME		

WHITE - OFFICE / YELLOW - LAB / PINK - CLIENT

ATC ASSOCIATES, INC

104 E 25th Street, 10th Floor

New York, NY 10010

Tel. 212-353-8280

Fax 212-353-8306

REPORT DATE: 07-22-02
CLIENT: Taylor Environmental Group, Inc.
PROJECT NAME: SCA/Stuyvesant HS
 345 Chambers Street, NY
 7th Floor
PROJECT NUMBER: M477-15217/29881
SAMPLED BY: Client
SAMPLE DATE: 07-22-02
DATE RECEIVED: 07-22-02
DATE ANALYZED: 07-22-02
SAMPLE MEDIA: Dust Wipe Sample
ANALYSIS REQUIRED: Method EPA 3050/7420

ANALYSIS RESULTS

SAMPLE ID	BATCH NO.	SAMPLE DESCRIPTION	LEAD CONCENTRATION (µg/ft²)	DETECTION LIMIT (µg/ft²)
01	20538	Room 739 Right	16.0	9.0
02	20538	Room 739 Left	<9.0	9.0
03	20538	Room 737 Right	<9.0	9.0
04	20538	Room 737 Left	<9.0	9.0
05	20538	Room 735 Right	<9.0	9.0
06	20538	Room 735 Left	<9.0	9.0
07	20538	Room 731 Right 4	<9.0	9.0
08	20538	Room 731 Right 3	<9.0	9.0
09	20538	Room 731 Right 2	<9.0	9.0
10	20538	Room 731 Left 1	<9.0	9.0
11	20538	Room 729	12.2	9.0
12	20538	Room 726	<9.0	9.0
13	20538	Room 736 Right	<9.0	9.0
14	20538	Room 736 Left	11.7	9.0
15	20538	Room 738 Right	<9.0	9.0
16	20538	Room 738 Left	<9.0	9.0

07366

ATC ASSOCIATES, INC
 104 E 25th Street, 10th Floor
 New York, NY 10010
 Tel. 212-353-8280
 Fax 212-353-8306

17	20538	Room 740 Right	<9.0	9.0
18	20538	Room 740 Left	<9.0	9.0
FB-1	20538	Field Blank	<9.0 µg	9.0 µg
FB-2	20538	Field Blank	<9.0 µg	9.0 µg

NOTE 1:

THE REPORTING LIMIT (RL) IS 18.0 µg

NOTE 2:

HUD Guidelines for final clearance dust wipe samples: Floor 40 µg/ft², Window sills 250 µg/ft²,
 Window wells 400 µg/ft², Exterior surfaces 800 µg/ft²

NOTE 3:

Blank units are in µg

CERTIFICATION AND SIGNATURES

ANALYSIS PERFORMED BY: *JK*

REPORT PREPARED BY: *Frank*

ATC certifies that this report is an accurate and authentic report of results obtained from the laboratory analysis.

QUALITY ASSURANCE COORDINATOR: *UM*

LABORATORY DIRECTOR: *M.L.*

ATC is accredited by the New York State Department of Health Environmental Laboratory Approval Program (ELAP) and by the American Industrial Hygiene Association (AIHA) to perform analysis of lead in paint, dust wipes, air and soil samples. (ELAP #10879), (AIHA #100229).

07367

CITY_21MC100_008878541

TAYLOR ENVIRONMENTAL GROUP, INC.
130 JERICHO TPKE., FLORAL PARK, NY 11001

516-358-2955
Fax 516-358-1780

20543

LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT											
CLIENT NAME/ADDRESS SEA Stuyvesant			CONTACT Hamid Savor		SAMPLER (SIGNATURE) [Signature]		DATE 7/20		TIME 3:10		
PROJECT LOCATION 345 Chambers			PROJECT # W477-15217		SAMPLE (PRINT) [Signature]		SAMPLE(S) SEALED YES / NO		CORRECT CONTAINER(S) YES / NO		
SAMPLE INFORMATION:					MATRIX (CIRCLE ONE): ☒ WIFE ☐ PAINT ☐ SOIL ☐ OTHER						
			AREA (FT ²)		SURFACE MATERIAL				LAB RESULT		
LABORATORY #	SAMPLE #	LOCATION			WOOD	METAL	BRICK	OTHER			
	19	rm 639 left	1			1			14.4		
	20	↓ right	1			1			25.8		
	21	rm 640 left	1			1			16.8		
	22	↓ right	1			1			15.3		
	FB-3	Field Blk							<9.0		
	FB-4	Field Blk							<9.0		
					TURNAROUND REQUIRED: NORMAL ☐ STAT ☐ BY 1/1			COMMENTS / INSTRUCTIONS			
RELINQUISHED BY (SIGNATURE) [Signature]			DATE 7/22		PRINTED NAME			RECEIVED BY (SIGNATURE) [Signature]		DATE 7/22	
RELINQUISHED BY (SIGNATURE)			DATE		PRINTED NAME			RECEIVED BY (SIGNATURE)		DATE	
			TIME							TIME	

WHITE - OFFICE / YELLOW - LAB / PINK - CLIENT

07368

CITY_21MC100_008878542

ATC ASSOCIATES, INC

104 E 25th Street, 10th Floor

New York, NY 10010

Tel. 212-353-8280

Fax 212-353-8306

REPORT DATE: 07-23-02
CLIENT: Taylor Environmental Group, Inc.
PROJECT NAME: SCA/Stuyvesant HS
345 Chambers Street, NY
PROJECT NUMBER: M477-15217
SAMPLED BY: Client
SAMPLE DATE: 07-22-02
DATE RECEIVED: 07-22-02
DATE ANALYZED: 07-22-02
SAMPLE MEDIA: Dust Wipe Sample
ANALYSIS REQUIRED: Method EPA 3050/7420


ANALYSIS RESULTS

SAMPLE ID	BATCH NO.	SAMPLE DESCRIPTION	LEAD CONCENTRATION ($\mu\text{g}/\text{ft}^2$)	DETECTION LIMIT ($\mu\text{g}/\text{ft}^2$)
19	20543	Rm 639 Left	14.4	9.0
20	20543	Rm 639 Right	25.8	9.0
21	20543	Rm 640 Left	16.8	9.0
22	20543	Rm 640 Right	15.3	9.0
FB-3	20543	Field Blank	<9.0 μg	9.0 μg
FB-4	20543	Field Blank	<9.0 μg	9.0 μg

NOTE 1:**THE REPORTING LIMIT (RL) IS 18.0 μg** **NOTE 2:**HUD Guidelines for final clearance dust wipe samples: Floor 40 $\mu\text{g}/\text{ft}^2$, Window sills 250 $\mu\text{g}/\text{ft}^2$, Window wells 400 $\mu\text{g}/\text{ft}^2$, Exterior surfaces 800 $\mu\text{g}/\text{ft}^2$.**NOTE 3:**Blank units are in μg

07369

CITY_21MC100_008878543



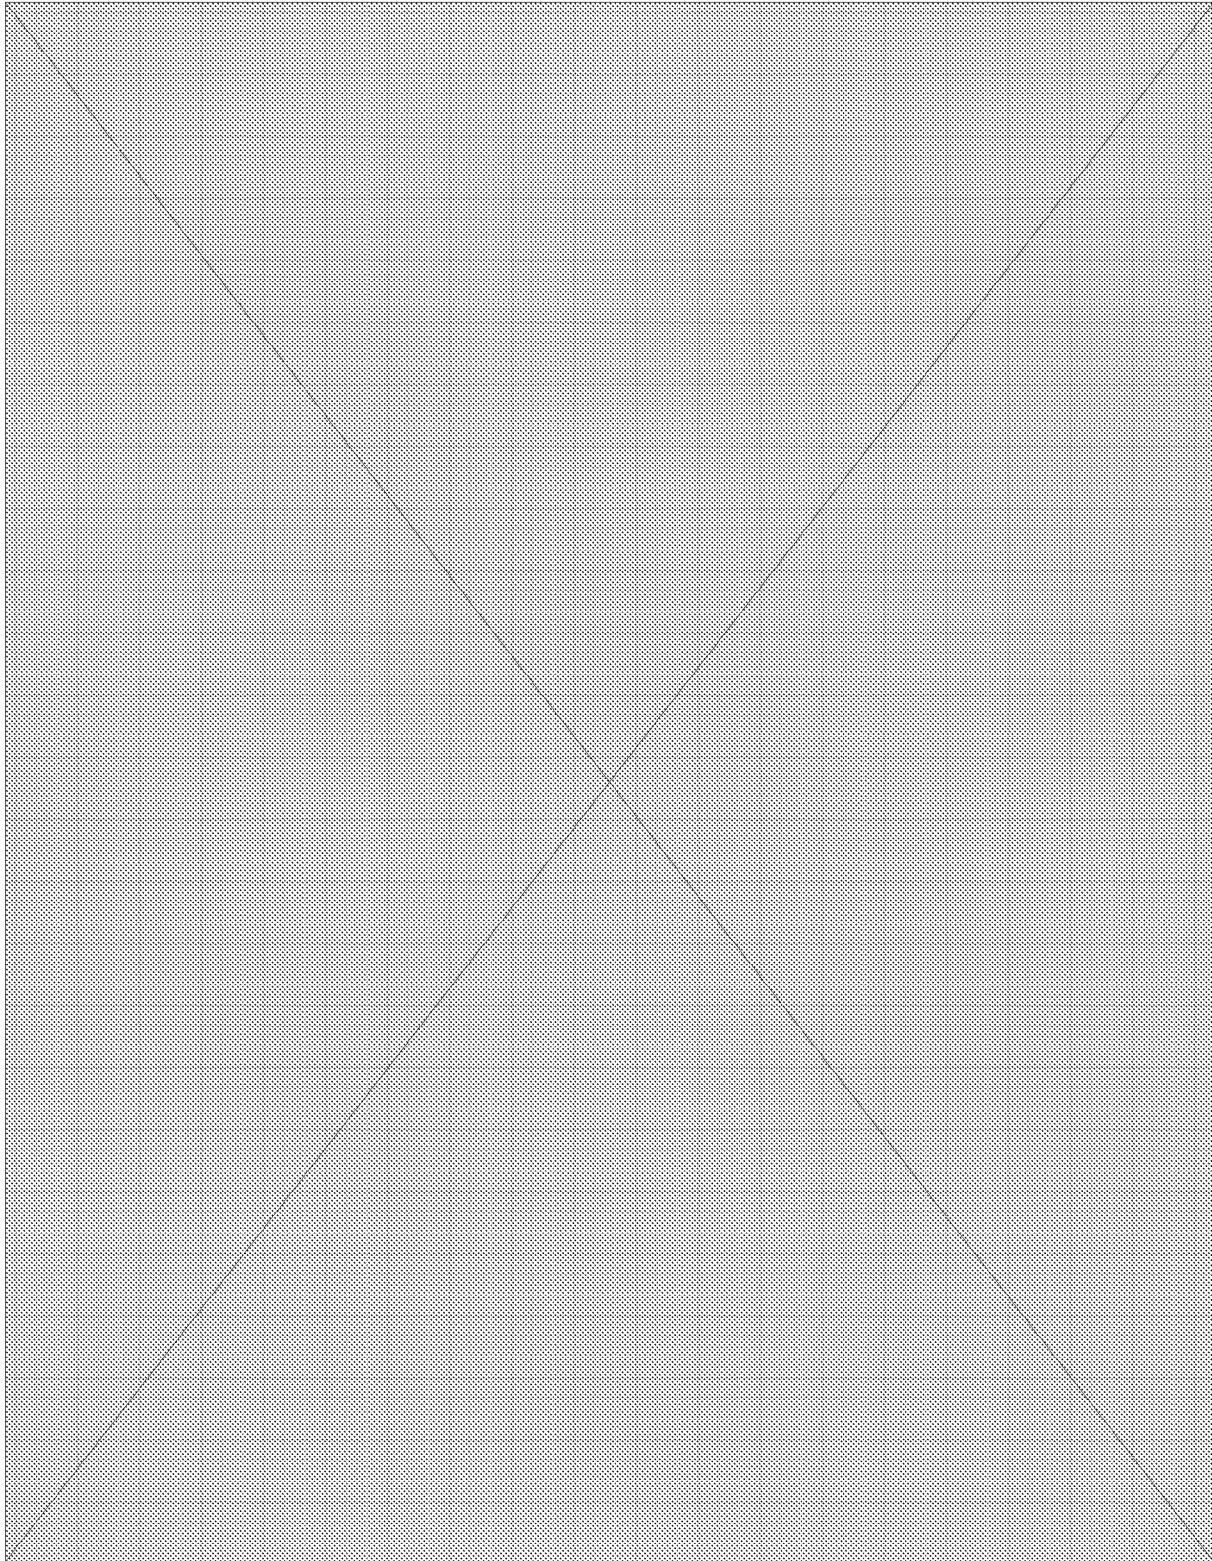


TAYLOR ENVIRONMENTAL GROUP, INC.
130 JERICHO PIKE., FLORAL PARK, NY 11001

20539

516-358-2955
Fax 516-358-1780

LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT

CLIENT NAME/ADDRESS SCA		CONTACT: Harold Savoy		SAMPLER SIGNATURE 		DATE 7/22/02		TIME		SAMPLE(S) SEALED ☒ YES / NO	
PROJECT LOCATION: Stuyvesant H.S.		PROJECT # M477-15217/29881		SAMPLER NAME (PRINT) R. Kuznetsov		CORRECT CONTAINER(S) ☒ YES / NO					
SAMPLE INFORMATION:				MATRIX (CIRCLE ONE): ☒ WIFE PAINT SOIL OTHER							
				AREA (FT ²)				SURFACE MATERIAL			
				WOOD METAL BRICK OTHER				LAB RESULT mg/ft ²			
LABORATORY #	SAMPLE #	LOCATION									
	W-09	F/B								49.0	
	W-10	F/B								49.0	
Please fax results to Taylor: (212) 406-2535				TURNAROUND REQUIRED: NORMAL ☐ STAT ☐ BY 1/1				COMMENTS / INSTRUCTIONS Gha TAT.			
RELINQUISHED BY (SIGNATURE) 		DATE 7/23/02 TIME 01:00		PRINTED NAME R. Kuznetsov		RECEIVED BY (SIGNATURE) 		DATE 7.23.02 TIME		PRINTED NAME R. Divudina	
RELINQUISHED BY (SIGNATURE)		DATE TIME		PRINTED NAME		RECEIVED BY LAB (SIGNATURE)		DATE TIME		PRINTED NAME	

WHITE - OFFICE / YELLOW - LAB / PINK - CLIENT

07371

CITY_21MC100_008878545

ATC ASSOCIATES, INC
104 E 25th Street, 10th Floor
New York, NY 10010
Tel. 212-353-8280
Fax 212-353-8306

REPORT DATE: 07-23-02

CLIENT: Taylor Environmental Group, Inc.

PROJECT NAME: SCA/Stuyvesant HS
345 Chambers Street, NY

PROJECT NUMBER: M477-15217/29881

SAMPLED BY: Client

SAMPLE DATE: 07-22-02
DATE RECEIVED: 07-22-02
DATE ANALYZED: 07-22-02

SAMPLE MEDIA: Dust Wipe Sample
ANALYSIS REQUIRED: Method EPA 3050/7420

ANALYSIS RESULTS

SAMPLE ID	BATCH NO.	SAMPLE DESCRIPTION	LEAD CONCENTRATION (µg/ft²)	DETECTION LIMIT (µg/ft²)
W-01	20559	Rm 638 North Side Left Univent (Back Wall)	9.7	9.0
W-02	20559	Rm 639 North Side Right Univent (Back Wall)	<9.0	9.0
W-03	20559	Rm 615B South Side Left Univent (Back Wall)	<9.0	9.0
W-04	20559	Rm 615B South Side Right Univent (Back Wall)	<9.0	9.0
W-05	20559	Rm 636 North Side Right Univent (Back Wall)	<9.0	9.0
W-06	20559	Rm 636 North Side Right Univent (Back Wall)	<9.0	9.0
W-07	20559	Rm 627 South Side Right Univent (Back Wall)	<9.0	9.0
W-08	20559	Rm 627 South Side Left Univent (Back Wall)	<9.0	9.0
W-09	20559	Field Blank	<9.0 µg	9.0 µg
W-10	20559	Field Blank	<9.0 µg	9.0 µg

NOTE 1:

THE REPORTING LIMIT (RL) IS 18.0 µg

NOTE 2:

HUD Guidelines for final clearance dust wipe samples: Floor 40 µg/ft², Window sills 250 µg/ft², Window wells 400 µg/ft², Exterior surfaces 800 µg/ft².

NOTE 3:

Blank units are in µg

07372

CITY_21MC100_008878546

TAYLOR ENVIRONMENTAL GROUP, INC.
130 JERICHO TPKE., FLORAL PARK, NY 11001

20599

193

516-358-2955

Fax 516-358-1700

LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT

CLIENT NAME/ADDRESS NYC SCA		CONTACT: Hamid Sados		SAMPLE(S) SIGNATURE(S) [Signature]		DATE 7/23/02		TIME 11:00		SAMPLE(S) SEALED (YES) / NO	
PROJECT LOCATION: Stuyvesant H.S. 245 Chambers St. NY		PROJECT # M477-15217-29881		SAMPLER NAME (PRINT) Kirk McKenzie		CORRECT CONTAINER(S) (YES) / NO					
SAMPLE INFORMATION:				MATRIX (CIRCLE ONE): (PAVE) PAINT SOIL OTHER							
LABORATORY #	SAMPLE #	LOCATION	AREA (FT ²)	SURFACE MATERIAL				LAB RESULT			
	LW-01	ROOM 601 - EAST SIDE Unit Vent - Rear	1	WOOD	METAL	BRICK	OTHER	18.3			
	LW-02	ROOM 615 - EAST SIDE Unit Vent - Rear	1		✓			24.4			
	LW-03	ROOM 615 - South side Unit Vent "A" - Rear	1		✓			30.1			
	LW-04	ROOM 615 - South side Unit Vent "B" - Rear	1		✓			29.0			
	LW-05	ROOM 615 - South side Unit Vent "C" - Rear	1		✓			29.0			
	LW-06	ROOM 615 - South side Unit Vent "D" - Rear	1		✓			15.5			
	LW-07	ROOM 615 - South side Unit Vent "E" - Rear	1		✓			11.7			
	LW-08	ROOM 615 - South side Unit Vent "F" - Rear	1		✓			13.3			
				TURNAROUND REQUIRED: NORMAL ☐ STAT ☐ BY 11				COMMENTS / INSTRUCTIONS 6 HR TAT			
RELINQUISHED BY (SIGNATURE) [Signature]		DATE 7/24/02 TIME 10:05		PRINTED NAME Kirk McKenzie		RECEIVED BY (SIGNATURE) [Signature]		DATE 7/23/02		PRINTED NAME [Signature]	
RELINQUISHED BY (SIGNATURE) [Signature]		DATE 7/24/02 TIME 1:00		PRINTED NAME Tara M. [Signature]		RECEIVED BY LAB (SIGNATURE)		DATE 7/24/02		PRINTED NAME	

WHITE - OFFICE / YELLOW - LAB / PINK - CLIENT

07373

CITY_21MC100_008878547

TAYLOR ENVIRONMENTAL GROUP, INC.
130 JERICHO TPKE., FLORHAM PARK, NY 11001

2872
516-358-2955
Fax 516-358-1780

LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT

CLIENT NAME/ADDRESS NYC SCA		CONTACT HAROLD SANDS		SAMPLER SIGNATURE <i>[Signature]</i>		DATE 7/23/02		TIME		SAMPLE(S) SEALED (YES) / NO	
PROJECT LOCATION: Stuyvesant HS. 345 Chambers St. N.Y.		PROJECT # M477-15217-29881		SAMPLER NAME (PRINT) Kirk McKenzie						CORRECT CONTAINER(S) (YES) / NO	
SAMPLE INFORMATION:				MATRIX (CIRCLE ONE): (VAPE) PAINT SOIL OTHER							
LABORATORY #	SAMPLE #	LOCATION	AREA (FT ²)	SURFACE MATERIAL				LAB RESULT			
				WOOD	METAL	BRICK	OTHER				
	LW-09	ROOM 615-South side unit vent "G" - Rear	1		✓			<9.0			
	LW-10	ROOM 615-South side unit vent "H" - Rear	1		✓			<9.0			
	LW-11	ROOM 615-South side unit vent "I" - Rear	1		✓			<9.0			
	LW-12	ROOM 615-South side unit vent "J" - Rear	1		✓			<9.0			
	LW-13	ROOM 615-South side unit vent "K" - Rear	1		✓			<9.0			
	LW-14	ROOM 629/635-South side Left unit vent - Rear	1		✓			<9.0			
	LW-15	ROOM 629/635-South side Left Center unit vent - Rear	1		✓			<9.0			
	LW-16	ROOM 629/635-South side Right Center unit vent - Rear	1		✓			<9.0			
				TURNAROUND REQUIRED: NORMAL ☐ STAT ☐ BY 11				COMMENTS / INSTRUCTIONS 6 HR. TOT			
RELINQUISHED BY (SIGNATURE) <i>[Signature]</i>		DATE 7/23/02		PRINTED NAME Kirk McKenzie		RECEIVED BY (SIGNATURE) <i>[Signature]</i>		DATE 07/23/02		PRINTED NAME	
RELINQUISHED BY (SIGNATURE)		DATE		PRINTED NAME		RECEIVED BY LAB (SIGNATURE)		DATE		PRINTED NAME	
		TIME						TIME			

WHITE - OFFICE / YELLOW - LAB / PINK - CLIENT

07374

CITY_21MC100_008878548

383

LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT

07375

WHITE - OFFICE / YELLOW - BAR / PINK - CLIENT

ATC ASSOCIATES, INC
104 E 25th Street, 10th Floor
New York, NY 10010
Tel 212-353-8280
Fax 212-353-8306

REPORT DATE: 07-24-02
CLIENT: Taylor Environmental Group, Inc.
PROJECT NAME: SCA/Snyvesant HS
 345 Chambers Street, NY
PROJECT NUMBER: M477-15217/29881
SAMPLED BY: Client
SAMPLE DATE: 07-23-02
DATE RECEIVED: 07-23-02
DATE ANALYZED: 07-23-02
SAMPLE MEDIA: Dust Wipe Sample
ANALYSIS REQUIRED: Method EPA 3050/7420

ANALYSIS RESULTS

SAMPLE ID	BATCH NO.	SAMPLE DESCRIPTION	LEAD CONCENTRATION ($\mu\text{g}/\text{ft}^2$)	DETECTION LIMIT ($\mu\text{g}/\text{ft}^2$)
LW-01	20599	Rm 601 East Side Unitvent Rear	18.3	9.0
LW-02	20599	Rm 615 East Side Unitvent Rear	24.4	9.0
LW-03	20599	Rm 615 South Side Unitvent A Rear	30.1	9.0
LW-04	20599	Rm 615 South Side Unitvent B Rear	<9.0	9.0
LW-05	20599	Rm 615 South Side Unitvent C Rear	<9.0	9.0
LW-06	20599	Rm 615 South Side Unitvent D Rear	15.5	9.0
LW-07	20599	Rm 615 South Side Unitvent E Rear	11.7	9.0
LW-08	20599	Rm 615 South Side Unitvent F Rear	13.3	9.0
LW-09	20599	Rm 615 South Side Unitvent G Rear	<9.0	9.0
LW-10	20599	Rm 615 South Side Unitvent H Rear	<9.0	9.0
LW-11	20599	Rm 615 South Side Unitvent I Rear	<9.0	9.0
LW-12	20599	Rm 615 South Side Unitvent J Rear	<9.0	9.0
LW-13	20599	Rm 615 South Side Unitvent K Rear	<9.0	9.0
LW-14	20599	Rm 629/635 South Side Left Center Unitvent Rear	<9.0	9.0
LW-15	20599	Rm 629/635 South Side Left Center Unitvent Rear	<9.0	9.0

07376

ATC ASSOCIATES, INC
104 E 25th Street, 10th Floor
New York, NY 10010
Tel. 212-353-8280
Fax 212-353-8306

LW-16	20599	Rm 329/635 South Side Right Center Unitvent Rear	<9.0	9.0
LW-17	20599	Rm 329/635 South Side Right Unitvent Rear	<9.0	9.0
LW-18	20599	Rm 639 South Side Left Unitvent Rear	<9.0	9.0
LW-19	20599	Rm 639 South Side Right Unitvent Rear	<9.0	9.0
FBL-1	20599	Field Blank	<9.0 µg	9.0 µg
FBL-2	20599	Field Blank	<9.0 µg	9.0 µg

NOTE 1:

THE REPORTING LIMIT (RL) IS 18.0 µg

NOTE 2:

HUD Guidelines for final clearance dust wipe samples: Floor 40 µg/ft², Window sills 250 µg/ft², Window walls 400 µg/ft², Exterior surfaces 800 µg/ft².

NOTE 3:

Blank units are in µg

CERTIFICATION AND SIGNATURESANALYSIS PERFORMED BY: SCAREPORT PREPARED BY: [Signature]

ATC certifies that this report is an accurate and authentic report of results obtained from the laboratory analysis.

QUALITY ASSURANCE COORDINATOR: [Signature]LABORATORY DIRECTOR: [Signature]

ATC is accredited by the New York State Department of Health Environmental Laboratory Approval Program (ELAP) and by the American Industrial Hygiene Association (AIHA) to perform analysis of lead in paint, dust wipes, air and soil samples. (ELAP #10879), (AIHA #100225).

07377

CITY_21MC100_008878551

TAYLOR ENVIRONMENTAL GROUP, INC.
130 JERICHO TPKE., FLORAL PARK, NY 11001

516-358-2955
Fax 516-358-1780

1 of 3 20614


LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT

CLIENT NAME/ADDRESS SCA Stuyvesant		CONTACT Hamm Saw		SAMPLER (SIGNATURE) <i>[Signature]</i>		DATE 7/2/00	TIME 10a	SAMPLE(S) SEALED	YES / NO
PROJECT LOCATION: 345 Chambers St.		PROJECT # m477-15217-29881		SAMPLER NAME (PRINT) P. Hamm				CORRECT CONTAINER(S)	YES / NO
SAMPLE INFORMATION:				MATRIX (CIRCLE ONE):		☒ WIPE ☐ SCRAPE ☐ OTHER			
LABORATORY #	SAMPLE #	LOCATION	AREA (FT ²)	SURFACE MATERIAL				LAB RESULT	
				WOOD	METAL	BRICK	OTHER		
	1	Librany 815 (En 616) east s.d. rear window	1		X			29.0	
	2	Librany 815 (En 616) "A" rear window	1		X			24.4	
	3	m525 left window	1		X			22.3	
	4	m525 right window	1		Y			21.2	
	5	m513 left	1		X			32.5	
	6	right	1		Y			29.0	
	7	m513 left	1		X			15.1	
	8	↓ right	1		Y			29.0	
TURNAROUND REQUIRED:				NORMAL ☐ STAT ☐ BY 10/10		COMMENTS / INSTRUCTIONS Fax 212-400-2535			
RELINQUISHED BY (SIGNATURE)		DATE/TIME 7/2/00 5:28p		PRINTED NAME		RECEIVED BY (SIGNATURE) <i>[Signature]</i>		DATE/TIME 7/2/00 6p	
RELINQUISHED BY (SIGNATURE)		DATE/TIME		PRINTED NAME		RECEIVED BY LAB (SIGNATURE)		DATE/TIME	

WHITE - OFFICE / YELLOW - LAB / PINK - CLIENT

07378

CITY_21MC100_008878552

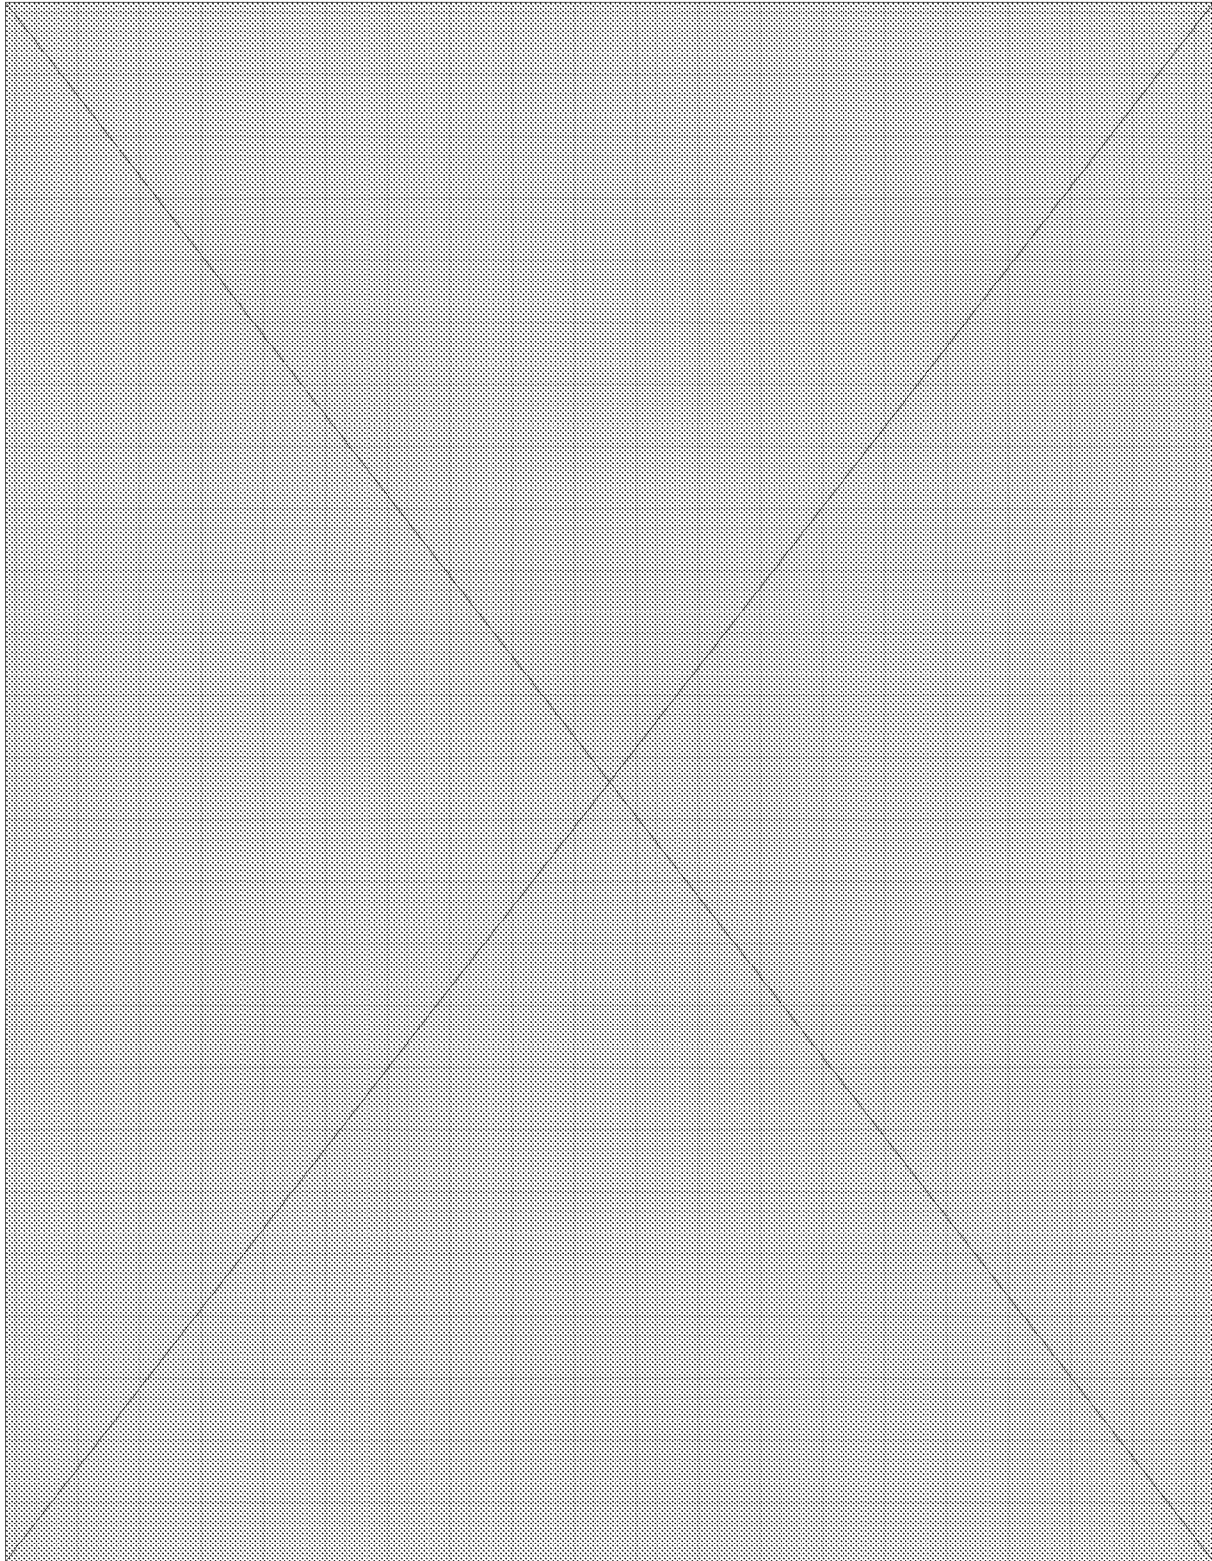

ATC ASSOCIATES, INC

104 E 25th Street, 10th Floor

New York, NY 10010

Tel. 212-353-8280

Fax 212-353-8306

REPORT DATE: 07-25-02
CLIENT: Taylor Environmental Group, Inc.
PROJECT NAME: SCA/Stuyvesant HS
 345 Chambers Street, NY
PROJECT NUMBER: M477-15217/29881
SAMPLED BY: Client
SAMPLE DATE: 07-24-02
DATE RECEIVED: 07-24-02
DATE ANALYZED: 07-24-02
SAMPLE MEDIA: Dust Wipe Sample
ANALYSIS REQUIRED: Method EPA 3050/7420

ANALYSIS RESULTS

SAMPLE ID	BATCH NO.	SAMPLE DESCRIPTION	LEAD CONCENTRATION (µg/ft²)	DETECTION LIMIT (µg/ft²)
01	20614	Library/615 East Side Rear Unitvent	<9.0	9.0
02	20614	Library/315 A Rear Unitvent	24.4	9.0
03	20614	Rm 525 Left Unitvent	22.3	9.0
04	20614	Rm 525 Right Unitvent	21.2	9.0
05	20614	Rm 513 Left	32.5	9.0
06	20614	Rm 513 Right	<9.0	9.0
07	20614	Rm 513 Left	15.1	9.0
08	20614	Rm 513 Right	<9.0	9.0
09	20614	Rm 501C Unitvent	<9.0	9.0
10	20614	Rm 501B Unitvent	13.9	9.0
11	20614	Rm 508 Unitvent Left	13.3	9.0
12	20614	Rm 508 Unitvent Right	20.3	9.0
13	20614	Rm 531 Unitvent Right	<9.0	9.0
14	20614	Rm 531 Unitvent Center	<9.0	9.0
15	20614	Rm 531 Unitvent Left	<9.0	9.0

07200

TAYLOR ENVIRONMENTAL GROUP, INC.
130 JERICHO TPKE., FLORAL PARK, NY 11001

20598

516-358-2955
Fax 516-358-1780

LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT

CLIENT NAME/ADDRESS NYC SCH		CONTACT: HAROLD SAWOJ		SAMPLER(S) SIGNATURE(S) <i>[Signature]</i>		DATE 11.24.02		TIME		SAMPLE(S) SEATED ☒ YES ☐ NO	
PROJECT LOCATION: STUYVESANT H.S. 345 CHAMBERS ST. NY, NY		PROJECT # M477-15217-29881		SAMPLER NAME (PRINT) KIRK MC KENZIE						CORRECT CONTAINER(S) ☒ YES ☐ NO	
SAMPLE INFORMATION:				MATRIX (CIRCLE ONE): ☒ WIPE ☐ PAINT ☐ SOIL ☐ OTHER							
LABORATORY #	SAMPLE #	LOCATION	AREA (FT ²)	SURFACE MATERIAL				LAB RESULT			
				WOOD	METAL	BRICK	OTHER				
	LW-01	ROOM 501 C UNIT VENT - REAR	1		☒			21.9			
	LW-02	ROOM 503 - LEFT SIDE UNIT VENT - REAR	1		☒			13.4			
	LW-03	ROOM 503 - RIGHT SIDE UNIT VENT - REAR	1		☒			< 9.0			
	LW-04	ROOM 505 - LEFT SIDE UNIT VENT - REAR	1		☒			12.9			
	LW-05	ROOM 505 - RIGHT SIDE UNIT VENT - REAR	1		☒			< 9.0			
	LW-06	ROOM 1024 D UNIT VENT - REAR	1 composit		☒			< 9.0			
	FBL-1	Field Blank						< 9.0			
	FBL-2	Field Blank						< 9.0			
				TURNAROUND REQUIRED: NORMAL ☐ STAT ☐ BY 1/1				COMMENTS / INSTRUCTIONS 6 HR TAT			
RELINQUISHED BY (SIGNATURE) <i>[Signature]</i>		DATE 7/24/02 TIME 00:05		PRINTED NAME Kirk McKenzie		RECEIVED BY (SIGNATURE) <i>[Signature]</i>		DATE 11/23/02		PRINTED NAME A. M.	
RELINQUISHED BY (SIGNATURE) <i>[Signature]</i>		DATE 7.24.02 TIME 1:00		PRINTED NAME Teresa M. M. M.		RECEIVED BY LAB (SIGNATURE) <i>[Signature]</i>		DATE		PRINTED NAME	

WHITE - OFFICE / YELLOW - LAB / PINK - CLIENT

07381

CITY_21MC100_008878555

ATC ASSOCIATES, INC
 104 E 25th Street, 10th Floor
 New York, NY 10010
 Tel. 212-353-8280
 Fax 212-353-8306

REPORT DATE: 07-24-02
 CLIENT: Taylor Environmental Group, Inc.
 PROJECT NAME: SCA/Stuyvesant HS
 345 Chambers Street, NY
 PROJECT NUMBER: M477-15217/29881
 SAMPLED BY: Client
 DATE RECEIVED: 07-23-02
 DATE ANALYZED: 07-23-02
 SAMPLE MEDIA: Dust Wipe Sample
 ANALYSIS REQUIRED: Method EPA 3050/7420

ANALYSIS RESULTS

SAMPLE ID	BATCH NO.	SAMPLE DESCRIPTION	LEAD CONCENTRATION ($\mu\text{g}/\text{ft}^2$)	DETECTION LIMIT ($\mu\text{g}/\text{ft}^2$)
LW-01	20598	Rm 501C Univent Rear	21.9	9.0
LW-02	20598	Rm 503 Left Side Univent Rear	13.4	9.0
LW-03	20598	Rm 503 Right Side Univent Rear	<9.0	9.0
LW-04	20598	Rm 505 Left Side Univent Rear	12.9	9.0
LW-05	20598	Rm 505 Right Side Univent Rear	<9.0	9.0
LW-06	20598	Rm 1024A Univent Rear	<9.0	9.0
LW-07	20598	Field Blank	<9.0 μg	9.0 μg
LW-08	20598	Field Blank	<9.0 μg	9.0 μg

NOTE 1:

THE REPORTING LIMIT (RL) IS 18.0 μg

NOTE 2:

HUD Guidelines for final clearance dust wipe samples: Floor 40 $\mu\text{g}/\text{ft}^2$, Window sills 250 $\mu\text{g}/\text{ft}^2$, Window wells 400 $\mu\text{g}/\text{ft}^2$, Exterior surfaces 500 $\mu\text{g}/\text{ft}^2$.

NOTE 3:

Blank units are in μg

07383

CITY_21MC100_008878556

TAYLOR ENVIRONMENTAL GROUP, INC.
130 JERICHO TPKE., FLORAL PARK, NY 11001

20633 192

516-358-2955
Fax 516-358-1780


LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT

CLIENT NAME/ADDRESS NYC SCA		CONTACT: HAMID SAVOS		SAMPLER SIGNATURE [Signature]		DATE 7/24/02		TIME 		SAMPLE(S) SEALED (YES) NO	
PROJECT LOCATION: Stuyvesant H.S. 345 Chambers ST. NY		PROJECT # M477-15217-29881		SAMPLER NAME (PRINT) Kirk McKenzie						CORRECT CONTAINER(S) (YES) NO	
SAMPLE INFORMATION:				MATRIX (CIRCLE ONE): (VAPE) PAINT SOL OTHER							
LABORATORY #	SAMPLE #	LOCATION	AREA (FT ²)	SURFACE MATERIAL				LAB RESULT ug/ft²			
				WOOD	METAL	BRICK	OTHER				
	LW-01	Room 911 South side Left ceiling unit vent - Pumper	1		✓						49.0
	LW-02	Room 511, South side Left unit vent - Rear	1		✓						49.0
	LW-03	Room 511, South side Right unit vent - Rear	1		✓						13.3
	LW-04	Room 403, South side Left unit vent - Rear	1		✓						49.0
	LW-05	Room 403, South side Right unit vent - Rear	1		✓						49.0
	LW-06	Room 405, South side Left unit vent - Rear	1		✓						49.0
	LW-07	Room 405, South side Right unit vent - Rear	1		✓						49.0
	LW-08	Room 407, South side Left unit vent - Rear	1		✓						49.0
				TURNAROUND REQUIRED: NORMAL ☐ STAT ☐ BY 1/1				COMMENTS / INSTRUCTIONS 6 HR TAT			
RELINQUISHED BY (SIGNATURE) [Signature]		DATE 7/24/02 TIME 0015		PRINTED NAME Kirk McKenzie		RECEIVED BY (SIGNATURE) R. Diordina		DATE 7.25.02 TIME 00.30		PRINTED NAME R. Diordina	
RELINQUISHED BY (SIGNATURE) [Signature]		DATE 7/24/02 TIME 01.40		PRINTED NAME GARY McKenzie		RECEIVED BY LAB (SIGNATURE)		DATE TIME		PRINTED NAME	

WHITE - OFFICE / YELLOW - LAB / PINK - CLIENT

07383

CITY_21MC100_008878557

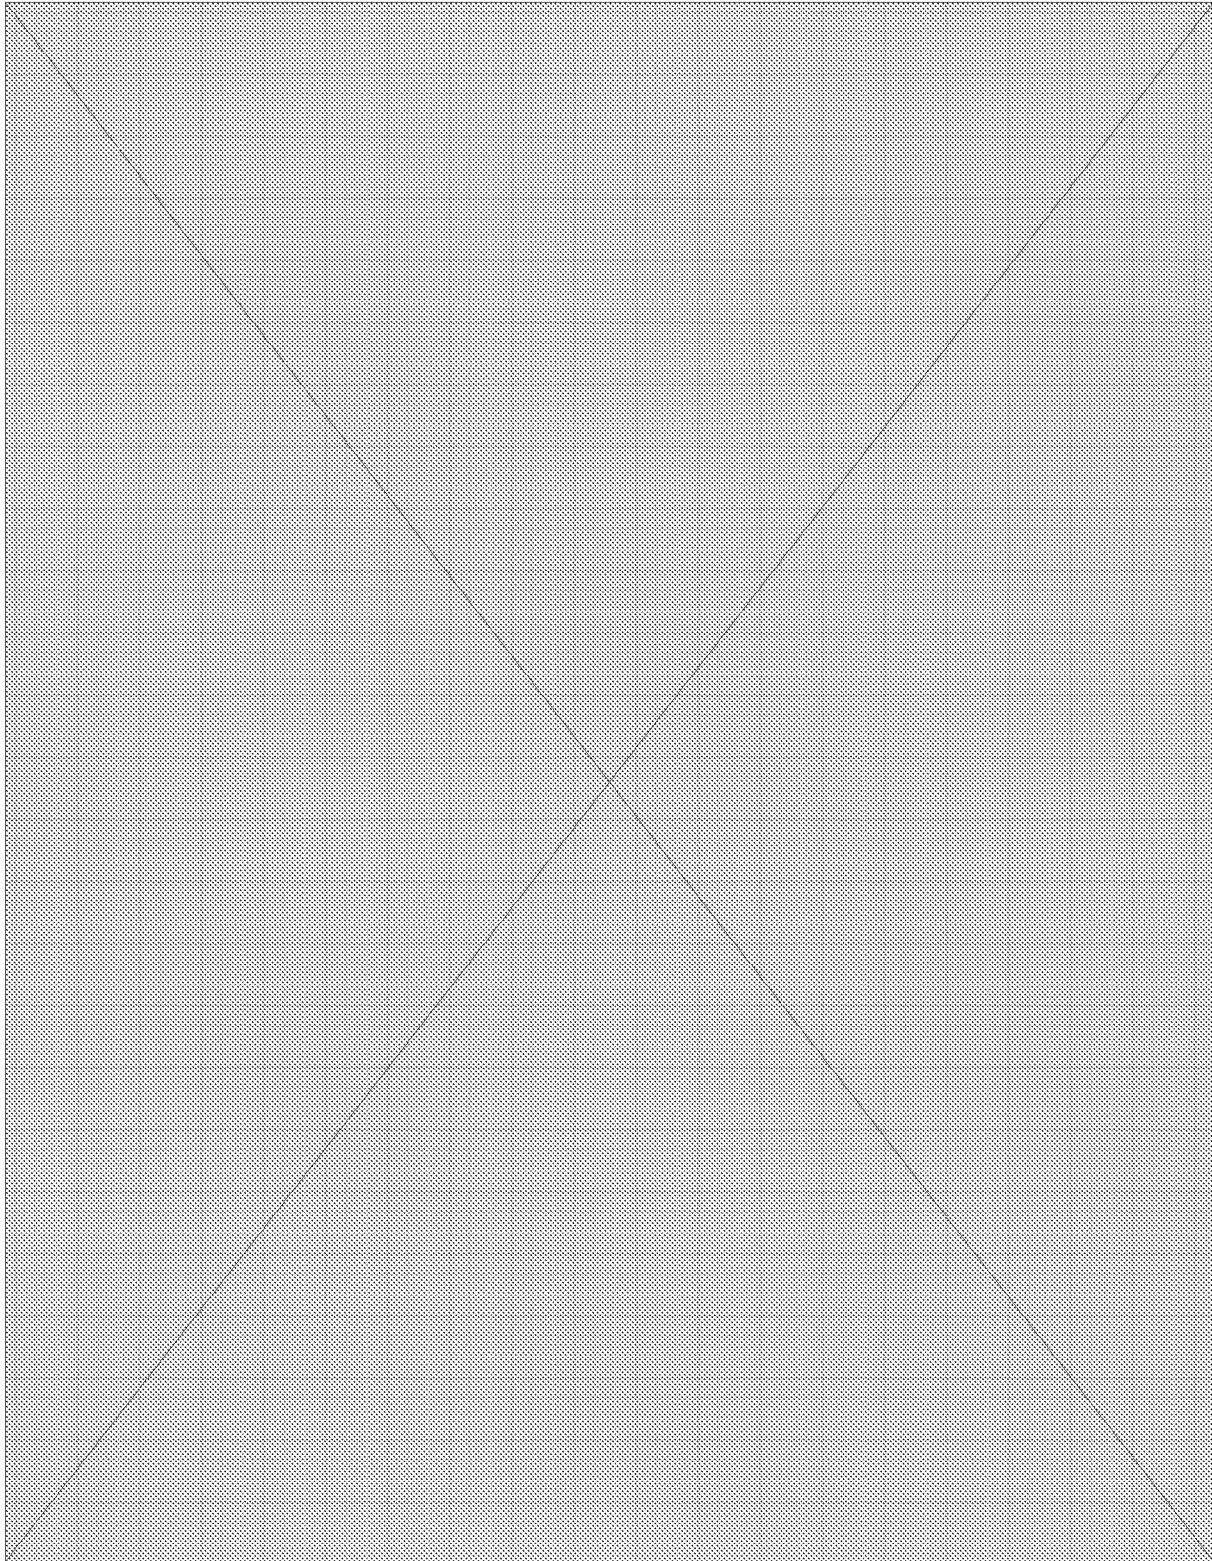

ATC ASSOCIATES, INC
 104 E 25th Street, 10th Floor
 New York, NY 10010
 Tel. 212-353-8280
 Fax 212-353-8306

REPORT DATE: 07-25-02
 CLIENT: Taylor Environmental Group, Inc
 PROJECT NAME: SCA/Stuyvesant HS
 345 Chambers Street, NY
 PROJECT NUMBER: M477-15217/29881
 SAMPLED BY: Client
 SAMPLE DATE: 07-24-02
 DATE RECEIVED: 07-25-02
 DATE ANALYZED: 07-25-02
 SAMPLE MEDIA: Dust Wipe Sample
 ANALYSIS REQUIRED: Method EPA 3050/7420

ANALYSIS RESULTS

SAMPLE ID	BATCH NO.	SAMPLE DESCRIPTION	LEAD CONCENTRATION ($\mu\text{g}/\text{ft}^2$)	DETECTION LIMIT ($\mu\text{g}/\text{ft}^2$)
LW-01	20633	Rm 911 South Side Left Ceiling Unitvent Damper Composit	<9.0	9.0
LW-02	20633	Rm 511 South Side Left Unitvent Rear	<9.0	9.0
LW-03	20633	Rm 511 South Side Right Unitvent Rear	13.3	9.0
LW-04	20633	Rm 403 South Side Left Unitvent Rear	<9.0	9.0
LW-05	20633	Rm 403 South Side Right Unitvent Rear	<9.0	9.0
LW-06	20633	Rm 405 South Side Left Unitvent Rear	<9.0	9.0
LW-07	20633	Rm 405 South Side Right Unitvent Rear	<9.0	9.0
LW-08	20633	Rm 407 South Side Left Unitvent Rear	<9.0	9.0
LW-09	20633	Rm 407 South Side Right Unitvent Rear	<9.0	9.0
FBL-1	20633	Field Blank	<9.0 μg	9.0 μg
FBL-2	20633	Field Blank	<9.0 μg	9.0 μg

NOTE 1:

THE REPORTING LIMIT (RL) IS 18.0 μg

NOTE 2:

HUD Guidelines for final clearance dust wipe samples: Floor 40 $\mu\text{g}/\text{ft}^2$, Window sills 250 $\mu\text{g}/\text{ft}^2$, Window wells 400 $\mu\text{g}/\text{ft}^2$, Exterior surfaces 800 $\mu\text{g}/\text{ft}^2$.

NOTE 3:

Blank units are in μg

07205

TAYLOR ENVIRONMENTAL GROUP, INC.
130 JERICHO TPKE., FLORAL PARK, NY 11001

516-350-2955

Fax: 516-350-1780

LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT

CLIENT NAME/ADDRESS Stuyvesant			CONTACT Hon. J. Savio		SAMPLER SIGNATURE <i>[Signature]</i>		DATE 7/25/07		TIME 5:00		SAMPLE(S) SEALED YES / NO	
PROJECT LOCATION: 345 Chambers St			PROJECT # M422-1527-29881		SAMPLER NAME (PRINT) R. Savio						CORRECT CONTAINER(S) YES / NO	
SAMPLE INFORMATION:					MATRIX (CIRCLE ONE): <u>PAPE</u> PAINT SOIL OTHER							
LABORATORY #	SAMPLE #	LOCATION	AREA (FT ²)	SURFACE MATERIAL				LEAD RESULT				
				WOOD	METAL	BRICK	OTHER					
	1	5m 431 left	1		X			14.3				
	2	↓ right	1		Y			11.9				
	3	5m 429 right	1		Y			11.0				
	4	↓ left	1		X			14.2				
	5	5m 427 right	1		Y			26.5				
	6	↓ left	1		Y			23.4				
	7	5m 413 right	1		Y			29.0				
	8	↓ left	1		Y			29.0				
all samples from rear of uni-vent					TURNAROUND REQUIRED: NORMAL ☐ STAT ☐ BY 10/				COMMENTS / INSTRUCTIONS			
RECEIVED BY (SIGNATURE) <i>[Signature]</i>		DATE 7/25/07		PRINTED NAME R. Savio		RECEIVED BY (SIGNATURE) <i>[Signature]</i>		DATE 7/25/07		PRINTED NAME		
RECEIVED BY (SIGNATURE)		DATE		PRINTED NAME		RECEIVED BY (SIGNATURE)		DATE		PRINTED NAME		

WHITE - OFFICE / YELLOW - LAB / PINK - CLIENT

07386

CITY_21MC100_008878560

TAYLOR ENVIRONMENTAL GROUP, INC.
130 JERICHO TPKE., FLORAL PARK, NY 11001

516-358-2955
Fax 516-358-1780

LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT

CLIENT NAME/ADDRESS <i>Stuyvesant</i>		CONTACT <i>Hand Served</i>		SAMPLER (SIGNATURE) <i>[Signature]</i>		DATE <i>2/25/07</i>	TIME <i>3:10</i>	SAMPLE(S) SEALED YES / NO
PROJECT LOCATION <i>345 Charles St</i>		PROJECT # <i>M427-15217-24881</i>		SAMPLER NAME (PRINT) <i>Robert</i>		CORRECT CONTAINER(S) YES / NO		
SAMPLE INFORMATION:				MATRIX (CIRCLE ONE): <u>WIFE</u> PAINT SOIL OTHER				
LABORATORY #	SAMPLE #	LOCATION	AREA (FT ²)	SURFACE MATERIAL				LAB RESULT
				WOOD	METAL	BRICK	OTHER	
	9	sm 411 right	1		X			<9.0
	10	↓ left	1		X			<9.0
	PA1	Field Blk						<9.0
	PA2	Field Blk						<9.0
Fax 516-358-1780 212-406-2535				TURNAROUND REQUIRED: NORMAL ☐ STAT ☐ BY <i>10/</i>		COMMENTS / INSTRUCTIONS		
RELINQUISHED BY (SIGNATURE) <i>[Signature]</i>		DATE <i>2/25/07</i>	PRINTED NAME <i>Robert</i>		RECEIVED BY (SIGNATURE) <i>[Signature]</i>		DATE <i>07/25/07</i>	PRINTED NAME
RELINQUISHED BY (SIGNATURE)		DATE	PRINTED NAME		RECEIVED BY LAB (SIGNATURE)		DATE	PRINTED NAME
		TIME					TIME	

WHITE - OFFICE / YELLOW - LAB / PINK - CLIENT

07387

CITY_21MC100_008878561

ATC ASSOCIATES, INC

104 E 25th Street, 10th Floor

New York, NY 10010

Tel 212-353-8280

Fax 212-353-8306

REPORT DATE: 07-26-02

CLIENT: Taylor Environmental Group, Inc.

PROJECT NAME: SCA/Stuyvesant HS
345 Chambers Street, NY

PROJECT NUMBER: M477-15217/29881

SAMPLED BY: Client

SAMPLE DATE: 07-26-02

DATE RECEIVED: 07-26-02

DATE ANALYZED: 07-26-02

SAMPLE MEDIA: Dust Wipe Sample

ANALYSIS REQUIRED: Method EPA 3050/7420

ANALYSIS RESULTS

SAMPLE ID	BATCH NO.	SAMPLE DESCRIPTION	LEAD CONCENTRATION ($\mu\text{g}/\text{ft}^2$)	DETECTION LIMIT ($\mu\text{g}/\text{ft}^2$)
1	20669	Rm 431 Left	14.3	9.0
2	20669	Rm 431 Right	11.9	9.0
3	20669	Rm 429 Right	11.0	9.0
4	20669	Rm 429 Left	14.2	9.0
5	20669	Rm 427 Right	26.5	
6	20669	Rm 427 Left	23.4	9.0
7	20669	Rm 413 Right	<9.0	9.0
8	20669	Rm 413 Left	<9.0	9.0
9	20669	Rm 411 Right	<9.0	9.0
10	20669	Rm 411 Left	<9.0	9.0
11	20669	Field Blank	<9.0 μg	9.0 μg
12	20669	Field Blank	<9.0 μg	9.0 μg

NOTE 1:

THE REPORTING LIMIT (RL) IS 18.0 μg

NOTE 2:


HUD Guidelines for final clearance dust wipe samples: Floor 40 $\mu\text{g}/\text{ft}^2$, Window sill 250 $\mu\text{g}/\text{ft}^2$, Window wells 400 $\mu\text{g}/\text{ft}^2$, Exterior surfaces 800 $\mu\text{g}/\text{ft}^2$.

NOTE 3:

Blank units are in μg

07388

CITY_21MC100_008878562

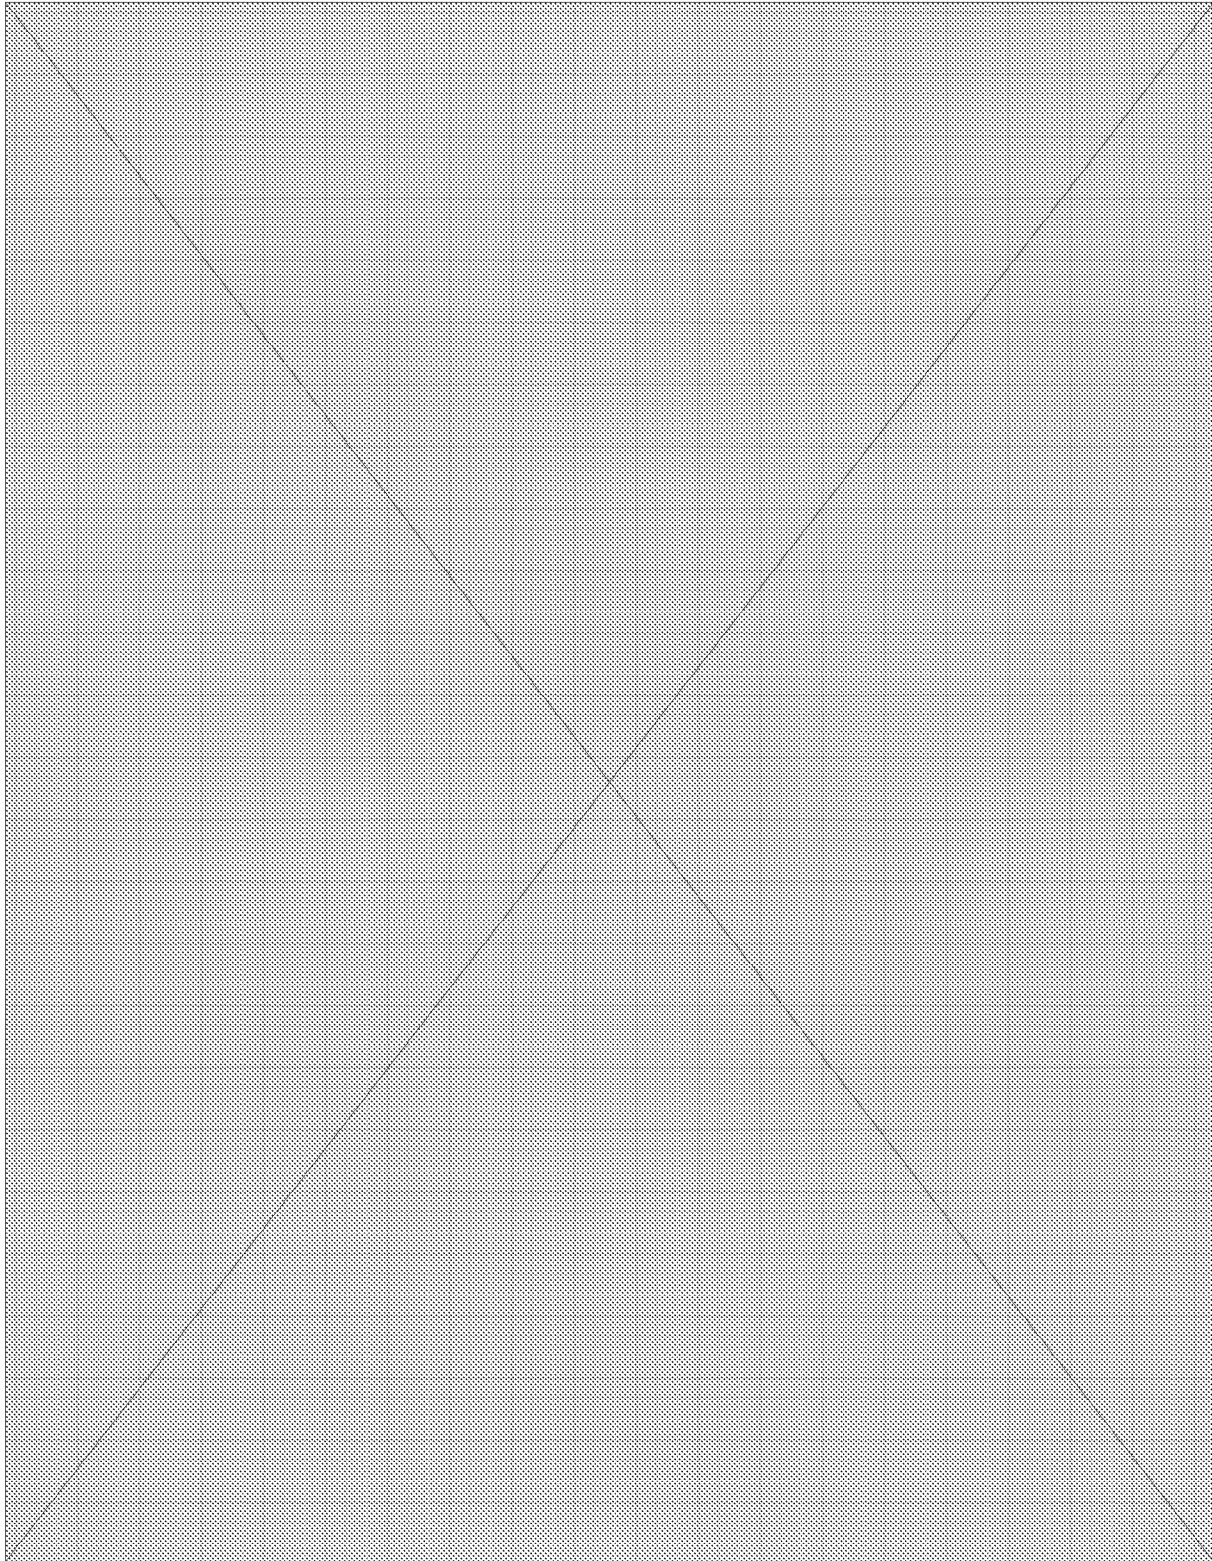

TAYLOR ENVIRONMENTAL GROUP, INC.
130 JERICHO TPKE., FLORAL PARK, NY 11001

516-358-2955
Fax 516-358-1780

LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT

CLIENT NAME/ADDRESS SCA	CONTACT: Hamid Saraf	SAMPLER (SIGNATURE) <i>[Signature]</i>	DATE 7/25/02	TIME	SAMPLE(S) SEALED ☒ YES ☐ NO
PROJECT LOCATION: Stuyvesant H.S.	PROJECT # 11477-15217/29881	SAMPLER NAME (PRINT) AL. KARAKOV	# 20658		CORRECT CONTAINER(S) ☒ YES ☐ NO
MATRIX (CIRCLE ONE): ☒ WIFE ☐ PAINT ☐ SOIL ☐ OTHER					

SAMPLE INFORMATION:			AREA (F ²)	SURFACE MATERIAL				LAB RESULT
LABORATORY #	SAMPLE #	LOCATION		WOOD	METAL	BRICK	OTHER	
	LW-09.	ROOM # 401 RIGHT UNIT VENT FEAR	↓ F ²		✓			
	FB 1	FIELD BLANK						
	FB 2	FIELD BLANK						

TURNAROUND REQUIRED-

NORMAL ☐ STAT ☐ BY **1 / 1**

COMMENTS / INSTRUCTIONS

6 hr 8.9. P.

RELINQUISHED BY (SIGNATURE) <i>[Signature]</i>	DATE 7/25/02	PRINTED NAME AL. KARAKOV	RECEIVED BY (SIGNATURE) <i>[Signature]</i>	DATE	PRINTED NAME
	TIME 14:40			TIME	
RELINQUISHED BY (SIGNATURE)	DATE	PRINTED NAME	RECEIVED BY LAB (SIGNATURE) <i>[Signature]</i>	DATE 7/25/02	PRINTED NAME
	TIME			TIME 15:00	

WHITE - OFFICE / YELLOW - LAB / PINK - CLIENT

07390

CITY_21MC100_008878564

ATC ASSOCIATES, INC.
 104 E 25th Street, 10th Floor
 New York, NY 10010
 Tel. 212-353-8280
 Fax 212-353-8306

REPORT DATE: 07-25-02
 CLIENT: Taylor Environmental Group, Inc.
 PROJECT NAME: SCA/Stuyvesant HS
 345 Chambers Street, NY
 PROJECT NUMBER: M477-15217/29881
 SAMPLED BY: Client
 SAMPLE DATE: 07-25-02
 DATE RECEIVED: 07-25-02
 DATE ANALYZED: 07-25-02
 SAMPLE MEDIA: Dust Wipe Sample
 ANALYSIS REQUIRED: Method EPA 3050/7420

ANALYSIS RESULTS

SAMPLE ID	BATCH NO.	SAMPLE DESCRIPTION	LEAD CONCENTRATION ($\mu\text{g}/\text{ft}^2$)	DETECTION LIMIT ($\mu\text{g}/\text{ft}^2$)
LW-01	20658	Rm 525 Right Unitvent Rear	<9.0	9.0
LW-02	20658	Rm 525 Left Unitvent Rear	<9.0	9.0
LW-03	20658	Rm 513 Left Unitvent Rear	<9.0	9.0
LW-04	20658	Rm 507 Right Unitvent Rear	<9.0	9.0
LW-05	20658	Rm 615 Unitvent #1 Rear	<9.0	9.0
LW-06	20658	Rm 404 Unitvent Rear	<9.0	9.0
LW-07	20658	Rm 401 East Unitvent Rear	<9.0	9.0
LW-08	20658	Rm 401 Left Unitvent Rear	<9.0	9.0
LW-09	20658	Rm 401 Right Unitvent Rear	<9.0	9.0
FBL-1	20658	Field Blank	<9.0 μg	9.0 μg
FBL-2	20658	Field Blank	<9.0 μg	9.0 μg

NOTE 1:

THE REPORTING LIMIT (RL) IS 18.0 μg

NOTE 2:

HUD Guidelines for final clearance dust wipe samples: Floor 40 $\mu\text{g}/\text{ft}^2$, Window sills 250 $\mu\text{g}/\text{ft}^2$, Window wells 400 $\mu\text{g}/\text{ft}^2$, Exterior surfaces 800 $\mu\text{g}/\text{ft}^2$.

NOTE 3:

Blank units are in μg

07391

CITY_21MC100_008878565

TAYLOR ENVIRONMENTAL GROUP, INC.
130 JERICHO TPKE., FLORAL PARK, NY 11001

516-358-2955
FAX 516-358-1780

LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT

CLIENT NAME/ADDRESS NYC SCA		CONTACT: HAMID SANDS		SAMPLER(S) SIGNATURE: <i>[Signature]</i>	DATE 7/26/07	TIME 0015	SAMPLE(S) SEALED (YES) NO	
PROJECT LOCATION: Stuyvesant HS 345 Chambers ST. N.Y.		PROJECT # M477-15217-29881		SAMPLER NAME (PRINT) Kirk McKenzie		CORRECT CONTAINER(S) (YES) NO		
SAMPLE INFORMATION:				MATRIX (CIRCLE ONE): (WIFE) PAINT SOIL OTHER				
LABORATORY #	SAMPLE #	LOCATION	AREA (F ²)	SURFACE MATERIAL				LAB RESULT
				WOOD	METAL	BRICK	OTHER	
	LW-01	Room 427, South side Left unit vent - Rear	1		✓			< 9.0
	LW-02	Room 427, South side Right unit vent - Rear	1		✓			
	LW-03	Room 432, South side Left unit vent - Rear	1		✓			
	LW-04	Room 432, South side Right unit vent - Rear	1		✓			
	LW-05	Room 437 - South side Left unit vent - Rear	1		✓			
	LW-06	Room 437 - South side Right unit vent - Rear	1		✓			
	LW-07	Room 439 - South side Left unit vent - Rear	1		✓			
	LW-08	Room 439 - South side Right unit vent - Rear	1		✓			✓
TURNAROUND REQUIRED:				COMMENTS / INSTRUCTIONS				
NORMAL ☐ STAT ☐ BY 1 / 1				6 HR - TAT				
RELINQUISHED BY (SIGNATURE) <i>[Signature]</i>		DATE 7/26/07 TIME 0015		PRINTED NAME Kirk McKenzie		RECEIVED BY (SIGNATURE) <i>[Signature]</i>		DATE 7/26/07
RELINQUISHED BY (SIGNATURE) <i>[Signature]</i>		DATE TIME		PRINTED NAME		RECEIVED BY LAB (SIGNATURE) <i>[Signature]</i>		DATE TIME

WHITE - OFFICE / YELLOW - LAB / PINK - CLIENT

07392

CITY_21MC100_008878566

TAYLOR ENVIRONMENTAL GROUP, INC.
130 JERICHO TPKE., FLORAL PARK, NY 11001

516-358-2955

Fax 516-358-1700

LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT

CLIENT NAME/ADDRESS NYC SCA		CONTACT: Harold Davis		SAMPLER SIGNATURE <i>[Signature]</i>		DATE 7/21/02		TIME 0015		SAMPLE(S) SEALED ☒ YES / NO	
PROJECT LOCATION: Stuyvesant H.S.		PROJECT # 1477-15217-29881		SAMPLER NAME (PRINT) Kirk McKenzie		CORRECT CONTAINER(S) ☒ YES / NO					
SAMPLE INFORMATION:				MATRIX (CIRCLE ONE): ☒ PAINT ☐ SOIL ☐ OTHER							
LABORATORY #	SAMPLE #	LOCATION	AREA (F ²)	SURFACE MATERIAL				LAB RESULT			
	LU-09	Room 451 - north side left cabinet - paint	1		☒			<9.0			
	FBL-1	Field Blank						↓			
	FBL-2	Field Blank									
TURNAROUND REQUIRED:				COMMENTS / INSTRUCTIONS							
NORMAL ☐ STAT ☐ BY 1/1				6 HR TAT							
RELINQUISHED BY (SIGNATURE) <i>[Signature]</i>		DATE 7/21/02		PRINTED NAME Kirk McKenzie		RECEIVED BY (SIGNATURE) <i>[Signature]</i>		DATE 7/26/02		PRINTED NAME	
RELINQUISHED BY (SIGNATURE)		DATE		PRINTED NAME		RECEIVED BY LAB (SIGNATURE)		DATE		PRINTED NAME	

WHITE - OFFICE / YELLOW - LAB / PINK - CLIENT

07393

CITY_21MC100_008878567

AIC ASSOCIATES, INC
 104 E 25th Street, 10th Floor
 New York, NY 10010
 Tel. 212-353-8280
 Fax 212-353-8306

REPORT DATE: 07-26-02
CLIENT: Taylor Environmental Group, Inc.
PROJECT NAME: SCA/Stuyvesant ES
 345 Chambers Street, NY
PROJECT NUMBER: M477-15217/29881
SAMPLED BY: Client
SAMPLE DATE: 07-26-02
DATE RECEIVED: 07-26-02
DATE ANALYZED: 07-26-02
SAMPLE MEDIA: Dust Wipe Sample
ANALYSIS REQUIRED: Method EPA 3050/7420

ANALYSIS RESULTS

TURNAROUND REQUIRED:		COMMENTS / INSTRUCTIONS	
NORMAL ☐	STAT ☐	BY 1/1	6 HZ 7H T
RECEIVED BY (SIGNATURE)		DATE	PRINTED NAME
RECEIVED BY LAB (SIGNATURE)		DATE	PRINTED NAME

OFFICE / YELLOW - LAB / PINK - CLIENT

516-350-2955
 Fax 516-358-1780

CHAIN OF CUSTODY DOCUMENT

SAMPLED (SIGNATURE)	DATE	TIME	SAMPLE(S) SEALED	YES NO
7/26/02	7/26/02			YES NO
SAMPLE NAME (PRINT)			CORRECT CONTAINER(S)	YES NO
Liz McKeown				YES NO
MATRIX (CIRCLE ONE): WIFE PAINT SOIL OTHER				
SURFACE MATERIAL			LAB RESULT	
AREA (FT ²)	WOOD	METAL	OTHER	
1	✓			29.0
1	✓			29.0
				29.0
				29.0

516-358-2955
Fax 516-358-1780

20694

07395

WHITE - OFFICE / YELLOW - LAB / PINK - CLIENT

ATC ASSOCIATES, INC
104 E 25th Street, 10th Floor
New York, NY 10010
Tel. 212-353-8280
Fax 212-353-8306

REPORT DATE: 07-29-02
CLIENT: Taylor Environmental Group, Inc.
PROJECT NAME: SCA/Stuyvesant HS
345 Chambers Street, NY
PROJECT NUMBER: M477-15217/29881
SAMPLED BY: Client
SAMPLE DATE: 07-26-02
DATE RECEIVED: 07-26-02
DATE ANALYZED: 07-26-02
SAMPLE MEDIA: Dust Wipe Sample
ANALYSIS REQUIRED: Method EPA 3050/7420

ANALYSIS RESULTS

SAMPLE ID	BATCH NO.	SAMPLE DESCRIPTION	LEAD CONCENTRATION ($\mu\text{g}/\text{ft}^2$)	DETECTION LIMIT ($\mu\text{g}/\text{ft}^2$)
LWED-01	20694	Rm 1017A Ceiling Unitvent Exhaust Duct	<9.0	9.0
LWED-02	20694	Rm 907 Ceiling Unitvent	<9.0	9.0
FBL-1	20694	Field Blank	<9.0 μg	9.0 μg
FBL-2	20694	Field Blank	<9.0 μg	9.0 μg

NOTE 1:

THE REPORTING LIMIT (RL) IS 18.0 μg

NOTE 2:

HUD Guidelines for final clearance dust wipe samples: Floor 40 $\mu\text{g}/\text{ft}^2$, Window sills 250 $\mu\text{g}/\text{ft}^2$, Window wells 400 $\mu\text{g}/\text{ft}^2$, Exterior surfaces 800 $\mu\text{g}/\text{ft}^2$.

NOTE 3:

Blank units are in μg

CERTIFICATION AND SIGNATURES

ANALYSIS PERFORMED BY: PCY

REPORT PREPARED BY: PCY

ATC certifies that this report is an accurate and authentic report of results obtained from the laboratory analysis.

QUALITY ASSURANCE COORDINATOR: WSS

LABORATORY DIRECTOR: WSS

ATC is accredited by the New York State Department of Health Environmental Laboratory Approval Program (ELAP) and by the American Industrial Hygiene Association (AIHA) to perform analysis of lead in paint, dust wipes, air and soil samples. (ELAP #10879), (AIHA #100229).

07000




CITY_21MC100_008878570

TAYLOR ENVIRONMENTAL GROUP, INC.
130 JERICHO TPKE., FLORAL PARK, NY 11001

516-358-2955
Fax 516-358-1780

20202


LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT

CLIENT NAME/ADDRESS S CA		CONTACT: Hamid Savag		SAMPLER SIGNATURE 		DATE 7/27/02		TIME		SAMPLE(S) SEALED YES NO	
PROJECT LOCATION: Stuyvesant H.S.		PROJECT # M477-15217/29881		SAMPLER NAME (PRINT) Al. Karimov						CORRECT CONTAINER(S) YES NO	
SAMPLE INFORMATION:				MATRIX (CIRCLE ONE): WIPE PAINT SOIL OTHER							
LABORATORY #	SAMPLE #	LOCATION	AREA (FT ²)	SURFACE MATERIAL				LAB RESULT			
				WOOD	METAL	BRICK	OTHER				
	LDW-01	Room # 802A Ceiling unit Exhaust duct.	1		X			29.0			
	LDW-02	Room # 807 Ceiling unit Exhaust duct	1		X			29.0			
	LDW-03	Room # 817 Ceiling unit Exhaust duct.	1		X			29.0			
	LDW-04	F/B						29.0			
	LDW-05	F/B						29.0			
Fax results to Y44 Cox at (212) 406-2555				TURNAROUND REQUIRED: NORMAL ☐ STAT ☐ BY 1/1				COMMENTS / INSTRUCTIONS 6 hr P.A.T.			
RELINQUISHED BY (SIGNATURE) 		DATE 7/27/02	PRINTED NAME		RECEIVED BY (SIGNATURE) 		DATE	PRINTED NAME			
RELINQUISHED BY (SIGNATURE)		DATE	PRINTED NAME		RECEIVED BY LAB (SIGNATURE) 		DATE 7/27/02 10:00	PRINTED NAME			

WHITE - OFFICE / YELLOW - LAB / PINK - CLIENT

07397

CITY_21MC100_008878571

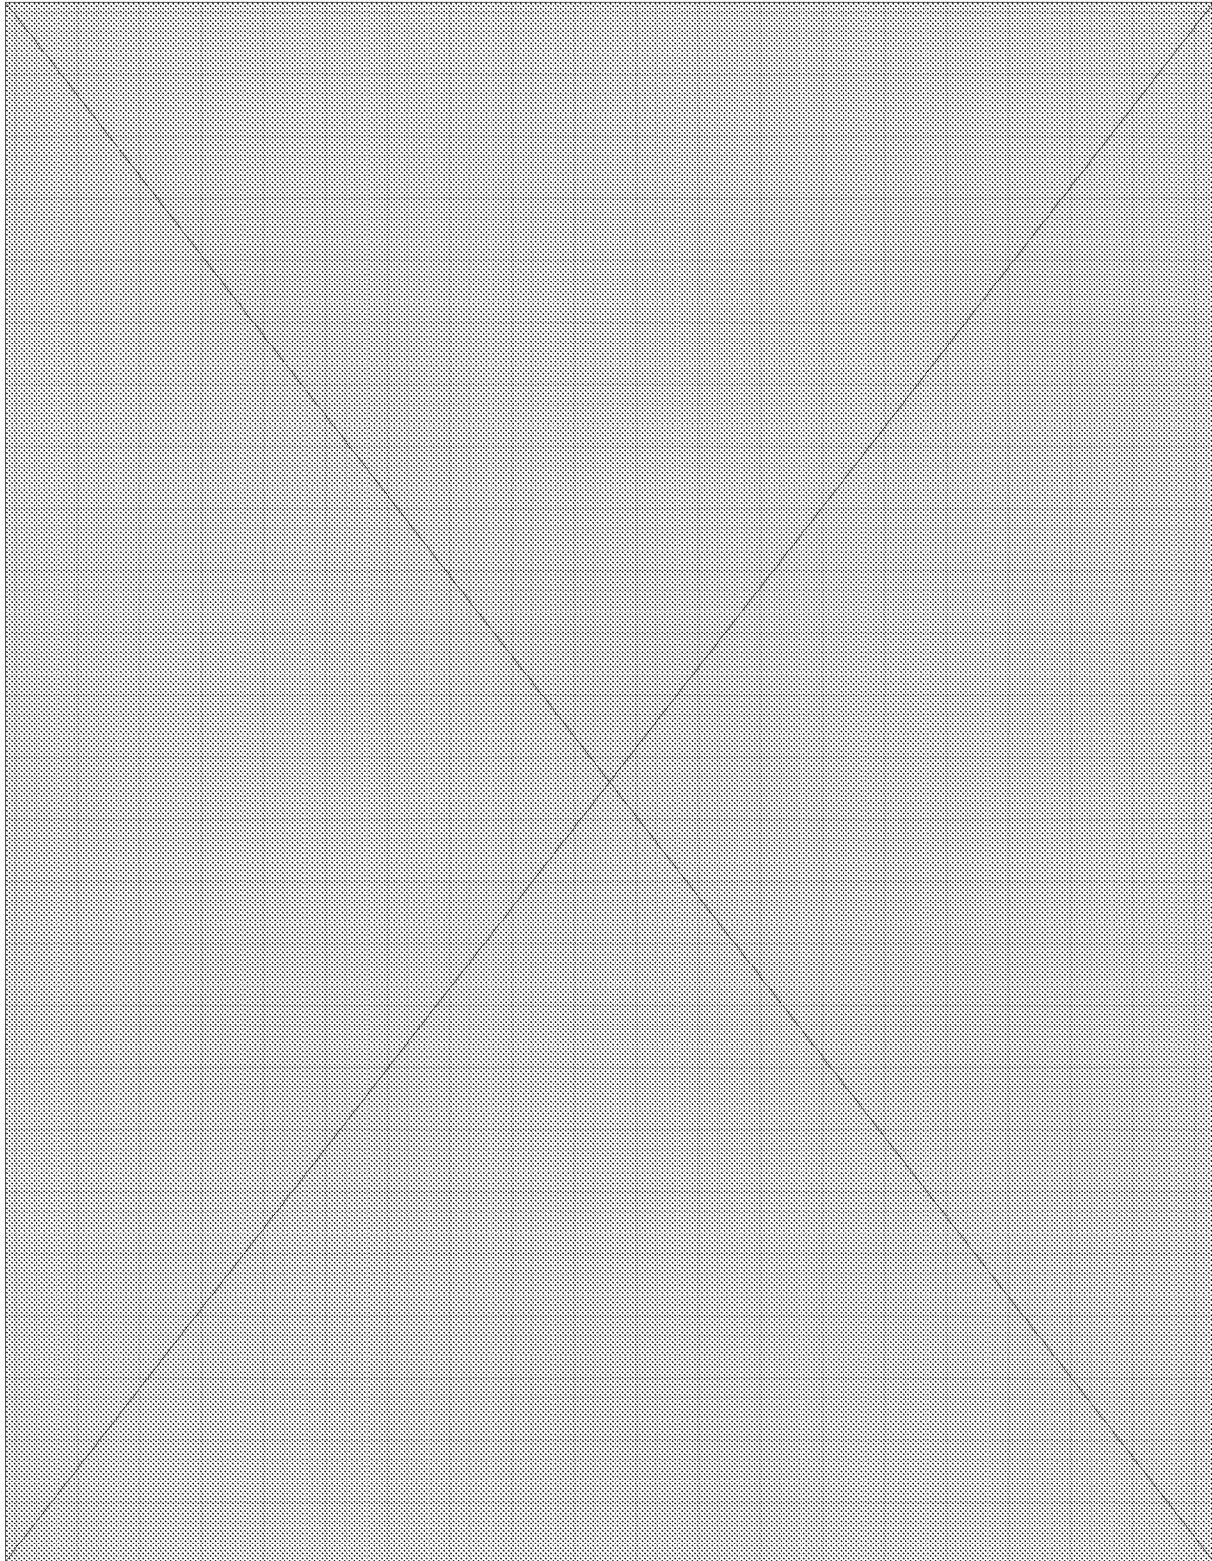

ATC ASSOCIATES, INC

104 E 25th Street, 10th Floor

New York, NY 10010

Tel. 212-353-8280

Fax 212-353-8306

REPORT DATE: 07-29-02

CLIENT: Taylor Environmental Group, Inc.

PROJECT NAME: SCA/Stuyvesant HS
345 Chambers Street, NY

PROJECT NUMBER: M477-15217/29881

SAMPLED BY: Client

SAMPLE DATE: 07-27-02

DATE RECEIVED: 07-28-02

DATE ANALYZED: 07-28-02

SAMPLE MEDIA: Dust Wipe Sample

ANALYSIS REQUIRED: Method EPA 3050/7420

ANALYSIS RESULTS

SAMPLE ID	BATCH NO.	SAMPLE DESCRIPTION	LEAD CONCENTRATION (µg/ft²)	DETECTION LIMIT (µg/ft²)
LW-01	20713	Rm 925 Ceiling Unitvent Damper	<9.0	9.0
FBL-1	20713	Field Blank	<9.0 µg	9.0 µg
FBL-2	20713	Field Blank	<9.0 µg	9.0 µg

NOTE 1:

THE REPORTING LIMIT (RL) IS 18.0 µg

NOTE 2:

HUD Guidelines for final clearance dust wipe samples: Floor 40 µg/ft², Window sills 250 µg/ft², Window wells 400 µg/ft², Exterior surfaces 800 µg/ft².

NOTE 3:

Blank units are in µg

CERTIFICATION AND SIGNATURES

ANALYSIS PERFORMED BY: WMS

REPORT PREPARED BY: [Signature]

ATC certifies that this report is an accurate and authentic report of results obtained from the laboratory analysis.

QUALITY ASSURANCE COORDINATOR: [Signature]

LABORATORY DIRECTOR: [Signature]

ATC is accredited by the New York State Department of Health Environmental Laboratory Approval Program (ELAP) and by the American Industrial Hygiene Association (AIHA) to perform analysis of lead in paint, dust wipes, air and soil samples. (ELAP #10879), (AIHA #100229).

07399

TAYLOR ENVIRONMENTAL GROUP, INC.
130 JERICHO TPKE., FLORAL PARK, NY 11001

#20714

516-358-2955
Fax 516-358-1780

LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT

CLIENT NAME/ADDRESS NYC SCA		CONTACT HAMID SAVOJ		SAMPLER SIGNATURE <i>[Signature]</i>		DATE 7/27/02	TIME	SAMPLE(S) SEALED (YES) / NO
PROJECT LOCATION: Stuyvesant HS. 345 Chambers ST NY		PROJECT # M477-15217-29881		SAMPLER NAME (PRINT) Kirk McKenzie		CORRECT CONTAINER(S) (YES) / NO		
SAMPLE INFORMATION:				MATRIX (CIRCLE ONE): (WIFE) PAINT SOIL OTHER				
LABORATORY #	SAMPLE #	LOCATION	AREA (FT ²)	SURFACE MATERIAL: WOOD METAL BRICK OTHER				LAB RESULT
	LWD-01	Room 925-Ceiling Unit Exhaust Duct	1		✓			C9.0
	FBL-1	Field Blank						C9.0
	FBL-2	Field Blank						C9.0
TURNAROUND REQUIRED: NORMAL ☐ STAT ☐ BY 1 / 1			COMMENTS / INSTRUCTIONS 6 HR TAT					
RELINQUISHED BY (SIGNATURE) <i>[Signature]</i>	DATE 7/28/02	PRINTED NAME Kirk McKenzie	RECEIVED BY (SIGNATURE) <i>[Signature]</i>		DATE 07/28/02	PRINTED NAME D. Kosar		
RELINQUISHED BY (SIGNATURE)	DATE	PRINTED NAME	RECEIVED BY LAB (SIGNATURE)		DATE	PRINTED NAME		
	TIME				TIME			

07400

CITY_21MC100_008878574

ATC ASSOCIATES, INC.

104 E 25th Street, 10th Floor

New York, NY 10010

Tel. 212-353-8280

Fax 212-353-8306

REPORT DATE: 07-29-02
CLIENT: Taylor Environmental Group, Inc.
PROJECT NAME: SCA/Stuyvesant HS
345 Chambers Street, NY
PROJECT NUMBER: M477-15217/29881
SAMPLED BY: Client
SAMPLE DATE: 07-27-02
DATE RECEIVED: 07-28-02
DATE ANALYZED: 07-28-02
SAMPLE MEDIA: Dust Wipe Sample
ANALYSIS REQUIRED: Method EPA 3050/7420

ANALYSIS RESULTS

SAMPLE ID	BATCH NO.	SAMPLE DESCRIPTION	LEAD CONCENTRATION ($\mu\text{g}/\text{ft}^2$)	DETECTION LIMIT ($\mu\text{g}/\text{ft}^2$)
LWD-01	20714	Rm 925 Ceiling Unitvent Exhaust Duct	<9.0	9.0
FBL-1	20714	Field Blank	<9.0 μg	9.0 μg
FBL-2	20714	Field Blank	<9.0 μg	9.0 μg

NOTE 1:THE REPORTING LIMIT (RL) IS 18.0 μg **NOTE 2:**HUD Guidelines for final clearance dust wipe samples: Floor 40 $\mu\text{g}/\text{ft}^2$, Window sills 250 $\mu\text{g}/\text{ft}^2$, Window wells 400 $\mu\text{g}/\text{ft}^2$, Exterior surfaces 800 $\mu\text{g}/\text{ft}^2$.**NOTE 3:**Blank units are in μg **CERTIFICATION AND SIGNATURES****ANALYSIS PERFORMED BY:** ms**REPORT PREPARED BY:** Dr. [Signature]

ATC certifies that this report is an accurate and authentic report of results obtained from the laboratory analysis.

QUALITY ASSURANCE COORDINATOR: WS**LABORATORY DIRECTOR:** MI

ATC is accredited by the New York State Department of Health Environmental Laboratory Approval Program (ELAP) and by the American Industrial Hygiene Association (AIHA) to perform analysis of lead in paint, dust wipes, air and soil samples. (ELAP #10879), (AIHA #100229).

07401

CITY_21MC100_008878575

TAYLOR ENVIRONMENTAL GROUP, INC.
130 JERICHO PKW., FLORAL PARK, NY 11001

Patch #20712

516-358-2955
Fax 516-358-1760


LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT

CLIENT NAME/ADDRESS NYC SCA		CONTACT: HANNA SAVOJ		SAMPLER (SIGNATURE) <i>[Signature]</i> DATE 7/27/07 TIME		SAMPLE(S) SEALED (YES) / NO		
PROJECT LOCATION: Stuyvesant H.S. 345 Chambers St. NY		PROJECT # M477-15217-29881		SAMPLER NAME (PRINT) Kirk McKenzie		CORRECT CONTAINER(S) (YES) / NO		
SAMPLE INFORMATION:				MATRIX (CIRCLE ONE): (WIPE) PAINT SCRL OTHER				
LABORATORY #	SAMPLE #	LOCATION	AREA (FT ²)	SURFACE MATERIAL				LAB RESULT
				WOOD	METAL	BRICK	OTHER	
	LWD-01	Room 911 - Ceiling Exhaust Duct	1		✓			18/ft ² 69.0
	FB1-1	Field Blank						69.0
	FB2-2	Field Blank						69.0
				TURNAROUND REQUIRED: NORMAL ☐ STAT ☐ BY 1/1		COMMENTS / INSTRUCTIONS 6 HR TAT		
RELINQUISHED BY (SIGNATURE) <i>[Signature]</i>		DATE 7/28/07 TIME 2:00	PRINTED NAME Kirk McKenzie		RECEIVED BY (SIGNATURE) <i>[Signature]</i>		DATE 07/28/07 TIME 2:00	PRINTED NAME D. KOGAN
RETINQUISHED BY (SIGNATURE)		DATE TIME	PRINTED NAME		RECEIVED BY LAB (SIGNATURE)		DATE TIME	PRINTED NAME

WHITE - OFFICE / YELLOW - LAB / PINK - CLIENT

07/28/07

CITY_21MC100_008878576

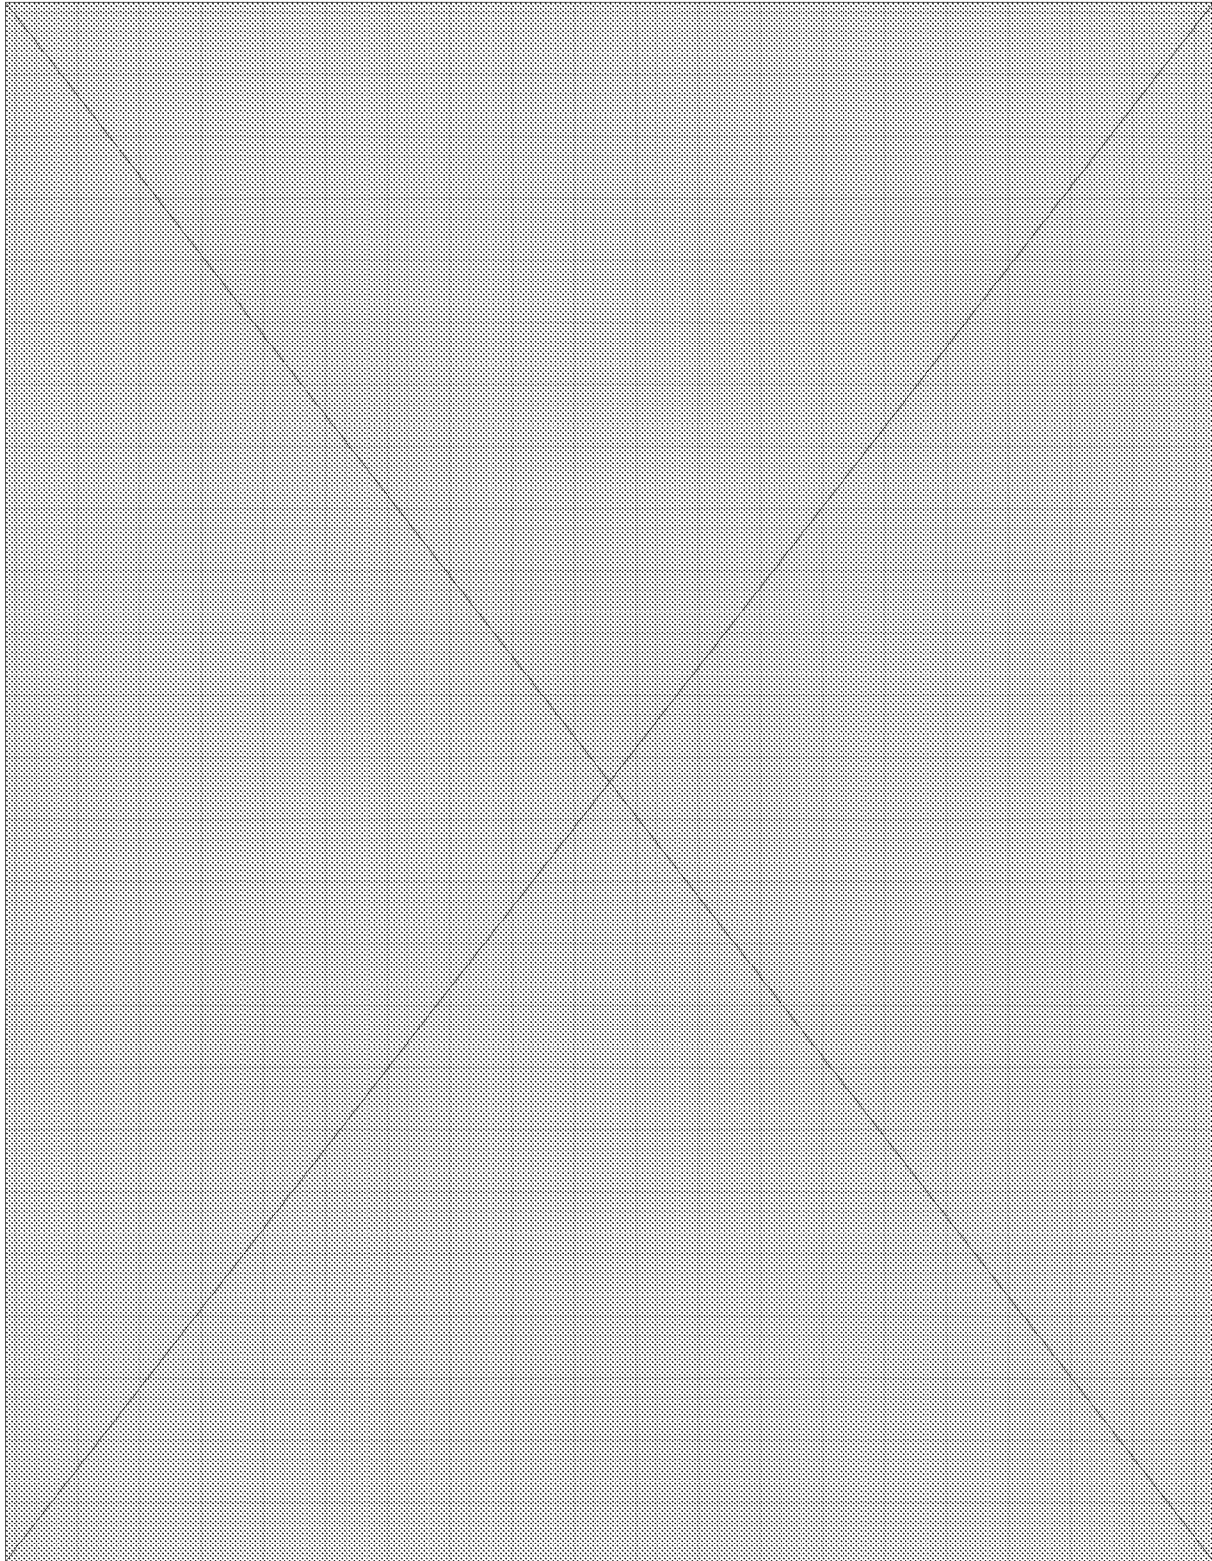

TAYLOR ENVIRONMENTAL GROUP, INC.
130 LERICH TPK, FLORAL PARK, NY 11001

20698

516 358 2955
Fax 516-358-1760

LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT

CLIENT NAME/ADDRESS NYC SCA		CONTACT: HAMID SAVOJ	SAMPLED (SIGNATURE) <i>[Signature]</i>	DATE 7/27/02	TIME	SAMPLE(S) SEALED ☒ YES ☐ NO		
PROJECT LOCATION: Stuyvesant H.S.		PROJECT # 345 Chambers St NY M477-15217-29881	SAMPLE NAME (PRINT) Kirk McKenzie		CORRECT CONTAINER(S) ☒ YES ☐ NO			
SAMPLE INFORMATION:			MATRIX (CIRCLE ONE): ☒ WIFE ☐ PAINT ☐ SOIL ☐ OTHER					
LABORATORY #	SAMPLE #	LOCATION	AREA (FT ²)	SURFACE MATERIAL				LAB RESULT
				WOOD	METAL	BRICK	OTHER	
	LW-01	ROOM 907 - Ceiling unit vent - sample	1 composit		✓			49.0
	FBL-1	Field Blank	---					49.0
	FBL-2	Field Blank	---					49.0
			TURNAROUND REQUIRED: NORMAL ☐ STAT ☐ BY 1/1		COMMENTS / INSTRUCTIONS 6 HR TAT			
RECEIVED BY (SIGNATURE) <i>[Signature]</i>		DATE 7/27/02	PRINTED NAME Kirk McKenzie		RECEIVED BY (SIGNATURE) <i>[Signature]</i>		DATE 7.27.02	PRINTED NAME R. Droudina
RELINQUISHED BY (SIGNATURE) <i>[Signature]</i>		DATE 7/27/02	PRINTED NAME Kirk McKenzie		RECEIVED BY LAB (SIGNATURE) <i>[Signature]</i>		DATE 00.30	PRINTED NAME R. Droudina

07404

CITY_21MC100_008878578

ATC ASSOCIATES, INC
104 E 25th Street, 10th Floor
New York, NY 10010
Tel. 212-353-8280
Fax 212-353-8306

REPORT DATE: 07-29-02
CLIENT: Taylor Environmental Group, Inc.
PROJECT NAME: SCA/Stuyvesant HS
 345 Chambers Street, NY
PROJECT NUMBER: M477-15217/29881
SAMPLED BY: Client
SAMPLE DATE: 07-27-02
DATE RECEIVED: 07-27-02
DATE ANALYZED: 07-27-02
SAMPLE MEDIA: Dust Wipe Sample
ANALYSIS REQUIRED: Method EPA 3050/7420

ANALYSIS RESULTS

SAMPLE ID	BATCH NO.	SAMPLE DESCRIPTION	LEAD CONCENTRATION (µg/ft²)	DETECTION LIMIT (µg/ft²)
LW-01	20698	Rm 907 Ceiling Unitvent Damper	<9.0	9.0
FBL-1	20698	Field Blank	<9.0 µg	9.0 µg
FBL-2	20698	Field Blank	<9.0 µg	9.0 µg

NOTE 1:
 THE REPORTING LIMIT (RL) IS 18.0 µg
 NOTE 2:
 HUD Guidelines for final clearance dust wipe samples: Floor 40 µg/ft², Window sills 250 µg/ft²,
 Window wells 400 µg/ft², Exterior surfaces 800 µg/ft².
 NOTE 3:
 Blank units are in µg

CERTIFICATION AND SIGNATURES

ANALYSIS PERFORMED BY: RP

REPORT PREPARED BY: [Signature]

ATC certifies that this report is an accurate and authentic report of results obtained from the laboratory analysis.

QUALITY ASSURANCE COORDINATOR: [Signature]

LABORATORY DIRECTOR: [Signature]

ATC is accredited by the New York State Department of Health Environmental Laboratory Approval Program (ELAP) and by the American Industrial Hygiene Association (AIHA) to perform analysis of lead in paint, dust wipes, air and soil samples. (ELAP #10579), (AIHA #100229).

07405

T, YLC® ENVIRONMENTAL GROUP, INC.
130 JERICHO TPKE., FLORAL PARK, NY 11001

516-358-2955
Fax 516-358-1700

20724

158 ✓


LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT

CLIENT NAME/ADDRESS NYC SCA		CONTACT: HAMID SAVOJ		SAMPLE(S) SIGNATURE: <i>[Signature]</i>		DATE 7/28/02		TIME		SAMPLE(S) SEALED (YES) NO			
PROJECT LOCATION: Bayview Ave 245 Chambers St NY		PROJECT # M477-15217-29881		SAMPLE NAME (PRINT) Kirk McKenzie						CORRECT CONTAINER(S) (YES) NO			
SAMPLE INFORMATION:				MATRIX (CIRCLE ONE): (PAVE) PAINT SOIL OTHER									
LABORATORY #		SAMPLE #		LOCATION		AREA (FT²)		SURFACE MATERIAL WOOD METAL BRICK OTHER				LAB RESULT	
	LW-01	ROOM 301A EAST SIDE unit vent - Rear		1		✓						69.0	
	LW-02	ROOM 301A South side unit vent - Rear		1		✓							
	LW-03	ROOM 303 - South side Left unit vent - Rear		1		✓							
	LW-04	ROOM 303 - South side Right unit vent - Rear		1		✓							
	LW-05	ROOM 305 - South side Left unit vent - Rear		1		✓							
	LW-06	ROOM 305 - South side Right unit vent - Rear		1		✓							
	LW-07	ROOM 325 - South side Left unit vent - Rear		1		✓							
	LW-08	ROOM 325 - South side Right unit vent - Rear		1		✓							
Fax results to TAYLOR 212 406-2695 x 516 358-1780				TURNAROUND REQUIRED: NORMAL ☐ STAT ☐ BY 1/1				COMMENTS / INSTRUCTIONS 6 HR TAT					
RELINQUISHED BY (SIGNATURE) <i>[Signature]</i>		DATE 7/29/02 TIME 0830		PRINTED NAME Kirk McKenzie		RECEIVED BY (SIGNATURE) <i>[Signature]</i>		DATE 7/29/02 TIME 5:00		PRINTED NAME			
RELINQUISHED BY (SIGNATURE) <i>[Signature]</i>		DATE 7/29/02 TIME 1:00		PRINTED NAME TERESA MICHAEL		RECEIVED BY LAB (SIGNATURE) <i>[Signature]</i>		DATE 7/29/02 TIME 5:00		PRINTED NAME			

WHITE - OFFICE / YELLOW - LAB / PINK - CLIENT

07406

CITY_21MC100_008878580

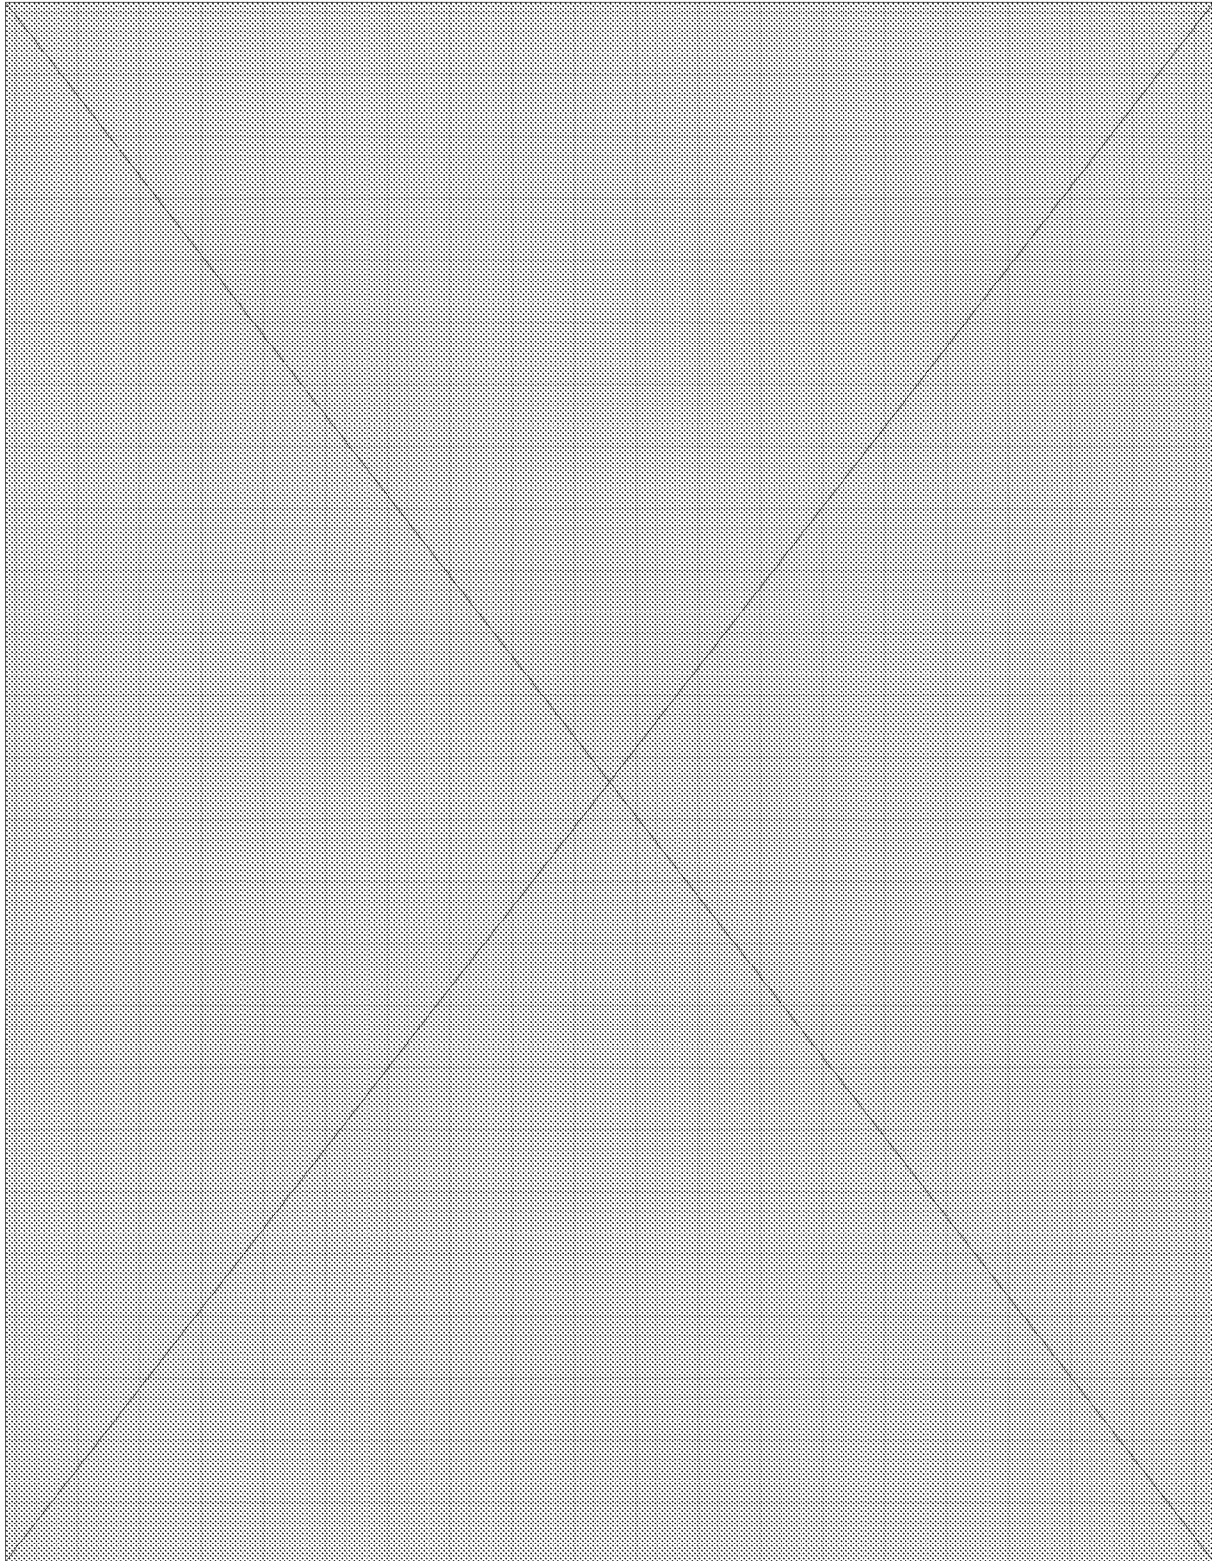

ATC ASSOCIATES, INC
104 E 25th Street, 10th Floor
New York, NY 10010
Tel. 212-353-8280
Fax 212-353-8306

REPORT DATE: 07-29-02

CLIENT: Taylor Environmental Group, Inc.

PROJECT NAME: SCA/Shuyvesant HS
345 Chambers Street, NY

PROJECT NUMBER: M477-15217/29881

SAMPLED BY: Client

SAMPLE DATE: 07-28-02
DATE RECEIVED: 07-29-02
DATE ANALYZED: 07-29-02

SAMPLE MEDIA: Dust Wipe Sample
ANALYSIS REQUIRED: Method EPA 3050/7420

ANALYSIS RESULTS

SAMPLE ID	BATCH NO.	SAMPLE DESCRIPTION	LEAD CONCENTRATION ($\mu\text{g}/\text{ft}^2$)	DETECTION LIMIT ($\mu\text{g}/\text{ft}^2$)
LW-01	20724	Rm 301A East Side Unitvent Rear	<9.0	9.0
LW-02	20724	Rm 301A South Side Unitvent Rear	<9.0	9.0
LW-03	20724	Rm 302 South Side Left Unitvent Rear	<9.0	9.0
LW-04	20724	Rm 302 South Side Right Unitvent Rear	<9.0	9.0
LW-05	20724	Rm 305 South Side Left Unitvent Rear	<9.0	9.0
LW-06	20724	Rm 305 South Side Right Unitvent Rear	<9.0	9.0
LW-07	20724	Rm 325 South Side Left Unitvent Rear	<9.0	9.0
LW-08	20724	Rm 325 South Side Right Unitvent Rear	<9.0	9.0
LW-09	20724	Rm 313 South Side Left Unitvent Rear	<9.0	9.0
LW-10	20724	Rm 313 South Side Right Unitvent Rear	<9.0	9.0
FBL-1	20724	Field Blank	<9.0 μg	9.0 μg
FBL-2	20724	Field Blank	<9.0 μg	9.0 μg

NOTE 1:

THE REPORTING LIMIT (RL) IS 18.0 μg

NOTE 2:

RWD Guidelines for final clearance dust wipe samples: Floor 40 $\mu\text{g}/\text{ft}^2$, Window sills 250 $\mu\text{g}/\text{ft}^2$, Window wells 400 $\mu\text{g}/\text{ft}^2$, Exterior surfaces 300 $\mu\text{g}/\text{ft}^2$.

NOTE 3:

Blank units are in μg .

07408

CITY_21MC100_008878582

ATC ASSOCIATES, INC
 104 E 25th Street, 10th Floor
 New York, NY 10010
 Tel. 212-353-8280
 Fax 212-353-8306

REPORT DATE: 07-29-02
CLIENT: Taylor Environmental Group, Inc.
PROJECT NAME: SCA/Stuyvesant HS
 345 Chambers Street, NY
PROJECT NUMBER: M477-15217/29881
SAMPLED BY: Client
SAMPLE DATE: 07-28-02
DATE RECEIVED: 07-29-02
DATE ANALYZED: 07-29-02
SAMPLE MEDIA: Dust Wipe Sample
ANALYSIS REQUIRED: Method EPA 3050/7420

ANALYSIS RESULTS

SAMPLE ID	BATCH NO.	SAMPLE DESCRIPTION	LEAD CONCENTRATION ($\mu\text{g}/\text{ft}^2$)	DETECTION LIMIT ($\mu\text{g}/\text{ft}^2$)
LW-01	20724	Rm 301A East Side Unitvent Rear	<9.0	9.0
LW-02	20724	Rm 301A South Side Unitvent Rear	<9.0	9.0
LW-03	20724	Rm 303 South Side Left Unitvent Rear	<9.0	9.0
LW-04	20724	Rm 303 South Side Right Unitvent Rear	<9.0	9.0
LW-05	20724	Rm 305 South Side Left Unitvent Rear	<9.0	9.0
LW-06	20724	Rm 305 South Side Right Unitvent Rear	<9.0	9.0
LW-07	20724	Rm 325 South Side Left Unitvent Rear	<9.0	9.0
LW-08	20724	Rm 325 South Side Right Unitvent Rear	<9.0	9.0
LW-09	20724	Rm 313 South Side Left Unitvent Rear	<9.0	9.0
LW-10	20724	Rm 313 South Side Right Unitvent Rear	<9.0	9.0
FBL-1	20724	Field Blank	<9.0 μg	9.0 μg
FBL-2	20724	Field Blank	<9.0 μg	9.0 μg

NOTE 1:

THE REPORTING LIMIT (RL) IS 18.0 μg

NOTE 2:

HUD Guidelines for final clearance dust wipe samples: Floor 40 $\mu\text{g}/\text{ft}^2$, Window sills 250 $\mu\text{g}/\text{ft}^2$, Window wells 400 $\mu\text{g}/\text{ft}^2$, Exterior surfaces 800 $\mu\text{g}/\text{ft}^2$.

NOTE 3:

Blank units are in μg

ATC ASSOCIATES, INC
104 E 25th Street, 10th Floor
New York, NY 10010
Tel. 212-353-8280
Fax 212-353-8306

CERTIFICATION AND SIGNATURES

ANALYSIS PERFORMED BY: EL

REPORT PREPARED BY: EL

ATC certifies that this report is an accurate and authentic report of results obtained from the laboratory analysis.

QUALITY ASSURANCE COORDINATOR: EL

LABORATORY DIRECTOR: EL

ATC is accredited by the New York State Department of Health Environmental Laboratory Approval Program (ELAP) and by the American Industrial Hygiene Association (AIHA) to perform analysis of lead in paint, dust wipes, air and soil samples. (ELAP #10879), (AIHA #100229).

07410

CITY_21MC100_008878584

TAYLOR ENVIRONMENTAL GROUP, INC.
130 JERICHO TPKE., FLORAL PARK, NY 11001

#20715


516-358-2955
Fax 516-358-1780

LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT

CLIENT NAME/ADDRESS NYC SCA		CONTACT: HAMID SANDJ		SAMPLER SIGNATURE <i>[Signature]</i>		DATE 7/27/02		TIME		SAMPLE(S) SEALED (YES) NO	
PROJECT LOCATION: Stuyvesant HS 345 Chambers St N.Y.		PROJECT # M477-15217-29881		SAMPLER NAME (PRINT) Kirk McKenzie						CORRECT CONTAINER(S) (YES) NO	
SAMPLE INFORMATION:				MATRIX (CIRCLE ONE): (WIPE) PAINT SOIL OTHER							
LABORATORY #	SAMPLE #	LOCATION	AREA (FT ²)	SURFACE MATERIAL				LAB RESULT			
				WOOD	METAL	BRICK	OTHER				
	LW-01	Room 327 - South side Left unit vent - Rear	1		✓			15/ft ² C9.0			
	LW-02	Room 327 - South side Right unit vent - Rear	1		✓						
	LW-03	Room 335 - South side Left unit vent - Rear	1		✓						
	LW-04	Room 335 - South side Right unit vent - Rear	1		✓						
	LW-05	Room 337 - South side Left unit vent - Rear	1		✓						
	LW-06	Room 337 - South side Right unit vent - Rear	1		✓						
	LW-07	Room 339 - South side Left unit vent - Rear	1		✓						
	LW-08	Room 339 - South side Right unit vent - Rear	1		✓						
				TURNAROUND REQUIRED: NORMAL ☐ STAT ☐ BY 1/1				COMMENTS / INSTRUCTIONS			
RELINQUISHED BY (SIGNATURE) <i>[Signature]</i>		DATE 7/28/02		PRINTED NAME Kirk McKenzie		RECEIVED BY (SIGNATURE) <i>[Signature]</i>		DATE 07/28/02		PRINTED NAME D. Kogan	
RELINQUISHED BY (SIGNATURE) <i>[Signature]</i>		DATE 7/28/02		PRINTED NAME TERESA MICHAEL		RECEIVED BY LAB (SIGNATURE) <i>[Signature]</i>		DATE		PRINTED NAME	
		TIME 2:00 PM						TIME			

07411

For To (112) 100 3525 or to TEOWHITE OFFICE (YELLOW) LAB / BINK CLIENT

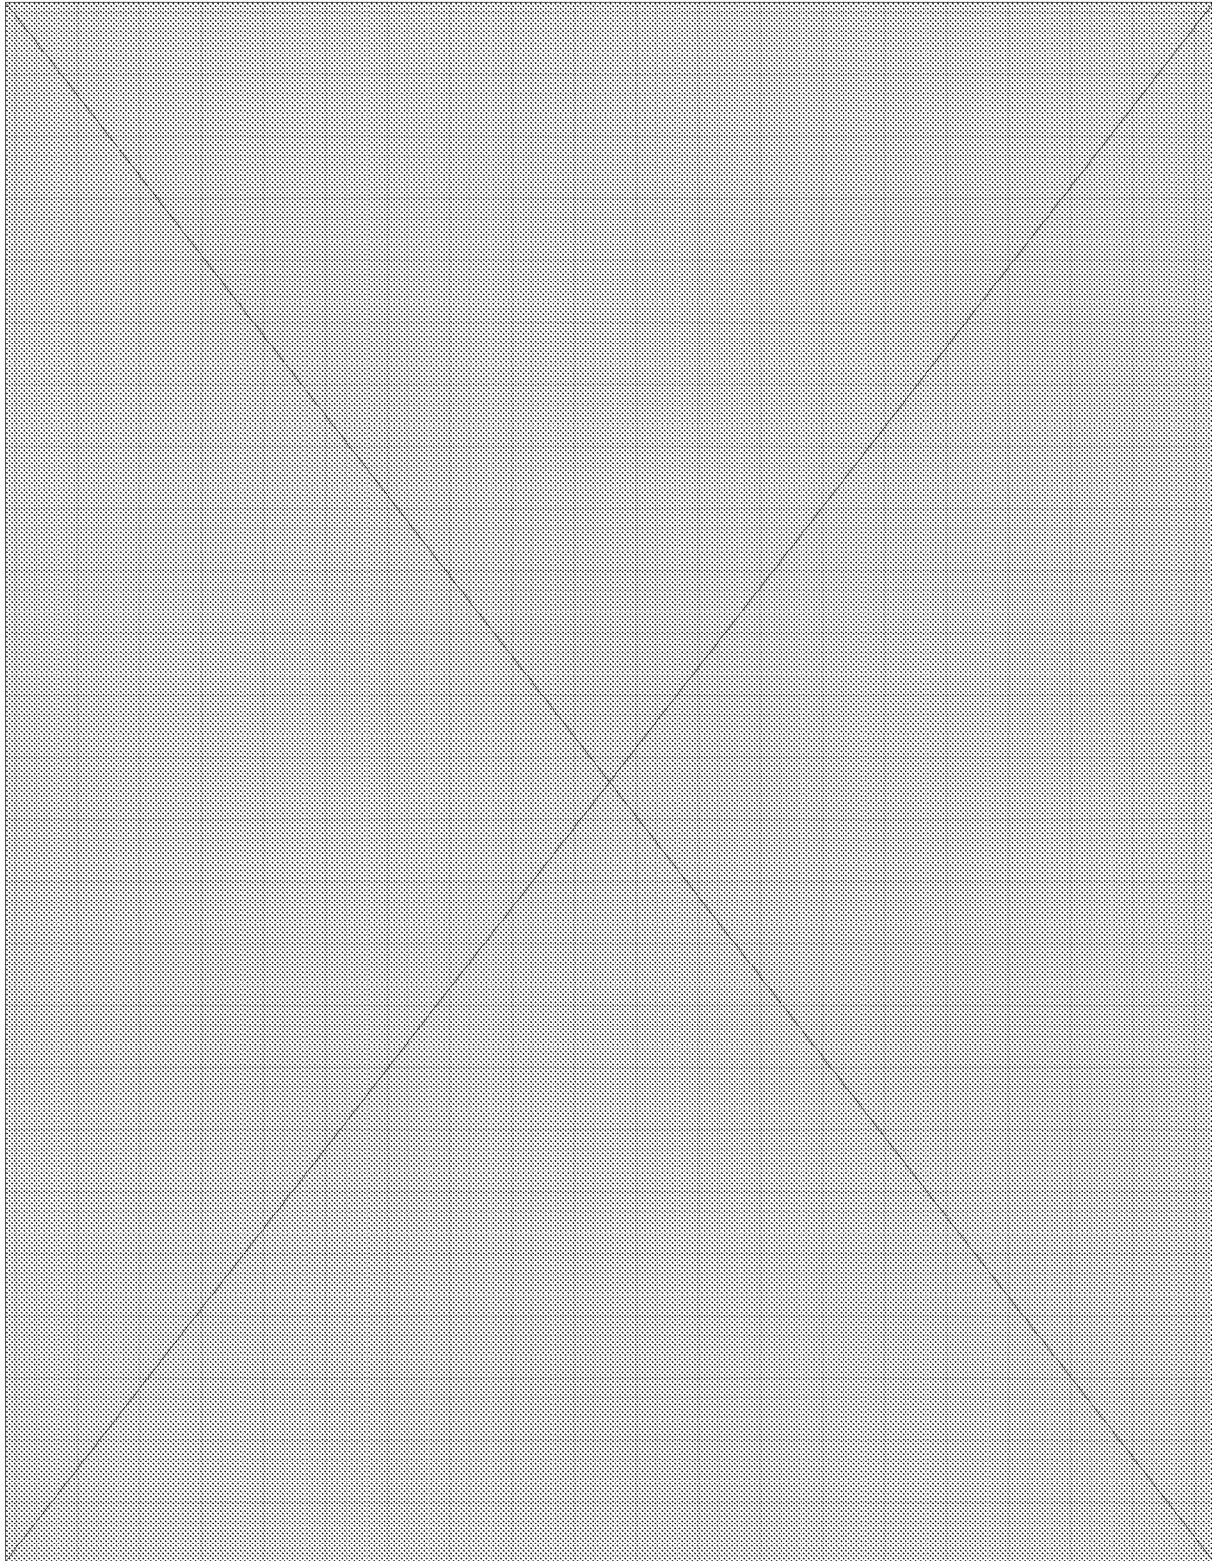

ATC ASSOCIATES, INC

104 E 25th Street, 10th Floor

New York, NY 10010

Tel. 212-353-8280

Fax 212-353-8306

REPORT DATE: 07-29-02
CLIENT: Taylor Environmental Group, Inc.
PROJECT NAME: SCA/Stuyvesant HS
 345 Chambers Street, NY
PROJECT NUMBER: M477-15217/29881
SAMPLED BY: Client
SAMPLE DATE: 07-27-02
DATE RECEIVED: 07-28-02
DATE ANALYZED: 07-28-02
SAMPLE MEDIA: Dust Wipe Sample
ANALYSIS REQUIRED: Method EPA 3050/7420

ANALYSIS RESULTS

SAMPLE ID	BATCH NO.	SAMPLE DESCRIPTION	LEAD CONCENTRATION ($\mu\text{g}/\text{ft}^2$)	DETECTION LIMIT ($\mu\text{g}/\text{ft}^2$)
LW-01	20715	Rm 327 South Side Left Unitvent Rear	<9.0	9.0
LW-02	20715	Rm 327 South Side Right Unitvent Rear	<9.0	9.0
LW-03	20715	Rm 335 South Side Left Unitvent Rear	<9.0	9.0
LW-04	20715	Rm 335 South Side Right Unitvent Rear	<9.0	9.0
LW-05	20715	Rm 337 South Side Left Unitvent Rear	<9.0	9.0
LW-06	20715	Rm 337 South Side Right Unitvent Rear	<9.0	9.0
LW-07	20715	Rm 339 South Side Left Unitvent Rear	<9.0	9.0
LW-08	20715	Rm 339 South Side Right Unitvent Rear	<9.0	9.0
FBL-1	20715	Field Blank	<9.0 μg	9.0 μg
FBL-2	20715	Field Blank	<9.0 μg	9.0 μg

NOTE 1:

THE REPORTING LIMIT (RL) IS 18.0 μg

NOTE 2:

HUD Guidelines for final clearance dust wipe samples: Floor 40 $\mu\text{g}/\text{ft}^2$, Window sills 250 $\mu\text{g}/\text{ft}^2$, Window wells 400 $\mu\text{g}/\text{ft}^2$, Exterior surfaces 800 $\mu\text{g}/\text{ft}^2$.

NOTE 3:

Blank units are in μg

07413

TAYLOR ENVIRONMENTAL GROUP, INC.
130 JERICHO TPKE., FLORAL PARK, NY 11001

516-358-2955

Fax 516-358-1780

LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT

CLIENT NAME/ADDRESS SCA		CONTACT: Humid Savoy		SAMPLER (SIGNATURE) <i>[Signature]</i>		DATE 7/25/02		TIME		SAMPLE(S) SEALED YES NO	
PROJECT LOCATION: Stuyvesant H.S.		PROJECT # M477-75217/29881		SAMPLER NAME (PRINT) AL. Karaman						CORRECT CONTAINER(S) YES NO	
SAMPLE INFORMATION:				MATRIX (CIRCLE ONE): WPE PAINT SOIL OTHER							
LABORATORY #	SAMPLE #	LOCATION	AREA (FT ²)	SURFACE MATERIAL				LAB RESULT			
				WOOD	METAL	BRICK	OTHER				
	W-01	Room #455 South side Left Univert (back wall)	1		X			9.4			
	W-02	Room #435 South side Right Univert (back wall)	1		X			14.6			
	W-03	Room #450 Univert (back wall)	1		X			29.0			
	W-04	Room #315 South side Left Univert (back wall)	1		X			29.0			
	W-05	Room #315 South side Right Univert (back wall)	1		X			29.0			
	W-06	Room #307 South side Left Univert (back wall)	1		X			29.0			
	W-07	Room #307 South side Middle Univert (back wall)	1		X			29.0			
	W-08	Room #307 South side Right Univert (back wall)	1		X			29.0			
TURNAROUND REQUIRED:				COMMENTS / INSTRUCTIONS							
NORMAL ☐ STAT ☐ BY 1/1				6 hr. P.A.S.							
RELINQUISHED BY (SIGNATURE) <i>[Signature]</i>		DATE 7/26/02		PRINTED NAME		RECEIVED BY (SIGNATURE) <i>[Signature]</i>		DATE 7/26/02		PRINTED NAME	
RELINQUISHED BY (SIGNATURE)		DATE		PRINTED NAME		RECEIVED BY (SIGNATURE)		DATE 7/26/02		PRINTED NAME	

07414

CITY_21MC100_008878588

TAYLOR ENVIRONMENTAL GROUP, INC.
130 JERICHO TPKE., FLORAL PARK, NY 11001

516-358-2955
Fax 516-358-1780

LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT

CLIENT NAME/ADDRESS SCA		CONTACT: Hamid Savoy		SAMPLER (SIGNATURE) <i>[Signature]</i>		DATE 7/26/02		TIME		SAMPLE(S) SEALED YES NO	
PROJECT LOCATION: Stuyvesant H.S.		PROJECT # M479-25217/29881		SAMPLER NAME (PRINT) Al. Nazarek						CORRECT CONTAINER(S) YES NO	
SAMPLE INFORMATION:				MATRIX (CIRCLE ONE): WIFE PAINT SOIL OTHER							
LABORATORY #	SAMPLE #	LOCATION	AREA (FT ²)	SURFACE MATERIAL				LAB RESULT			
				WOOD	METAL	BRICK	OTHER				
	W-09	F/B									
	W-10	F/B									
Fax results to Taylor (212) 406-2535				TURNAROUND REQUIRED: NORMAL ☐ STAT ☐ BY 1 / 1				COMMENTS / INSTRUCTIONS 6 hr TAD.			
RELINQUISHED BY (SIGNATURE) <i>[Signature]</i>		DATE 7/26/02		PRINTED NAME		RECEIVED BY (SIGNATURE)		DATE		PRINTED NAME	
RELINQUISHED BY (SIGNATURE)		DATE		PRINTED NAME		RECEIVED BY LAB (SIGNATURE)		DATE		PRINTED NAME	
		TIME						TIME			

WHITE - OFFICE / YELLOW - LAB / PINK - CLIENT

07415

CITY_21MC100_008878589

ATC ASSOCIATES, INC.

104 E 25th Street, 10th Floor

New York, NY 10010

Tel. 212-353-8280

Fax 212-353-8306

REPORT DATE: 07-26-02

CLIENT: Taylor Environmental Group, Inc.

PROJECT NAME: SCA/Stuyvesant HS
345 Chambers Street, NY

PROJECT NUMBER: M477-15217/29881

SAMPLED BY: Client

SAMPLE DATE: 07-26-02
DATE RECEIVED: 07-26-02
DATE ANALYZED: 07-26-02

SAMPLE MEDIA: Dust Wipe Sample
ANALYSIS REQUIRED: Method EPA 3050/7420

ANALYSIS RESULTS

SAMPLE ID	BATCH NO.	SAMPLE DESCRIPTION	LEAD CONCENTRATION ($\mu\text{g}/\text{ft}^2$)	DETECTION LIMIT ($\mu\text{g}/\text{ft}^2$)
W-01	20677	Rm 435 South Side Left Unitvent (Back Wall)	9.4	9.0
W-02	20677	Rm 435 South Side Right Unitvent (Back Wall)	14.6	9.0
W-03	20677	Rm 450 Unitvent (Back Wall)	<9.0	9.0
W-04	20677	Rm 315 South Side Left Unitvent (Back Wall)	<9.0	9.0
W-05	20677	Rm 315 South Side Right Unitvent (Back Wall)	<9.0	9.0
W-06	20677	Rm 307 South Side Left Unitvent (Back Wall)	<9.0	9.0
W-07	20677	Rm 307 South Side Middle Unitvent (Back Wall)	<9.0	9.0
W-08	20677	Rm 307 South Side Right Unitvent (Back Wall)	<9.0	9.0
W-09	20677	Field Blank	<9.0 μg	9.0 μg
W-10	20677	Field Blank	<9.0 μg	9.0 μg

NOTE 1:

THE REPORTING LIMIT (RL) IS 18.0 μg

NOTE 2:


HUD Guidelines for final clearance dust wipe samples: Floor 40 $\mu\text{g}/\text{ft}^2$, Window sills 250 $\mu\text{g}/\text{ft}^2$, Window wells 400 $\mu\text{g}/\text{ft}^2$, Exterior surfaces 800 $\mu\text{g}/\text{ft}^2$.

NOTE 3:

Blank units are in μg

07416

CITY_21MC100_008878590

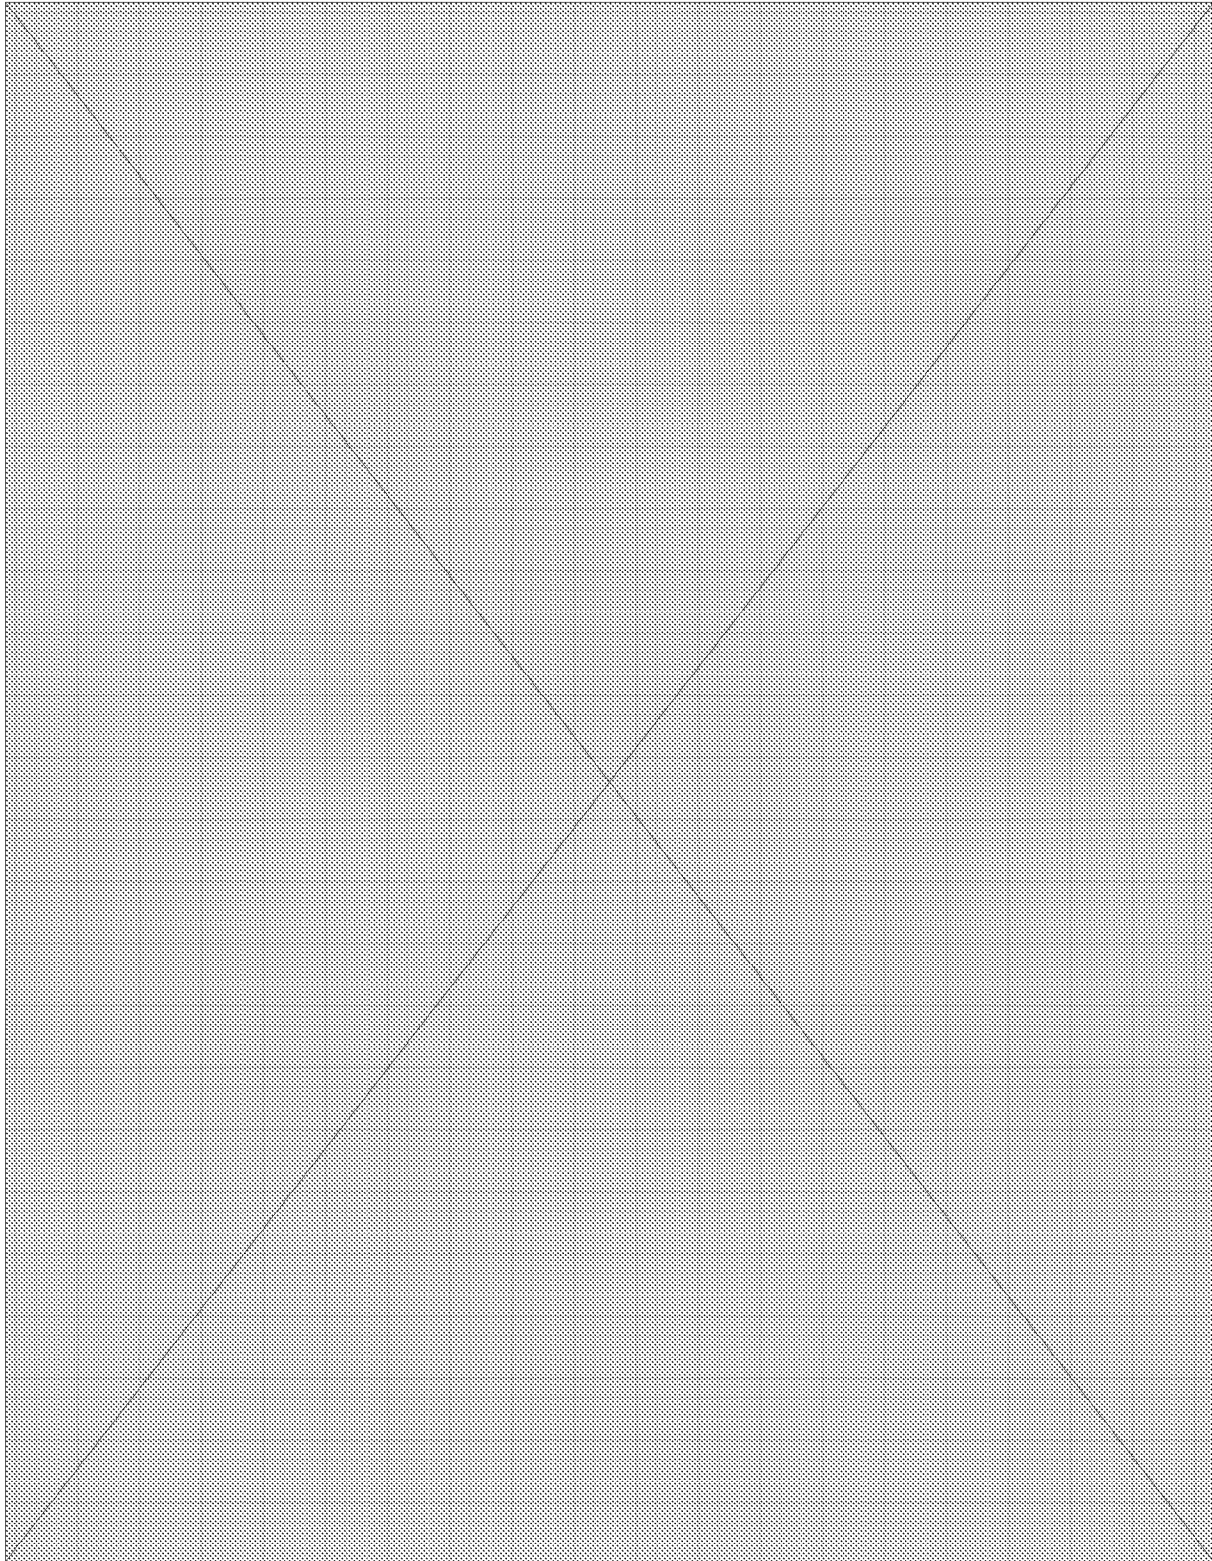

2070,

LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT

WHITE - OFFICE / YELLOW - LAB / PINK - CLIENT

ATC ASSOCIATES, INC.

104 E 25th Street, 10th Floor

New York, NY 10010

Tel. 212-353-8280

Fax 212-353-8306

REPORT DATE: 07-29-02
CLIENT: Taylor Environmental Group, Inc.
PROJECT NAME: SCA/Stuyvesant HS
345 Chambers Street, NY
PROJECT NUMBER: M477-15217/29881
SAMPLED BY: Client
SAMPLE DATE: 07-27-02
DATE RECEIVED: 07-27-02
DATE ANALYZED: 07-27-02
SAMPLE MEDIA: Dust Wipe Sample
ANALYSIS REQUIRED: Method EPA 3050/7420

ANALYSIS RESULTS

SAMPLE ID	BATCH NO.	SAMPLE DESCRIPTION	LEAD CONCENTRATION ($\mu\text{g}/\text{ft}^2$)	DETECTION LIMIT ($\mu\text{g}/\text{ft}^2$)
W-01	20701	Rm 802A Ceiling Unit (Unitvent)	31.7	9.0
W-02	20701	Rm 807 Ceiling Unit (Unitvent)	30.3	9.0
W-03	20701	Rm 817 Ceiling Unit (Unitvent)	35.5	9.0
W-04	20701	Rm 333 South Side Left Unitvent	38.8	9.0
W-05	20701	Rm 333 South Side Right Unitvent	<9.0	9.0
W-06	20701	Rm 329 South Side Left Unitvent (Back Wall)	13.8	9.0
W-07	20701	Rm 329 South Side Right Unitvent (Back Wall)	<9.0	9.0
W-08	20701	Field Blank	<9.0 μg	9.0 μg
W-09	20701	Field Blank	<9.0 μg	9.0 μg

NOTE 1:THE REPORTING LIMIT (RL) IS 18.0 μg **NOTE 2:**HUD Guidelines for final clearance dust wipe samples: Floor 40 $\mu\text{g}/\text{ft}^2$, Window sills 250 $\mu\text{g}/\text{ft}^2$, Window walls 400 $\mu\text{g}/\text{ft}^2$, Exterior surfaces 800 $\mu\text{g}/\text{ft}^2$.**NOTE 3:**Blank units are in μg

07419

CITY_21MC100_008878593

IA, ENVIRONMENTAL GROUP, INC.
130 JERICHO TPKE., FLORAL PARK, NY 11001

516-358-2955
Fax 516-358-1780

LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT

20719

CLIENT NAME/ADDRESS SCA		CONTACT: Hamid Savat		SAMPLER (SIGNATURE) <i>[Signature]</i>	DATE 7/28/02	TIME	SAMPLE(S) SEALED (YES) NO
PROJECT LOCATION: Stuyvesant H.S.		PROJECT # 01477-15217/29881		SAMPLER NAME (PRINT) AL. Kazzam		CORRECT CONTAINER(S) (YES) NO	
SAMPLE INFORMATION:		MATRIX (CIRCLE ONE): (WIPE) PAINT SOIL OTHER		AREA (FT ²)		SURFACE MATERIAL	
LABORATORY #	SAMPLE #	LOCATION		WOOD	METAL	BRICK	OTHER
	W-01	Room # 802 A Ceiling Unit (Univent)	Composite 1 sq'		X		
	W-02	Room # 807 Ceiling Unit (Univent)	Composite 1 sq'		X		
	W-03	Room # 817 Ceiling Unit (Univent)	Composite 1 sq'		X		
	W-04	Room # 833 South side Left Univent	1 sq'		X		
	W-05	F/B					C9.0 (23)
	W-06	F/B					C9.0 (4)
Pay results to Tylen at (202) 406-2535.				TURNAROUND REQUIRED: NORMAL ☐ STAT ☐ BY 1 / 1		COMMENTS / INSTRUCTIONS 6 hr P.A.T.	
RELINQUISHED BY (SIGNATURE) <i>[Signature]</i>	DATE 7/28/02 TIME 10:00	PRINTED NAME AL. Kazzam	RECEIVED BY (SIGNATURE) <i>[Signature]</i>		DATE 7/28/02 TIME 10:00	PRINTED NAME WIC (Kaz)	
RELINQUISHED BY (SIGNATURE)	DATE TIME	PRINTED NAME	RECEIVED BY LAB (SIGNATURE)		DATE TIME	PRINTED NAME	

WHITE - OFFICE / YELLOW - LAB / PINK - CLIENT

07420

CITY_21MC100_008878594

ATC ASSOCIATES, INC
 104 E 25th Street, 10th Floor
 New York, NY 10010
 Tel. 212-353-8280
 Fax 212-353-8306

REPORT DATE: 07-29-02
CLIENT: Taylor Environmental Group, Inc.
PROJECT NAME: SCA/Stuyvesant HS
 343 Chambers Street, NY
PROJECT NUMBER: M477-15217/29881
SAMPLED BY: Client
SAMPLE DATE: 07-28-02
DATE RECEIVED: 07-28-02
DATE ANALYZED: 07-28-02
SAMPLE MEDIA: Dust Wipe Sample
ANALYSIS REQUIRED: Method EPA 3050/7420

ANALYSIS RESULTS

SAMPLE ID	BATCH NO.	SAMPLE DESCRIPTION	LEAD CONCENTRATION (µg/R ²)	DETECTION LIMIT (µg/R ²)
W-01	20719	Rm 802A Ceiling Unit (Unitvent)	<9.0	9.0
W-02	20719	Rm 807 Ceiling Unit (Unitvent)	<9.0	9.0
W-03	20719	Rm 817 Ceiling Unit (Unitvent)	<9.0	9.0
W-04	20719	Rm 333 South Side Left Unitvent	<9.0	9.0
W-05	20719	Field Blank	<9.0 µg	9.0 µg
W-06	20719	Field Blank	<9.0 µg	9.0 µg

NOTE 1:

THE REPORTING LIMIT (RL) IS 18.0 µg


NOTE 2:

HUD Guidelines for final clearance dust wipe samples: Floor 40 µg/R², Window sills 250 µg/R², Window walls 400 µg/R², Exterior surfaces 800 µg/R².

NOTE 3:

Blank units are in µg.

07424

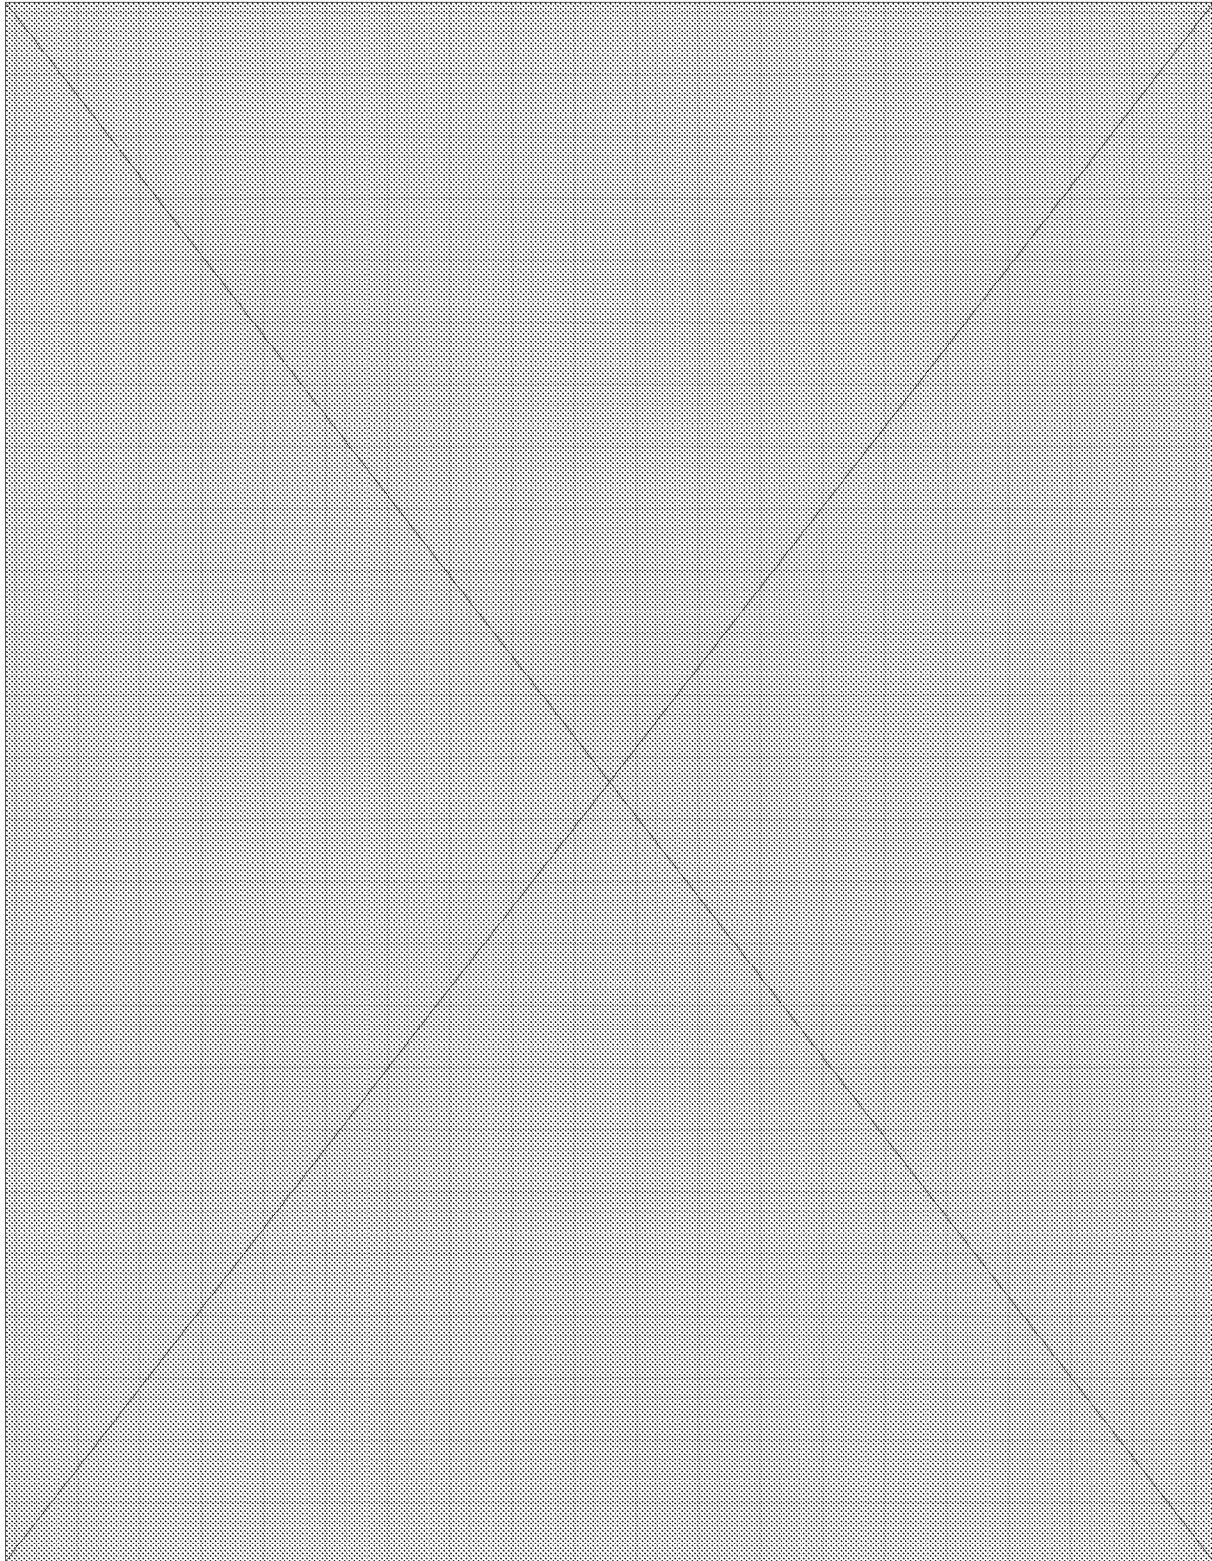

08/05/2002 07:25 212-290-2536

EMSL ANALYTICAL INC.

PAGE 01/07

EMSL Analytical, Inc.

307 West 38th Street, New York, NY 10018

Phone: 212-290-0051 Fax: 212-290-0058 Email: manhattanlab@emsl.com



Attn: Taylor Environmental Group, Inc.
Floral Park Corporate Center
130 Jericho Tpke.
Floral Park, NY 11001

Fax: (516) 358-1780 Phone: 516-358-2955
Project: NYC SCAM477-15217-27881/345 Chambers St. New
York, N.Y.

Customer ID: TAY150
Customer PO:
Received: 08/09/02 8:52 AM
EMSL Order: 030210609
EMSL Project ID:

Lead in Wipes by Flame AAS (SW 846, 7420)

Client Sample Description	Lab ID	Analyzed	Area Sampled	Lead Concentration	Note
LW-01 Room 301C-Ceiling Unit Vent-Damper	0001		144 in²	<10.0 µg/ft²	
LW-02 371E-Ceiling Unit Vent-Damper	0002		144 in²	<10.0 µg/ft²	
LW-03 350-Floor/Wall Unit Vent-Rear	0003		144 in²	11.0 µg/ft²	
LW-04 350-Floor/Wall Unit Vent (Left)-Damper	0004		144 in²	<10.0 µg/ft²	
LW-05 Room 350-Ceiling Unit Vent (Right)-Damper	0005		144 in²	<10.0 µg/ft²	
FBL-1 Field blank	0006		n/a	<10.0 µg/wipe	
FBL-2 Field blank	0007		n/a	<10.0 µg/wipe	

Eric B. B.
Laboratory Manager
or other approved signatory

Reporting limit is 10 µg/wipe
ACCREDITATIONS: AIHA Environmental Lead Laboratory Approval Program #102581

Page 1 of 1

07423

9/10/02 PAGE

ENVIRONMENTAL INC

8652-862-272

8652-862-272 0806/07424

TAYLOR ENVIRONMENTAL GROUP, INC.
130 JERICHO TPKE., FLORAL PARK, NY 11001

030210734

516-358-2955
Fax 516-358-1780

LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT

CLIENT NAME/ADDRESS NYC SC/1		CONTACT HABIB SOUDJ		SAMPLER (SIGNATURE) <i>Carlos Jofat</i>		DATE 8-6-02		TIME 0913		SAMPLE(S) SEALED ☒ YES / NO	
PROJECT LOCATION STUYVESANT H.S.		PROJECT # M477-15217/29881		SAMPLER NAME (PRINT) CARLOS JOFAT						CORRECT CONTAINER(S) ☒ YES / NO	
SAMPLE INFORMATION:				MATRIX (CIRCLE ONE): <u>WIPE</u> PAINT		SOIL		OTHER			
LABORATORY #	SAMPLE #	LOCATION		AREA (FT ²)	SURFACE MATERIAL WOOD METAL DNCK OTHER				LAB RESULT		
	LW-01	ROOM # 373 CEILING UNITVENT AIR DAMPER		COMPOSITE 1 FT ²		X			10.0		
	FB 1	FIELD BLANK							-		
	FB 2	FIELD BLANK							-		
	LW-02	ROOM # 351 CEILING UNITVENT AIR DAMPER. RIGHT UNIT		1 FT ²		X			<10.0		
	LW-03	ROOM # 351 CEILING UNITVENT AIR DAMPER. LEFT UNIT		1 FT ²		X			11.0		
				TURNAROUND REQUIRED: NORMAL ☐ STAT ☐ BY / /				COMMENTS / INSTRUCTIONS NIOSH Method 7082.			
RELINQUISHED BY (SIGNATURE) <i>Carlos Jofat</i>		DATE 8-6-02 TIME 1752		PRINTED NAME CARLOS JOFAT		RECEIVED BY (SIGNATURE) <i>[Signature]</i>		DATE 8/6/02 TIME 555		PRINTED NAME	
RELINQUISHED BY (SIGNATURE)		DATE TIME		PRINTED NAME		RECEIVED BY LAB (SIGNATURE)		DATE TIME		PRINTED NAME	

WHITE - OFFICE / YELLOW - LAB / PINK - CLIENT

ENG. MATERIAL
RECEIVED

02 AUG - 6 PM 5:55

08/07/2002 08:59 212-298-2538

EMSL ANALYTICAL INC

PAGE 01/06

EMSL Analytical, Inc.

367 West 36th Street, New York, NY 10018

Phone: 212-298-0051 Fax: 212-298-0059 Email: manhattanlab@emsl.com

Attn: Taylor Environmental Group, Inc.
Floral Park Corporate Center
130 Jericho Tpke.
Floral Park, NY 11001

Fax: (516) 358-1780

Phone: 516-358-2955

Project: M477-15217/25881/ NYC SCA/ STUYVESANT H.S.

Customer ID: TAYL50

Customer PO:

Received: 08/06/02 5:55 PM

EMSL Order: 030210734

EMSL Project ID:

Lead in Wipes by Flame AAS (SW 846, 7420)

Client Sample Description	Lab ID	Analyzed	Area Sampled	Lead Concentration	Notes
LW-01 ROOM #373 CEILING UNITUENT AIR DAMPER	0001		144 in ²	10.0 µg/ft ²	
FB 1 Field blank	0002		n/a	<10.0 µg/wipe	
FB 2 Field blank	0003		n/a	<10.0 µg/wipe	
LW-02 ROOM #351 CEILING UNITUENT AIR DAMPER RIGHT UNIT	0004		144 in ²	<10.0 µg/ft ²	
LW-03 ROOM #351 CEILING UNITUENT AIR DAMPER LEFT UNIT	0005		144 in ²	11.0 µg/ft ²	

Laboratory Manager
or other approved signatory

Reporting Unit is 10 µg/wipe

ACCREDITATIONS: AHA Environmental Lead Laboratory Approval Program #100581

Page 1 of 1

07425

TAYLOR ENVIRONMENTAL GROUP, INC.
130 JERICHO TPKE., FLORAL PARK, NY 11001

20172

516-358-2955

Fax 516-358-1780

LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT


CLIENT NAME/ADDRESS NYC SCA			CONTACT: HAMID SAJOJ		SAMPLER SIGNATURE <i>[Signature]</i>		DATE 7/30/02	TIME	SAMPLE(S) SEALED (YES) NO
PROJECT LOCATION: Stuyvesant HS 345 Chambers ST NY			PROJECT # M477-15217-29881		SAMPLER NAME (PRINT) Kirk McKenzie		CORRECT CONTAINER(S) (YES) NO		
SAMPLE INFORMATION:					MATRIX (CIRCLE ONE): (WIFE) PAINT SOIL OTHER				
LABORATORY #	SAMPLE #	LOCATION	AREA (FT ²)	SURFACE MATERIAL WOOD METAL BRICK OTHER				LAB RESULT	
	LW-01	Room 209 - South side unit vent - Rear	1		✓			9.6	
	LW-02	Room 229 - South side Left unit vent - Rear	1		✓			49.0	
	LW-03	Room 229 - South side Right unit vent - Rear	1		✓			49.0	
	LW-04	Room 225 - South side Left unit vent - Rear	1		✓			49.0	
	LW-05	Room 225 - South side Right unit vent - Rear	1		✓			49.0	
	LW-06	Room 237 - South side Left unit vent - Rear	1		✓			49.0	
	LW-07	Room 237 - South side Right unit vent - Rear	1		✓			49.0	
	LW-08	Room 250 - North side unit vent - Rear	1		✓			49.0	
TURNAROUND REQUIRED: NORMAL ☐ STAT ☐ BY 1/1					COMMENTS / INSTRUCTIONS 6 HR TAT				
RELINQUISHED BY (SIGNATURE) <i>[Signature]</i>		DATE 7/30/02	PRINTED NAME Kirk McKenzie		RECEIVED BY (SIGNATURE) <i>[Signature]</i>		DATE 7/31/02	PRINTED NAME R. Doudina	
RELINQUISHED BY (SIGNATURE)		DATE	PRINTED NAME		RECEIVED BY LAB (SIGNATURE)		DATE	PRINTED NAME	
		TIME					TIME		

WHITE - OFFICE / YELLOW - LAB / PINK - CLIENT

+ 516-358-1780

07476

CITY_21MC100_008878600

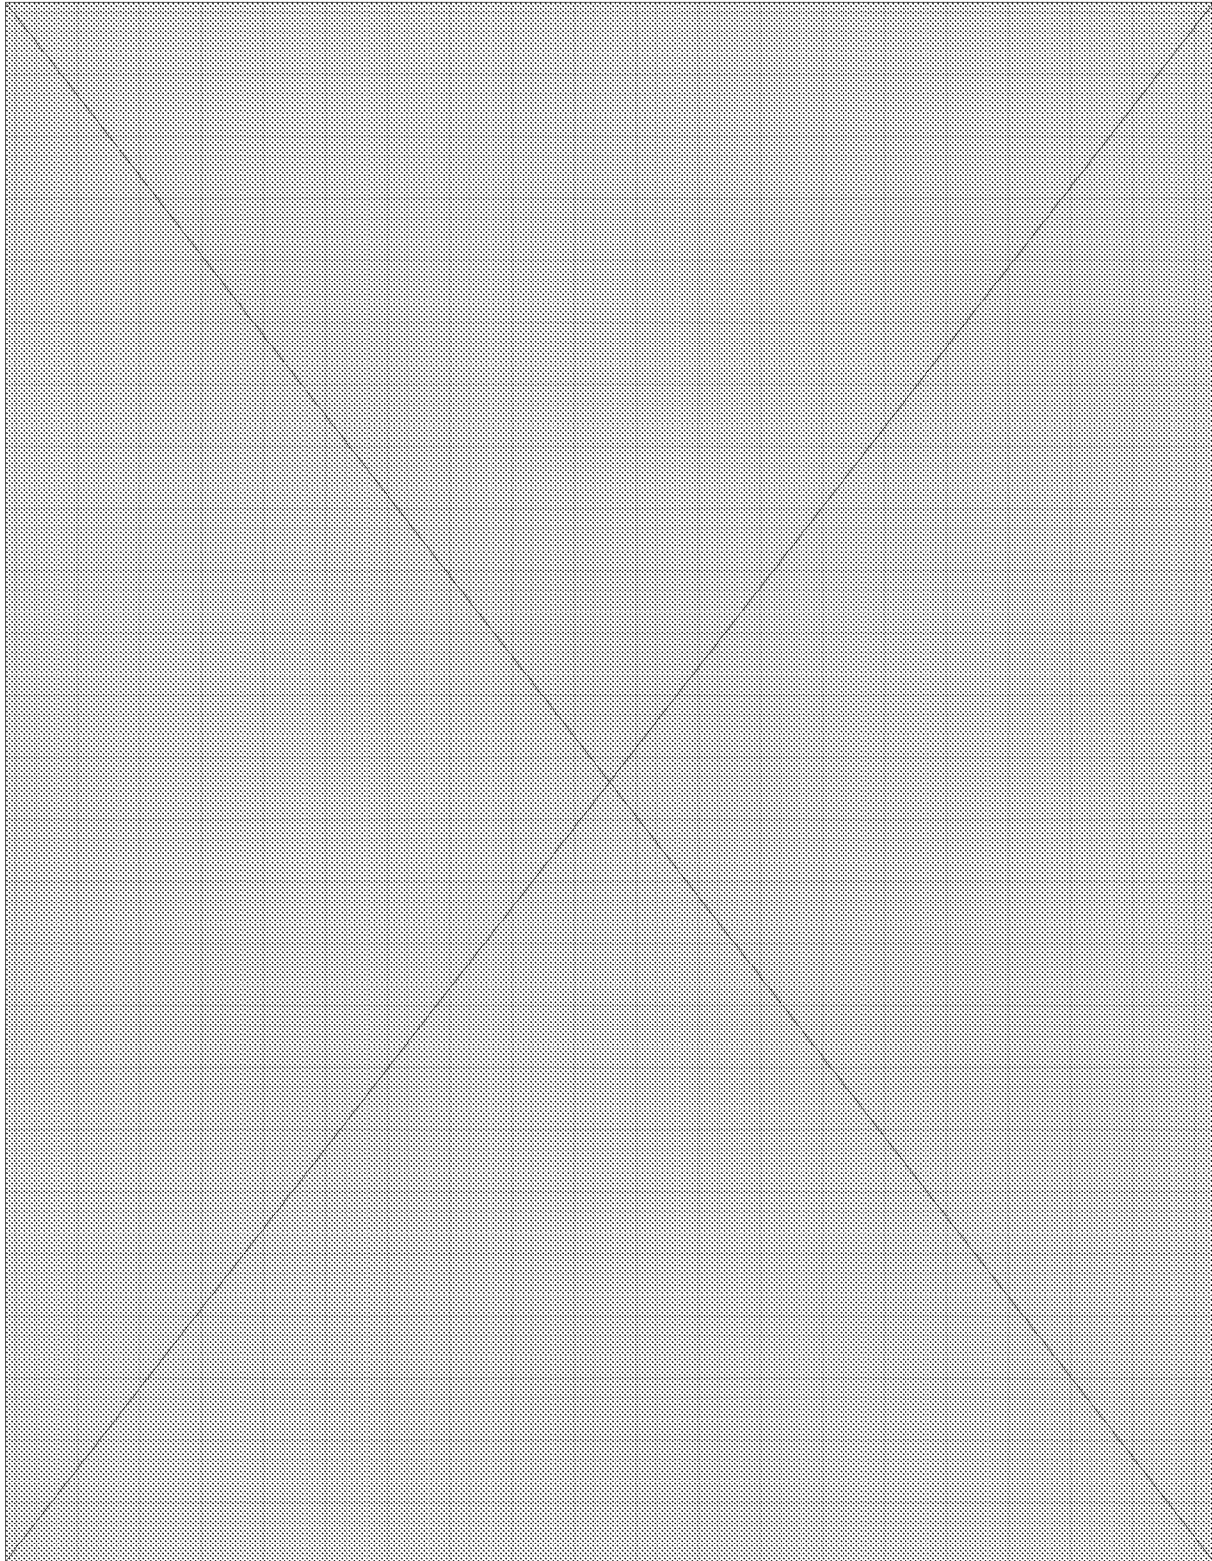

RAYLOK ENVIRONMENTAL GROUP, INC.
130 JERICHO TPKE., FLORAL PARK, NY 11001

516-358-2955
Fax 516-358-1700

LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT											
CLIENT NAME/ADDRESS NYC-SCA			CONTACT: HANID SAVOJ		SAMPLER SIGNATURE <i>[Signature]</i>		DATE 7/21/02		TIME		
PROJECT LOCATION: Stuyvesant HS 345 Chambers St NY			PROJECT # 11477-15217-29881		SAMPLER NAME/PRINT Kirk McKenzie		SAMPLE(S) SEALED YES NO		CORRECT CONTAINER(S) YES NO		
SAMPLE INFORMATION:					MATRIX (CIRCLE ONE): WIPE PAINT SOIL OTHER						
LABORATORY #	SAMPLE #	LOCATION	AREA (FT ²)	SURFACE MATERIAL WOOD METAL BRICK OTHER				LAB RESULT			
	LW-01	Room 601A Ceiling unit vent - Dampers	1 composite					29.0			
	LW-02	Room 615 - Floor unit vent "L" - Rear	1					29.0			
	LW-03	Room 615 - Ceiling unit vent "O" - Dampers	1 composite					29.0			
	4	Blank						29.0			
	5	Blank						29.0			
TURNAROUND REQUIRED: NORMAL ☐ STAT ☐ BY 1/1					COMMENTS / INSTRUCTIONS 6 HQ. TAT						
RELINQUISHED BY (SIGNATURE) <i>[Signature]</i>		DATE 7/21/02 TIME 2356		PRINTED NAME Kirk McKenzie		RECEIVED BY (SIGNATURE) <i>[Signature]</i>		DATE		PRINTED NAME	
RELINQUISHED BY (SIGNATURE) <i>[Signature]</i>		DATE 8/1/02 TIME 900		PRINTED NAME G. McKenzie		RECEIVED BY LAB (SIGNATURE) <i>[Signature]</i>		DATE 8.1.02 TIME 01.00		PRINTED NAME R. Drouina	

For Results to 212-441-2535 or 516-358-1700
WHITE - OFFICE / YELLOW - LAB / PINK - CLIENT

07428

20822

LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT

07429

ATC ASSOCIATES, INC.
104 E 25th Street, 10th Floor
New York, NY 10010
Tel. 212-353-8280
Fax 212-353-8306

REPORT DATE: 08-01-02
CLIENT: Taylor Environmental Group, Inc.
PROJECT NAME: SCA/Stuyvesant HS
345 Chambers Street, NY
PROJECT NUMBER: M477-15217/29881
SAMPLED BY: Client
SAMPLE DATE: 07-31-02
DATE RECEIVED: 08-01-02
DATE ANALYZED: 08-01-02
SAMPLE MEDIA: Dust Wipe Sample
ANALYSIS REQUIRED: Method EPA 3050/7420

ANALYSIS RESULTS

SAMPLE ID	BATCH NO.	SAMPLE DESCRIPTION	LEAD CONCENTRATION ($\mu\text{g}/\text{ft}^2$)	DETECTION LIMIT ($\mu\text{g}/\text{ft}^2$)
LWD-01	20822	Rm 601A Ceiling Univent Duct	11.8	9.0
LWD-02	20822	Rm 615 Ceiling Univent O - Duct	<9.0	9.0
FBL-1	20822	Field Blank	<9.0 μg	9.0 μg
FBL-2	20822	Field Blank	<9.0 μg	9.0 μg

NOTE 1:

THE REPORTING LIMIT (RL) IS 18.0 μg

NOTE 2:

HUD Guidelines for final clearance dust-wipe samples: Floor 40 $\mu\text{g}/\text{ft}^2$, Window sills 250 $\mu\text{g}/\text{ft}^2$, Window wells 400 $\mu\text{g}/\text{ft}^2$, Exterior surfaces 800 $\mu\text{g}/\text{ft}^2$.

NOTE 3:

Blank units are in μg

CERTIFICATION AND SIGNATURES

ANALYSIS PERFORMED BY: AD

REPORT PREPARED BY: [Signature]

ATC certifies that this report is an accurate and authentic report of results obtained from the laboratory analysis.

QUALITY ASSURANCE COORDINATOR: [Signature]

LABORATORY DIRECTOR: [Signature]

ATC is accredited by the New York State Department of Health Environmental Laboratory Approval Program (ELAP) and by the American Industrial Hygiene Association (AIHA) to perform analysis of lead in paint, dust wipes, air and soil samples. (ELAP #10879), (AIHA #100229).

07430

CITY_21MC100_008878604

TAYLOR ENVIRONMENTAL GROUP, INC.
130 JERICHO TPKE., FLORAL PARK, NY 11001

20793

516-358-2955
Fax 516-358-1780


LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT

CLIENT NAME/ADDRESS NYC SCA		CONTACT: HANIB SANDJ		SAMPLER SIGNATURE <i>[Signature]</i>		DATE 7/30/02		TIME 11:30		SAMPLE(S) SEaled (YES) NO	
PROJECT LOCATION: Stuyvesant H.S. 345 Chambers St. NY		PROJECT # M477-15217-29881		SAMPLER NAME (PRINT) Kirk McKenzie						CORRECT CONTAINER(S) (YES) NO	
SAMPLE INFORMATION:				MATRIX (CIRCLE ONE): (WIPE) PAINT SOIL OTHER							
LABORATORY #	SAMPLE #	LOCATION	AREA (FT ²)	SURFACE MATERIAL				LAB RESULT			
				WOOD	METAL	BRICK	OTHER				
	LW-01	Room 209 - South side unit vent - Rear	1		✓			9.6			
	LW-02	Room 229 - South side Left unit vent - Rear	1		✓			49.0			
	LW-03	Room 229 - South side Right unit vent - Rear	1		✓			49.0			
	LW-04	Room 235 - South side Left unit vent - Rear	1		✓			49.0			
	LW-05	Room 235 - South side Right unit vent - Rear	1		✓			49.0			
	LW-06	Room 237 - South side Left unit vent - Rear	1		✓			49.0			
	LW-07	Room 237 - South side Right unit vent - Rear	1		✓			49.0			
	LW-08	Room 250 - North side unit vent - Rear	1		✓			49.0			
				TURNAROUND REQUIRED: NORMAL ☐ STAT ☐ BY 1/1				COMMENTS / INSTRUCTIONS 6 HR TAT			
REINQUISHED BY (SIGNATURE) <i>[Signature]</i>		DATE 7/30/02 TIME 0130		PRINTED NAME Kirk McKenzie		RECEIVED BY (SIGNATURE) <i>[Signature]</i>		DATE 7.31.02 TIME 01.30		PRINTED NAME R. Droulina	
RELINQUISHED BY (SIGNATURE)		DATE TIME		PRINTED NAME		RECEIVED BY LAB (SIGNATURE)		DATE TIME		PRINTED NAME	

WHITE - OFFICE / YELLOW - LAB / PINK - CLIENT

07424

CITY_21MC100_008878605

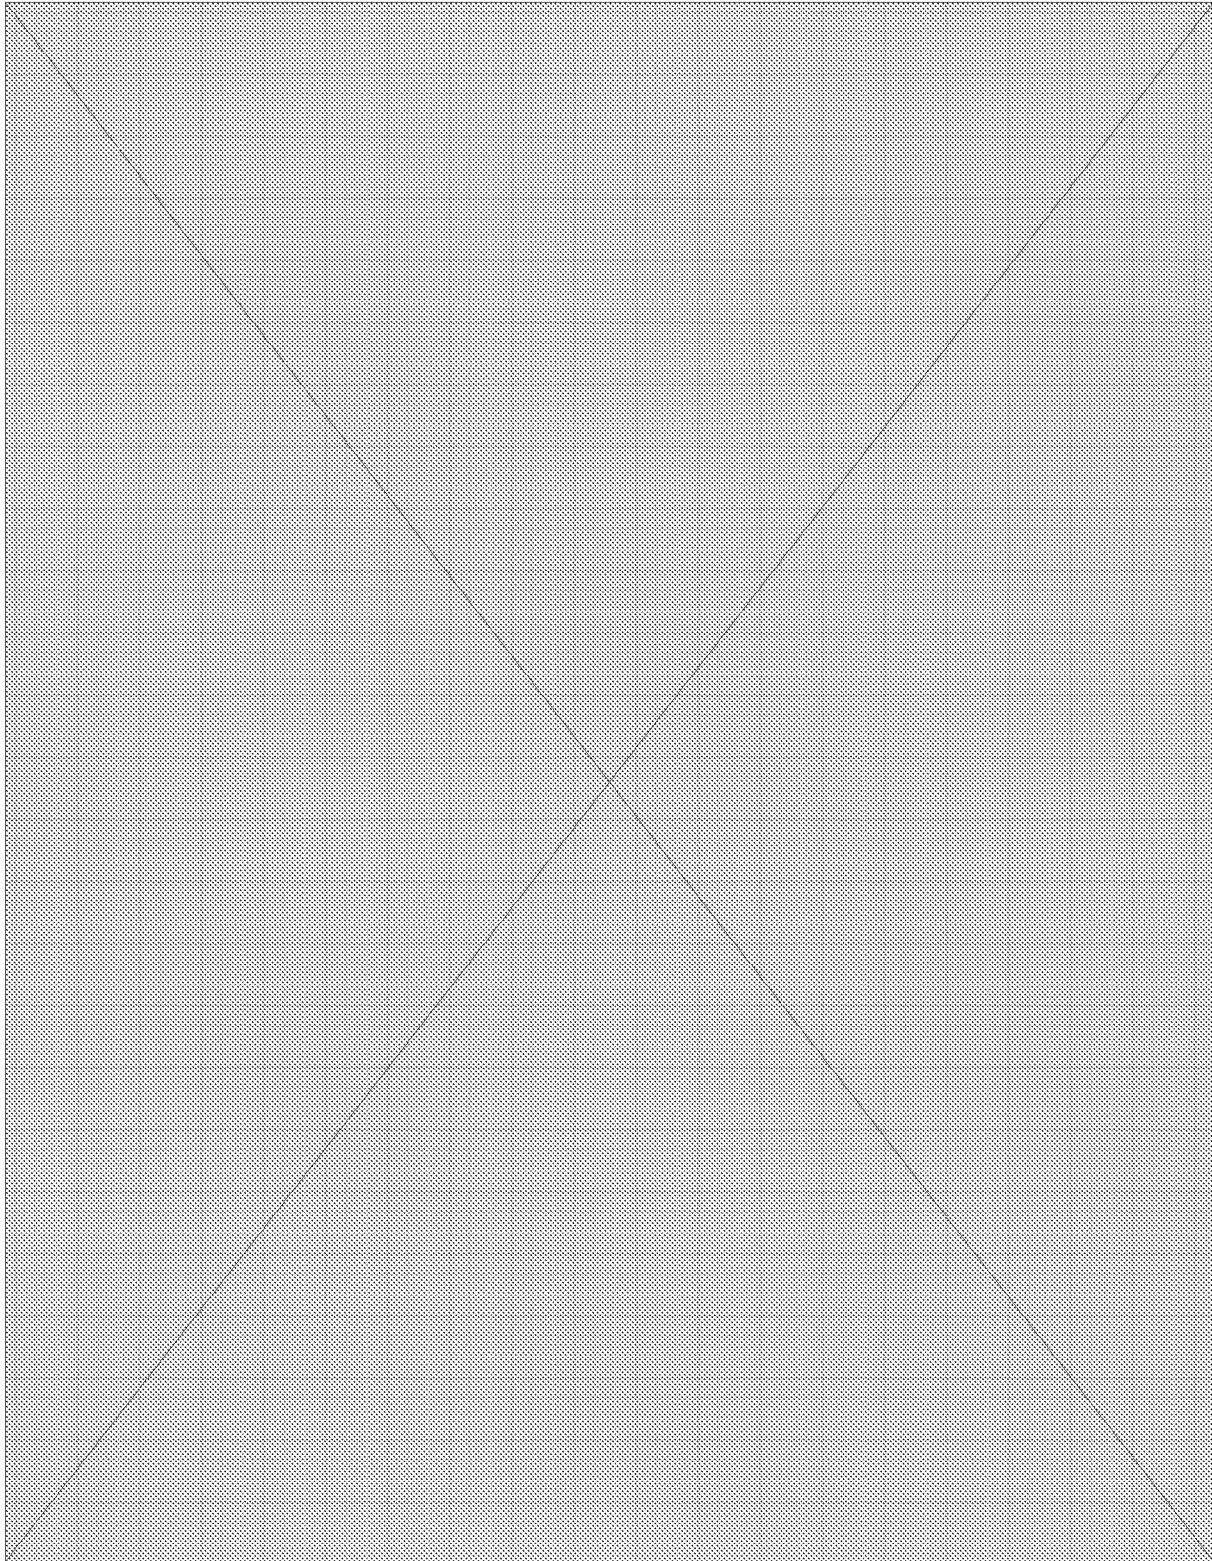

L09878800-001CW1Z-ALIC

22720

AIC ASSOCIATES, INC.
 104 E 25th Street, 10th Floor
 New York, NY 10010
 Tel. 212-353-8280
 Fax 212-353-8306

REPORT DATE: 07-31-02
CLIENT: Taylor Environmental Group, Inc.
PROJECT NAME: SCA/Stuyvesant HS
 345 Chambers Street, NY
PROJECT NUMBER: M477-15217/29881
SAMPLED BY: Client
SAMPLE DATE: 07-30-02
DATE RECEIVED: 07-31-02
DATE ANALYZED: 07-31-02
SAMPLE MEDIA: Dust Wipe Sample
ANALYSIS REQUIRED: Method EPA 3050/7420

ANALYSIS RESULTS

SAMPLE ID	BATCH NO.	SAMPLE DESCRIPTION	LEAD CONCENTRATION ($\mu\text{g}/\text{ft}^2$)	DETECTION LIMIT ($\mu\text{g}/\text{ft}^2$)
LW-01	20793	Rm 209 South Side Unitvent Rear	9.6	9.0
LW-02	20793	Rm 229 South Side Left Unitvent Rear	<9.0	9.0
LW-03	20793	Rm 229 South Side Right Unitvent Rear	<9.0	9.0
LW-04	20793	Rm 235 South Side Left Unitvent Rear	<9.0	9.0
LW-05	20793	Rm 235 South Side Right Unitvent Rear	<9.0	9.0
LW-06	20793	Rm 237 South Side Left Unitvent Rear	<9.0	9.0
LW-07	20793	Rm 237 South Side Right Unitvent Rear	<9.0	9.0
LW-08	20793	Rm 250 North Side Unitvent Rear	<9.0	9.0
LW-09	20793	Rm 251 North Side Left Unitvent Rear	<9.0	9.0
LW-10	20793	Rm 251 North Side Right Unitvent North Side	<9.0	9.0
FBL-1	20793	Field Blank	<9.0 μg	9.0 μg
FBL-2	20793	Field Blank	<9.0 μg	9.0 μg
LW-11	20793	Rm 233 South Side Left Unitvent Rear	<9.0	9.0
LW-12	20793	Rm 233 South Side Right Unitvent Rear	<9.0	9.0

809878800-0010W12-ALIC

ATC ASSOCIATES, INC.
104 E 25th Street, 10th Floor
New York, NY 10010
Tel. 212-353-8280
Fax 212-353-8306

NOTE 1:
THE REPORTING LIMIT (RL) IS 18.0 µg
NOTE 2:
HUD Guidelines for final clearance dust wipe samples: Floor 40 µg/ft², Window sills 250 µg/ft²,
Window walls 400 µg/ft², Exterior surfaces 800 µg/ft².
NOTE 3:
Blank units are in µg

CERTIFICATION AND SIGNATURES

ANALYSIS PERFORMED BY: RP

REPORT PREPARED BY: [Signature]

ATC certifies that this report is an accurate and authentic report of results obtained from the laboratory analysis.

QUALITY ASSURANCE COORDINATOR: WJ

LABORATORY DIRECTOR: GMK

ATC is accredited by the New York State Department of Health Environmental Laboratory Approval Program (ELAP) and by the American Industrial Hygiene Association (AIHA) to perform analysis of lead in paint, dust wipes, air and soil samples. (ELAP #10879), (AIHA #100229).

030210370

07/31/2002 18:49 212-296-2538

EMSL ANALYTICAL INC

PAGE 72/82

[illegible]

07435

1 & 2 PINK - CLIENT

07/31/2002 18:43 212-290-2536

EMSL ANALYTICAL INC

PAGE 01/01

EMSL Analytical, Inc.

307 West 29th Street, New York, NY 10018

Phone: 212-290-0051 Fax: 212-290-0055 Email: manhattanlab@emsl.com



Attn: Taylor Environmental Group, Inc.
Floral Park Corporate Center
130 Jericho Tpke.
Floral Park, NY 11001

Customer ID: TAYL50
Customer PO:
Received: 07/31/02 4:16 PM

Fax: (516) 868-1780 Phone: 516-355-2955

EMSL Order: 030210370

Project: M477-15217-29981/ SCA/ STUYVESANT/ 345
CHAMBERS ST

EMSL Project ID:

Lead in Wipes by Flame AAS (SW 846, 7420)


Client Sample Description	Lab ID	Analyzed	Area Sampled	Lead Concentration	Notes
5 IN 911 CEILING UNI. OUTSIDE GRILL SIDE	0001	7/31/02	144 in ²	61.0 ug/m ²	
FB-3 Field blank	0002	7/31/02	n/a	<10.0 ug/wipe	
FB-4 Field blank	0003	7/31/02	n/a	<10.0 ug/wipe	

Laboratory Manager
or other approved signatory

Reporting limit is 10 ug/wipe

ACCREDITATIONS: ANA Environmental Lab. Laboratory Approval Program #102861

PAGE 1 OF 1

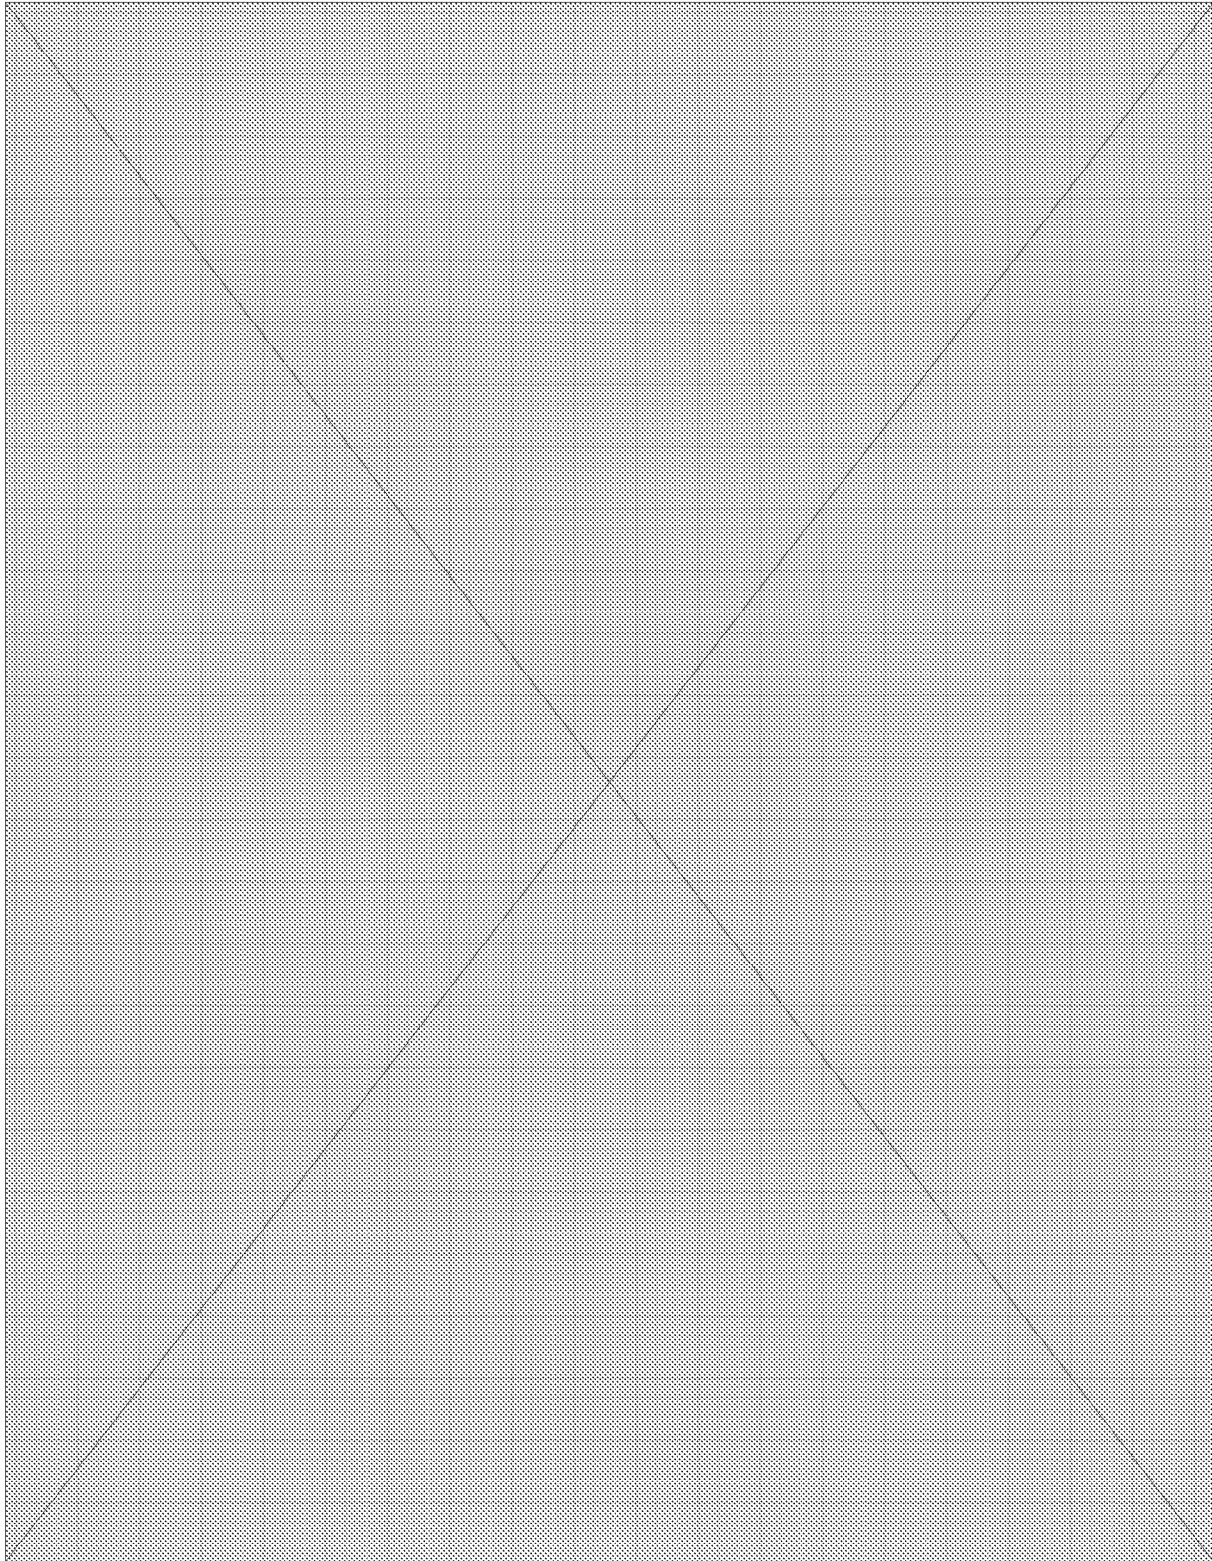

08/01/2002 19:25 212-290-2535

EMSL ANALYTICAL LAB

PAGE 001 OF 01

EMSL Analytical, Inc.

307 West 38th Street, New York, NY 10018

Phone: 212-290-0051 Fax: 212-290-0055 Email: manhattanlab@emsl.com

Attn: Taylor Environmental Group, Inc.
Floral Park Corporate Center
130 Jaricho Turnpike
Floral Park, NY 11001

Fax: (516) 358-1790 Phone: 516-358-2955

Project: M477-15217/ 29881 / SCA / Stayvacant H.S.

Customer ID: TAYLEO

Customer PO:

Received: 08/01/02 3:36 PM

EMSL Order: 030210423

EMSL Project ID:

Lead in Wipes by Flame AAS (SW 846, 7420)

Client Sample Description	Lab ID	Analyzed	Area Sampled	Lead Concentration	Notes
W-08 Room #615 E Ceiling Univent Air Dumper	0001	8/1/02	144 in ²	<10.0 µg/ft ²	
W-09 Room #615 E Wall Univent Back Wall	0002	8/1/02	144 in ²	<10.0 µg/ft ²	
W-10 F/B	0003	8/1/02	n/a	<10.0 µg/wipe	
W-11 F/B	0004	8/1/02	n/a	<10.0 µg/wipe	

Laboratory Manager
or other approved signatory

Reporting limit is 10 µg/wipe

ACCREDITATIONS: AIHA Environmental Lead Laboratory Approval Program #102581

Page 1 of 1

07438

TAYLOR ENVIRONMENTAL GROUP, INC.
130 JERICHO TPKE., FLORAL PARK, NY 11001

516-358-2955
Fax 516-358-1780

LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT										
CLIENT NAME/ADDRESS SCA			CONTACT Hamid Savor		SAMPLER (SIGNATURE) 		DATE 8/01/02		SAMPLE(S) SEALED ☒ YES ☐ NO	
PROJECT LOCATION 84 Avenue H.S.			PROJECT # MT44-15217/29881		SAMPLER NAME (PRINT) AL. KAZAKOV		CORRECT CONTAINER(S) ☒ YES ☐ NO			
SAMPLE INFORMATION:					MATRIX (CIRCLE ONE): ☒ SOIL ☐ PAINT ☐ SOIL ☐ OTHER 2083.3					
LABORATORY #	SAMPLE #	LOCATION	AREA (FT ²)	SURFACE MATERIAL				LAB RESULT		
				WOOD	METAL	BRICK	OTHER			
	W-01	Room #911 Ceiling Unit Air Ductwork	Component 1 sq'		X			29.0		
	F/B-01	F/B								
	F/B-02	F/B								
Please fax results to Taylor at (516) 406-2535				TURNAROUND REQUIRED: NORMAL ☐ STAT ☐ BY 1/1			COMMENTS / INSTRUCTIONS S.T.A.T. (A.S.A.P.)			
RELINQUISHED BY (SIGNATURE) 		DATE 8/1/02		PRINTED NAME AL. KAZAKOV		RECEIVED BY (SIGNATURE) 		DATE 8/1/02		
RELINQUISHED BY (SIGNATURE)		DATE		PRINTED NAME		RECEIVED BY LAB (SIGNATURE) 		DATE 8/1/02		

WHITE - OFFICE YELLOW - FOR FIELD USE

ATC ASSOCIATES, INC
104 E 25th Street, 10th Floor
New York, NY 10010
Tel. 212-353-8280
Fax 212-353-8306

REPORT DATE: 08-01-02
CLIENT: Taylor Environmental Group, Inc.
PROJECT NAME: SCA/Stuyvesant HS
345 Chambers Street, NY
PROJECT NUMBER: M477-15217/29881
SAMPLED BY: Client
SAMPLE DATE: 08-01-02
DATE RECEIVED: 08-01-02
DATE ANALYZED: 08-01-02
SAMPLE MEDIA: Dust Wipe Sample
ANALYSIS REQUIRED: Method EPA 3050/7420

ANALYSIS RESULTS

SAMPLE ID	BATCH NO.	SAMPLE DESCRIPTION	LEAD CONCENTRATION ($\mu\text{g}/\text{ft}^2$)	DETECTION LIMIT ($\mu\text{g}/\text{ft}^2$)
W-01	20833	Rm 911 Ceiling Unitvent Air Dumper	<9.0	9.0
F/B-01	20833	Field Blank	<9.0 μg	9.0 μg
F/B-02	20833	Field Blank	<9.0 μg	9.0 μg

NOTE 1:

THE REPORTING LIMIT (RL) IS 18.0 μg

NOTE 2:

HUD Guidelines for final clearance dust wipe samples: Floor 40 $\mu\text{g}/\text{ft}^2$, Window sills 250 $\mu\text{g}/\text{ft}^2$, Window wells 400 $\mu\text{g}/\text{ft}^2$, Exterior surfaces 800 $\mu\text{g}/\text{ft}^2$.

NOTE 3:

Blank units are in μg

CERTIFICATION AND SIGNATURES

ANALYSIS PERFORMED BY: JK

REPORT PREPARED BY: [Signature]

ATC certifies that this report is an accurate and authentic report of results obtained from the laboratory analysis.

QUALITY ASSURANCE COORDINATOR: [Signature]

LABORATORY DIRECTOR: M-L

ATC is accredited by the New York State Department of Health Environmental Laboratory Approval Program (ELAP) and by the American Industrial Hygiene Association (AIHA) to perform analysis of lead in paint, dust wipes, air and soil samples (ELAP #10879), (AIHA #100229).

07440

CITY_21MC100_008878614

PAGE 02/02

ENVIRONMENTAL INC.

212-292-212

01:00 08/27/2004

TAYLOR ENVIRONMENTAL GROUP, INC.
130 JERICHO TPKE., FLORAL PARK, NY 11001

030210446

516-358-2955
Fax 516-358-1780


LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT

CLIENT NAME/ADDRESS NYC PCA		CONTACT: HANIS SANDS		SAMPLED BY (SIGNATURE) <i>[Signature]</i>	DATE 8/1/02	TIME	SAMPLE(S) SEALED (YES) NO	
PROJECT LOCATION: Stuyvesant HS 345 Chambers St. NY		PROJECT # H477-15211-29881		SAMPLE NAME (PRINT) Kirk McKenzie		CORRECT CONTAINER(S) (YES) NO		
SAMPLE INFORMATION:				MATRIX (CIRCLE ONE): (WIPE) PAINT SOIL OTHER				
LABORATORY #	SAMPLE #	LOCATION	AREA (FT ²)	SURFACE MATERIAL				LAB RESULT
				WOOD	METAL	BRICK	OTHER	
	LW-01	ROOM 501 - Ceiling unknown - Danger	1 composit		✓			<10.0 µg/ft²
	PRL-1	Field Blank						
	PRL-2	Field Blank						
				TURNAROUND REQUIRED: NORMAL ☐ STAT ☐ BY 1/1		COMMENTS / INSTRUCTIONS 6 HR TAT		
RELINQUISHED BY (SIGNATURE) <i>[Signature]</i>		DATE 8/1/02 TIME 0030	PRINTED NAME Kirk McKenzie		RECEIVED BY (SIGNATURE) <i>[Signature]</i>		DATE TIME	PRINTED NAME
RELINQUISHED BY (SIGNATURE)		DATE TIME	PRINTED NAME		RECEIVED BY LAB (SIGNATURE)		DATE TIME	PRINTED NAME

02 AUG - 2 AM 12:35

ENSL. MANHATTAN
RECEIVED

WHITE - OFFICE / YELLOW - LAB / PINK - CLIENT

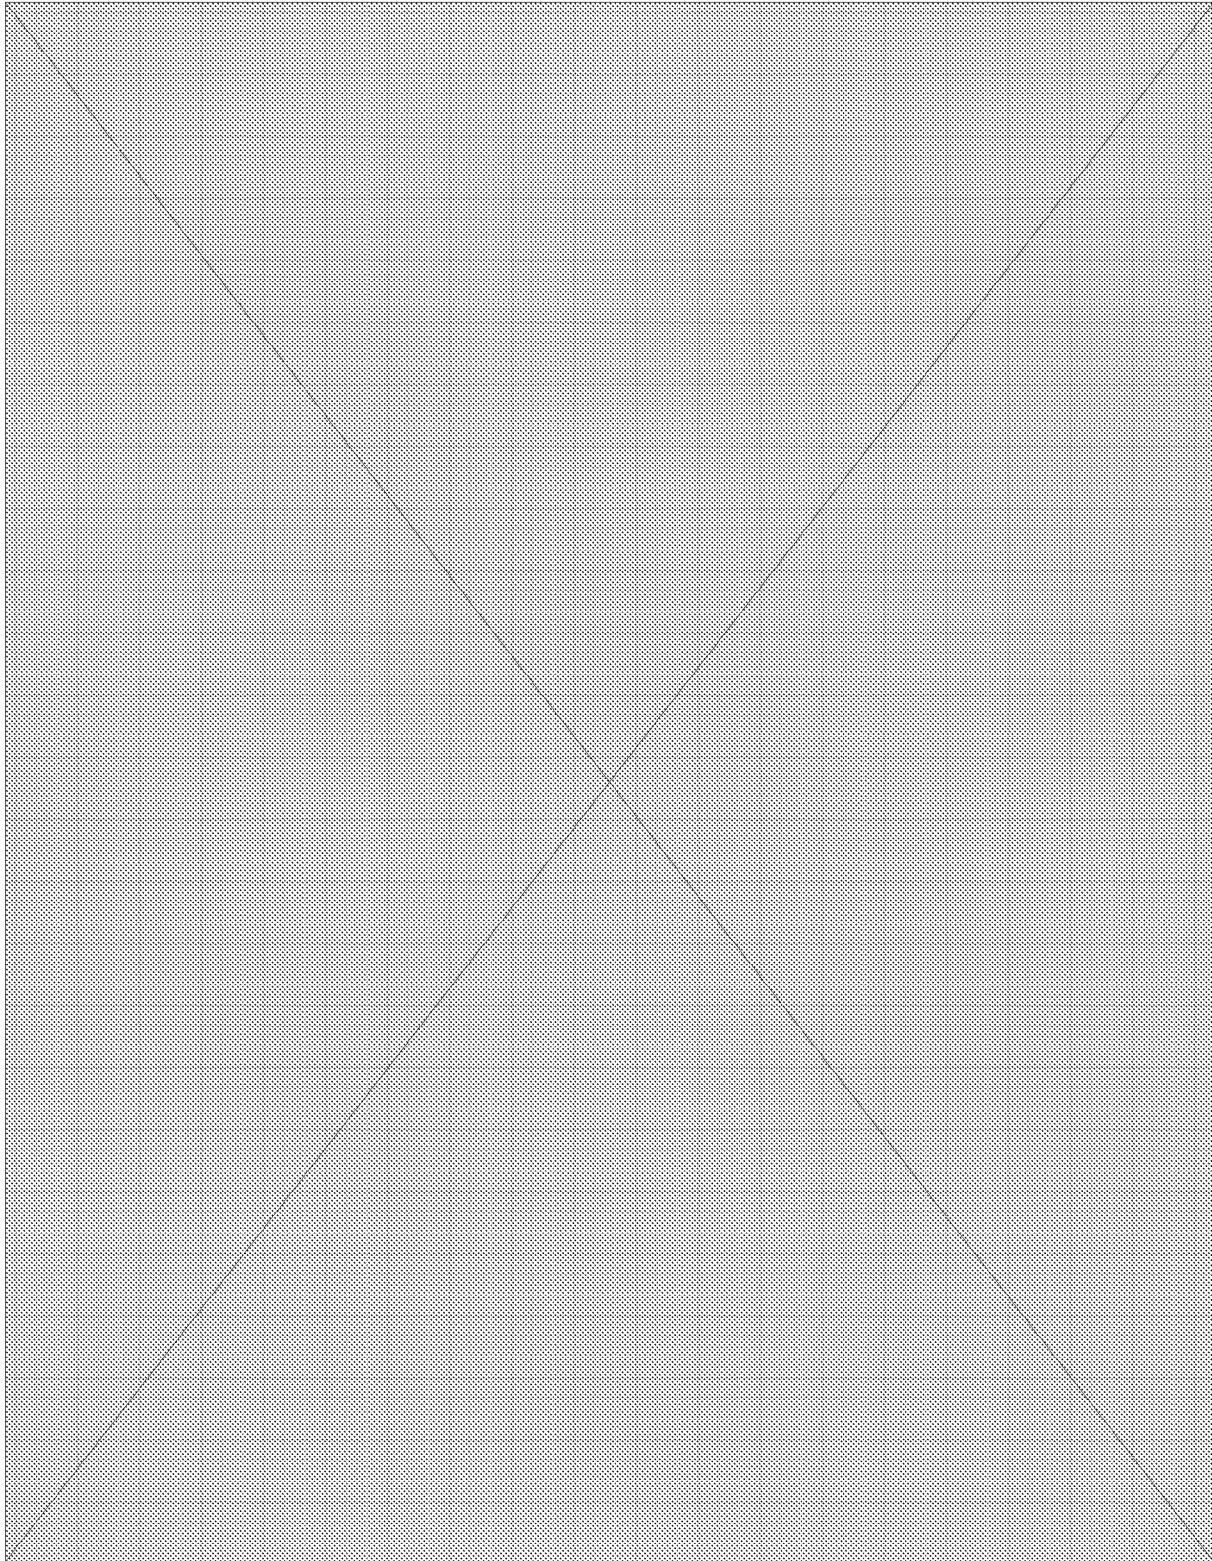

TAYLOR ENVIRONMENTAL GROUP, INC.
130 JERICHO TPKE., FLORAL PARK, NY 11001

516-358-2955
Fax 516-358-1780

LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT

CLIENT NAME/ADDRESS SCA		CONTACT: Himel Savos		SAMPLE (SIGNATURE) <i>[Signature]</i>		DATE 8/01/02		TIME		SAMPLE(S) SEALED (YES) NO	
PROJECT LOCATION: Stuyvesant H.S.		PROJECT # W477-15217/29881		SAMPLER NAME (PRINT) AL. Haganov						CORRECT CONTAINER(S) (YES) NO	
SAMPLE INFORMATION:				MATRIX (CIRCLE ONE): (WIPE) PAINT SOIL OTHER						20834	
LABORATORY #	SAMPLE #	LOCATION	AREA (FT ²)	SURFACE MATERIAL				LAB RESULT			
				WOOD	METAL	BRICK	OTHER				
	W-02	Room # 615 Ceiling Unit "D"	Composit		X						
	W-03	Room # 615 Unit "M"	139'		X						
	W-04	Room # 615 Ceiling Unit "Q"	139'		X						
	W-05	Room # 615 Unit "N"	139'		X						
	W-06	F/B									
	W-07	F/B									
Fax results to Taylor on site (212) 406-2535				TURNAROUND REQUIRED: NORMAL ☐ STAT ☐ BY 1/1				COMMENTS / INSTRUCTIONS 6hr TAT			
RELINQUISHED BY (SIGNATURE) <i>[Signature]</i>		DATE 8/01/02		PRINTED NAME AL. Haganov		RECEIVED BY (SIGNATURE) <i>[Signature]</i>		DATE 8/1/02		PRINTED NAME JO	
RELINQUISHED BY (SIGNATURE)		DATE		PRINTED NAME		RECEIVED BY LAB (SIGNATURE)		DATE		PRINTED NAME	

07443

WHITE - OFFICE / YELLOW - LAB / PINK - CLIENT

ATC ASSOCIATES, INC
104 E 25th Street, 10th Floor
New York, NY 10010
Tel. 212-353-8280
Fax 212-353-8306

REPORT DATE: 08-01-02
CLIENT: Taylor Environmental Group, Inc.
PROJECT NAME: SCA/Snyvesant HS
 345 Chambers Street, NY
PROJECT NUMBER: M477-15217/29881
SAMPLED BY: Client
SAMPLE DATE: 08-01-02
DATE RECEIVED: 08-01-02
DATE ANALYZED: 08-01-02
SAMPLE MEDIA: Dust Wipe Sample
ANALYSIS REQUIRED: Method EPA 3050/7420

ANALYSIS RESULTS

SAMPLE ID	BATCH NO.	SAMPLE DESCRIPTION	LEAD CONCENTRATION (µg/ft²)	DETECTION LIMIT (µg/ft²)
W-02	20834	Rm 615 Ceiling Unitvent P Air Dumper	<9.0	9.0
W-03	20834	Rm 615 Unitvent M Back Wall	<9.0	9.0
W-04	20834	Rm 615 Ceiling Unitvent Q Air Dumper	<9.0	9.0
W-05	20834	Rm 615 Unitvent N Back Wall	<9.0	9.0
W-06	20834	Field Blank	<9.0 µg	9.0 µg
W-07	20834	Field Blank	<9.0 µg	9.0 µg

NOTE 1:
THE REPORTING LIMIT (RL) IS 18.0 µg
 NOTE 2:
 HUD Guidelines for final clearance dust wipe samples: Floor 40 µg/ft², Window sills 250 µg/ft²,
 Window wells 400 µg/ft², Exterior surfaces 800 µg/ft².
 NOTE 3:
 Blank units are in µg

07444

ATC ASSOCIATES, INC
104 E 25th Street, 10th Floor
New York, NY 10010
Tel. 212-353-8280
Fax 212-353-8306

CERTIFICATION AND SIGNATURES

ANALYSIS PERFORMED BY: JK

REPORT PREPARED BY: [Signature]

ATC certifies that this report is an accurate and authentic report of results obtained from the laboratory analysis.

QUALITY ASSURANCE COORDINATOR: [Signature]

LABORATORY DIRECTOR: M.L.

ATC is accredited by the New York State Department of Health Environmental Laboratory Approval Program (ELAP) and by the American Industrial Hygiene Association (AIHA) to perform analysis of lead in paint, dust wipes, air and soil samples. (ELAP #10879), (AIHA #100229).


07445

20871

LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT

07446

WHITE OFFICE YELLOW TOP BOARD CLIENTS

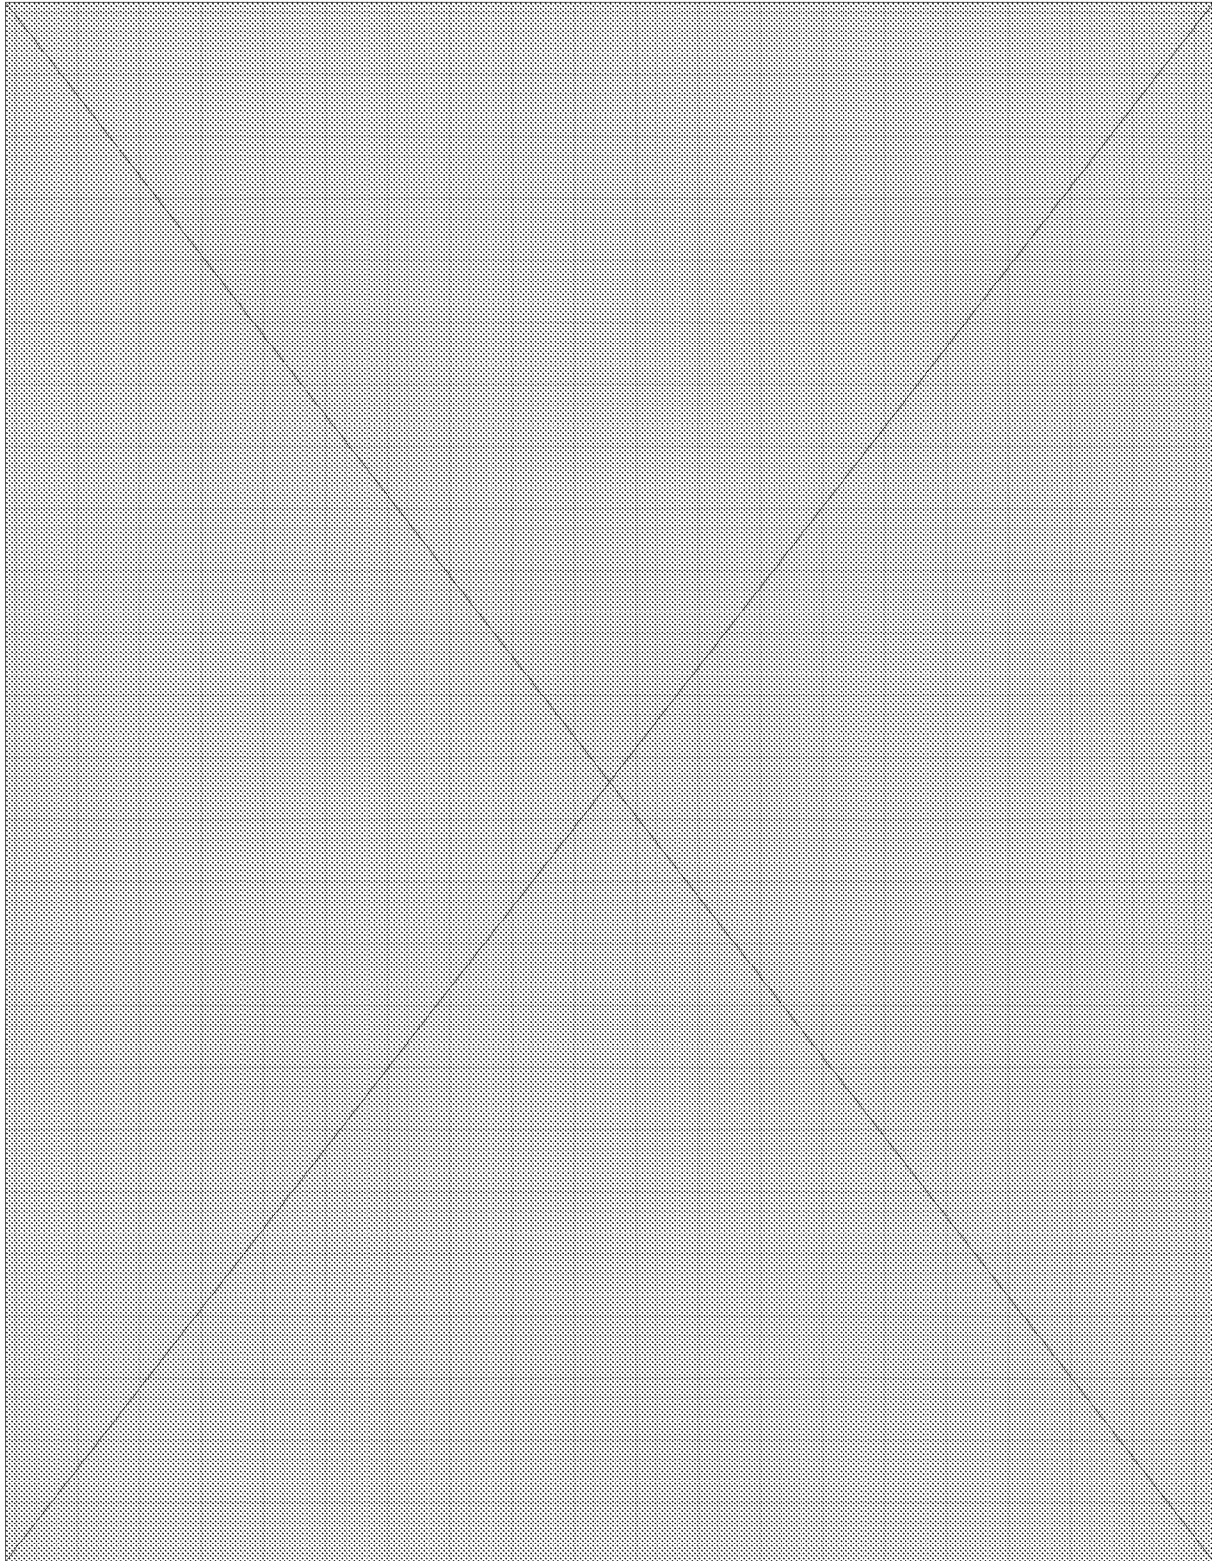

TAYLOR ENVIRONMENTAL GROUP, INC.
130 JERICHO TURN, FLORAL PARK, NY 11001

20898

516-358-2955

Fax 516-358-1780

LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT

CLIENT NAME/ADDRESS NYC RCA		CONTACT: HANID SAVOY		SAMPLER SIGNATURE 	DATE 8/3/02	TIME	SAMPLE(S) SEALED YES / NO	
PROJECT LOCATION: Stuyvesant H.S.		PROJECT # 345 Chambers St. NY 10013-15217-2881		SAMPLER NAME (PRINT) Kirk McKenzie		CORRECT CONTAINER(S) YES / NO		
SAMPLE INFORMATION:				MATRIX (CIRCLE ONE): (WIPE) PAINT SOIL OTHER				
LABORATORY #	SAMPLE #	LOCATION	AREA (FT ²)	SURFACE MATERIAL				LAB RESULT
				WOOD	METAL	BRICK	OTHER	
	LW-01	ROOM 451 - North side wall untreated - Rear	1		✓			49.0
	LW-02	ROOM 451 - North side ceiling untreated - Damper	1		✓			49.0
	LW-03	ROOM 453 - North side wall untreated - Rear	1		✓			49.0
	LW-04	ROOM 453 - North side ceiling untreated - Damper	1		✓			49.0
	FBL-1	Field Blank						49.0
	FBL-2	Field Blank						49.0
TURNAROUND REQUIRED:				COMMENTS / INSTRUCTIONS				
FAX TO 212-406-2535 #516-358-2955				NORMAL ☐ STAT ☐ BY 1/1				
RELINQUISHED BY (SIGNATURE) 		DATE 8/4/02		PRINTED NAME Kirk McKenzie		RECEIVED BY (SIGNATURE) 		
TIME 00:20				ATC Lab 1		DATE 08/04/02		
RELINQUISHED BY (SIGNATURE)		DATE		PRINTED NAME		RECEIVED BY LAB (SIGNATURE)		
		TIME				DATE		
						PRINTED NAME		

07448

CITY_21MC100_008878622

84420

ATC ASSOCIATES, INC
 104 E 25th Street, 10th Floor
 New York, NY 10010
 Tel. 212-353-8280
 Fax 212-353-8306

REPORT DATE: 08-05-02
CLIENT: Taylor Environmental Group, Inc.
PROJECT NAME: SCA/Stuyvesant HS
 345 Chambers Street, NY
PROJECT NUMBER: M477-15217/29881
SAMPLED BY: Client
SAMPLE DATE: 08-03-02
DATE RECEIVED: 08-04-02
DATE ANALYZED: 08-04-02
SAMPLE MEDIA: Dust Wipe Sample
ANALYSIS REQUIRED: Method EPA 3050/7420

ANALYSIS RESULTS

SAMPLE ID	BATCH NO.	SAMPLE DESCRIPTION	LEAD CONCENTRATION ($\mu\text{g}/\text{ft}^2$)	DETECTION LIMIT ($\mu\text{g}/\text{ft}^2$)
LW-01	20898	Rm 451 North Side Wall Unitvent Rear	<9.0	9.0
LW-02	20898	Rm 451 North Side Ceiling Unitvent Damper	<9.0	9.0
LW-03	20898	Rm 453 North Side Wall Unitvent Rear	<9.0	9.0
LW-04	20898	Rm 453 North Side Ceiling Unitvent Damper	<9.0	9.0
FBL-1	20898	Field Blank	<9.0 μg	9.0 μg
FBL-2	20898	Field Blank	<9.0 μg	9.0 μg

NOTE 1:THE REPORTING LIMIT (RL) IS 18.0 μg **NOTE 2:**HUD Guidelines for final clearance dust wipe samples: Floor 40 $\mu\text{g}/\text{ft}^2$, Window sills 250 $\mu\text{g}/\text{ft}^2$, Window wells 400 $\mu\text{g}/\text{ft}^2$, Exterior surfaces 800 $\mu\text{g}/\text{ft}^2$.**NOTE 3:**Blank units are in μg

TAYLOR ENVIRONMENTAL GROUP, INC.
130 JERICHO TPKE., FLORAL PARK, NY 11001

70893

516-358-2955
Fax 516-358-1780

LEAD SAMPLING DATA AND CHAIN OF CUSTODY DOCUMENT

CLIENT NAME/ADDRESS SCA		CONTACT: Hamid Savag		SAMPLER (SIGNATURE) <i>[Signature]</i>	DATE 8/03/02	TIME	SAMPLE(S) SEALED (YES) NO
PROJECT LOCATION Stuyvesand H.S.		PROJECT # W477-15217/29881		SAMPLER NAME (PRINT) AL. KARANOV	CORRECT CONTAINER(S) (YES) NO		
SAMPLE INFORMATION:		MATRIX (CIRCLE ONE): (TYPE) PAINT SOIL OTHER					
LABORATORY #	SAMPLE #	LOCATION	AREA (FT ²)	SURFACE MATERIAL WOOD METAL BRICK OTHER		LAB RESULT	
	BW-01	Room #450 Ceiling Univalent Air Dampers	1	X		29.0	
	BW-02	Room #450 Wall Univalent Back Wall	1	X		↓	
	BW-03	Room #402 Ceiling Univalent Air dampers	1	X			
	BW-04	F/B					
	BW-05	F/B					
TURNAROUND REQUIRED: NORMAL ☐ STAT ☐ BY 1/1				COMMENTS / INSTRUCTIONS 6hr FAT.			
RELINQUISHED BY (SIGNATURE) <i>[Signature]</i>	DATE 8/03/02	PRINTED NAME AL. KARANOV	RECEIVED BY (SIGNATURE) <i>[Signature]</i>		DATE	PRINTED NAME	
RELINQUISHED BY (SIGNATURE) <i>[Signature]</i>	DATE 8/3/02	PRINTED NAME	RECEIVED BY LAB (SIGNATURE) <i>[Signature]</i>		DATE 8/3/02	PRINTED NAME	

WHITE - OFFICE / YELLOW - LAB / PINK - CLIENT

18:00

07450

CITY_21MC100_008878624

ATC ASSOCIATES, INC
104 E 25th Street, 10th Floor
New York, NY 10010
Tel. 212-353-8280
Fax 212-353-8306

REPORT DATE: 08-05-02
CLIENT: Taylor Environmental Group, Inc.
PROJECT NAME: SCA/Stuyvesant HS
345 Chambers Street, NY
PROJECT NUMBER: M477-15217/29881
SAMPLED BY: Client
SAMPLE DATE: 08-03-02
DATE RECEIVED: 08-03-02
DATE ANALYZED: 08-03-02
SAMPLE MEDIA: Dust Wipe Sample
ANALYSIS REQUIRED: Method EPA 3050/7420

ANALYSIS RESULTS

SAMPLE ID	BATCH NO.	SAMPLE DESCRIPTION	LEAD CONCENTRATION ($\mu\text{g}/\text{ft}^2$)	DETECTION LIMIT ($\mu\text{g}/\text{ft}^2$)
DW-01	20893	Rm 450 Ceiling Unitvent Air Damper	<9.0	9.0
DW-02	20893	Rm 450 Wall Unitvent Back Wall	<9.0	9.0
DW-03	20893	Rm 402 Ceiling Unitvent Air Damper	<9.0	9.0
DW-04	20893	Field Blank	<9.0 μg	9.0 μg
DW-05	20893	Field Blank	<9.0 μg	9.0 μg

NOTE 1:

THE REPORTING LIMIT (RL) IS 18.0 μg

NOTE 2:

HUD Guidelines for final clearance dust wipe samples: Floor 40 $\mu\text{g}/\text{ft}^2$, Window sills 250 $\mu\text{g}/\text{ft}^2$.


Window wells 400 $\mu\text{g}/\text{ft}^2$, Exterior surfaces 800 $\mu\text{g}/\text{ft}^2$.

NOTE 3:


Blank units are in μg

CERTIFICATION AND SIGNATURES

ANALYSIS PERFORMED BY: 

REPORT PREPARED BY: 

ATC certifies that this report is an accurate and authentic report of results obtained from the laboratory analysis.

QUALITY ASSURANCE COORDINATOR: 

LABORATORY DIRECTOR: 

ATC is accredited by the New York State Department of Health Environmental Laboratory Approval Program (ELAP) and by the American Industrial Hygiene Association (AIHA) to perform analysis of lead in paint, dust/wipes, air and soil samples. (ELAP #10579), (AIHA #100229).

07451